



Renault Master: V467ZL

Vinnumber:	VF1MA000762914370	Versionname:	Master T35 2.3 dCi 96kW FWD L1H1 GB
First Registrationdate:	21/05/2019	Fiscalpower:	
Expertise Mileage:	196644	Power Kw:	96
Bodytype:		Body colour:	Blanc Glacier
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:		Type of rims (mounted):	Steel
Fueltype:	Diesel	Parking lot:	1195
Number of seats:	3		
Type of rims (mounted):	Steel		
Maintenance needed:	Yes		

Options

Number of keys total	1	Rear parking sensors
GPS		Hook
Manual climate control		Sliding door right-side
Radio multimedia		

Tyres

Location	Position	Measures	Depth	Make	Type
Front	Left	225 / 65 / 16 / 112 / R / Steel	6,0 mm	Bridgestone	Summer
	Right	225 / 65 / 16 / 112 / R / Steel	6,1 mm	Bridgestone	Summer
Rear	Left	225 / 65 / 16 / 112 / R / Steel	6,2 mm	Goodyear	Summer
	Right	225 / 65 / 16 / 112 / R / Steel	7,2 mm	Goodyear	Summer

Assistance equipment


Service, Maintenance, Execute



Air vent R, Broken, Replace



Air vent L, Broken, Replace

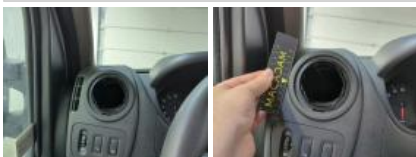

Ignition key, Missing, Replace

No pictures to display

Interior, Dirty, Cleaning




Seat cover FL, Worn, Replace



Door FL, Dent(s) and scratch(es), Repair and paint (complete)



Outside rear-view mirror housing L, Scratch(es), Replace

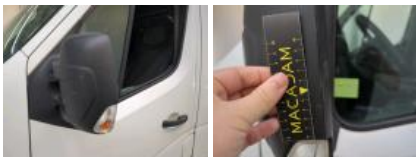

Windscreen, Crack, Replace



Headlight R, Scratch(es), Replace



Bumper F, Dent(s) and scratch(es), Replace



Wing trim RR, Missing, Replace



Side wall RR, Dent(s), Repair and paint (complete)




Sliding door R, Dent(s), Repair and paint (complete)



Door trim RR, Dent(s) and scratch(es), Replace



Outside rear-view mirror glass R, Missing, Replace

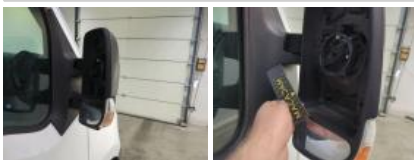


Boot door lining R, Crack, Replace




Bull bar R, Broken, Replace



Rear light L, Crack, Replace

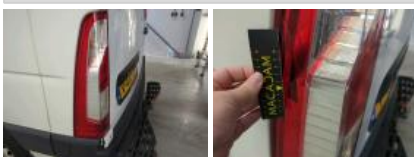

Boot door panel RR, Dent(s), Repair and paint (complete)

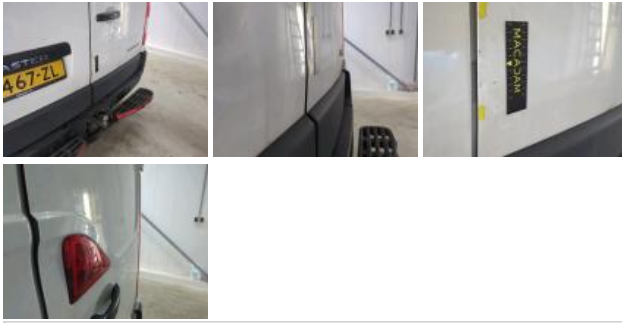


Bumper R, Scratch(es), Smart repair



Bumper corner RR, Scratch(es), Smart repair



Bodywork, Chemical polution, Polish

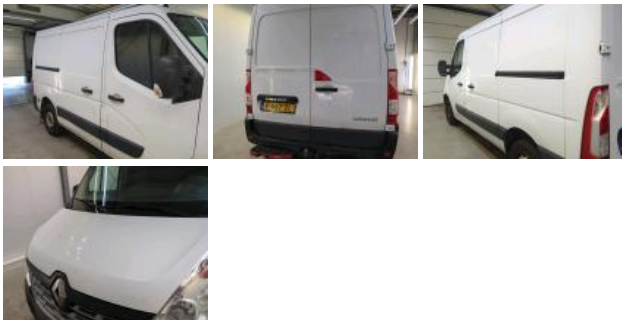

Roof, Rust, Repair and paint (complete)

