



Skoda Octavia (UKL): 2AMS118

Vinnumber:	TMBJJ7NX9MY157727	Versionname:	Octavia Combi Ambition 2.0TDi 150pk/cv 5p DSG7
First Registrationdate:	18/05/2021	Fiscalpower:	
Expertise Mileage:	108609	Power Kw:	110
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	Automatic		
Transmission:			
Fueltype:	Diesel		
Maintenance	OK		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
GPS		Type of Tow bar	No Tow bar
Type of Maintenance book	Digital maintenance		
Type of GPS storage	HD		

Tyres

205/60/16/92 V				
Summer tyres:	Fr.L.	Kumho: 4 mm	Fr.R.	Kumho: 4 mm
	Re.L.	Kumho: 3 mm	Re.R.	Kumho: 3 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				3.0
Tyre profile depth RR				3.0
Tyre size FL				205/60 R 16 92 V
Tyre size FR				205/60 R 16 92 V
Tyre size RL				205/60 R 16 92 V
Tyre size RR				205/60 R 16 92 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				2482
Tyre make FR				2482
Tyre make RL				2482
Tyre make RR				2482

Assistance equipment

Spare wheel	Yes	Jack	Yes
Bumper F, Scratch(es), Acceptable			



Wing RL, Scratch(es), Repair and paint (complete)



Alloy rim FL, Scratch(es), Acceptable



Bumper R, Scratch(es), Repair and paint (complete)




Alloy rim FR, Scratch(es), Acceptable



Door RR, Bad repair, Repair and paint (complete)



Door FR, Bad repair, Repair and paint (complete)

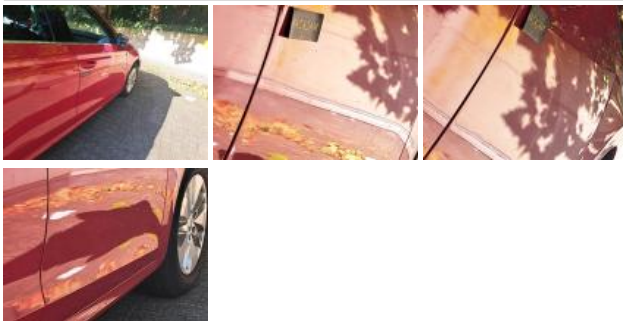

Kenteken	2AMS118
Merk Model	Skoda Octavia Combi Ambition 2.0TDi 150pk/cv 5p DSG7
Brandstofsoort	Diesel
Datum deel1	5/18/21

Datum reparatie	Kilometerstand	Reparatie omschrijving	Bewerking
10/29/25	91,531	batterij	Vervangen
10/29/25	91,531	brandstof hoofdfilter	Vervangen
10/29/25	91,531	Inspectie met olie vervanging (vast in	Uitvoeren
10/29/25	91,531	klein materiaal	
10/29/25	91,531	koelwater vloeistof	Bijvullen/-laden
10/29/25	91,531	luchtfilter	Vervangen
10/29/25	91,531	luchtfilter interieur	Vervangen
10/29/25	91,531	remblokken achter	Vervangen
10/29/25	91,531	remvloeistof	Vervangen
10/29/25	91,531	ruitenwisserrubber achter	Vervangen
10/29/25	91,531	ruitenwisserrubber vooraan	Vervangen
10/29/25	91,531	ruitenwisservloeistof	Bijvullen/-laden
8/5/25	86,804	diagnose	Uitvoeren
8/5/25	86,804	klein materiaal	N.v.t.
10/4/24	66,863	batterij	Vervangen
10/4/24	66,863	klein materiaal	
10/4/24	66,863	koelwater vloeistof	Bijvullen/-laden
10/4/24	66,863	Onderhoudsbeurt met oliewissel (variab	Uitvoeren
10/4/24	66,863	remblokken vooraan	Vervangen
10/4/24	66,863	ruitenwisserrubber achter	Vervangen
10/4/24	66,863	ruitenwisserrubber vooraan	Vervangen
10/4/24	66,863	ruitenwisservloeistof	Bijvullen/-laden
10/4/24	66,863	Tussentijds onderhoud (vast interval)	Uitvoeren
8/7/23	39,777	Inspectie met olie vervanging (vast in	Uitvoeren
8/7/23	39,777	klein materiaal	Uitvoeren
8/7/23	39,777	koelwater vloeistof	Bijvullen/-laden
8/7/23	39,777	luchtfilter interieur	Vervangen
8/7/23	39,777	remvloeistof	Vervangen
8/7/23	39,777	ruitenwisserrubber achter	Vervangen
8/7/23	39,777	ruitenwisserrubber vooraan	Vervangen
8/7/23	39,777	ruitenwisservloeistof	Bijvullen/-laden