



TOYOTA COROLLA TOURING SPORTS:

Vinnumber:	SB1Z53BE20E027002	Versionname:	2.0 Hybrid Premium e-CVT
First Registrationdate:	10/09/2019	Fiscalpower:	
Expertise Mileage:	124929	Power Kw:	132
Bodytype:		Body colour	Light Blue
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:		Parking lot	2623
Fueltype:	Hybrid Petrol		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Registration Certificate Home (BE)	No		

Options

Number of keys total	2	Panoramic roof	
Cruise Control		Luggage cover	
Steering wheel multifunctional		Front parking sensors	
Seats F heated		Rear parking sensors	
Radio multimedia		Type of Tow bar	Tow bar removable
Type of headlighting	Headlighting LED		
Type of GPS	GPS base		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		
Adaptive cruise control			
Sport seats			
Type of GPS storage	HD		

Limited Technical Inspection

Tyres

225/40/18/92 V				
Winter tyres:	Fr.L.	Uniroyal: 4 mm	Fr.R.	Uniroyal: 4 mm
	Re.L.	Michelin: 5,5 mm	Re.R.	Michelin: 5,5 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				5.5
Tyre profile depth RR				5.5
Tyre size FL				225/40 R 18 92 V
Tyre size FR				225/40 R 18 92 V
Tyre size RL				225/40 R 18 92 V
Tyre size RR				225/40 R 18 92 V
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				265
Tyre make FR				265
Tyre make RL				261
Tyre make RR				261

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	968,72
Interior, Not original part, Check	0,00



Bumper F, Scratch(es), Repair and paint (complete)

356,09



Bumper moulding F, Scratch(es), Acceptable

0,00



Alloy rim FL polished, Scratch(es), Repair and paint (complete)

204,21




Alloy rim RL polished, Scratch(es), Repair and paint (complete)

204,21



Wing RL, Dent(s), Acceptable

0,00

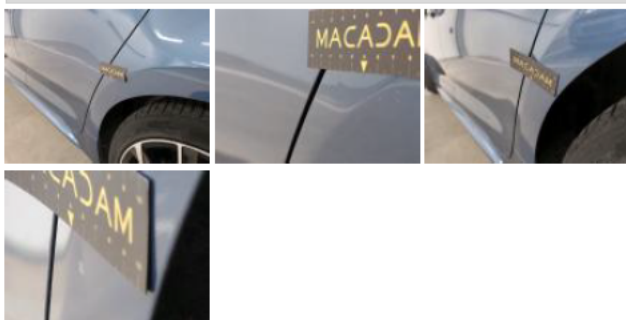

Bumper R, Scratch(es), Acceptable

0,00



Tailgate / Boot, Dent(s), Acceptable

0,00



Rear window, Scratch(es), Replace		0,00
		
Alloy rim FR polished, Scratch(es), Repair and paint (complete)		204,21
		
Alloy rim RR polished, Scratch(es), Acceptable		0,00
		
Outside rear-view mirror housing R, Scratch(es), Acceptable		0,00
		