



Expertise

Protocol number: 46720573  
Order No. / Reference: 26740887  
Inspection date: 17 Jul 2026

Manufacturer: Volkswagen

Model: ID.4 Performance Upgrade Pro

VIN: WVGZZZE2ZPP010776



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen ID.4 Performance Upgrade Pro

|                                      |                   |
|--------------------------------------|-------------------|
| Vehicle Identification number        | WVGZZZE2ZPP010776 |
| Mileage (Read)                       | 76,723 km         |
| First registration                   | 12 Jul 2023       |
| Number of holders                    | 1                 |
| Next periodical technical inspection | 07/2026           |
| (Report not on hand)                 |                   |

|                           |                        |
|---------------------------|------------------------|
| Fuel type                 | Electric               |
| Power                     | 70 kW                  |
| Gearbox / Number of gears | Direct drive / 1       |
| Type of drive             | Rear drive             |
| Type of vehicle           | Station wagon          |
| Colour / colour code      | Gletscherweiß Metallic |
| Doors / Seats             | 5 / 5                  |
| Upholstery type           | Alcantara / Leather    |
| Colour of upholstery      | Black-Anthracite       |
| readiness to drive        | Roadworthy             |



## Vehicle details

|                                                  |                          |                                |                                                            |
|--------------------------------------------------|--------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>               | digital proof / complete | <b>Next maintenance in</b>     | 348 Tag(e)                                                 |
| <b>Last service on / at</b>                      | 06/2025 at 52,082 km     |                                |                                                            |
| <b>Key is / should be</b>                        | 2 / 2                    | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                  |                          | <b>Letter No.</b>              | GS599682                                                   |
| <b>Previous damage / Accident</b>                | Detectable               | <b>Repainting</b>              | None detectable                                            |
| <b>Inspection conditions</b>                     | sufficient               | <b>Lifting equipment / pit</b> | No                                                         |
| <b>Test drive</b>                                | Not performed            | <b>Engine function test</b>    | Performed                                                  |
| <b>readiness to drive</b>                        | Roadworthy               |                                |                                                            |
| <b>Manufacturer key number/ type code number</b> | 0603 / CLQ 00114         |                                |                                                            |
| <b>Emission standard</b>                         | 2017/1151                | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                    | 2,540 kg                 | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 235/55 R19 101T | Summer tyres on Light alloy | Bridgestone  | 5mm / 5mm   |
| 2) | 255/50 R19 103T | Summer tyres on Light alloy | Bridgestone  | 4mm / 4mm   |

### Additional tyres

| #  | Tyre size       | Type of tyre                               | Manufacturer | Tread depth |
|----|-----------------|--------------------------------------------|--------------|-------------|
| 1) | 235/55 R19 101T | Winter tyres on Steel rim with wheel cover | Bridgestone  | 6mm / 6mm   |
| 2) | 255/50 R19 103T | Winter tyres on Steel rim with wheel cover | Bridgestone  | 5mm / 5mm   |

### Replacement

| Typ | Tyre size | Type of tyre            | Manufacturer | Tread depth |
|-----|-----------|-------------------------|--------------|-------------|
|     | Tirefit   | Expiration date 02/2027 |              |             |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

## Equipment

### Standard equipment

- 2 USB-C ports on the front
- Airbag for driver and front passenger, with front passenger airbag deactivation
- Ambient lighting, 10 colors
- Electrically adjustable, folding and heated exterior mirrors
- Car2X
- e-Sound (artificially generated engine noise to inform other road users about the approach of the e-vehicle)
- ESP Electronic Stability Program (incl. ABS Anti-lock Braking System)
- Speed limiter (in conjunction with online services)
- Transmission: 1-speed automatic
- Back window, heater
- rear window wiper
- Interior mirror automatically dimming
- ISOFIX mounting points for child seats (mounting points for child seats on the outer rear seats and on the front passenger seat, i-Size compatible)
- Mode 3 Type 2 charging cable, 16 A
- Charging: 125 kW DC charging power (direct current)
- Steering wheel: Multifunction steering wheel with touch controls
- Navigation system "Discover Pro" (23.4 cm touchscreen - map with 2D display - traffic sign display - points of interest - App-Connect Wireless - voice control)
- Package: Infotainment package (Navigation system "Discover Pro": 23.4 cm touchscreen, map with 2D display, traffic sign display, points of interest, App-Connect Wireless, voice control - "Comfort" telephone interface with inductive charging function including hands-free system, Bluetooth audio, external antenna connection with LTE support)
- LED taillights
- Electromechanical power steering (speed-dependent control)
- Seats: Armrest for front seats
- Seats: Driver's seat height adjustable
- Seats: Rear bench seat undivided, backrest asymmetrically split and foldable
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking including remote control
- Turning brake function and evasive steering support
- Airbags: Front and rear head airbags, front side airbags, center airbag
- App-Connect Wireless for Apple CarPlay and Android Auto
- third brake light
- black roof rails
- Parking aid (warning signals for obstacles in the front and rear area)
- Driving profile selection (possibility to set different vehicle settings: Comfort (only in conjunction with Adaptive Chassis Control DCC), Normal, Sport, Eco, Individual - adjustable vehicle systems are: engine, Adaptive Chassis Control DCC, DSG, steering, start-stop system, cornering lights and "Dynamic Light Assist", Adaptive Cruise Control ACC, air conditioning)
- "Climatronic" air conditioning system (active combination filter - stationary air conditioning)
- Front and rear headrests (5)
- Charging: 11 kW AC charging power (alternating current)
- LED headlights with automatic headlight control
- Makeup mirrors in the sun visors
- Fatigue detection
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Emergency call service (no registration required, service is activated upon delivery)
- Upholstery: Seat center panels of the front seats and the outer rear seats in "Matrix" fabric
- Radio "Ready 2 Discover" (Digital radio reception DAB+ - Diversity antenna for FM reception)
- Radio accessories: 6 + 1 speakers
- Tire pressure monitoring system
- Keyless Start system (without safe locking)
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner (3 three-point automatic seat belts at the rear - warning tone and light for unfastened seat belts at the front and rear)
- Voice control
- Lane keeping assistant "Lane Assist"
- Ambient lighting with logo projection
- Traffic sign recognition
- Green thermal insulation glazing, sides and rear



## Extra equipment

- Exterior Style "Silver" (rear roof trim and roof pillars in silver - silver anodized roof rails)
- Paint finish: Metallic, different roof color
- Package: Assistance package "Plus" incl. "IQ.DRIVE" with "Travel Assist" (Easy Open & Close - tailgate with sensor-controlled opening and closing, with remote control, Adaptive Cruise Control (ACC) stop&go, speed limiter, anti-theft alarm with interior monitoring and towing, Travel Assist, Lane Assist and Emergency Assist, illuminated strip between headlights and door handle recesses, memory radio for Park Assist, multifunction steering wheel with LED lighting, Park Assist, Active Parking Assist, occupant protection, keyless entry and start system, Keyless Access with Safe-Side, Lane Change Assist, Side Assist, Area View including Rear View camera)
- Package: Comfort package in conjunction with Interior Style (2 USB-C interfaces in the front, 2 USB-C charging ports on the rear center console - Windscreen in laminated safety glass, wirelessly heated and infrared-reflecting, noise-reducing - "Air Care Climatronic" air conditioning with active combination filter, stationary climate control and 2-zone temperature control - Variable center console with interchangeable inserts for cup holders and storage compartments - Rain sensor - Automatically heated windscreen washer nozzles in the front - Heated front seats)
- Wheels: Winter wheels (4) (additional), steel (4 steel winter wheels 8 J x 19 - winter tires 235/55 R 19 T front, 255/50 R 19 T rear)
- Interior Style Platinum Grey with black steering wheel (30-color ambient lighting, leather multifunction steering wheel, heated, with touch controls, stainless steel pedals in "Play/Pause" design, asymmetrically split folding rear seat backrest with pass-through and center armrest, 2 cup holders, seat center panels of the front seats and outer rear seats in "ArtVelours" microfleece, height-adjustable front seats)
- Package: Design package (3D LED taillights with dynamic turn signals - Dynamic Light Assist high beam control for LED matrix headlights - IQ.LIGHT - LED matrix headlights with automatic headlight control, bad weather light, welcome function - illuminated strip between the headlights - tinted rear side windows and rear window)
- Package: Infotainment Package "Plus" (Head-up display - Navigation system "Discover Pro": 23.4 cm touchscreen, map with 2D display, traffic sign recognition, points of interest, App-Connect Wireless, voice control - Radio "Ready 2 Discover Max": DAB+ digital radio reception, diversity antenna for FM reception - Telephone interface "Comfort" with inductive charging function including hands-free system, Bluetooth audio, external antenna connection with LTE support - Sound system, 6 loudspeakers, digital channel amplifier, subwoofer, 450 W)
- Wheels: Alloy wheels (4) "Hamar" 8 J x 19 in black, gloss-turned finish (4 alloy wheels "Hamar" 8 J x 19 in black, gloss-turned surface - tires 235/55 R 19 front and 255/50 R 19 rear - wheel locks with enhanced theft protection)
- Heat pump for range optimization

## Brief expert findings

|                      |                                                                                                                                                                                                                                               |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)                                                                  |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.                                                                     |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent. |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                                                                                         |
| Engine function test | An engine test run was performed.                                                                                                                                                                                                             |
| readiness to drive   | The vehicle was roadworthy at the time of inspection.                                                                                                                                                                                         |

## Value reducing factors

| No. | Component group      | Description                                            |
|-----|----------------------|--------------------------------------------------------|
| 1   | Misc.                | Main inspection - No evidence - No deduction           |
| 2   | Front bumper         | Front bumper - Scratch(es) - Smart repair              |
| 3   | Seat - front         | Seat cover - left side - Worn - Smart repair           |
| 4   | Boot lid / rear door | Boot lid - Corrosion - repair according to calculation |



## Wear and tear

| No. | Component group | Description                         |
|-----|-----------------|-------------------------------------|
| 1   | Bonnet          | Bonnet - Stone chips - No deduction |
| 2   | Roof            | Roof - dent(s) - No deduction       |

The vehicle shows signs of wear and tear commensurate with its age and use.

## Accident damages

### No. Accident

1 Side right

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

## Comments

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

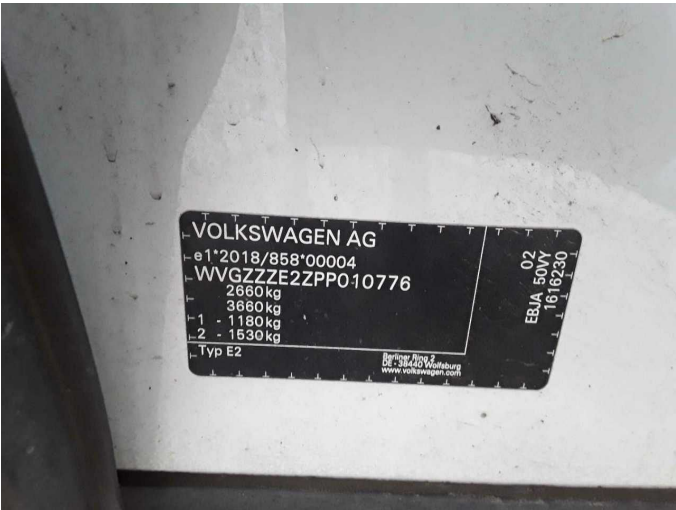


Figure 11: VIN



Figure 12: Mounted tyres

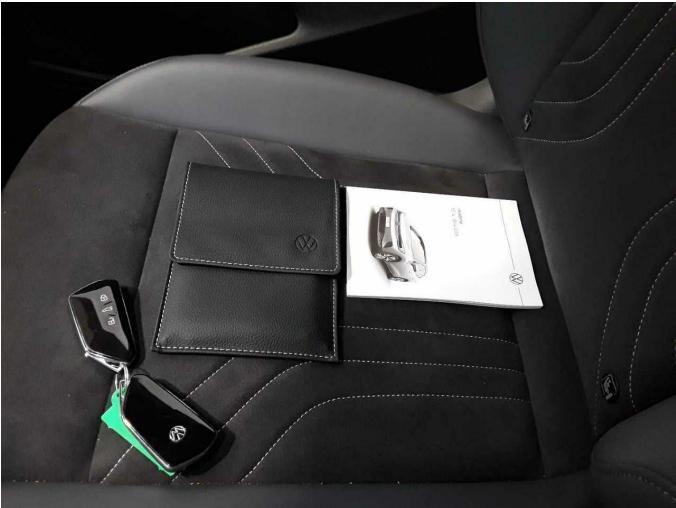


Figure 13: Documents



Figure 14: Documents

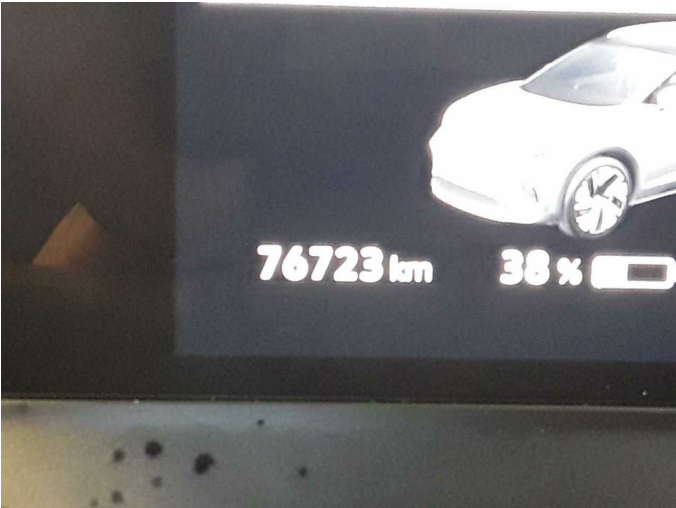


Figure 15: Documents



Figure 16: Additional tyres

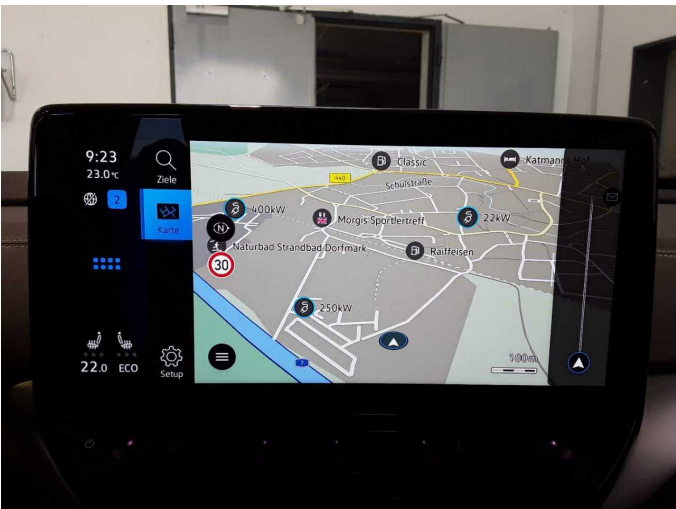


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

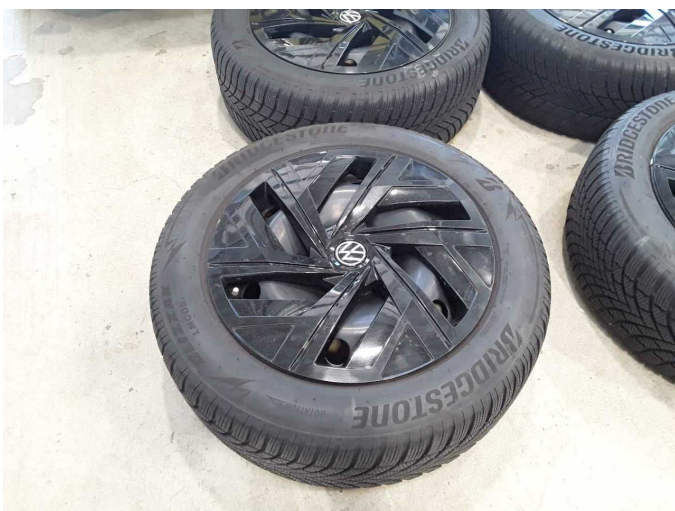


Figure 23: Misc.


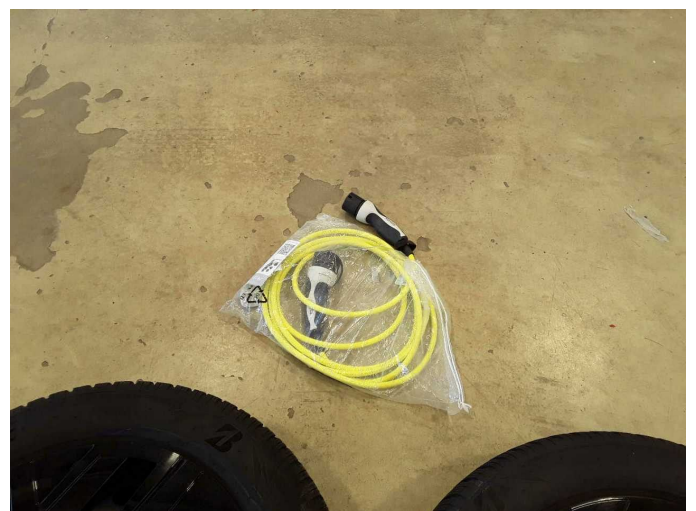


Figure 24: Misc.



**Figure 25:** Misc.

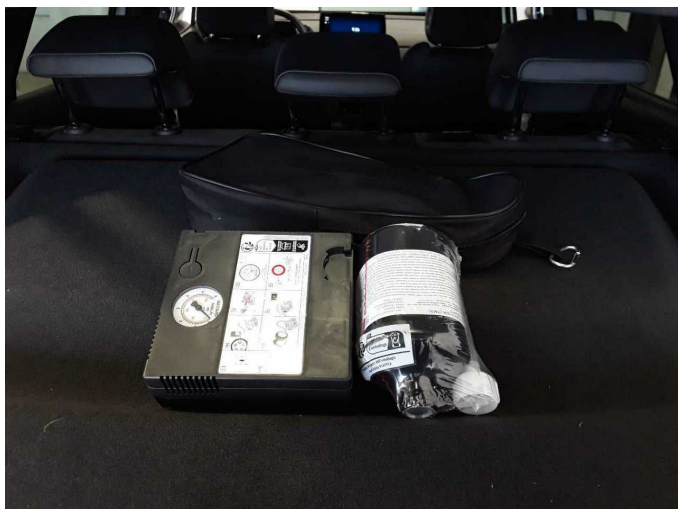

**Damage 2:** Front bumper: Front bumper - Scratch(es) - Smart repair



**Damage 2:** Front bumper: Front bumper - Scratch(es) - Smart repair




**Damage 3:** Seat - front: Seat cover - left side - Worn - Smart repair



**Damage 3:** Seat - front: Seat cover - left side - Worn - Smart repair



**Damage 4:** Boot lid / rear door: Boot lid - Corrosion - repair according to calculation

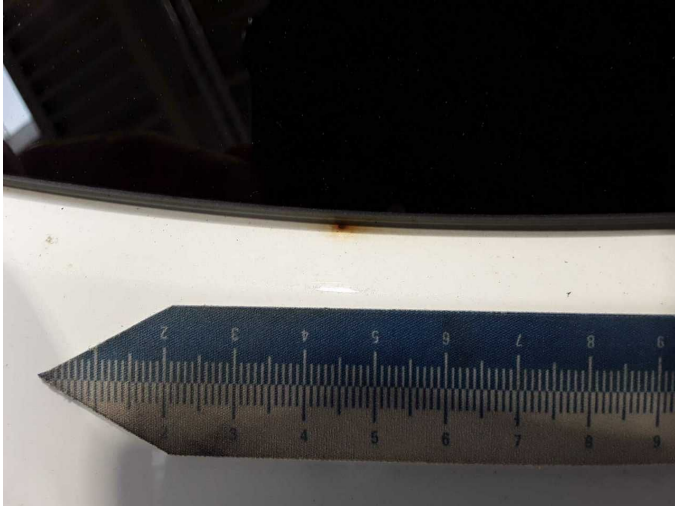


**Damage 4:** Boot lid / rear door: Boot lid - Corrosion - repair according to calculation



**Accident 1:** Side right




**Accident 1:** Side right

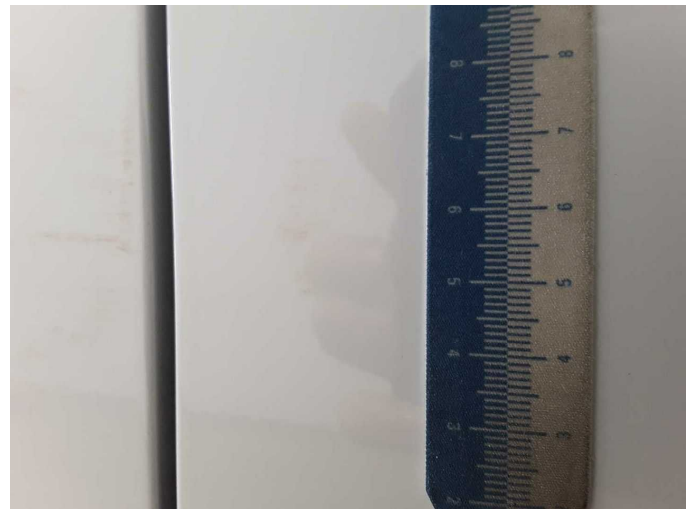

**Accident 1:** Side right




**Accident 1:** Side right

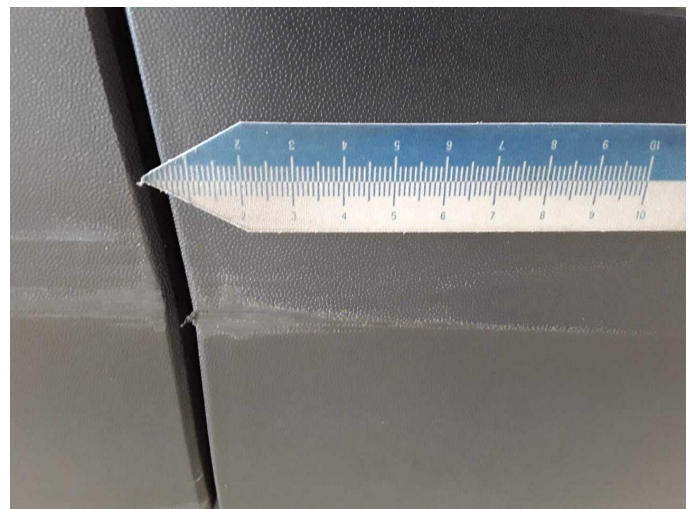

**Accident 1:** Side right




**Accident 1: Side right**

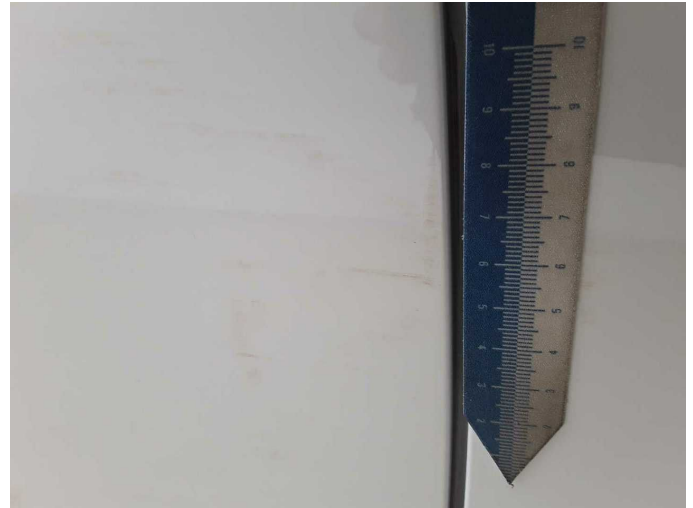

**Accident 1: Side right**



**Accident 1: Side right**

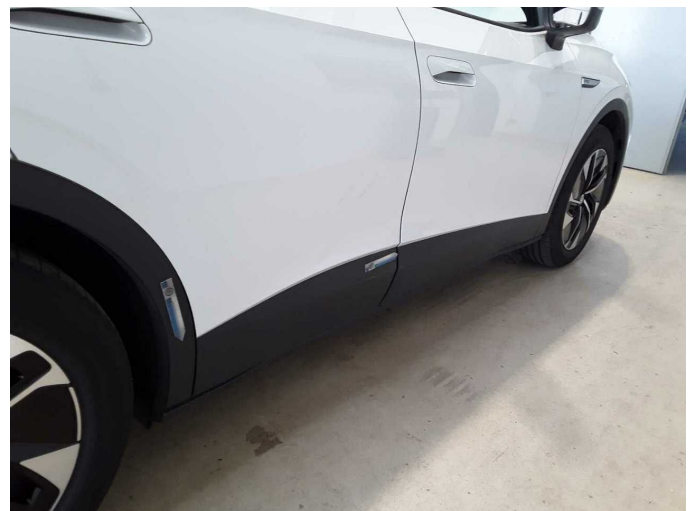

**Accident 1: Side right**



**Accident 1: Side right**



**Accident 1: Side right**



**Accident 1: Side right**



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZE2ZPP010776

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN ID.4 Performance Upgrade Pro

| Datum      | KM-Stand | Beschreibung                                                |
|------------|----------|-------------------------------------------------------------|
| 30.06.2025 | 52.082   | Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst |