



Expertise

Protocol number: 46122619  
Order No. / Reference: 26445233  
Inspection date: 24 Jun 2026

Manufacturer: Skoda  
VIN: TMBJJ7NS2P8029435

Model: Kodiahq 2.0 TDI DSG Ambition



| Vehicle details                         |                    |
|-----------------------------------------|--------------------|
| Manufacturer / Type / Model / Equipment |                    |
| Skoda Kodiaq 2.0 TDI DSG Ambition       |                    |
| Vehicle Identification number           | TMBJJ7NS2P8029435  |
| Mileage (Read)                          | 181,345 km         |
| First registration                      | 6 Mar 2023         |
| Number of holders                       | 1                  |
| Next periodical technical inspection    | 04/2028            |
| (Report on hand)                        |                    |
| Power / Engine displacement             | 110 kw / 1,968 ccm |
| Fuel type / Cylinder                    | Diesel / 4         |
| Gearbox / Number of gears               | Automatic / 7      |
| Type of drive                           | Front drive        |
| Type of vehicle                         | SUV                |
| Colour / colour code                    | Stahl-Grau Uni     |
| Doors / Seats                           | 5 / 5              |
| Upholstery type                         | Cloth              |
| Colour of upholstery                    | Black-Grey         |



| Vehicle details                              |                              |                         |                                                            |
|----------------------------------------------|------------------------------|-------------------------|------------------------------------------------------------|
| Maintenance booklet / proof                  | digital proof / complete     | Next maintenance in     | 15,100 km                                                  |
| Last service on / at                         | 02/2026 at 169,950 km        |                         |                                                            |
| Key is / should be                           | 2 / 2                        | FZG documents           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                              |                              | Letter No.              | GQ535863                                                   |
| Previous damage / Accident                   | None detectable              | Repainting              | None detectable                                            |
| Inspection conditions                        | sufficient                   | Lifting equipment / pit | No                                                         |
| Test drive                                   | Not performed                | Engine function test    | Performed                                                  |
| Manufacturer key number/<br>type code number | 8004 / ART 03803             |                         |                                                            |
| Emission standard                            | EURO6;WLTP;AP;PI/CI; M, N1 I | fine dust sticker       |                                                            |
| Permitted total weight                       | 2,350 kg                     | Empty weight            |                                                            |

| Tyres            |                |                             |              |             |
|------------------|----------------|-----------------------------|--------------|-------------|
| Mounted tyres    |                |                             |              |             |
| #                | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
| 1)               | 215/65 R17 99V | Summer tyres on Light alloy | Hankook      | 4mm / 4mm   |
| 2)               | 215/65 R17 99V | Summer tyres on Light alloy | Hankook      | 4mm / 4mm   |
| Additional tyres |                |                             |              |             |
| #                | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
| 1)               | 215/65 R17 99H | Winter tyres on Light alloy | Continental  | 6mm / 6mm   |
| 2)               | 215/65 R17 99H | Winter tyres on Light alloy | Continental  | 7mm / 7mm   |
| Replacement      |                |                             |              |             |
| Typ              | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|                  | Tirefit        | Expiration date 10/2026     |              |             |

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

## Equipment

### Standard equipment

- 12V socket in the center console and in the trunk
- Storage compartments behind the wheel arches in the trunk
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Hydraulic brake assist (HBA)
- Grey headliner
- Decorative inlay, brushed aluminum
- Digital Cockpit (8")
- Third brake light
- eCall
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor
- Front radar assistant including city emergency braking function with pedestrian detection
- Transmission: 7-speed dual-clutch transmission (DSG)
- Illuminated glove compartment
- Climatronic air conditioning (2-zone)
- Boot cover, roll-up and removable
- LED taillights in crystal glass look with animated turn signals
- Reading lights at the front of the headliner
- Rear center armrest with cup holders
- Engine drag torque control (MSR)
- Fog lights with integrated LED daytime running lights
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Tire Mobility Kit
- Wheels: 17" Mytikas alloy wheels
- Heated windshield washer nozzles, front
- Headlights washer / wiper system
- Kodiaq seat belts
- Seats: Height-adjustable front seats
- Sun visor on driver and passenger side with illuminated vanity mirror
- Variable fastening concept in the trunk
- Lashing eyes in the trunk
- Central locking with remote control
- Storage compartment on the left wheel arch
- front aero windshield wipers
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and driver's side mirrors with automatic dimming
- Hill start assist
- Care Connect: Proactive services (10-year term)
- Roof rails, black
- Diesel particulate filter
- Tachometer
- Easy Start (start-stop button)
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Electric windows front and rear
- Closed storage compartment on the driver's side
- Cruise control
- Tinted windows
- Isofix anchorage on the outer rear seats including top tether
- Front and rear headrests are height-adjustable.
- LED headlights with daytime running lights
- Steering wheel: Leather steering wheel with multifunction buttons including paddle shifters.
- Front center armrest, including storage compartment
- Multi-collision brake
- Rear parking sensors
- Wheel arch cover
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable, longitudinally adjustable, backrest angle adjustable
- Electromechanical power steering
- Seats: Adjustable lumbar support in the front seats
- Skoda Care Connect
- Speed limiter
- Telephone: Comfort hands-free telephone system (without connection to the external antenna)
- Immobiliser



### Extra equipment

- Front and rear parking sensors
- Paint finish: Special paint finish, solid color
- Seats: Heated front seats
- Swiveling trailer hitch (with electric release, including trailer stabilization)
- Package: Business Amundsen (Ambition) (Amundsen dynamic radio navigation system - 8" capacitive color display - Digital Cockpit Plus (10") - Wireless SmartLink - Voice control - Phonebox with inductive charging function (connection via external antenna) - Driver fatigue detection - 230V socket and a USB charging port (Type-C) on the back of the front center armrest - Sunset - Luggage net partition - Infotainment Online (3-year subscription))

### Brief expert findings

|                      |                                                                                                                                                                                                                                               |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)                                                                  |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.                                                                     |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent. |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                                                                                         |
| Engine function test | An engine test run was performed.                                                                                                                                                                                                             |

### Value reducing factors

| No. | Component group              | Description                                             |
|-----|------------------------------|---------------------------------------------------------|
| 1   | Door - front left side       | Door - Scratch(es) - Smart repair                       |
| 2   | Side panel - rear right side | Side panel - Dent / paintcoat damage - Repair and paint |

### Wear and tear

| No. | Component group             | Description                                          |
|-----|-----------------------------|------------------------------------------------------|
| 1   | Rear bumper                 | Rear bumper (unpainted) - Scratch(es) - No deduction |
| 2   | Bonnet                      | Bonnet - Stone chips - No deduction                  |
| 3   | Vehicle glazing             | Windscreen - Stone chips - No deduction              |
| 4   | Side panel - rear left side | Side panel - Scratch(es) - No deduction              |

The vehicle shows signs of wear and tear commensurate with its age and use.

### Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

## Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

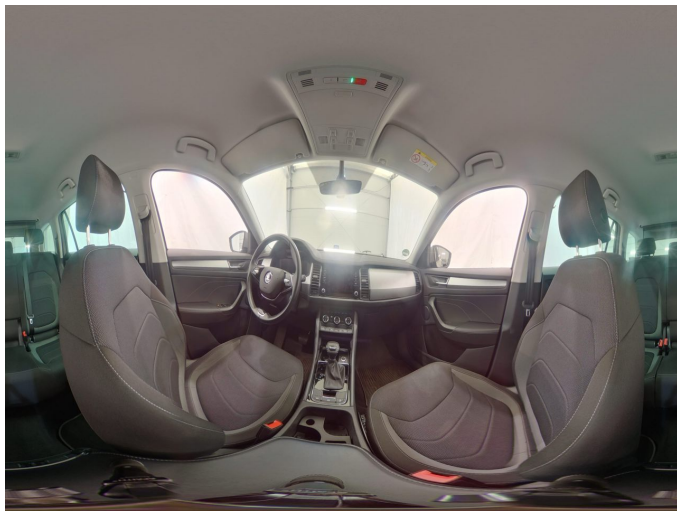


Figure 9: Interior 360° view



Figure 10: Cargo area

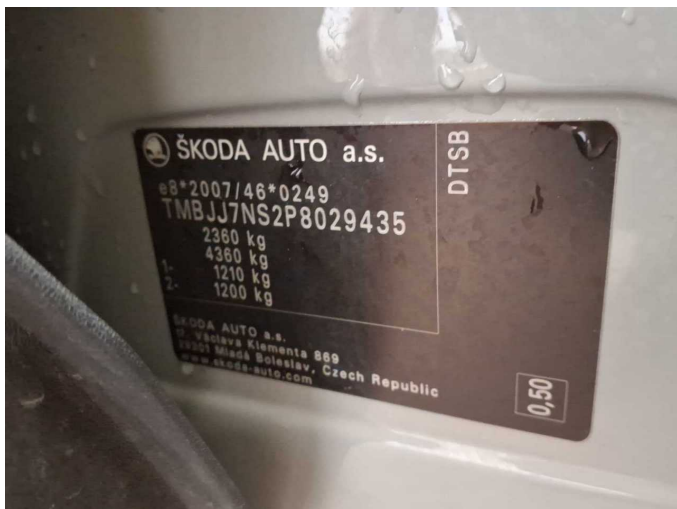


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

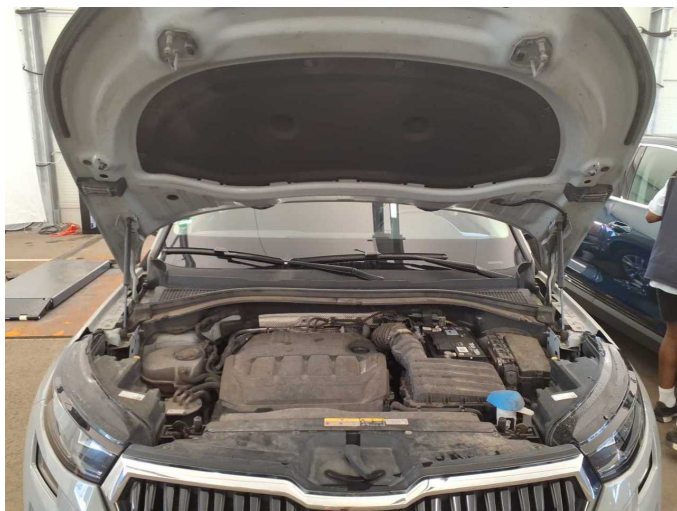


Figure 21: Misc.



Figure 22: Misc.

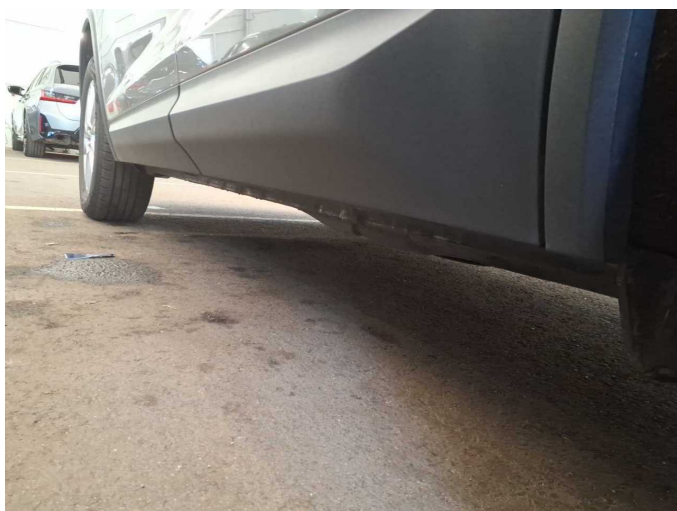


Figure 23: Misc.

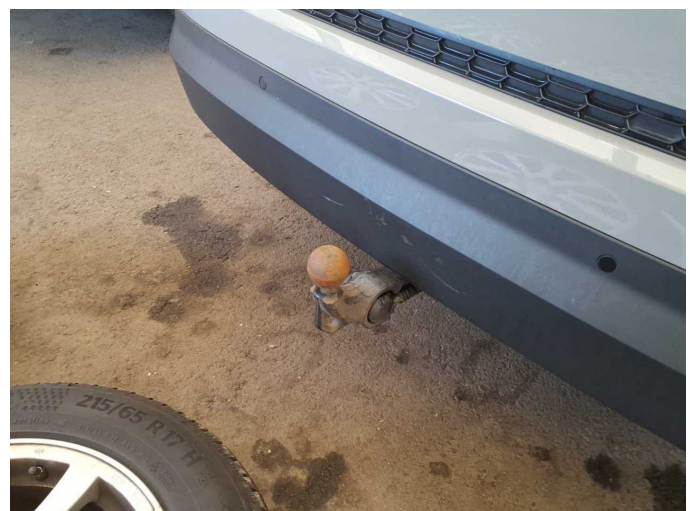



Figure 24: Misc.



**Figure 25:** Misc.




**Figure 26:** Misc.

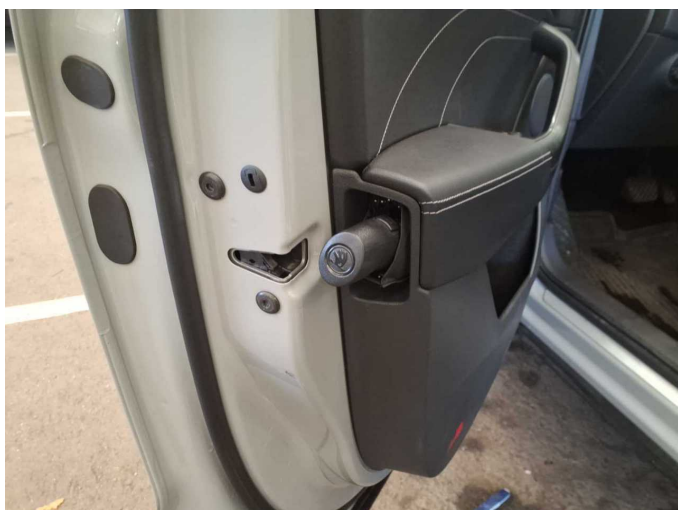

**Figure 27:** Misc.



**Damage 1:** Door - front left side: Door - Scratch(es) - Smart repair

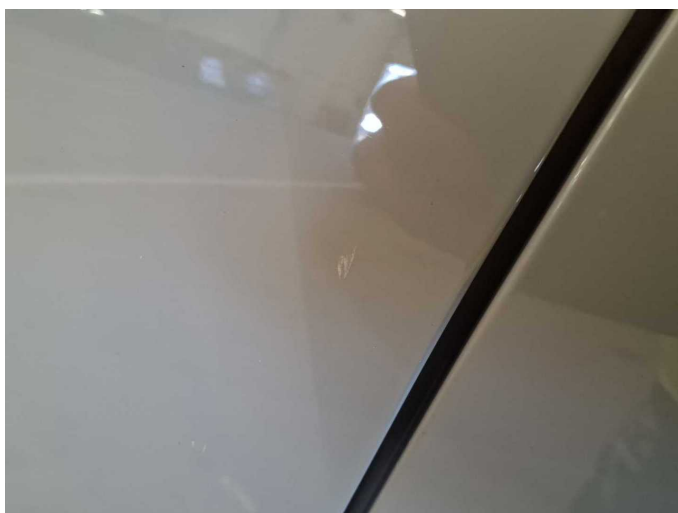

**Damage 1:** Door - front left side: Door - Scratch(es) - Smart repair



**Damage 2:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



**Damage 2:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



**Damage 2:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJJ7NS2P8029435  
Hersteller / Modell: SKODA SKODA Kodiaq 2.0 TDI DSG Ambition

| Datum      | KM-Stand | Beschreibung                                                                                                                                                                              |
|------------|----------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 28.04.2026 | 180.699  | AU; Bremse Sonstiges; Bremsklötze vorne                                                                                                                                                   |
| 13.02.2026 | 169.950  | Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h;<br>Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern;<br>Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges |
| 08.01.2026 | 165.973  | Batterie ern; Systemtest/Eigendiagnose                                                                                                                                                    |
| 20.08.2025 | 145.491  | Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Motoröl b.<br>Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                     |
| 11.03.2025 | 116.511  | Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Motoröl b.<br>Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                |
| 13.08.2024 | 86.690   | Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern;<br>Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges                                        |
| 28.05.2024 | 72.917   | Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben<br>hinten; Bremsscheiben vorne                                                                                     |
| 23.04.2024 | 58.322   | Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges;<br>Wartung Sonstiges                                                                                          |
| 31.10.2023 | 29.863   | Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                                                                                  |