



Expertise

Protocol number: 47196477
Order No. / Reference: 26653181-1
Inspection date: 17 Aug 2026

Manufacturer: Opel

Model: Insignia Sports Tourer 2.0 Diesel Business

VIN: W0VZT8EP6N1018366



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Insignia Sports Tourer 2.0 Diesel Business	
Vehicle Identification number	W0VZT8EP6N1018366
Mileage (Read)	104,330 km
First registration	20 Jul 2022
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,955 ccm / 4
Power	128 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Car station wagon
Colour / colour code	Argonsilber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Vehicle with smoke odor	no
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	82 %
Key is / should be	2 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ698505
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	With complaint
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	1844 / AMC 00313		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,205 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101Y	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	225/55 R17 101Y	Summer tyres on Light alloy	Continental	3mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 97H	Winter tyres on Light alloy	Bridgestone	4mm / 4mm
2)	225/55 R17 97H	Winter tyres on Light alloy	Bridgestone	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Equipment

- 1. WINDOW 2021/FRONT 1. WINDOW 2023
- 1995ccm (2.0 Ltr) 128kW
- 2-zone automatic climate control
- 2. WINDOW 2022/VO 2. WINDOW 2024
- 225/55 R 17 .. W
- 3EME FENETRE 2021 / AVANT 3EME FENETRE 2023
- from N1000001
- ACCES/DEMARRAGE MAINS LIBRES ACCES SS CONTACT+DEMARRAGE
- ACCOUDOIR ASSISE AR SANS
- Adaptive headlights/LED
- AFFICHEUR AV ECRAN 8P COUL HD TACTILE
- AIDE VISUAL PANORAMIQUE VISIO PARK 2
- ANTIVOLATIVE ALARMS WITHOUT
- ALLUMAGE FEUX ALLUM AUTO + COMMUT ADAPTATIVE
- AMELIORATION ACCOUSTIQUE AVEC
- APPEAL URGENCE E-CALL SANS
- ELECTRIC ARCHITECTURE WITHOUT
- ASSISE AR ASSISE MONO FX+DOS 2/3-1/3 RAB
- ASSISTANCE FREINAGE MARCHE AV ARC ALERTE COLLISION 30-80
- ATTACHE REMORQUE SANS
- Electrically folding exterior mirrors
- STANDARD AVERAGE DISPLAYER
- BASE DE CONCEPTION B0.
- Indoor lighting ambience
- BOITIER SERVITUDE SANS
- CAPOT (TYPE) LONG ACTIF CHOC PIETON
- FUEL (TYPE) DIESEL
- CDE ASSISE AV CONDUCTEUR MANUAL + REGL NEZ COUSSIN
- CITY PARK SANS
- COLONNE DIRECTION REGL(SKIN+PROF)MANUEL
- COMMANDE A DISTANCE COMMANDE COFFRE AR
- COMMANDE OUVRANT AR COFFRE MOTORISE
- COMMANDE VITESSES AU PLANCHER
- LATERAL CORRECTION LKA LIGNE
- COTE CONDUITE/POSTE CONDUITE A GAUCHE
- Black garnish color
- COUPLE PONT 20 X 73
- CYLINDREE 2000
- Roof lining Jet Black
- DEFLECTEUR AERODYNAMIQUE AR SANS
- DEMARREUR STTD
- DETECTION PASSAGERS AR AVEC NAPPE
- DIMENSION DISQUE AV DIAMETRE 321 EPAISSEUR 28
- DIMENSION FREIN AR DISQUE DIAMETRE 288 EP 12
- DIRECTION (FONCTIONNEMENT) ELEC ASS DBLE PIGNON HIGH POW
- ECHAPPEMENT DOUBLE
- ECROUS ANTIVOL SANS
- 1. WINDOW 2022/VO 1. WINDOW 2024
- 2-layer metallic
- 2nd WINDOW 2021 / BEFORE 2nd WINDOW 2023
- 2022
- 3rd WINDOW 2020 / BEFORE 3rd WINDOW 2022
- 6-speed
- ACCES BRAS CHARGE AVEC
- ACCESSORY INT.DIVERS SUPPORT GOBELET COVER
- ACCESSORIES EXT (ASPECT) CALANDRE COULEUR CAISSE
- AFFICHAGE PANNEAU ROUTIER VITESSE+SIGNALIZATION (ETSR)
- Acoustics improved pack
- ALLEGEMENT LEVEL 0 SANS
- ALTERNATEUR CLASSE 17 UHEA
- ANTENNA AIRERON AR + NUM
- APPUI-TETE AV REGLABLE 4 VOIES COND+PASS
- INTERIOR AIR AIR AIR
- ASSISTANCE FREINAGE MARCHE AR ALERTE COLLISION - RCTA
- ATMOSPHERE STANDARD
- ATTENTION DEFINITION
- AVERTISSEUR SONORE (TYPE) TROMPE MONOTON GRAV ELECTROMECC
- BATTERY (TYPE) L3 760 70AH EFBC 760 EN EFBC
- BOITIER ELECTRO COMPLEMENTAIRE SANS
- 17-inch brake system
- CARBURANT (RON MINI MOTEUR) GASOIL -QUALITE DA/DE/ DE+
- CDE ASSISE AV PASSENGER MANUAL
- CHAUFFAGE ADDITIONNEL SANS
- CLIMAT (TEMP AMBIANTE) FROID
- COMBINE (CARACTERISTIQUES) MATRICE COULEUR 8
- COMMANDE ASSISE AR SANS
- COMMANDE TOIT OUV VELUM (TYPE) SANS
- CONNECTIVITE TELECOM SANS
- COTE CIRCULATION A DROITE
- COULEUR DE CAISSE KVE GRIS SWITCH BLADE
- COUPE CIRCUIT SANS
- CRIT.VARIANC CLIENT.CONCEPTION BUSINESS LINE
- Silver roof rails
- DECORATION (ADHESIVE) ENJ AR ENC NOIR BRILLANT
- Interior decor black
- DETECTION OBSTACLE PROXIMITE AVANT+ARRIERE
- DETECTION SOUS GONFLAGE DIRECTE
- DIMENSION ENJOLIVEMENT LAT SANS
- DIMENSIONS-TYPE PNEUMATIQUE 225/55 R17 97W -NON RENFORCE
- DIRECTIVE EUROPEAN e4
- ECLAIRAGE AMBIANCE BLANC
- ELEMENTS GARNISSAGE INT PAVILION JET BLACK



- EMISSION DONNEES VEHICULE SANS
- ENJOLIVEUR VITRE NOIR BRILLANT + CHROME
- EQUIPEMENT PLANCHE BORD DECOR COLOR HEXAGON + GARNISSAGE PORTE DECOR TISSU+COULEUR HEXAGON
- ESSUIE-VITRE AV INTERMIT 2 VIT+CAD AUTOMAT
- EVOLUTION DEFINITION TECHNIQUE GAMME INITIAL
- FILTRE A POLLEN AVEC + CHARBON ACTIF
- FINITION HAUTE MOYENNE PLUS
- FREQUENCE TELECDE CONDAMNATION 433.92 MHZ SUPER HETERODYNE
- GARNISSAGE PORTE DECOR TISSU+COULEUR HEXAGON
- GRADUATION VITESSES KILOMETRE
- electric tailgate
- INDICE FAMILY WLTP LEVEL 01
- INDICE MAJEUR 0D.
- INDICE MINEUR 2EME MODIFICATION IMPORTANTE
- Interior mirror automatically dimming
- JANTE (DIAMETRE) MONTE 17P
- JANTE (STYLE) 17P 5 TWIN SPOKES DESIGN INSIG
- Keyless Open (keyless start/lock system)
- LCD instrument cluster
- LAMP LED (DIODES ELECTROLUMIN.)
- LED headlights
- Heated steering wheel
- LEVE VITRE AV LVE CONDUCTOR+PASSAGER
- LIGNE DE PRODUIT Insignia B
- LSQFAT EU63 DIE L4 2.0L DOHC
- Opel brand
- MASE MAXI ESSIEU AR 1200
- MASSE TECHNIQUE ADMI EN CHARGE 1995
- MASS TOTAL OPTIONS 105
- MESURE CHARGE BATTERIE AVEC
- MIROIR COURTOISIE CDC+PSG OCCULT PASS ECLAIR LED
- MONOGRAM COMPL MOTORIZATION SANS
- ASSEMBLY APPUI TETE AR 3 APPUI TETE
- Fog light
- NUMERO DIRECTIVE *2007/46
- NUMBER EXTENSION *09
- PACK ASSISTANCE AU PARKING DUB23+DQK14+DN400
- PACK MODULARITE/ERGO ASSISE AV
IP11RH13+IT12IQNA1+INIUYH0+AK7
- Front and rear parking sensors
- PEDALIER (TYPE) STANDARD SIMPLE
- PNEUMATIQUE (MARQUE) BRIDGESTONE
- PORTE BAGAGE (ASPECT) ALU
- PRIZE ACCESSORIES ACCESSORIES (DOUBLE)
- PINSE USB CHARGE 2 USB TYPE A
- PROJECTEUR ANTI-BROUILLARD A LED
- PROTECTION CAISSE SANS
- RANGEMENT VOLUME CHARGEMENT AVEC FILET DANS COFFRE
- RECHAUFFEUR HABITACLE RESISTANCES AIR - CTP

- ENJOLIVEUR ROUE (STYLE) CABOCHON OPEL
- EQUIPEMENT PLANCHE BOARD DECOR COLOR HEXAGON
- EQUIPEMENT SECOURS KIT ANTI CREVAISON
- VIRY ESSUIE AR AVEC
- ETRIER FREIN PERSONNALIZATION STANDARD
- Chrome/gloss black window trim
- PARTICULE FILTRE PARTICULE SANS
- FONCTIONNEMENT COMPL RETRO EXT RABAT ELEC
COND+PAS+MARCHE AR
- Windscreen, heated
- GENRE DE PRODUIT VEHICULE PARTICULIER
- Speed control
- SKIN PARLEUR 7HP AV (2TW+2AV+2MED+1CENT)
- rear window wiper
- INDICE GRANDEURS PHYSIQUES CRR01-SCXS02-SCXE02-
MS03-ME03
- 8-inch infotainment system with navigation
- JANTE (COULEUR) SANS
- JANTE (LARGEUR) 7.5J17ET45
- JEU DE CLES 2PLIP IML+2CLE SECOURS METAL
- Front collision warning system
- Refrigerant R1234yf
- last 8 VIN digits to select Audatex option code for build date
- leather steering wheel
- LEVE VITRE AR COMMANDE ELEC SEQ+COMDAMNATION
- LIQUID REFRIGERANT 1234 YF
- MARQUE COMMERCIALE/TYPE ORGANS OPEL
- MASS A VIDE (KG) 1270
- MASSE MAXI ESSIEU AV 1120
- MASS DEAD ROULANTE ADMISSIBLE 2960
- MATELASSURE ASSISES AV AVEC NAPPE DETECTION
PASSENGER
- MIRROR SCREEN WITH
- MONOGRAMS COMPLETE DIVERS WITHOUT
- MONOGRAMS MONOGRAMS FAMILY
- ENGINE LSQFAT EU63 THE L4 2.0L DOHC
- NEUTRALIZATION SAC GONFLABLE MANUAL
- NUMBER DOSSIER *0996
- PACK ASPECT EQUIPEMENT EXT COLORE 1
- PACK EQUIPEMENT SANS
- PACK ROUES DZXT+N900
- PARE-CHOCS PC AV/AR CC + BARRE CHROME
- PAYS PROGRAMS (ICP) ALLEMAGNE
- SIGNATURE PLATE WITH NO
- PNEUMATIQUE (QUALITE) C1 A - CRR INF OU EGAL A 6.5
- PORTE BAGAGE BARRE DE TOIT LONGITUDINALE
- PRIZE AUXILIAIRE PACK AUDIO 1 PRIZE JACK + 2 USB
- Production Plant Rüsselsheim, Germany
- PROJECTEUR CORRECTEUR ASSIETTE AUTOMATIQUE
- RANGEMENT (AUTRES) SANS
- RECEPTER RADIO ANALOGIQUE + DAB
- NOMADE CHARGING WITH



- REFRIGERATION CHAUFFAGE AUTOMATIQUE - RFTA
- Rain sensor
- REGLAGE ASSISE AV PASSAGER SANS
- REGULATEUR VITESSES SANS CHANGEMENT DE RAPPORT
- REHAUSSE/SUSP ASS AV COND REGLAGE HAUTEUR + SITE AVANT
- RETROVISEUR EXT COTE COND AVEC CDE INT ELEC ET CHAUFFA
- RETROVISEUR EXT COTE PASSAGER AVEC CDE INT ELEC ET CHAUFFA
- RETROVISOR EXT. ASPECT RET EXT NOIR BRILL+PIED NEUTRE
- ROUES MOTRICES 2 ROUES MOTRICES
- SAC GONFLABLE CONDUCTEUR AVEC
- Inflatable passenger bag with
- Side windows/rear window dark tinted
- Blind spot sensor with lane assist
- SIEGE MASSANT SANS
- SILHOUETTE BREAK 5 PORTES
- Fabric seat covers
- Smartphone charging
- STOP AND START STT ALTERNO DEMARREUR
- SURTAPIS (ASPECT) SANS
- ESP/ESC SYSTEMS WITH
- SYSTEMS NAVIGATION INFO TRAFIC + NAVIGATION 2
- TAUX DE CO2 MIXTE 999
- TEMOINS (TYPE) SANS
- TR HOMOLO CLASSE CRR A
- TR HOMOLO CONFIGURATION B
- TR HOMOLO ESSIEU MOTEUR 1
- TR HOMOLO GMP OV 94
- TR HOMOLO RAPPORT FINAL K
- TRANSMISSION MANUAL 6 RAPPORTS STT
- TYPE ET CRYPTAGE ADML ADML AES
- TYPE HABILLAGE INTERIEUR TISSU BILLY
- Front door windows laminated glass
- Traffic sign readers
- VERSION TYPE MINE 12BG1BBCKH3A5
- VISION TETE HAUTE SANS
- VITRE (TYPE) PARE-BRISE FEUILLETEE
- VITRE PARE BRISE (GENRE) CHAUFFANTE
- LEATHER SEAT VOLANT
- ADDITIONAL WINDOW 2020/FRONT ADDITIONAL WINDOW 2022
- RECONNAISSANCE VOCALE VIA SD+AUTONOME+CONNECTABLE
- REGLAGE ASSISE AV CONDUCTEUR DOS INCL MTN LOMBAIRE ELE ERGO
- REGULATION CLIMAT/TEMPERATURE BI-ZONE
- REHAUSSE ASSISE AV PASSAGER SANS
- Tire pressure monitoring system
- RESITUTION SONORE STANDARD
- RETROVISEUR EXT COTE COND AVEC CDE INT ELEC ET CHAUFFA + RETROVISEUR EXT COTE PASSAGER AVEC CDE INT ELEC ET CHAUFFA
- RETROVISEUR EXT PARTICULARITE SANS
- RETROVISEUR INT JOUR-NUIT ELECTROCHROME
- ROUE SECOURS SANS
- Digital reversing camera
- SAC GONFLABLE LATERAL THORAX AV + RIDEAU GONFLABLE
- SELECTEUR DE FASHE SANS
- SEUIL CHARGEMENT BAS INOX
- SIEGES CHAUFFANTS VENTILES CHAUFFANTS R1 SIEGES
- Front seat heating
- Illuminated sun visors
- SURMONTE PNEUMATIQUE SANS
- SURVEILLANCE VOIE LATERALE SAM+ASSIST CHNGT VOIE PASSIF
- SYSTEMS NAVIGATION INFO TRAFIC + NAVIGATION 2 + AFFICHEUR AV ECRAN 8P COUL HD TACTILE
- TOIT OUVRANT SANS
- TR HOMOLO CONFIG ADDITIONNELLE C
- TR HOMOLO ESSIEU DIRECTEUR 2
- TR HOMOLO FAM INTERPOLAT WLTP ZAV
- TR HOMOLO NB DE SIEGES 5
- TR HOMOLO VARIANT CARROSSERIE F0
- TYPAGE GMP SANS
- TYPE HABILLAGE EXTERIOR METALLISEE VERNIS
- TYPE MINE B-KDA027DB
- VARIANT ASSOCIEE ASSISE EVOLUEE
- VERROU PORTES AVANT COTE CONDUCTEUR
- Multiple antenna system
- VITRE (ASPECT) TEINTEE + SURTEINTEE AR
- VITRE LATERALE TYPE LATERALE FEUILLETEE
- Heated steering wheel with
- ADDITIONAL WINDOW 2021/FRONT UPPER WINDOW 2023



Standard equipment

- Storage compartments
- Airbag: Front airbags and side airbags, driver and front passenger
- Anti-lock braking system (ABS)
- Hill Start Assist
- third brake light
- Roof rails, silver anodized
- Diesel particulate filter
- Electronic brake force distribution (EBD)
- Electric windows front and rear
- Pedestrian protection including active hood
- luggage compartment cover
- Speed controller
- Back window, heater
- Automatic climate control, two zones
- Rear headrests (3 pieces)
- LED fog lights
- Steering column adjustable for height and reach
- Illuminated makeup mirrors in both sun visors
- Package: Winter 1
- Parkpilot, front and rear parking aid
- Quickheat rapid heating system
- Radio: Multimedia Navi Pro with 8" color touchscreen display
- Wheels: 7.5 J x 17 alloy wheels in a 5 double-spoke design
- Seat belts: Three-point seat belts in all seats
- Visibility equipment
- Lane Keeping Assist
- Bumpers painted in body color
- Traffic sign assistant
- Immobiliser
- Central locking with remote control

Extra equipment

- Package: Business Premium (Easy Access Package: Keyless locking and starting system, sensor-controlled tailgate, electric loading sill protection, stainless steel - Charging Package: Wireless charging, 2 USB ports, rear center console - Park & Go: Digital reversing camera, reversing assistant, lane change assistant, blind spot warning in both exterior mirrors - Innovation Package 1: IntelliLux LED Pixel headlights, traffic sign assistant - Solar Protect heat-insulating glass, heavily tinted, in the rear)

- Adaptive brake light
- Airbag: Front and rear outer head airbags
- Ambient lighting
- Electrically adjustable and heated exterior mirrors for driver and passenger side
- Glasses compartment in the headliner
- Decorative strip hexagon
- Tachometer
- Electronic Stability Program (ESP Plus)
- Front collision warning system with pedestrian detection and automatic emergency braking
- Noise-reducing, laminated front side windows
- Transmission: 6-speed manual transmission
- Child safety lock in the rear doors, manual
- Front headrests
- LED headlights
- LED daytime running lights including LED indicators, front and LED taillights
- Center armrest, front
- Electric parking brake
- Upholstery: Billy fabric, black
- Radio: Digital radio reception DAB+
- Tire repair kit
- Tire pressure gauge
- Rear seat backrest folds forward in a 60:40 split
- Power steering
- safety net
- Seats: Ergonomic active seat (AGR) driver
- Start/Stop System
- Traction Control (TC) Plus
- Pre-installation for child seat mounting system "ISOFIX"
- Thermal insulation glazing, green tinted

- Paint finish: Metallic
- third key



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed, problem has been detected This is due to the following reason.: Motorschaden
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Body	Body - Glued / labelled - De-glue / neutralise
2	Engine	Engine (Keine Leistung) - Functional / admissibility - Replace

Missing parts

Description

Equipment - Vehicle key

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 16 Jul 2025	2.951,57 €

Repainting

No. Repainting

1	Roof, Professionally carried out, Invoice of repair done Non-existent
2	Roof rail - right side, Professionally carried out, Invoice of repair done Non-existent
3	Mudguard - left side, Professionally carried out, Invoice of repair done Non-existent
4	Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
5	Bonnet, Professionally carried out, Invoice of repair done Non-existent
6	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
7	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
8	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
9	Door - front left side
10	Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof	203 µm	Roof rail - right side	207 µm
Mudguard - left side	177 µm	Mudguard - right side	184 µm
Bonnet	174 µm	Side panel - rear right side	172 µm
Door - rear left side	185 µm	Door - rear right side	213 µm
Door - front left side	190 µm	Door - front right side	191 µm



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Ausstattung.

Minderwerte höher als HEK



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

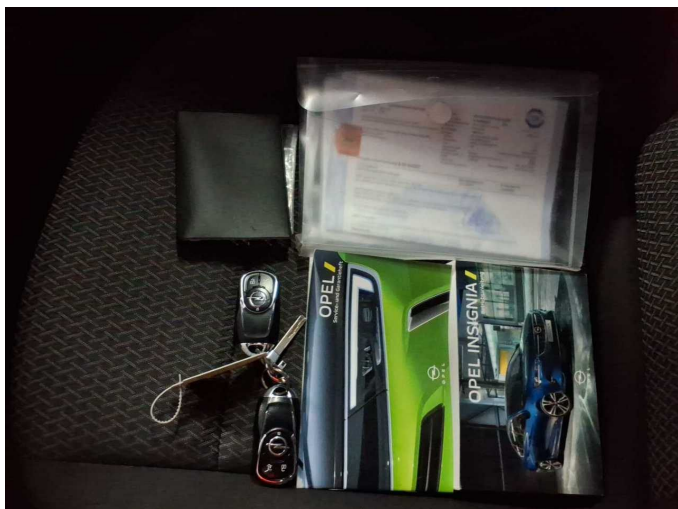


Figure 13: Documents



Figure 14: Additional tyres

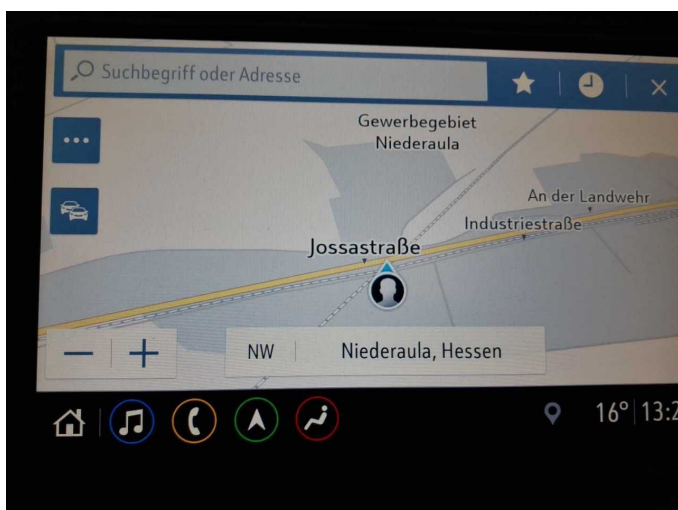


Figure 15: Navigation



Figure 16: Misc.

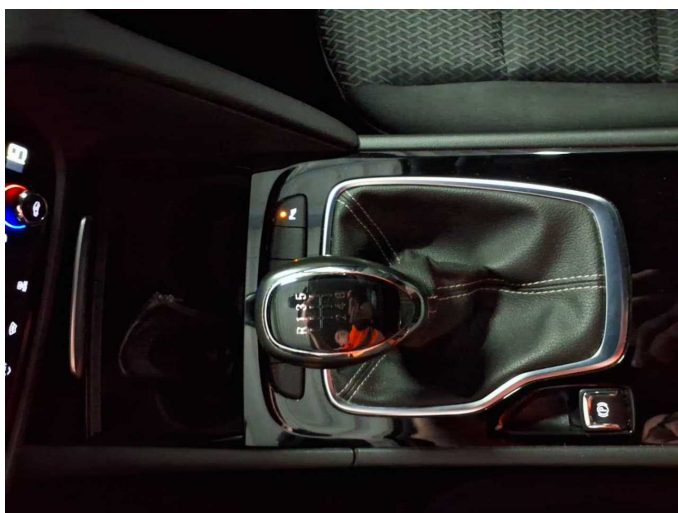


Figure 17: Misc.

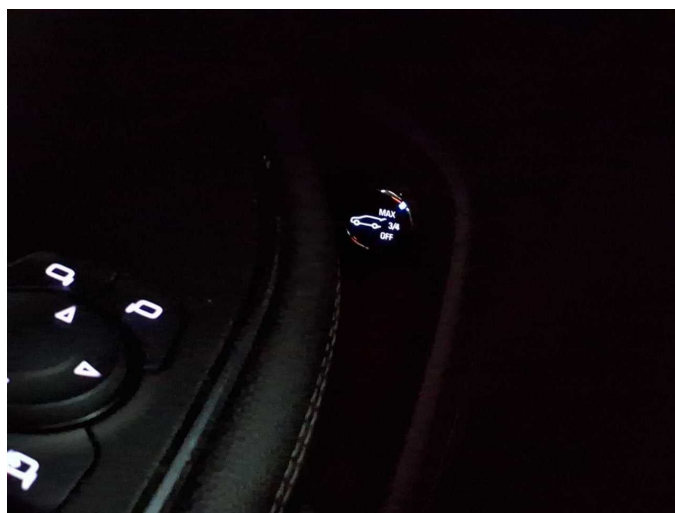


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

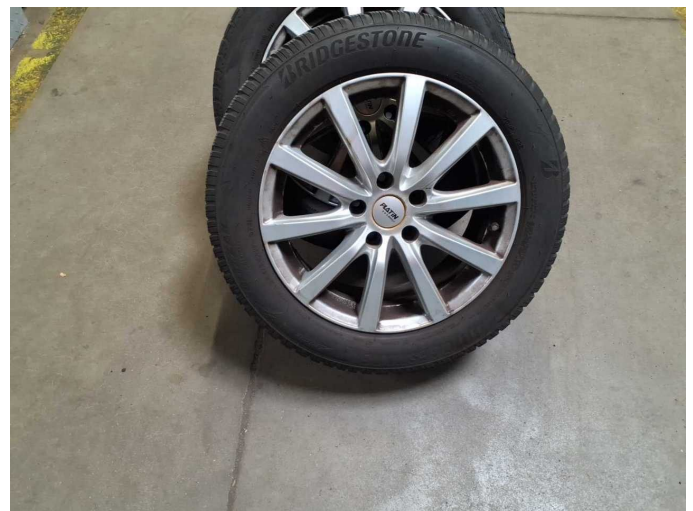


Figure 24: Misc.

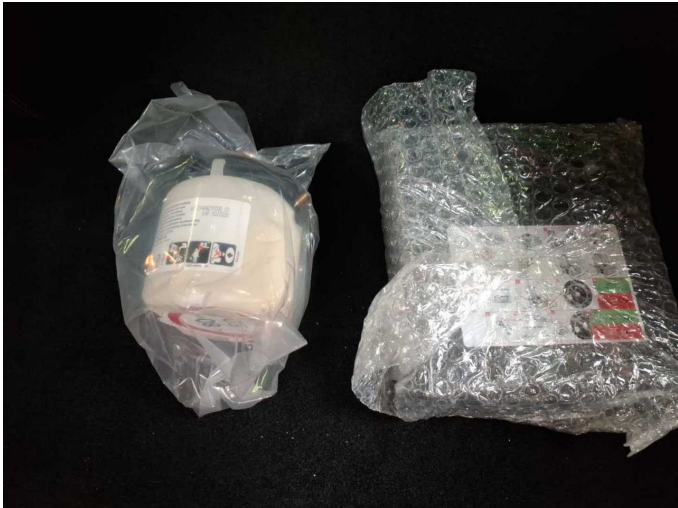


Figure 25: Misc.

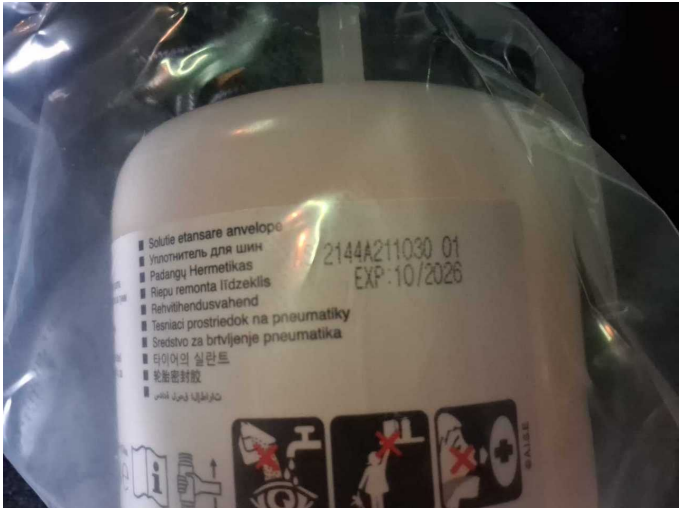


Figure 26: Misc.



Figure 27: Misc.

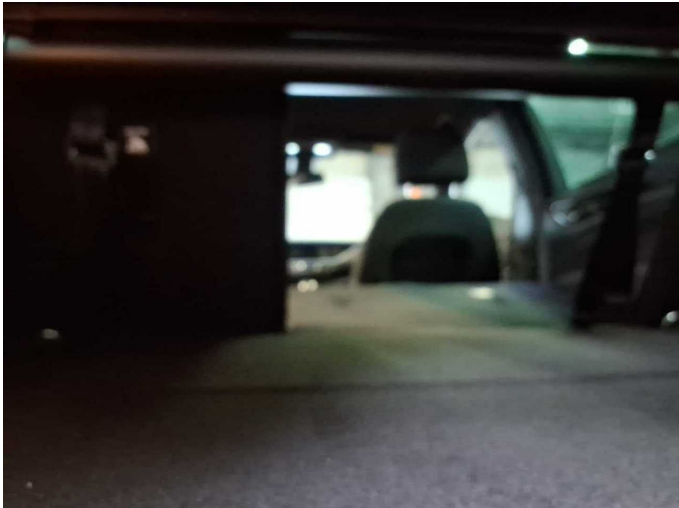


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Damage 1: Body: Body - Glued / labelled - De-glue / neutralise



Damage 1: Body: Body - Glued / labelled - De-glue / neutralise



Damage 1: Body: Body - Glued / labelled - De-glue / neutralise



Repainting 1: Roof



Repainting 1: Roof



Repainting 2: Roof rail - right side



Repainting 2: Roof rail - right side



Repainting 3: Mudguard - left side



Repainting 3: Mudguard - left side



Repainting 4: Mudguard - right side



Repainting 4: Mudguard - right side



Repainting 5: Bonnet



Repainting 5: Bonnet



Repainting 6: Side panel - rear right side



Repainting 6: Side panel - rear right side



Repainting 7: Door - rear left side



Repainting 7: Door - rear left side



Repainting 8: Door - rear right side



Repainting 8: Door - rear right side



Repainting 9: Door - front left side



Repainting 9: Door - front left side



Repainting 10: Door - front right side



Repainting 10: Door - front right side