

Expertise

Protocol number: 46226527
Order No. / Reference: 26472210
Inspection date: 30 Jun 2026

Manufacturer: Skoda	Model: Kodiahq 2.0 TSI 4x4 DSG RS
VIN: TMBLU7NS7P8042228	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiaq 2.0 TSI 4x4 DSG RS	
Vehicle Identification number	TMBLU7NS7P8042228
Mileage (Read)	106,020 km
First registration	14 Apr 2023
Number of holders	1
Next periodical technical inspection	04/2028
(Report not on hand)	
Power / Engine displacement	180 kw / 1,984 ccm
Fuel type / Cylinder	Petrol / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Blau Race Metallic
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	15,500 km
Last service on / at	03/2026 at 97,948 km		
Key is / should be	2 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ569516
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AXH 00104		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,390 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/40 R20 101Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm
2)	255/40 R20 101W	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tires (with run-flat tires) on Light alloy	Pirelli	4mm / 4mm
2)	215/65 R17 99H	Winter tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 12V socket in the center console and in the trunk
- Storage compartments behind the wheel arches in the trunk
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Permanent all-wheel drive
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and driver's side mirrors with automatic dimming
- Hill start assist
- Hydraulic brake assist (HBA)
- Black headliner
- Dark Carbon decorative inlay
- Tachometer
- Easy Start (start-stop button)
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Chassis: Adaptive chassis DCC including driving profile selection
- Front radar assistant including city emergency braking function with pedestrian detection
- Closed storage compartment on the driver's side
- Transmission: 7-speed dual-clutch transmission (DSG)
- Illuminated glove compartment
- Climatronic air conditioning (2-zone)
- Boot cover, roll-up and removable
- LED ambient lighting
- LED matrix headlights and dynamic high beam assist (Light Assist)
- Steering wheel: Sport leather steering wheel with multifunction buttons including paddle shifters.
- Front center armrest, including storage compartment
- Multi-collision brake
- Otto particulate filter
- Stainless steel pedal design
- Progressive steering
- Radio: Bolero infotainment system
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring
- Heated windshield washer nozzles, front
- Headlights washer / wiper system
- Kodiahq seat belts
- Seats: Adjustable lumbar support in the front seats
- Seats: Height-adjustable front seats
- Seats: Remote release of the rear seat backrests (2nd row) in the boot
- Speed limiter
- Sunset
- Front door sill trims
- Variable fastening concept in the trunk
- Immobiliser
- Storage compartment on the left wheel arch
- front aero windshield wipers
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black with microfiber inlay
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Care Connect: Proactive services (10-year term)
- Roof rails, black
- Digital Cockpit Plus (10")
- Third brake light
- eCall
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor
- Electric windows front and rear
- High Beam Assist (Light Assist)
- front and rear floor mats
- Front and rear footwell lighting
- Cruise control
- Tinted windows
- Isofix anchorage on the outer rear seats including top tether
- Front headrests are fixed, rear headrests are height-adjustable.
- LED taillights in crystal glass look with animated turn signals
- Reading lights at the front of the headliner
- Rear center armrest with cup holders
- Engine drag torque control (MSR)
- Fog lights with integrated LED daytime running lights
- Front and rear parking sensors
- Upholstery: Microfiber RS-Black
- Wheel arch cover
- Radio accessories: 8 speakers
- Radio accessories: Wireless SmartLink
- Rear seat backrest split 60:40, foldable, longitudinally adjustable, backrest angle adjustable
- Electromechanical power steering
- Seats: Heated front seats
- Seats: Electrically adjustable front seats with memory function
- Skoda Care Connect
- Sun visor on driver and passenger side with illuminated vanity mirror
- Telephone: Convenient hands-free telephone system including phone box
- Lashing eyes in the trunk
- Central locking with remote control



Extra equipment

- Adaptive Cruise Control (ACC) (control range up to 210 km/h) (replaces cruise control)
- Paint finish: Metallic / Pearl effect
- Electric panoramic sunroof including sunshade (no glasses compartment in the headliner)
- Wheels: 20" Ignite anthracite alloy wheels, polished (8.5Jx20 tires 255/40 R20 101V ET41 - active tire pressure monitoring system)
- Rear view camera
- Auxiliary heating
- Swiveling trailer hitch (with electric release, including trailer stabilization)
- Package: Business Columbus (RS) (Dynamic radio navigation system Columbus - 9.2" capacitive color display - Digital Cockpit Plus (10") - Driver fatigue detection - 230V socket and a USB charging port (Type-C) on the back of the front center armrest - Acoustic glazing in the front doors - KESSY keyless entry - Electric tailgate operation including comfort opening - Luggage net partition - Infotainment Online (3-year subscription))

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Engine	Engine - Leaking - Diagnosed and repair if necessary
2	Front bumper	Front bumper - Scratch(es) - Smart repair
3	Door - rear left side	Door - Dent / paintcoat damage - Smart repair
4	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value
5	Vehicle glazing	Windscreen (Rissbildung, Randbereich) - Stone chips - repair according to calculation

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Alloy rim - front left side (Eingelaufen) - No deduction
2	Door - rear right side	Door - Dent / paintcoat damage - Smart repair
3	Bonnet	Bonnet - Dent / paintcoat damage - Smart repair

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key with remote control



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

Der beiliegende Radsatz ist nicht Bestandteil der vorliegenden Fahrzeugausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

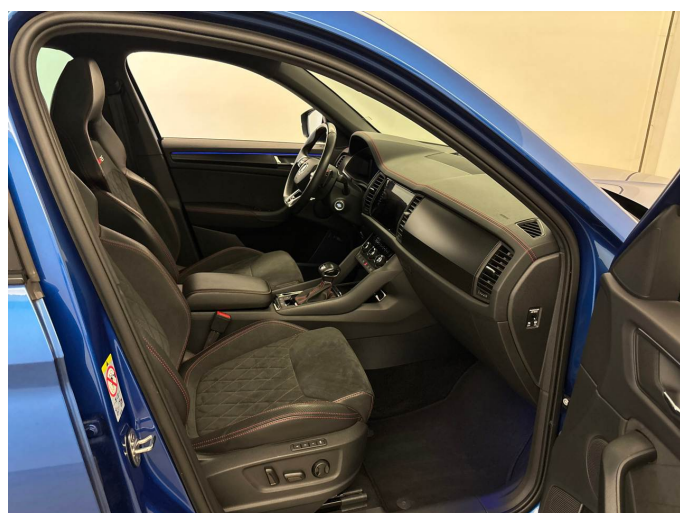


Figure 5: Interior - front

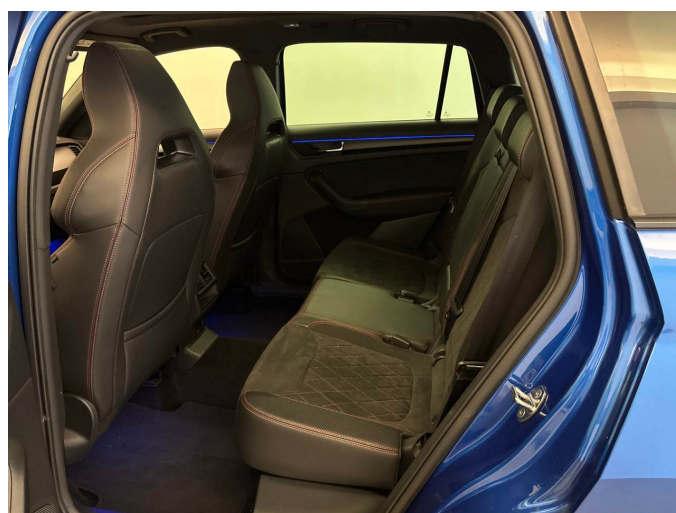


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

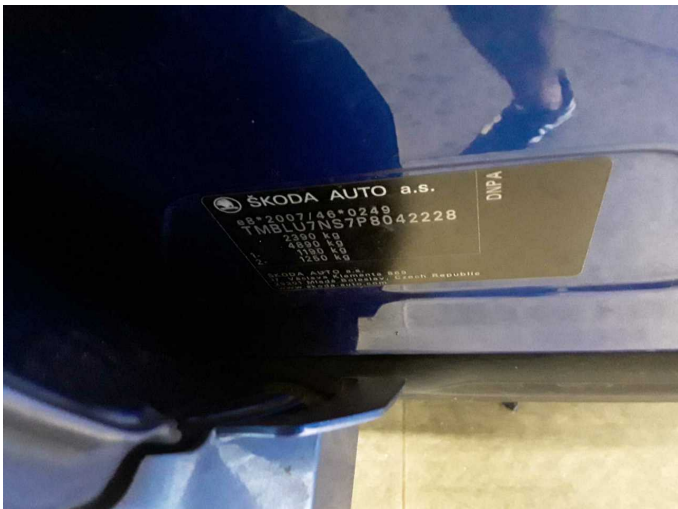


Figure 11: VIN



Figure 12: Mounted tyres

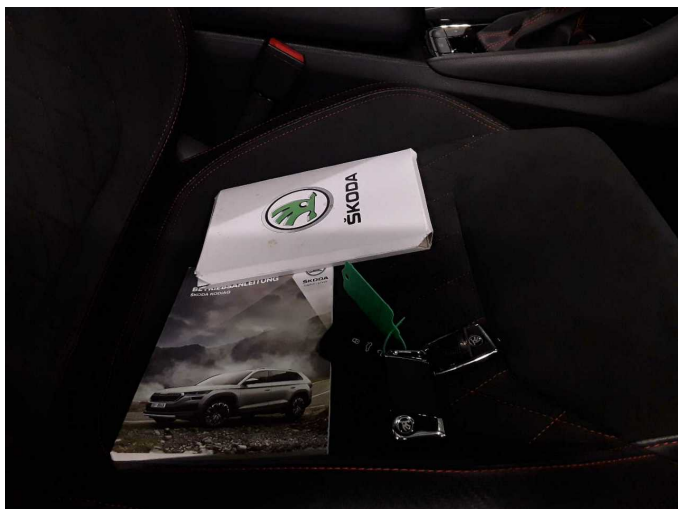


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.

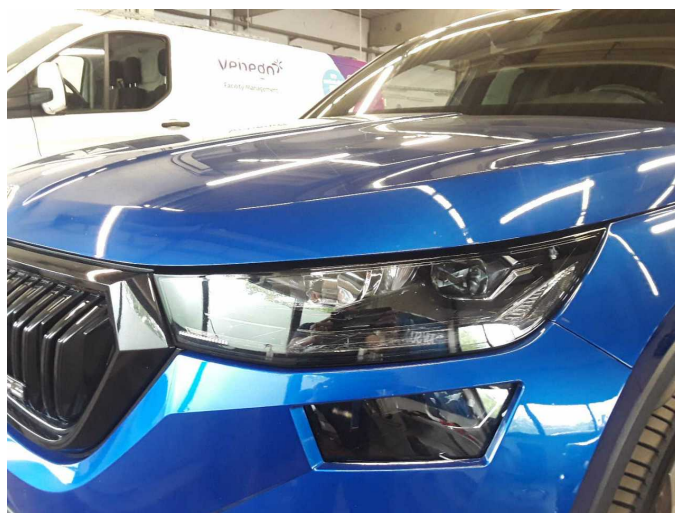


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

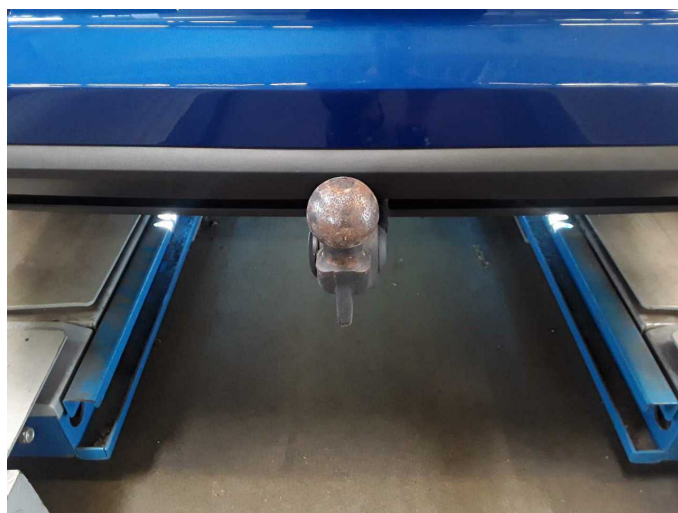


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

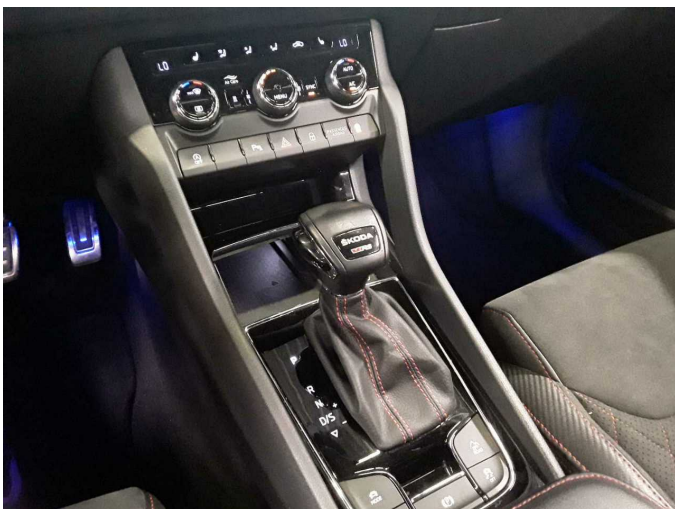


Figure 29: Misc.

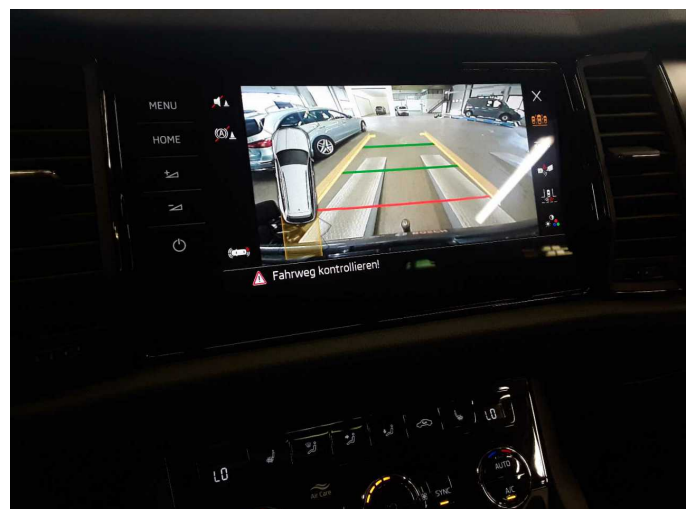


Figure 30: Misc.

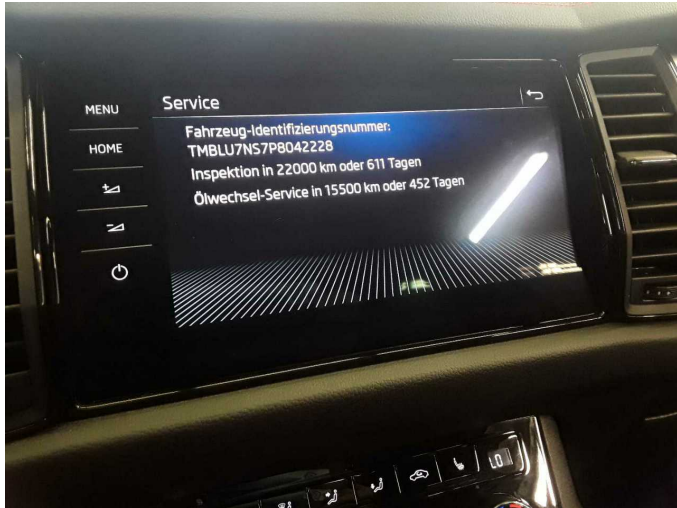


Figure 31: Misc.



Damage 1: Engine: Engine - Leaking - Diagnosed and repair if necessary




Damage 1: Engine: Engine - Leaking - Diagnosed and repair if necessary



Damage 2: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 2: Front bumper: Front bumper - Scratch(es) - Smart repair

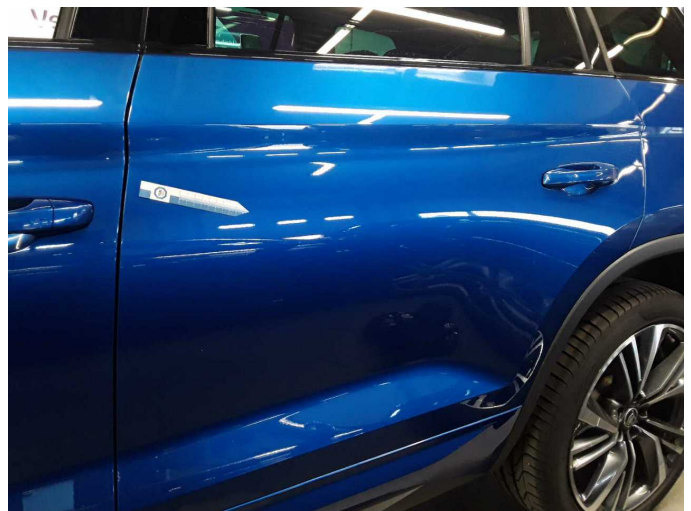


Damage 3: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage 3: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage 3: Door - rear left side: Door - Dent / paintcoat damage - Smart repair

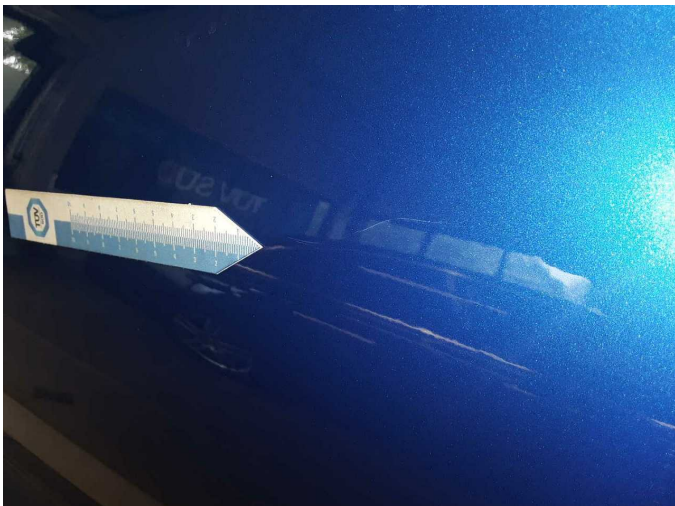

Damage 3: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value




Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 5: Vehicle glazing: Windscreen (Rissbildung, Randbereich) - Stone chips - repair according to calculation

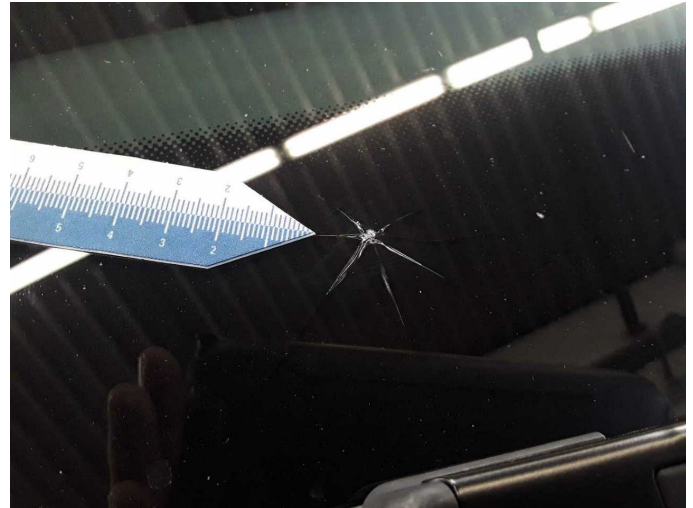

Damage 5: Vehicle glazing: Windscreen (Rissbildung, Randbereich) - Stone chips - repair according to calculation




Damage 5: Vehicle glazing: Windscreen (Rissbildung, Randbereich) - Stone chips - repair according to calculation



Damage 5: Vehicle glazing: Windscreen (Rissbildung, Randbereich) - Stone chips - repair according to calculation



Damage 5: Vehicle glazing: Windscreen (Rissbildung, Randbereich) - Stone chips - repair according to calculation

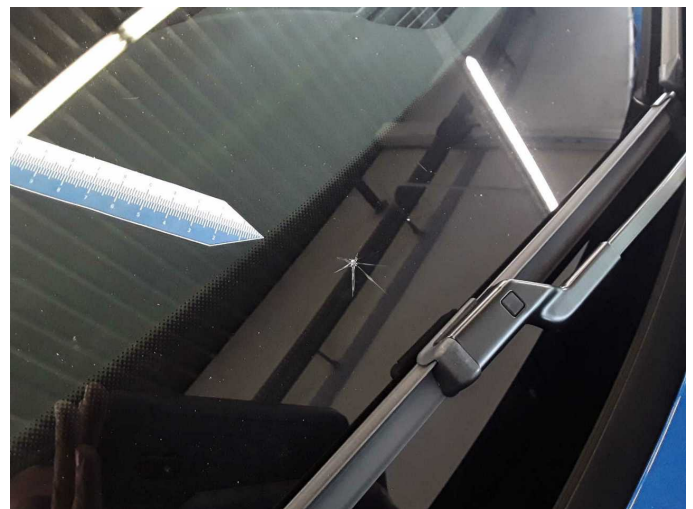


Damage 5: Vehicle glazing: Windscreen (Rissbildung, Randbereich) - Stone chips - repair according to calculation




Wear and tear 1: Wheel / tyres: Alloy rim - front left side (Eingelaufen) - No deduction



Wear and tear 1: Wheel / tyres: Alloy rim - front left side (Eingelaufen) - No deduction

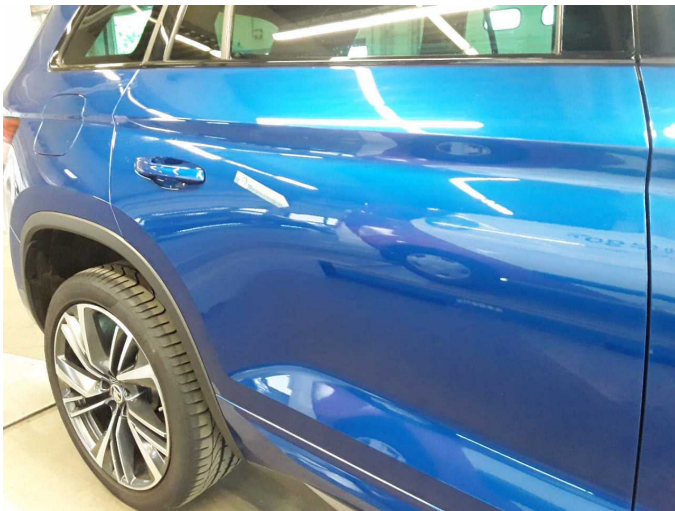


Wear and tear 2: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

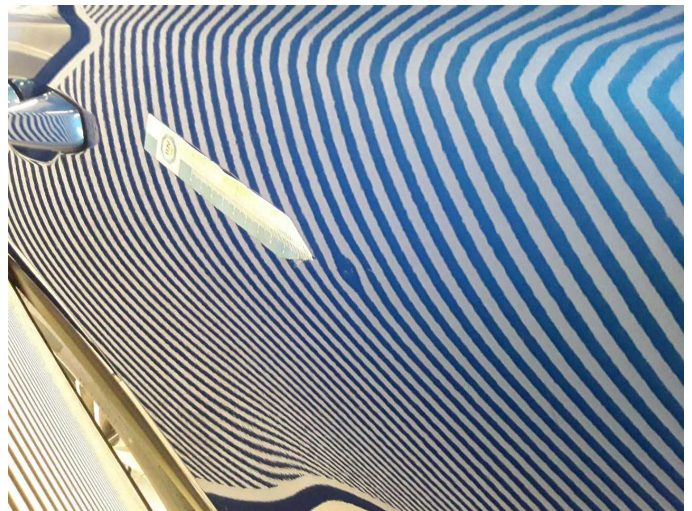


Wear and tear 2: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Wear and tear 3: Bonnet: Bonnet - Dent / paintcoat damage - Smart repair

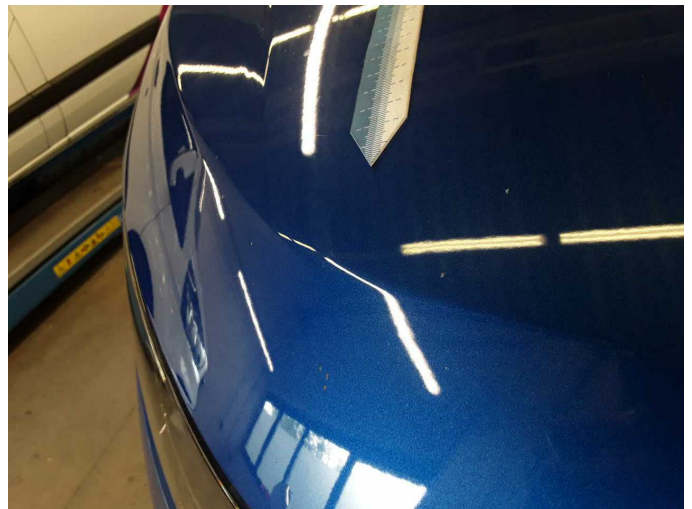

Wear and tear 3: Bonnet: Bonnet - Dent / paintcoat damage - Smart repair

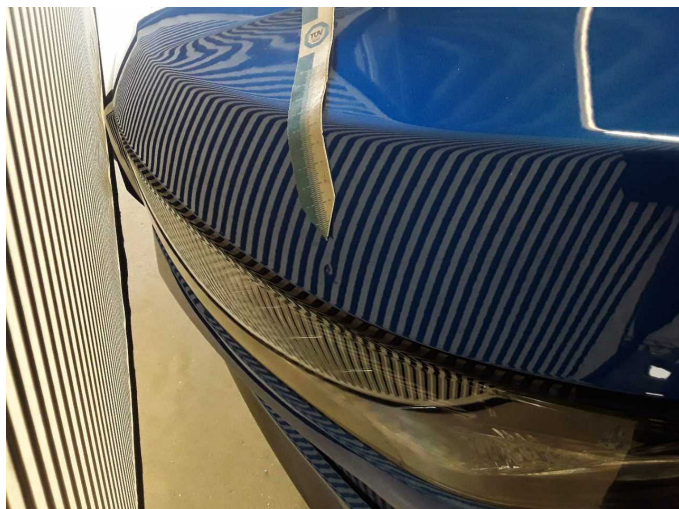

Wear and tear 3: Bonnet: Bonnet - Dent / paintcoat damage - Smart repair



Wear and tear 3: Bonnet: Bonnet - Dent / paintcoat damage - Smart repair



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBLU7NS7P8042228

Hersteller / Modell: SKODA SKODA Kodiaq 2.0 TSI ACT 4x4 DSG RS

Datum	KM-Stand	Beschreibung
27.04.2026	102.117	AU
03.03.2026	97.948	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
26.11.2025	85.854	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten
23.06.2025	71.233	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges; Zündkerzen ern
18.02.2025	60.180	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Getriebeöl ern/ prüfen; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
25.09.2024	47.492	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
25.03.2024	29.415	Regelwartungsdienst; Wartung Sonstiges
19.02.2024	25.251	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges