



## VOLVO XC60:

Vinnumber:	<b>YV1UZADVDL1587832</b>	Versionname:	<b>D4 120kW Geartronic R-Design</b>
First Registrationdate:	<b>11/05/2020</b>	Fiscalpower:	
Expertise Mileage:	<b>143097</b>	Power Kw:	<b>120</b>
Bodytype:		Body colour:	<b>Grey</b>
Gearbox:	<b>Automatic</b>	Type of rims (mounted):	<b>Aluminium</b>
Transmission:		Parking lot:	<b>1724</b>
Fueltype:	<b>Diesel</b>		
Maintenance:	<b>OK</b>		
Type of rims (mounted):	<b>Aluminium</b>		
Certificate of Conformity:	<b>Yes</b>		
Category:	<b>Passenger Car</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

## Options

Number of keys total:	<b>3</b>	Seats electric F L:	
Cruise Control:		Seats electric F R:	
Steering wheel multifunctional:		Luggage cover:	
Seats F heated:		Front parking sensors:	
Radio multimedia:		Rear parking sensors:	
Type of headlighting:	<b>Headlighting LED</b>	Type of Tow bar:	<b>No Tow bar</b>
Type of GPS:	<b>GPS big screen color</b>		
Type of Lining:	<b>Lining leather</b>		
Type of climate control:	<b>Autom climate control</b>		
Type of GPS storage:	<b>HD</b>		

## Limited Technical Inspection

## Tyres

235/55/19/105 V				
Winter tyres:	Fr.L.	<b>Vredestein: 5 mm</b>	Fr.R.	<b>Vredestein: 5 mm</b>
	Re.L.	<b>Michelin: 7 mm</b>	Re.R.	<b>Michelin: 7 mm</b>
Tyre profile depth FL				<b>5.0</b>
Tyre profile depth FR				<b>5.0</b>
Tyre profile depth RL				<b>7.0</b>
Tyre profile depth RR				<b>7.0</b>
Tyre size FL				<b>235/55 R 19 105 V</b>
Tyre size FR				<b>235/55 R 19 105 V</b>
Tyre size RL				<b>235/55 R 19 105 V</b>
Tyre size RR				<b>235/55 R 19 105 V</b>
Tyre type FL				<b>Winter</b>
Tyre type FR				<b>Winter</b>
Tyre type RL				<b>Winter</b>
Tyre type RR				<b>Winter</b>
Tyre make FL				<b>2480</b>
Tyre make FR				<b>2480</b>
Tyre make RL				<b>261</b>
Tyre make RR				<b>261</b>

## Assistance equipment

Repair kit:	<b>Yes</b>	Compressor:	<b>Yes</b>
Number of charging cables (normal):	<b>0</b>		
Number of charging cables (rapid charge):	<b>0</b>		

Total cost ex VAT:	<b>2977,48</b>
Engine insulation, Damaged, Replace:	<b>206,36</b>



Bumper F, Scratch(es), Repair and paint (complete) 355,89



Bonnet, Scratch(es), Acceptable 0,00



Windscreen, Broken, Replace 733,23



Wing RL, Scratch(es), Acceptable 0,00




Alloy rim RL polished, Rust, Acceptable 0,00



Door RL, Scratch(es), Acceptable 0,00



Alloy rim FL polished, Scratch(es), Repair and paint (complete) 204,21

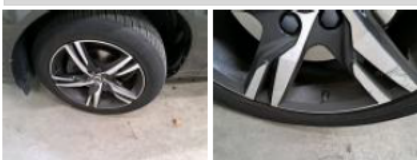

Bumper R, Dent(s) and scratch(es), Repair and paint (complete) 474,91



Alloy rim FR polished, Scratch(es), Repair and paint (complete) 204,21



Outside rear-view mirror housing R, Scratch(es), Acceptable 0,00



Door RR, Dent(s) and scratch(es), Repair and paint (complete) 594,46



Alloy rim RR polished, Scratch(es), Repair and paint (complete) 204,21

