



Expertise

Protocol number: 46176777
Order No. / Reference: 26358670
Inspection date: 26 Jun 2026

Manufacturer: Mercedes-Benz

Model: E 200 d 9G-TRONIC Exclusive

VIN: W1K2130121B001532



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz E 200 d 9G-TRONIC Exclusive	
Vehicle Identification number	W1K2130121B001532
Mileage (Read)	132,255 km
First registration	7 Oct 2022
Number of holders	1
Next periodical technical inspection	02/2027
(Report on hand)	
Power / Engine displacement	118 kw / 1,597 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	Rear drive
Type of vehicle	Saloon car
Colour / colour code	Polarweiß
Doors / Seats	4 / 5
Upholstery type	Artificial leather
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	137 Tag(e)
Last service on / at	10/2024 at 100,199 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ475962
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	2222 / All 00241		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,395 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101Y	Summer tyres on Light alloy	Sonstige	6mm / 6mm
2)	225/55 R17 101Y	Summer tyres on Light alloy	Sonstige	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 09/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- ADAPTIVE BRAKE with hill start assist, pre-filling and drying braking in wet conditions
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- Ambient lighting with 64 colors and 3 color zones
- Foldable armrest for driver and front passenger
- Left and right exterior mirrors, heated and electrically adjustable, painted in body color
- Brake assist, active
- Tachometer
- DYNAMIC SELECT
- Chassis: AGILITY CONTROL chassis with selective damping system and lowered suspension
- Velour floor mats
- Heated rear window with timer
- KEYLESS-GO start function
- Headrests (5)
- Steering wheel: Multifunction steering wheel in Nappa leather in a 3-spoke design
- Mercedes-Benz emergency call system
- Center console with on-the-fly storage compartment
- Navigation: Hard disk navigation
- Package: Filing package
- Package: Seating comfort
- PRE-SAFE system
- Radio: MBUX multimedia system
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Windscreen wipers with rain sensor
- Seats: i-Size child seat attachment
- Cruise control
- High-visibility vest for drivers
- Green, heat-insulating glass all around
- Decorative elements, light brown open-pored ash wood
- AdBlue tank with a capacity of 23.5 liters
- Airbag for driver and front passenger
- Airbag: Kneebag for driver
- Airbag: Windowbags left/right
- Anti-lock braking system (ABS)
- ATTENTION ASSIST
- Basic services
- On-board computer
- Diesel particulate filter
- Third brake light
- Electronic Stability Program (ESP)
- Electric window regulator with comfort operation and anti-pinch protection, 4-way
- Transmission: 9-speed automatic, 9G-TRONIC
- Interior headliner in nevagrau fabric
- THERMATIC automatic climate control
- LED High Performance Headlights
- Steering column mechanically adjustable in height and length
- Center console piano black finish
- Navigation accessories: Pre-installation for Live Traffic Information
- Package: AVANTGARDE Exterior
- Upholstery: ARTICO man-made leather
- Radio: Extended MBUX functions
- Radio accessories: Digital radio
- Tire pressure monitoring system
- Remote Services Plus
- Power steering
- Seats: Front seats electrically adjustable
- Touchpad
- Electronic immobilizer
- Central locking



Extra equipment

- Adaptive High Beam Assist (You activate the system with one operation and then benefit from the long beam range.)
- Decorative elements, wood, ash, brown, glossy
- Package: Mirrors (both exterior mirrors electrically foldable (button in the driver's door control panel) - automatic lowering of the passenger-side mirror glass to parking position when reverse gear is engaged - interior mirror and driver's side exterior mirror automatically dimming continuously - ambient lighting of the exterior mirror to illuminate the entry area)
- Package: Parking package with reversing camera (The parking package with reversing camera makes it easier to find and select parking spaces, as well as to park and exit in parallel and perpendicular parking spaces or garages. The active parking assistant steers the vehicle into parking spaces, including speed control and automatic gear changes.)
- Paint finish: Solid polar white
- Seats: Rear seat backrests foldable
- TIREFIT with tire inflation compressor
- Blind Spot Assist (you get two additional radar sensors installed in the rear bumper. This allows the system to detect both cars and motorcycles in the blind spot. If this occurs, a red warning triangle illuminates in the corresponding side mirror. If the turn signal is also activated, the Blind Spot Assist will warn you audibly of a potential collision. This warning helps you to avoid typical hazardous situations such as changing lanes, turning, and exiting the vehicle.)
- Heated windshield washer system (including heated washer fluid reservoir, windshield washer nozzles and washer fluid hoses)
- Package: Business (MBUX High-End Package - Connectivity Package Navigation - Traffic Sign Assist - Smartphone Integration - Pre-installation for Car Sharing - Widescreen Cockpit - Wireless Charging System for Mobile Devices - MBUX Augmented Reality for Navigation - Heated Seats for Driver and Front Passenger - Parking Package with Rearview Camera - Fuel Tank with 66 Liter Capacity (916) (60l for Diesel Plug-in Hybrids).)
- Seats: Heated seats for driver and front passenger (selectable in three stages - Intelligent and comfortable: The seat heating switches off automatically)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Roof	Roof (Steinschlag mit Korrosion) - Stone chips - Repair and paint
2	Front bumper	Front bumper - Scratch(es) - Paint
3	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - No deduction
2	Interior	Interior - Scratch(es) - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

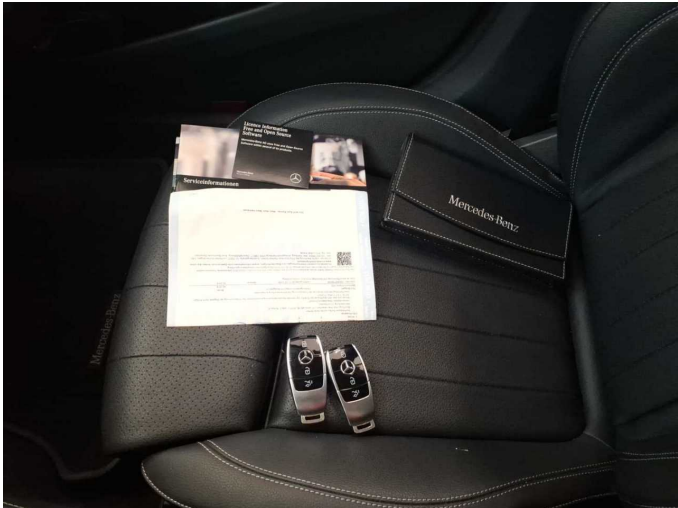


Figure 13: Documents

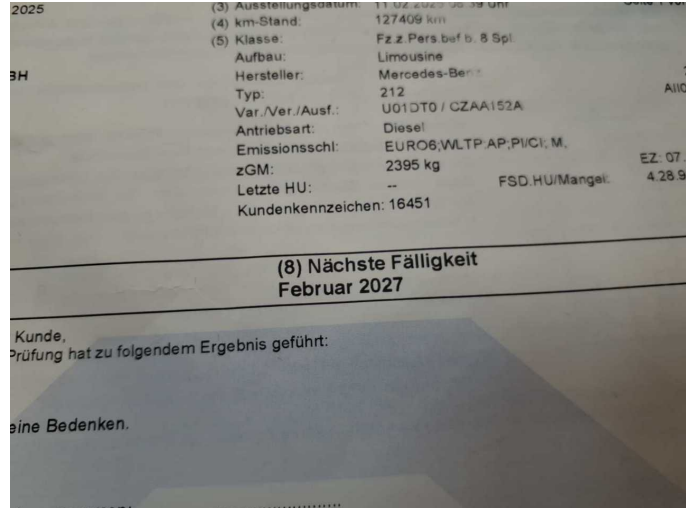


Figure 14: Documents



Figure 15: Documents



Figure 16: Documents

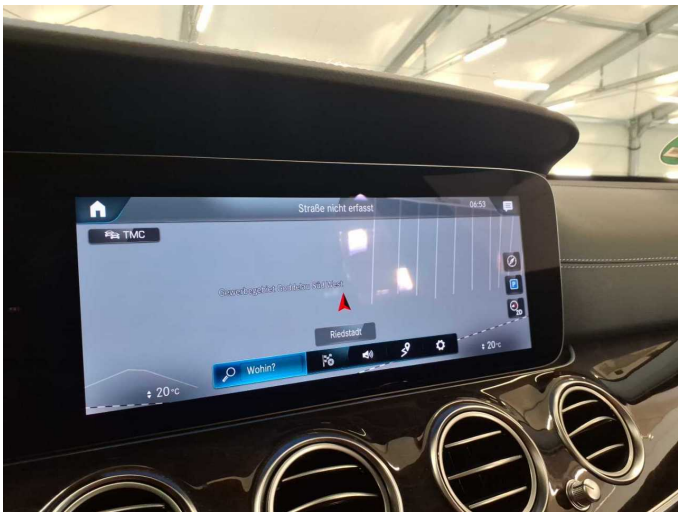


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

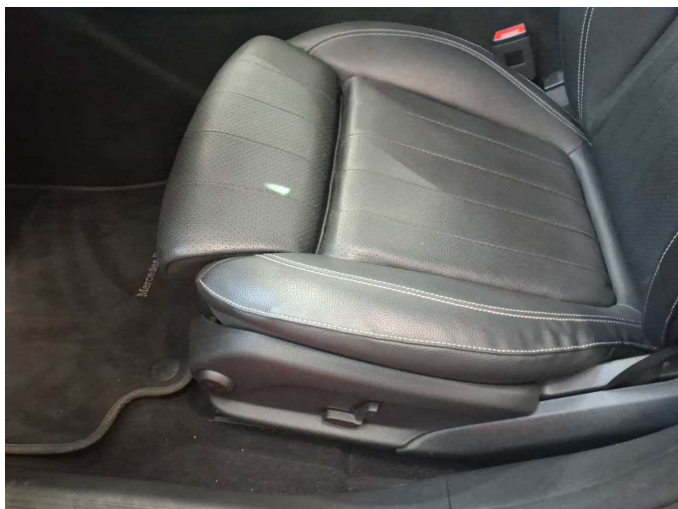


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

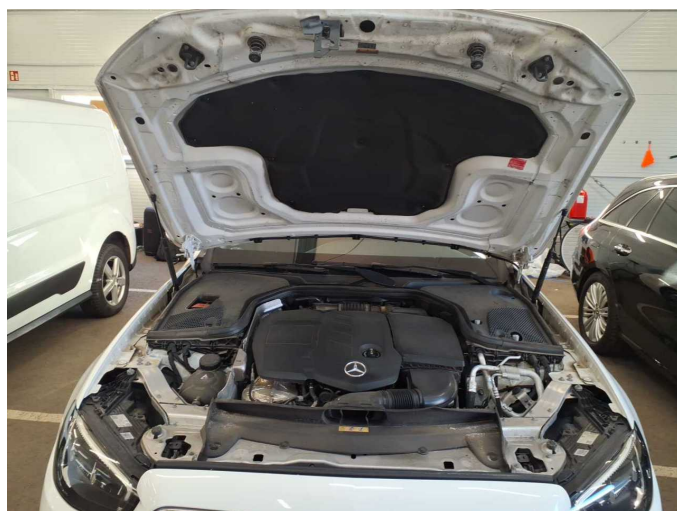


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Damage 1: Roof: Roof (Steinschlag mit Korrosion) - Stone chips - Repair and paint



Damage 1: Roof: Roof (Steinschlag mit Korrosion) - Stone chips - Repair and paint



Damage 1: Roof: Roof (Steinschlag mit Korrosion) - Stone chips - Repair and paint




Damage 1: Roof: Roof (Steinschlag mit Korrosion) - Stone chips - Repair and paint



Damage 2: Front bumper: Front bumper - Scratch(es) - Paint



Damage 2: Front bumper: Front bumper - Scratch(es) - Paint

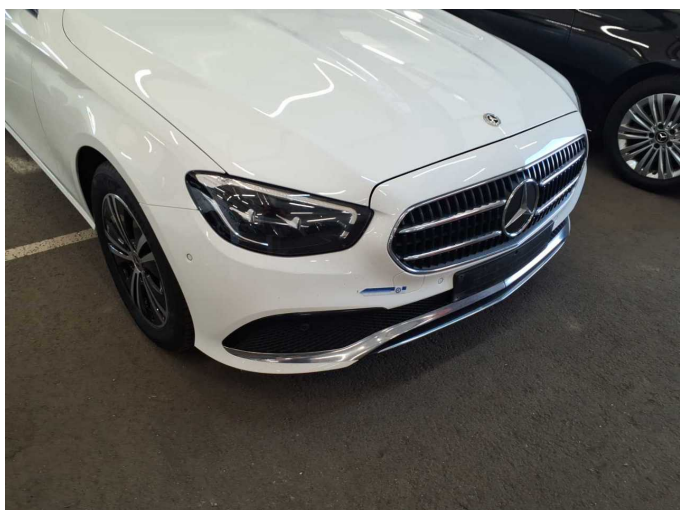

Damage 2: Front bumper: Front bumper - Scratch(es) - Paint




Damage 2: Front bumper: Front bumper - Scratch(es) - Paint



Damage 2: Front bumper: Front bumper - Scratch(es) - Paint



Damage 2: Front bumper: Front bumper - Scratch(es) - Paint

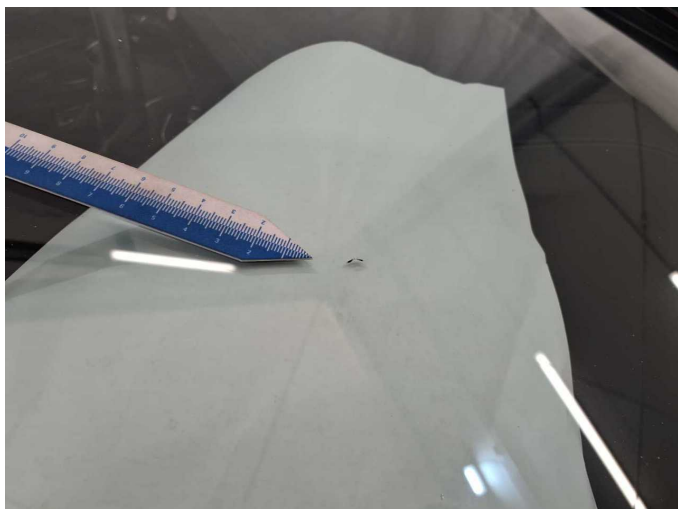

Damage 3: Vehicle glazing: Windscreen - Stone chips - Replace




Damage 3: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 3: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 3: Vehicle glazing: Windscreen - Stone chips - Replace

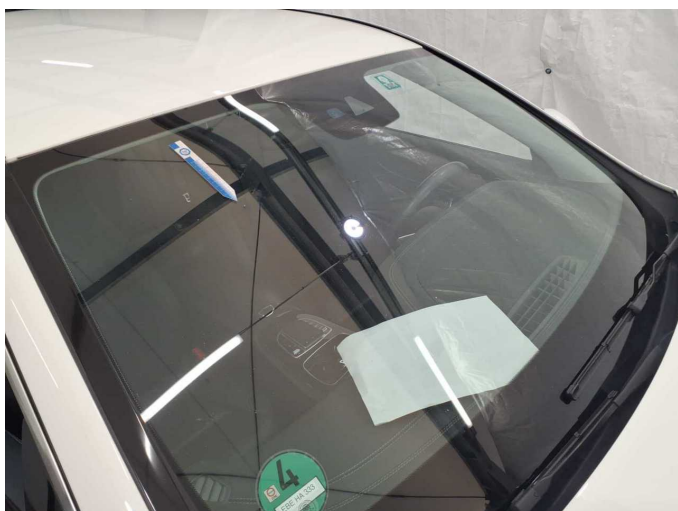

Damage 3: Vehicle glazing: Windscreen - Stone chips - Replace



Wear and tear 1: Rear bumper: Rear bumper - Scratch(es) - No deduction



Wear and tear 1: Rear bumper: Rear bumper - Scratch(es) - No deduction



Wear and tear 3: Bonnet: Bonnet - Stone chips - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1K2130121B001532

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ E 200 d 9G-TRONIC
Exclusive

Datum	KM-Stand	Beschreibung
10.11.2025	122.447	HU + AU; Regelwartungsdienst
25.10.2024	100.199	Regelwartungsdienst
19.07.2024	92.789	Bremsscheiben+Beläge v+h
21.02.2024	76.539	Regelwartungsdienst
25.10.2023	60.213	Bremsklötze vorne
15.09.2023	51.625	Bremsklötze hinten; Regelwartungsdienst
31.03.2023	26.927	Regelwartungsdienst