



Expertise

Protocol number: 46409136
Order No. / Reference: 26508848
Inspection date: 8 Jul 2026

Manufacturer: Mercedes-Benz

Model: EQC 400 4Matic AMG Line

VIN: W1K8P9AB0PF067195



ALPHABET



ALPHABET

Vehicle details

Manufacturer / Type / Model / Equipment

Mercedes-Benz EQC 400 4Matic AMG Line

Vehicle Identification number W1K8P9AB0PF067195
Mileage (Read) 132,335 km
First registration 28 Apr 2023
Number of holders 1
Next periodical technical inspection 04/2028
(Report on hand)

Power / Engine displacement 145 kw /
Fuel type / Cylinder Electric / 0
Gearbox / Number of gears Direct drive / 1
Type of drive All-wheel drive
Type of vehicle Saloon car

Colour / colour code Graphitgrau Metallic
Doors / Seats 5 / 5
Upholstery type Alcantara / Leather
Colour of upholstery Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	273 Tag(e)
Last service on / at	04/2026 at 127,073 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS719405
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AKA 00012		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,940 kg	Empty weight	
Dimensions	4774 x 1923 x 1625		

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R21 101Y	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	255/40 R21 102Y	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105H	Winter tyres on Light alloy	Bridgestone	4mm / 4mm
2)	235/55 R19 105H	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- Active Lane Keeping Assist
- 4MATIC all-wheel drive
- Anti-lock braking system (ABS)
- Color glass
- DYNAMIC SELECT
- EASY-Pack cargo cover (removable)
- ECO Assistant
- Electronic Stability Program (ESP)
- Driving modes
- Transmission: Direct drive
- rear window wiper
- Instrument panel in imitation leather Nappa look in metallic silver grey
- Climate: Pre-conditioning
- Headrests (5)
- Charging cable for wallboxes and public charging stations, 5m, smooth
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Mercedes-Benz emergency call system
- Navigation accessories: Pre-installation for Live Traffic Information
- Navigation accessories: Pre-installation for remote and navigation services
- Package: Interior light
- Package: Seating comfort
- Upholstery: ARTICO leatherette/DINAMICA microfiber
- Radio accessories: Advanced sound system
- Radio accessories: Touchpad
- Tire pressure monitoring system
- Cruise control
- Traffic Sign Assistant
- Immobiliser
- Central locking
- Airbag: Kneebag for driver
- Airbag: Windowbag
- Active Parking Assist with PARKTRONIC
- Acoustic environmental protection
- Ambient lighting
- outdoor thermometer
- Double cup holder
- EASY-Pack tailgate with electric operation for opening and closing
- Illuminated door sills with model-specific lettering
- ESP trailer stabilization
- Electric windows, front and rear
- Rear window heated
- Interior headliner in fabric
- Climate: THERMATIC automatic climate control with 2 climate zones
- Communication module (LTE) for the use of Mercedes me connect services
- Charging system: DC on-board charger (DC charging)
- Charging system: Alternating current charging system (AC charging) up to 11 kW (3-phase)
- Steering: Direct steering
- MULTIBEAM LED
- Navigation accessories: Pre-installation for navigation services
- Navigation: Hard disk navigation
- Package: AMG Line Exterior
- Package: Parking package with reversing camera
- Package: Mirror Package
- Radio: MBUX multimedia system
- Radio accessories: Digital radio
- Radio accessories: Pre-installation for digital radio
- Remote and Charging Services Premium
- TIREFIT with tire inflation compressor
- High-visibility vest for drivers
- Heat and sound insulating acoustic glass
- Decorative elements: Carbon look anthracite



Extra equipment

- Airbag: Side airbags in the rear
- Climate: THERMOTRONIC automatic climate control with 3 climate zones (The THERMOTRONIC automatic climate control with 3 climate zones and 3 climate styles allows for a personalized comfort climate on board. Driver and front passenger can each adjust the temperature, air distribution and climate style according to their personal needs. The third climate zone is located in the rear with separately adjustable temperature and airflow.)
- Package: Storage (storage and fastening options for the interior and under the load floor - folding box under the load floor - 12V socket on the left in the luggage compartment - map pockets on the backs of the front seats - double USB charging port in the rear (Type C))
- Package: Driving Assistance Package (Active Distance Assist DISTRONIC - Active Speed Limit Assist - Extended Automatic Restart on Highways - Route-Based Speed Adaptation with Traffic Jam Definition - Active Steering Assist - Active Emergency Stop Assist with SOS Function - Emergency Lane Radio - Active Brake Assist - Turning and Intersection Function - Traffic Jam Emergency Braking Function - Evasive Steering Assist - Active Lane Keeping Assist - Active Blind Spot Assist - Exit Warning Function - PRE-SAFE PLUS - Pedestrian Warning Function)
- Wheels: 53.3 cm (21") AMG multi-spoke light-alloy wheels (aerodynamically optimized, painted high-gloss black and polished, front axle 235/45 R 21 on 8.0 J x 21 H 2 ET 27, rear axle 255/40 R 21 on 9.0 J x 21 H 2 ET 31)
- Heated windshield washer system (washer hoses and spray nozzles heated by coolant waste heat - at temperatures below +5 degrees Celsius, the heating system operates in an energy-saving manner and only draws as much power as is necessary to defrost and keep the cleaning system clear - washer fluid reservoir with a capacity of 5 liters)
- Seats: Driver's seat electrically adjustable with memory function (electro-pneumatic 4-way lumbar support - electric seat cushion tilt adjustment - electric seat cushion depth adjustment - electrically adjustable seat height and fore/aft position - electric backrest adjustment - electric headrest adjustment - electric steering column height adjustment - memory function for all seat settings, for the electric exterior mirror settings, for the optional head-up display settings, for the steering column height adjustment - map pockets on the back of the front seats)
- Partition net for luggage compartment separation and occupant protection (behind the front seats or the 2nd row of seats)
- Head-up display (lens and mirror system projects a virtual image into the driver's field of vision - full-color display that is easily readable even on sunny days and at night - depending on the equipment, display of, for example, navigation instructions, speed, speed limits or settings of cruise control or active distance assist DISTRONIC)
- Paint finish: Metallic
- Navigation accessories: MBUX Augmented Reality for Navigation (To help you find your way in complex traffic situations, MBUX Augmented Reality for Navigation connects the virtual world with the real one. The technology overlays graphical navigation and traffic information onto live images. You reach your destination quickly, safely and stress-free.)
- Package: Parking Package with 360° camera (12 sensors: four front, four rear, two on the sides in the front/rear bumper; detects parking spaces up to 35 km/h; steering control; in conjunction with automatic transmission, assists with acceleration, braking, and gear changes; 360° camera; visual/audible warning of detected obstacles in front of/behind the vehicle up to approx. 10 km/h; Rear Cross Traffic Alert warns of detected cross traffic; Drive Away Assist (only in conjunction with automatic transmission); button on the center console or on the control panel for the assistance systems)
- Wheels: Complete summer wheel sets fitted at the factory
- Wheels: Winter complete wheels M+S 4-way 48.3 cm (19") (Light alloy wheels in 5-spoke design - aerodynamically optimized, high-gloss black painted and diamond-turned 235/55 R 19 on 8 J x 19 ET 34)
- Seats: Front passenger seat electrically adjustable with memory function (electro-pneumatic 4-way lumbar support and lateral support adjustment - electric seat cushion tilt adjustment - electric seat cushion depth adjustment - electrically adjustable seat height and longitudinal direction - electric backrest adjustment - electric headrest adjustment - memory function for all seat settings)
- Seats: Heated rear seats
- Heated seats for driver and front passenger
- Smartphone integration (supports Android Auto and Apple CarPlay - display of selected third-party apps - access to current software and data e.g. for navigation, traffic information, contact data, messaging, telephony, media, IP radio - prepared and optimized user interface for driving - control of smartphone functions via voice control)
- Dark tinted heat-insulating glass (rear side windows and rear window)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Sill - left side	Trim (Abdeckungs fehlt) - Missing - Perform
2	Vehicle glazing	Rear window - Scratch(es) - Loss in value
3	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
4	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
5	2nd wheel set	2 tyres - Worn - Replace
6	Bonnet	Bonnet - Stone chips - Paint
7	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Mudguard - right side	Mudguard - right side - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Paint coat thickness measurement

Roof	90 µm	Roof rail - left side	104 µm
Roof rail - right side	99 µm	Boot lid / rear door	92 µm
Mudguard - left side	112 µm	Mudguard - right side	100 µm
Bonnet	105 µm	Side panel - rear left side	100 µm
Side panel - rear right side	100 µm	Door - rear left side	109 µm
Door - rear right side	102 µm	Door - front left side	111 µm
Door - front right side	101 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

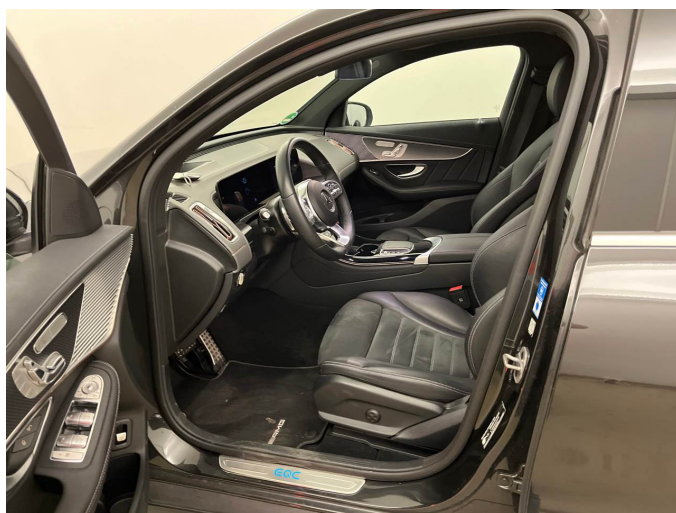


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

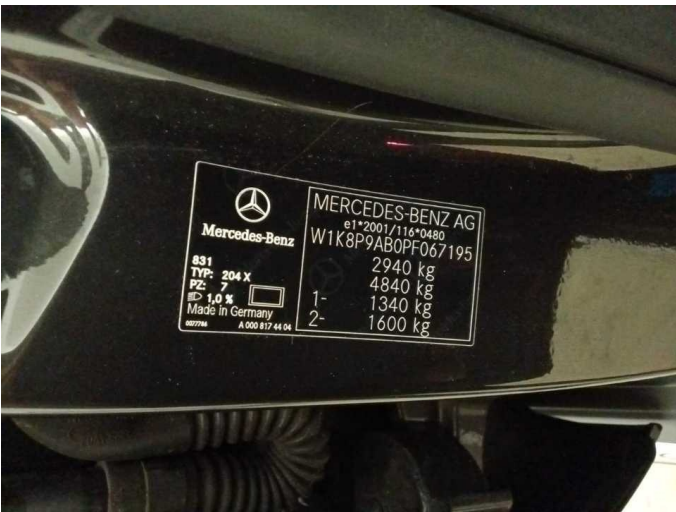


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation

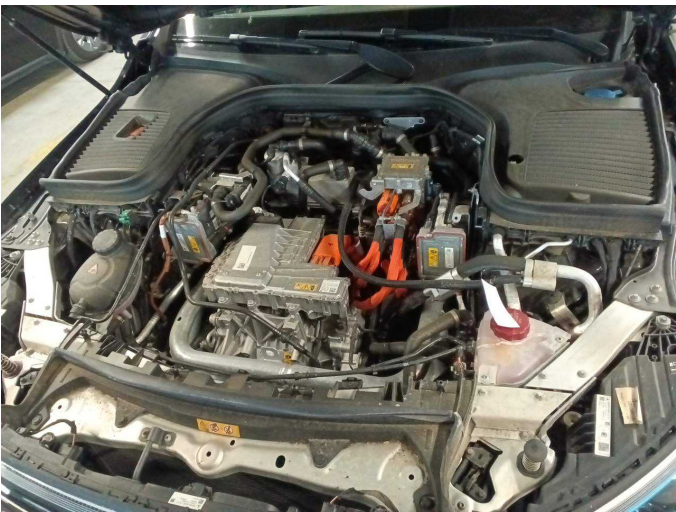


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.




Damage 1: Sill - left side: Trim (Abdeckungs fehlt) - Missing - Perform



Damage 1: Sill - left side: Trim (Abdeckungs fehlt) - Missing - Perform



Damage 2: Vehicle glazing: Rear window - Scratch(es) - Loss in value

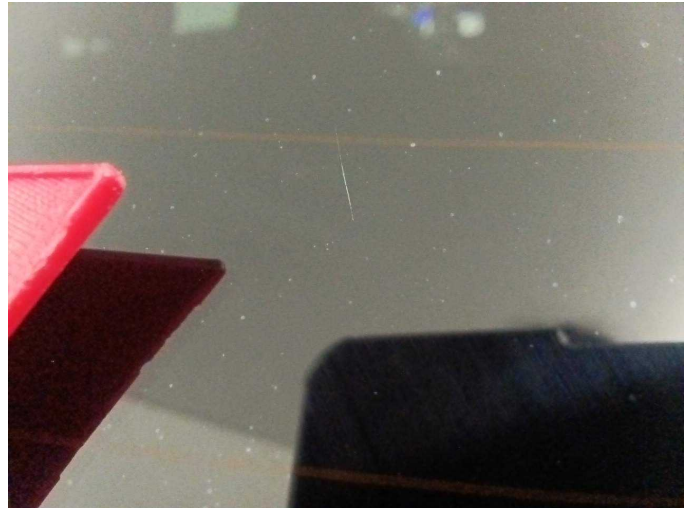

Damage 2: Vehicle glazing: Rear window - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 5: 2nd wheel set: 2 tyres - Worn - Replace



Damage 5: 2nd wheel set: 2 tyres - Worn - Replace



Damage 5: 2nd wheel set: 2 tyres - Worn - Replace



Damage 5: 2nd wheel set: 2 tyres - Worn - Replace



Damage 5: 2nd wheel set: 2 tyres - Worn - Replace




Damage 6: Bonnet: Bonnet - Stone chips - Paint



Damage 6: Bonnet: Bonnet - Stone chips - Paint



Damage 6: Bonnet: Bonnet - Stone chips - Paint

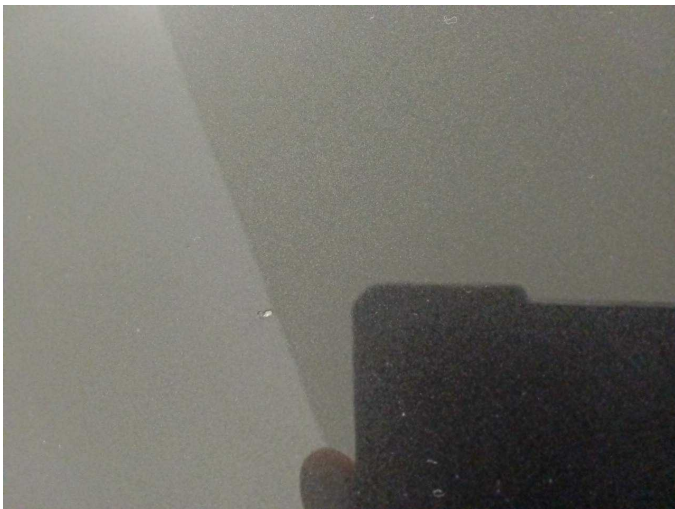

Damage 6: Bonnet: Bonnet - Stone chips - Paint



Damage 6: Bonnet: Bonnet - Stone chips - Paint



Damage 6: Bonnet: Bonnet - Stone chips - Paint



Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1K8P9AB0PF067195

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ EQC 400 4Matic AMG Line

Datum	KM-Stand	Beschreibung
07.04.2026	127.073	Bremsklötze hinten; Regelwartungsdienst
23.09.2025	102.600	Regelwartungsdienst
25.02.2025	78.216	Bremsscheiben hinten; Regelwartungsdienst
31.07.2024	52.241	Regelwartungsdienst
05.01.2024	27.986	Regelwartungsdienst