



OPEL GRANDLAND: GE-549-SE

Vinnumber:	W0VZCYHZXN6805448	Versionname:	OPEL GRANDLAND 1.5 DIESEL 130 ELEGANCE BUSINESS AUTO VP [5P] bva 8-131CH-7cv (SUV)
First Registrationdate:	16/02/2022	Fiscalpower:	
Expertise Mileage:	142324	Power Kw:	96
Bodytype:	SUV	Body colour:	Black
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Front	Interior colour:	Black
Fueltype:	Diesel	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options

Number of keys total	2	Radio	
Number keys remote	2	Central consol F	
GPS big screen color		Luggage cover	
GPS storage		Headlights Xenon/LED/Laser	
GPS storage	HD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Rear view camera	
Cruise Control		Seat cover lining	
Steering wheel multifunctional			Lining Other
Steering wheel leather			Lining Leather
Type of climate control	Autom climate control		

Tyres

225/55/18/102 V				
Summer tyres:	Fr.L.	Goodyear: 70%	Fr.R.	Goodyear: 70%
	Re.L.	Goodyear: 65%	Re.R.	Goodyear: 90%
Tyre profile depth FL				3.6
Tyre profile depth FR				3.6
Tyre profile depth RL				3.9
Tyre profile depth RR				2.2
Tyre size FL				225/55 R 18 102 V
Tyre size FR				225/55 R 18 102 V
Tyre size RL				225/55 R 18 102 V
Tyre size RR				225/55 R 18 102 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				259
Tyre make FR				259
Tyre make RL				259
Tyre make RR				259

Assistance equipment

Tyre FL, Out of tolerance, Replace



Tyre RL, Out of tolerance, Replace



Tyre RR, Out of tolerance, Replace



Alloy rim RR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Tyre FR, Out of tolerance, Replace



Door FL, Scratch(es), Paint



Door RL, Dent(s) and scratch(es), Repair and paint (complete)




Wing trim RL, Scratch(es), Paint



Bumper F, Scratch(es), Polish



Door RR, Dent(s) and scratch(es), Repair and paint (complete)

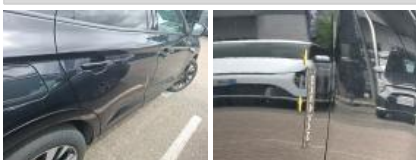

Wing RR, Scratch(es), Paint



Door FR, Scratch(es), Paint



Outside rear-view mirror base R, Broken, Replace



Wing FR, Scratch(es), Paint



Wing trim FR, Scratch(es), Paint



Bumper spoiler Rear, Scratch(es), Acceptable



Historique Maintenance

Immatriculation: **GE-549-SE** Date de 1ère immatriculation: **16/02/2022**

Modèle: **Opel GRANDLAND 1.5 DIESEL 130 ELEGANCE BUSINESS AUTO VP [5P] bva 8-131CH-7cv (SUV)**

Date	Kilométrage	Fournisseur	Descriptif
02/04/2026	133.374	PIGEON LIBOURNE	REVISION ET CLIM
			BALAIS ESSUIE GLACE AV
			ARBRE A CAMES RPLT
03/11/2025	122.864	PIGEON BRUGES	KIT DISTRIBUTION RPLT
			COURROIE ACCESSOIRES RPLT
			DIAG
			LIQUIDE DE REFROIDISSEMENT RPLT
14/08/2025	108.449	PIGEON BRUGES	CAPTEURS DIVERS RPLT
			REVISION
			BATTERIE RPLT
20/02/2025	82.617	AUTO VENTE	LIQUIDE DE FREIN
			ADBLUE
			PLAQUETTES AV RPLT
			BALAIS ESSUIE GLACE AV
			REVISION ET CLIM ET AIR ET CARBURANT
03/12/2024	73.121	FLEET SOLUTIONS FRANCE	BALAIS ESSUIE GLACE AV
02/08/2024	58.517	FLEET SOLUTIONS FRANCE	REMPLACEMENT PNEUS ETE
23/07/2024	57.752	AUTO VENTE	REVISION
29/12/2023	37.580	BRIE & CHAMPAGNE	REVISION ET CLIM ET AIR ET CARBURANT
			BALAIS ESSUIE GLACE AV
			LIQUIDE DE FREIN