



RENAULT KANGOO EXPRESS

Vinnumber:	VF1WF000X66995416	Versionname:	Blue dCi 80 Grand Confort
First Registrationdate:	15/02/2021	Fiscalpower:	
Expertise Mileage:	75866	Power Kw:	59
Bodytype:		Body colour:	Grey
Gearbox:	MAN 6 VIT	Type of rims (mounted):	Steel
Transmission:		Parking lot:	3126
Fueltype:	Diesel		
Type of rims (mounted):	Steel		
Certificate of Conformity:	Yes		
Category:	Light Commercial Vehicle		
Registration Certificate Car (BE):	Yes		
Registration Certificate Home (BE):	No		

Options

Number of keys total:	2	Type of Tow bar:	No Tow bar
Radio multimedia:			
Type of headlighting:	Headlighting Halogen		
Type of GPS:	No GPS		
Type of Lining:	Lining fabrics		
Type of climate control:	Manual climate control		

Limited Technical Inspection

Tyres

195/65/15/95 T				
Summer tyres:	Fr.L.	Vredestein: 4 mm	Fr.R.	Vredestein: 3 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 3 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				3.0
Tyre profile depth RL				4.0
Tyre profile depth RR				3.0
Tyre size FL				195/65 R 15 95 T
Tyre size FR				195/65 R 15 95 T
Tyre size RL				195/65 R 15 95 T
Tyre size RR				195/65 R 15 95 T
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				2480
Tyre make FR				2480
Tyre make RL				261
Tyre make RR				261

Assistance equipment

Emergency spare wheel:	Yes	Jack:	Yes
Number of charging cables (normal):	0		
Number of charging cables (rapid charge):	0		

Total cost ex VAT	2961,02
Seat cover FL, Burned, Replace	355,83



Interior, Damaged, Acceptable	0,00
-------------------------------	------



Bonnet, Dent(s) and scratch(es), Repair and paint (complete)	304,65
--	--------



Bumper F, Scratch(es), Acceptable	0,00
-----------------------------------	------



Wing RL, Dent(s) and scratch(es), Repair and paint (complete)	323,68
---	--------



Wing RL, Dent(s), Repair and paint (complete)	323,68
---	--------



--	--




	506,94
--	--------



Boot door panel RL, Scratch(es), Repair and paint (complete)	506,94
--	--------



Bumper moulding R, Scratch(es), Acceptable	0,00
--	------

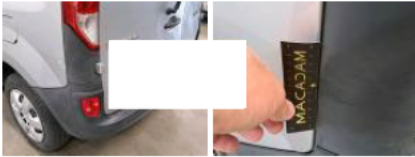

Boot door lining L, Broken, Replace	218,44
-------------------------------------	--------



Wheel cover FR, Scratch(es), Replace	44,82
--------------------------------------	-------



Door FR, Dent(s), Paintless dent repair	190,93
---	--------



Wheel cover RR, Scratch(es), Replace	44,82
--------------------------------------	-------



Wing RR, Dent(s), Paintless dent repair	95,47
---	-------



Wheel cover RR, Scratch(es), Replace	44,82
--------------------------------------	-------



Bodywork, Not original part, Remove lettering	0,00
---	------

