



Expertise

Protocol number: 46265990
Order No. / Reference: 26605555
Inspection date: 29 Jun 2026

Manufacturer: Volkswagen
VIN: WVGZZCD2PW008303

Model: Golf 2.0 TDI SCR DSG Life



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Golf 2.0 TDI SCR DSG Life	
Vehicle Identification number	WVGZZCD2PW008303
Mileage (Read)	67,326 km
First registration	25 Nov 2022
Number of holders	1
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Grey Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	20,000 km
Last service on / at	11/2025 at 57,893 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM720750
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CNX 01444		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,940 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91V	Summer tyres on Light alloy	Falken	3mm / 3mm
2)	205/55 R16 91V	Summer tyres on Light alloy	Falken	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm
2)	205/55 R16 91H	Winter tyres on Light alloy	Bridgestone	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 2 USB-C ports at the front, 2 USB-C charging ports at the rear of the center console (charging power up to 45 W)
- Distraction and fatigue detection
- Airbags: Front and rear head airbags, front side airbags, center airbag
- Anti-lock braking system (ABS)
- Adaptive Cruise Control (ACC)
- Exterior mirror housings and door handles in body color
- Hill start assist
- Vehicle tool kit
- Chrome applications on mirror adjustment and window regulator switches, chrome strips on the air vents
- Diesel particulate filter and SCR catalyst
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Electronic parking brake including auto-hold function
- Automatic headlight control, with LED daytime running lights (as well as welcome and farewell lights)
- Optional extras that can be activated: Heated front seats
- Windscreen made of laminated safety glass, heat and sound insulating
- Speed limiter with predictive control
- Rear window heated
- Rear window wiper with intermittent function
- "Climatronic" air conditioning system
- Rear headrests (3)
- LED reading lights at the front (2) and 2 at the rear
- LED headlights with daytime running lights
- Illuminated makeup mirrors in the sun visors
- Front center armrest adjustable in height and length
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Radio "Composition"
- Radio accessories: 6 + 1 speakers
- Wheels: Alloy wheels (4) "Norfolk" 7 J x 16 (tires 205/55 R 16)
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Keyless start system without safe locking
- Seat belts: Three-point automatic seat belt for the middle rear seat
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Comfort seats in the front
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- 12-volt power outlet in the luggage compartment
- "Comfort" telephone interface with inductive charging function
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened seat belts front and rear
- Central locking with remote control
- Turning brake function and evasive steering support
- Rear exhaust tailpipe (standard)
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Ambient lighting, 10 colors
- App-Connect Wireless for Apple CarPlay and Android Auto
- Electrically adjustable, folding and heated exterior mirrors (with passenger-side mirror lowering and memory function)
- third brake light
- Decorative inlays "Nature Cross Brushed" (for instrument panel and front door trim)
- Digital Cockpit Pro, multicolor (various info profiles selectable)
- Electronic differential lock XDS
- Electronic stability program and electromechanical brake booster
- Electric windows, front and rear
- Optional equipment that can be activated: High-beam assistant "Light Assist"
- luggage compartment cover
- Transmission: 7-speed DSG (7-speed dual-clutch transmission DSG)
- ISOFIX mounting points (for child seats on the outer rear seats and on the front passenger seat, i-Size compatible)
- Front headrests (safety-optimized)
- LED taillights
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency call service (no registration required, service is activated upon delivery)
- Radio accessories: Digital radio reception DAB+
- Wheels: Wheel locks with enhanced theft protection
- Wheels: Tire pressure monitoring system
- Rear bench seat undivided, backrest asymmetrically split and foldable, with center armrest
- Electromechanical power steering (speed-dependent control)
- Seat belts: Three-point automatic seat belts for the outer rear seats
- Seat covers in "Life" fabric (center panels of the front seats and the outer rear seats in "Life" fabric)
- Seats: Front seats are height-adjustable
- Start-stop system (with brake energy recuperation)
- Bumpers in body color
- Illuminated door handle recesses
- Ambient lighting with light projection
- Traffic sign recognition
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear



Extra equipment

- Paint finish: Metallic
- Package: Light and Sight Package incl. "Light Assist" (High Beam Assist - Automatically Dimming Interior Mirror - Rain Sensor)
- Rear View reversing camera
- Package: "Business Premium" package (DSG) (6+1 speakers - Head-up display - Infotainment system with 32 cm display (12.9 inches) - Multifunction leather steering wheel, heated, with shift paddles - Navigation system - Without headlight cleaning system with washer fluid level indicator - Rain sensor - IDA voice assistant and electronic voice amplification - Textile floor mats front and rear - Heated front seats)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Seat - front	Seat cover - left side - Soiled - Clean
2	Rear bumper	Rear bumper - Scratch(es) - Smart repair

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 23 May 2024	979,35 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Der beiliegende Winterradsatz ist nicht Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.




Damage 1: Seat - front: Seat cover - left side - Soiled - Clean



Damage 1: Seat - front: Seat cover - left side - Soiled - Clean



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair

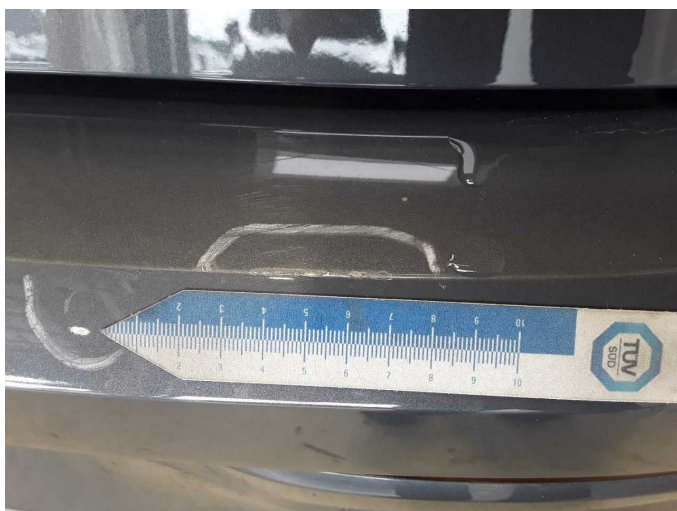

Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZCD2PW008303

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Golf 2.0 TDI SCR DSG Life

Datum	KM-Stand	Beschreibung
21.11.2025	57.893	AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
03.06.2024	28.818	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges