



Expertise

Protocol number: 46904729
Order No. / Reference: 26841514
Inspection date: 4 Aug 2026

Manufacturer: Volkswagen

Model: Golf Variant 2.0 TDI 4Motion SCR DSG Alltrack

VIN: WVVZZZCDZNW525131



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Golf Variant 2.0 TDI 4Motion SCR DSG Alltrack	
Vehicle Identification number	WVVZZZCDZNW525131
Mileage (Read)	147,665 km
First registration	9 Jun 2022
Number of holders	1
Next periodical technical inspection	07/2027
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	147 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Reflexsilber-metallic (A7W)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	595 Tag(e)
Last service on / at	04/2026 at 141,993 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ215430
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	0603 / COL 00333		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,110 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95Y	Summer tyres on Light alloy	Pirelli	7mm / 7mm
2)	225/45 R18 95Y	Summer tyres on Light alloy	Pirelli	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/50 R17 93H	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	205/50 R17 93H	Winter tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger (with passenger airbag deactivation)
- Permanent all-wheel drive
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto (selected apps for Android smartphones and Apple iPhones can be displayed and operated on the touchscreen of the radio or navigation system)
- third brake light
- Chrome strip at the bottom of the side windows
- Roof rails, silver anodized
- Decorative inlays "Nature Cross Brushed" (for instrument panel and front door trim)
- Diesel particulate filter and SCR catalyst
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Electronic parking brake including auto-hold function
- Automatic headlight control, with LED daytime running lights (as well as welcome and farewell lights)
- Driving profile selection (possibility to set different vehicle settings: Comfort, Normal, Sport, Eco, Individual - adaptable vehicle systems include: engine, adaptive chassis control DCC, DSG, steering, start-stop system, cornering lights and "Dynamic Light Assist", automatic distance control ACC, air conditioning)
- luggage compartment cover
- Transmission: 7-speed DSG (7-speed dual-clutch transmission DSG)
- Rear spoiler in car color
- "Climatronic" air conditioning system (with active combination filter)
- Front headrests (safety-optimized)
- LED reading lights at the front (2) and 2 at the rear
- LED taillights
- Illuminated strip between headlights and door handle recesses
- Fatigue detection (detects signs of possible driver fatigue based on characteristic steering behavior, time of day and driving duration and issues a visual and audible warning)
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection (detects critical distance situations to other vehicles and helps to shorten the stopping distance - warns the driver visually and audibly in dangerous situations as well as with a preventive braking jolt with pedestrian and cyclist detection - also reacts to pedestrians and cyclists)
- Brushed stainless steel pedals
- Radio: "Ready 2 Discover" radio including "Streaming & Internet" (25.4 cm touchscreen - 6+1 speakers - App-Connect including App-Connect Wireless for Apple CarPlay - FM and DAB+ radio reception - 4 x 20 watts - dual tuner with phase diversity - 3-band tone control - RDS - MP3 playback - USB-C with Apple compatibility - telephone interface (hands-free system, Bluetooth audio) - prepared for later activation: "Discover Media" navigation function including "Streaming & Internet")
- Airbag: Head airbag system for front and rear passengers including front side airbags
- Ambient lighting 30-color (LED light in the front footwell, light color selectable)
- Electrically adjustable and heated exterior mirrors with memory function and passenger-side mirror lowering function.
- Exterior mirror housings and door handles in body color
- Car2X (Using the WLANp ITS G5 standard, all Car2X-enabled vehicles and traffic systems such as traffic lights can transmit data at high speed without using the mobile network. This works over a distance of around 800 meters - enough to warn of an invisible traffic jam.)
- Digital Cockpit Pro, multicolor (various info profiles selectable)
- Electronic differential lock XDS
- Electronic stability program and electromechanical brake booster (Anti-lock braking system with brake assist - Electronic brake force distribution - Traction control - Electronic differential lock - Engine drag torque control - Trailer stabilization)
- Electric windows, front and rear
- Windscreen made of laminated safety glass, heat and sound insulating
- Pedestrian protection measures expanded
- Speed limiter (in conjunction with online services)
- Rear window heated
- Rear window wiper with intermittent function
- ISOFIX mounting points (for child seats on the outer rear seats and on the front passenger seat, i-Size compatible)
- Rear headrests (3)
- Paint finish: Solid
- LED Plus headlights (LED headlights for low and high beam - dynamic headlight range control - bad weather light and cornering light)
- Steering wheel: Multifunction leather steering wheel with paddle shifters
- Fog lights with cornering lights
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency call service (no registration required, service is activated upon delivery)
- Package: Seating comfort package (2 USB-C ports in the front, 2 USB-C charging ports on the rear center console; charging power up to 45 W - front center armrest adjustable in height and length - front seats with height adjustment)
- Tire pressure monitoring system (passive)
- Wheels: Alloy wheels (4) "Ronda" 7 J x 17 (tires 205/55 R 17 - optimized for low rolling resistance)
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Rear bench seat undivided, backrest asymmetrically split and foldable with center armrest



- Seat belts: Three-point automatic seat belt for the middle rear seat
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Comfort seats in the front (with height adjustment and lumbar support)
- Start-stop system (with brake energy recuperation)
- Telephone interface with inductive charging function
- Engine underguard
- Prepared for later activation: Navigation function "Discover Media" incl. "Streaming & Inter
- Central locking without safe locking, with remote control and 2 remote folding keys

- Keyless start system without safe locking
- Electromechanical power steering (speed-dependent control)
- Seat belts: Three-point automatic seat belts for the outer rear seats
- Seat covers in "Alltrack" fabric (center panels of the front seats and the outer rear seats)
- Lane keeping assistant "Lane Assist"
- 12-volt power outlet in the luggage compartment
- Textile floor mats front and rear
- Ambient lighting with logo projection
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear

Extra equipment

- Towbar, foldable with electric release
- Fire extinguisher
- Head-up display
- Navigation system "Discover Media" incl. "Streaming & Internet" (6+1 speakers - App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Multifunction camera - Navigation system "Discover Media" incl. "Streaming & Internet" - Radio - Traffic sign recognition)
- Package: Comfort Package (electrically adjustable, folding, and heated exterior mirrors with memory function and passenger-side mirror lowering - anti-theft alarm system with interior monitoring, backup horn, and tow-away protection - "Park Assist" parking assistant including parking aid - proactive occupant protection system in conjunction with Front Assist and Side Assist - Keyless Access keyless locking and starting system with safe locking - side airbags for the outer rear seats, including front side airbags and head airbag system)
- Park Assist system including parking aid
- Progressive steering (the steering ratio is progressively increased with increasing steering angle - the steering behavior becomes noticeably more direct depending on the driving situation, the steering wheel movements are significantly reduced and thus steering comfort is increased)
- Smoker's version (ashtray in front - cigarette lighter in front)
- Wheels: Alloy wheels (4) "Mount Vernon" 7.5 J x 18, polished surface (tires 225/45 R 18 - wheel locks with enhanced theft protection)
- Power outlet in the luggage compartment, 230 V

- Easy Open & Close - tailgate with sensor-controlled opening and closing, with remote unlocking
- Paint finish: Metallic
- Package: Business Premium incl. navigation system (DSG) (6+1 speakers, App-Connect incl. App-Connect Wireless for Apple CarPlay, Android Auto, automatic distance control, adaptive cruise control (ACC) stop/go, speed limiter, emergency brake, pedestrian detection, travel assist, lane assist, emergency assist, leather multifunction steering wheel, heated, with shift paddles, multifunction camera, Discover Media navigation incl. streaming & internet (MP3, touchscreen, USB), cargo net partition, radio, heated windshield washer system, voice control, telephone interface, Comfort with inductive charging, textile floor mats, traffic sign recognition, heated front seats)
- Package: Top Package (2 LED reading lights front, 2 rear, Dynamic High Beam Control, Dynamic Light Assist, Automatically dimming interior mirror, IQ.LIGHT - LED matrix headlights with LED daytime running lights, cornering lights and dynamic turn signals, Air Care Climatronic air conditioning with 3-zone temperature control, allergen filter and rear controls, LED taillights with dynamic turn signals, Dynamic headlight range control with dynamic cornering lights, Multifunction camera, Panoramic tilt/slide sunroof, Rain sensor, Bad weather lights and cornering lights)
- Rear View reversing camera
- Rear side windows and rear window tinted
- Engine underbody protection including stone chip protection

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Door - rear right side	Door - Scratch(es) - Smart repair
3	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value
4	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
5	Wheel / tyres	Alloy rim - front right side - Scratched - Replace

Wear and tear

No.	Component group	Description
1	Misc.	Misc. (Gehäuse für Pannenset) - Broken / torn - No deduction
2	Trim / covers	Floor mats (Vorne Links) - Abrasion - No deduction
3	2nd wheel set	1 tyre - Broken / torn - No deduction
4	2nd wheel set	2 alloy rims - Scratched - No deduction
5	Body	Underbody panelling - Scratch(es) - No deduction
6	Sill - left side	Trim - Scratch(es) - No deduction
7	Side panel - rear left side	Sill - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 15 Oct 2024	758,67 €
2	Side - left, Provided by user / customer, from 6 Jun 2026	1.057,96 €
3	Rear, Provided by user / customer, from 7 Dec 2023	1.803,38 €
4	Roof, Provided by user / customer, from 7 Dec 2023	3.328,84 €
5	Front, Provided by user / customer, from 23 Apr 2026	4.038,29 €

Repainting

No.	Repainting
1	Roof, Professionally carried out, Invoice of repair done Non-existent
2	Mudguard - left side, Professionally carried out, Invoice of repair done Non-existent
3	Bonnet, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof	285 µm	Mudguard - left side	188 µm
Bonnet	312 µm		



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

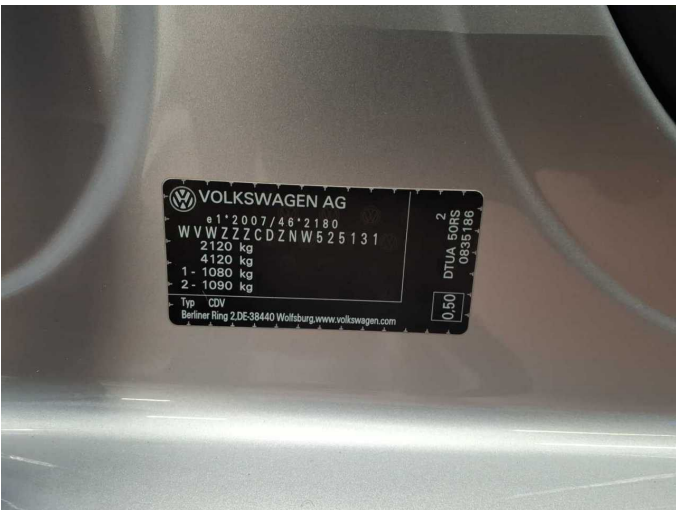


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

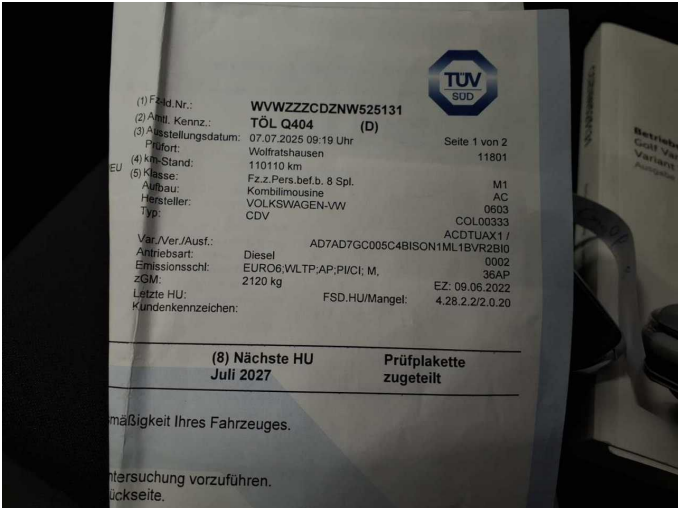


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.

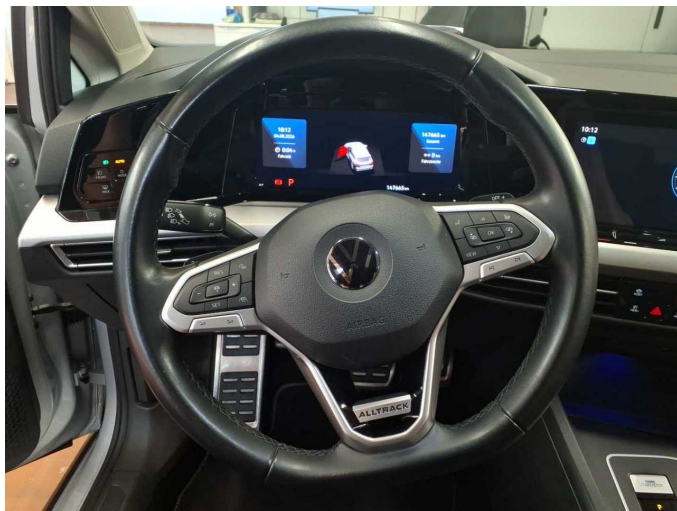


Figure 21: Misc.



Figure 22: Misc.

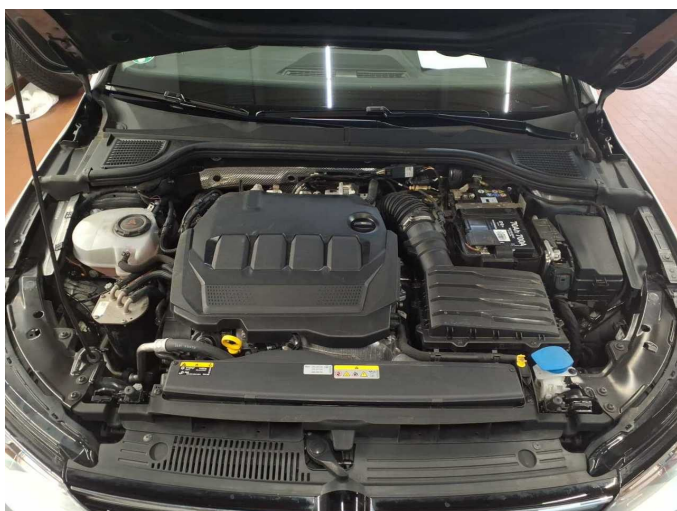


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Figure 30: Misc.




Figure 31: Misc.




Figure 32: Misc.

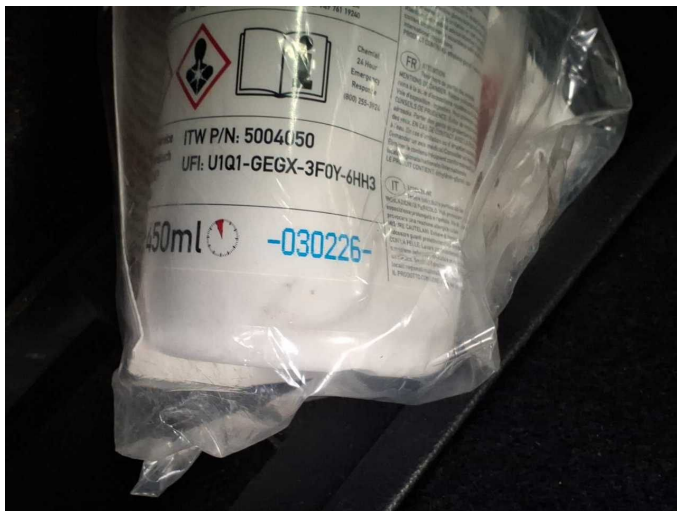

Damage 1: Equipment: Tirefit filler - Expired - Replace

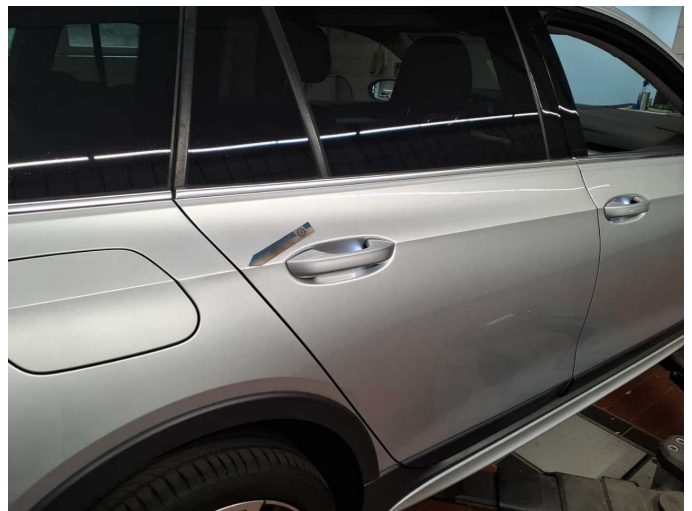

Damage 2: Door - rear right side: Door - Scratch(es) - Smart repair

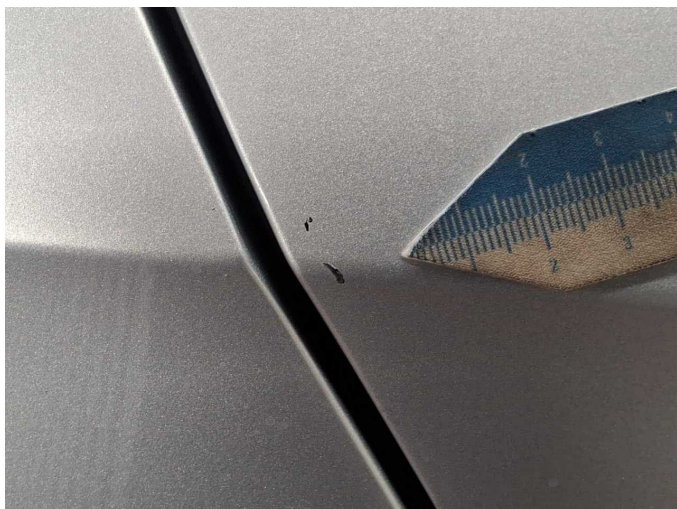

Damage 2: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value




Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value




Damage 4: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

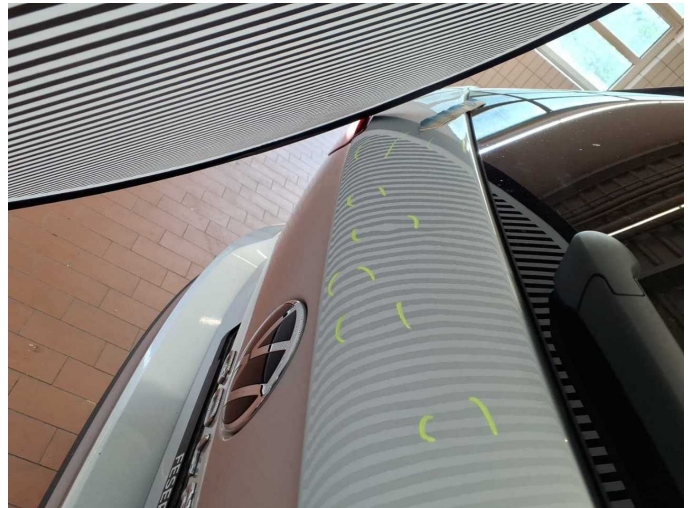

Damage 4: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 4: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

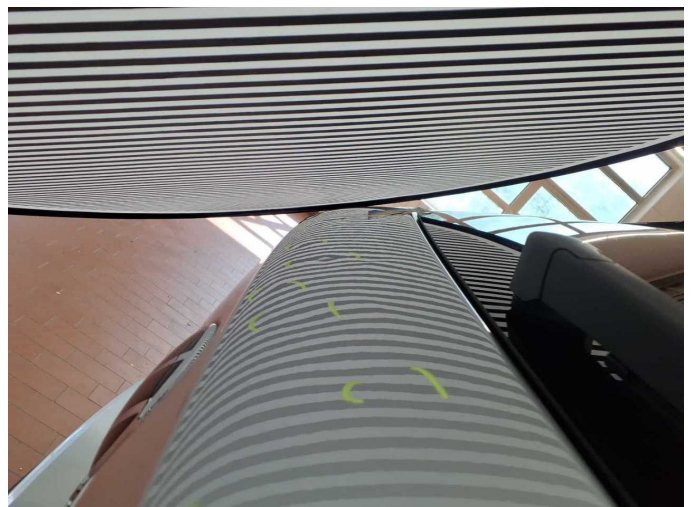

Damage 4: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 4: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Wear and tear 1: Misc.: Misc. (Gehäuse für Pannenset) - Broken / torn - No deduction



Wear and tear 1: Misc.: Misc. (Gehäuse für Pannenset) - Broken / torn -
No deduction



Wear and tear 1: Misc.: Misc. (Gehäuse für Pannenset) - Broken / torn -
No deduction



Repainting 1: Roof



Repainting 2: Mudguard - left side



Repainting 3: Bonnet



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZCDZNW525131

Hersteller / Modell: VOLKSWAGEN VW Golf Variant 2.0 TDI 4Motion SCR DSG
Alltrack

Datum	KM-Stand	Beschreibung
23.04.2026	141.993	Batterie ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
14.08.2025	115.887	Keilrippenriemen; Reparatur Sonstiges; Schwingungsdämpfer ern; Systemtest/Eigendiagnose; Wartung Sonstiges
07.08.2025	115.805	Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
07.07.2025	110.110	HU + AU
09.05.2025	104.917	Systemtest/Eigendiagnose
18.10.2024	88.582	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
12.01.2024	60.195	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
02.02.2023	28.204	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges