



Expertise

Protocol number: 46276651
Order No. / Reference: 26561964
Inspection date: 24 Jun 2026

Manufacturer: Ford

Model: S-Max 2.0 EcoBlue Aut. TITANIUM

VIN: WF0JXXWPCJNS88933



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford S-Max 2.0 EcoBlue Aut. TITANIUM	
Vehicle Identification number	WF0JXXWPCJNS88933
Mileage (Read)	128,106 km
First registration	7 Jun 2022
Number of holders	1
Power / Engine displacement	140 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Frost-Weiß
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	
Last service on / at	04/2026 at 122,701 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GK798298
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BQR 00323		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,555 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/55 R17 103Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103V	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/55 R17 103V	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Power outlet: 12-volt connection in the luggage compartment and in the center console
- LED daytime running lights
- Traffic sign recognition system
- Lashing eyes in the luggage compartment
- Immobiliser
- Central locking with remote control
- Cigarette lighter
- Ambient lighting at the front
- Anti-lock braking system (ABS)
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated
- Attachment points for safety partition grilles (attachment points 2nd row of seats)
- third brake light
- Roof rails "aluminum look"
- Tachometer
- Driver information system display 25.4 cm color
- Electric windows front and rear
- High Beam Assist
- Ford Easy Fuel
- Ford Power Start function
- Ford Power start function with Ford Key Free system
- Luggage compartment lighting
- Transmission: 8-speed automatic transmission
- rear window wiper
- Interior mirror, automatically dimming
- Isofix mounting (on all seats in the 2nd row)
- Electric child safety lock
- Air conditioning with automatic temperature control
- Paint finish: Solid
- Steering wheel: Steering column, adjustable in height and reach
- Steering wheel: Multifunction leather steering wheel
- Reading lights front and rear
- MyKey key system (individually programmable second key)
- Fog light
- Emergency brake light
- Front and rear parking pilot system
- Upholstery: Cloth
- Tire repair kit
- LED taillights
- Headlight dipped beam with switch-off delay including "greeting function"
- Seats: Driver and front passenger seats, 4-way manually adjustable (including manually adjustable lumbar support)
- Seats: Front sports seats (with enhanced lateral support)
- Seats: Front seats can be heated individually and variably.
- Start-stop system
- Bumpers painted in body color
- Trays on the front seatbacks
- Premium carpet floor mats front and rear (as well as in the 3rd row of seats if ordered as an optional extra)
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats (as well as the 3rd row of seats if ordered as an optional extra)
- Storage compartments (illuminated glove compartment - map pockets on the driver's and passenger's seat backrests)
- Attachment points for safety partition grilles (attachment points 1st row of seats)
- Tires: 7.5 J x 17 alloy wheels (4) with 235/55 R 17 tires
- Hill start assist
- roof console
- Diesel particulate filter (DPF)
- Electronic Shifter
- Lane keeping assist including lane keeping assist and driver fatigue warning
- Electronic parking brake
- Ford EasyFold: 2nd row seat backrests fold down electrically at the touch of a button.
- luggage compartment cover
- Cruise control system with intelligent speed limiter
- Back window, heater
- Interior lighting with delay circuit
- Intelligent Protection System (IPS): - Front headrests, 4-way height and tilt adjustable - Front airbag for driver and front passenger - Driver's knee airbag - Head and shoulder airbags, front and for 2nd row of seats - Side airbag for driver and front passenger - Side airbag for outer rear seats of the 2nd row - Seat belt tensioners and belt force limiters, front - 3-point seat belts on all seats, height adjustable in the front)
- Front center console with padded armrest
- Ford navigation system including Ford SYNC 3 with AppLink, touchscreen, DAB/DAB+ and FordPass Connect
- Package: Winter (Heated windscreen - Heated leather steering wheel - Individually and variably heated front seats)
- Tire Pressure Monitoring System (TPMS)
- Windscreen wipers with rain sensor
- Headlight assistant with day/night sensor
- Electromechanical power steering
- Seats: Flexible seating system "FoldFlatSystem (FFS)" (2nd row of seats with 3 individual seats - adjustable longitudinally - seat backrests adjustable for tilt and individually foldable - headrests retractable)
- 230 volt socket



Extra equipment

- Package: Business III (Automatic) (Sony Navigation incl. Ford SYNC 3, AppLink, Touchscreen, Voice Control, Radio/CD Player, MP3-compatible, 2 USB ports, 390-watt premium sound system, 12 speakers, steering wheel remote control, Bluetooth hands-free system, FordPass Connect, eCall, DAB/DAB+, Adaptive LED headlights with glare-free high beam, ACC, Traffic Jam Assist, Pre-Collision Assist, Forward Collision Warning, Emergency Brake Assist, Front and Rear View Camera, Blind Spot Assist, Cross Traffic Alert, Dynamic Distance Control, Power Tailgate with Sensors, Ford Key Free System, Park Assist)
- 2 kg powder fire extinguisher
- Anti-theft alarm system including double locking (with interior monitoring)
- Electrically swiveling towbar (including ESP trailer stabilization)
- Paint finish: Frost White
- Protective film for rear bumper
- Safety partition grille, mounting behind front seats
- Seats: Ford ergonomic seat (driver and front passenger seat adjustable in 18 ways: - length, height and tilt of the seat - extendable thigh support - adjustable backrest - lumbar support electrically adjustable in 4 ways)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Door - rear right side	Door handle - outside - Scratch(es) - Smart repair
3	Door - front right side	Door handle - outside - Scratch(es) - Smart repair
4	Sill - left side	Sill - Scratch(es) - Smart repair
5	Side panel - rear right side	Sill - Scratch(es) - Smart repair
6	Body	C-pillar - left side - Dent / paintcoat damage - Smart repair
7	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
8	Front bumper	Front bumper - Scratch(es) - Smart repair
9	Door - rear left side	Door - Scratch(es) - Smart repair
10	Rear bumper	Rear bumper - Scratch(es) - Paint
11	Bonnet	Bonnet - Stone chips - Paint
12	Door - front left side	Door - Dent / paintcoat damage - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 1 Aug 2024	1.767,78 €
2	Front, Provided by user / customer, from 2 Dec 2024	2.238,10 €
3	Side right, Provided by user / customer, from 11 Oct 2023	5.518,23 €

Repainting

No. Repainting

- | | |
|---|--|
| 1 | Side panel - rear right side, Door - front right side, Professionally carried out, Invoice of repair done Non-existent |
|---|--|

Paint coat thickness measurement

Side panel - rear right side	279 µm	Door - front right side	214 µm
------------------------------	--------	-------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Comments

- Der beiliegende Winterradsatz ist kein Bestandteil des
Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

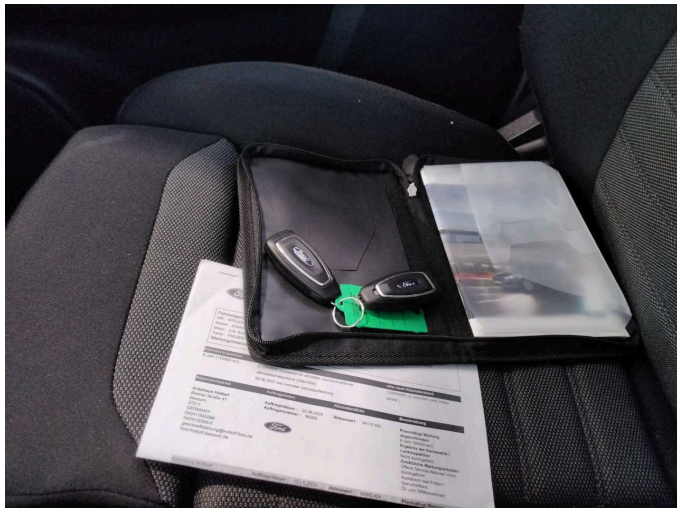


Figure 13: Documents

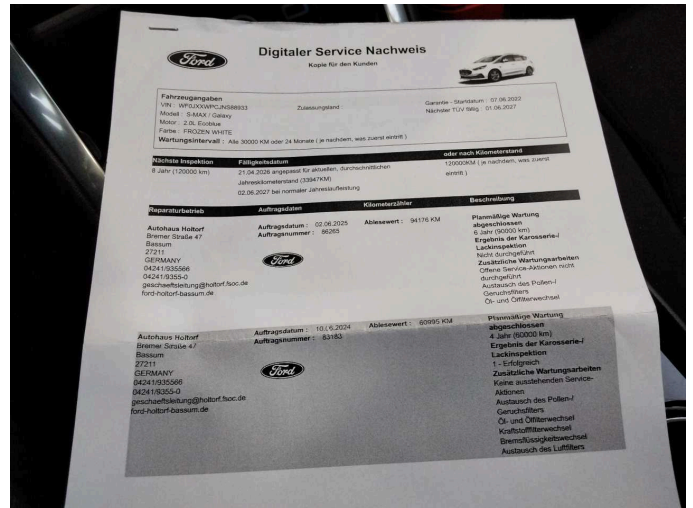


Figure 14: Documents

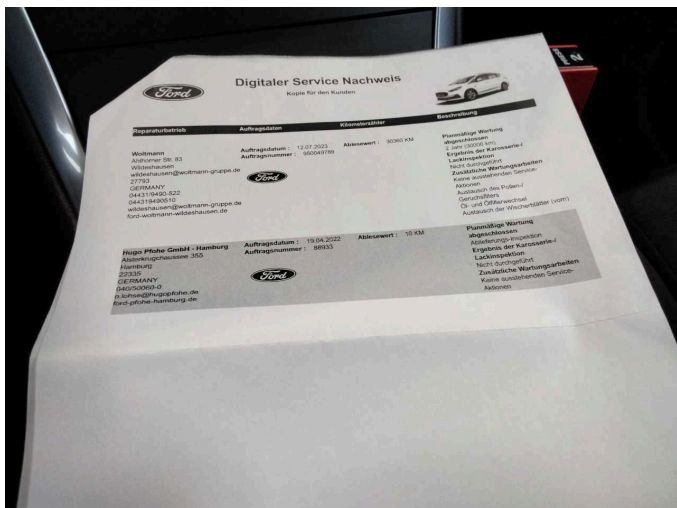


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Additional tyres

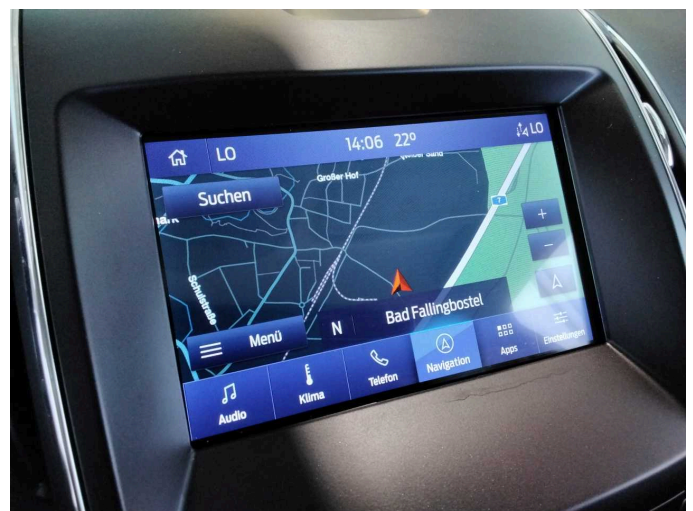


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

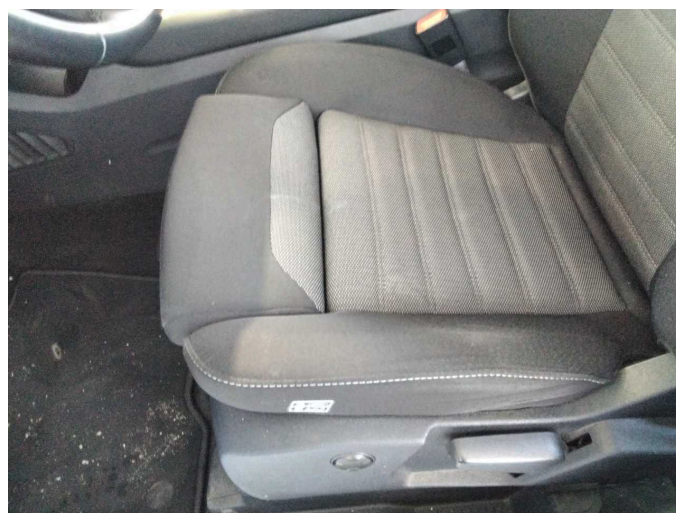


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

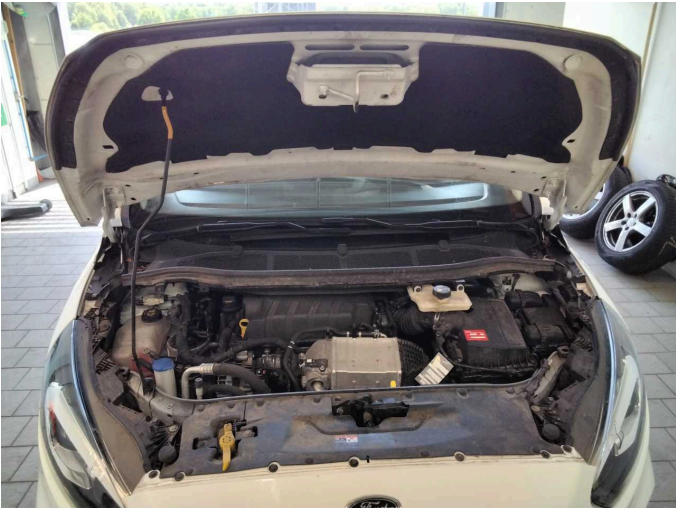


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Door - rear right side: Door handle - outside - Scratch(es) - Smart repair



Damage 2: Door - rear right side: Door handle - outside - Scratch(es) - Smart repair

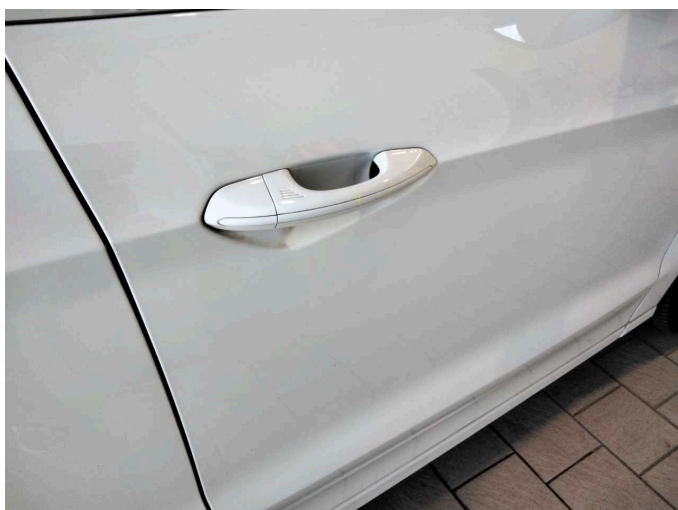

Damage 3: Door - front right side: Door handle - outside - Scratch(es) - Smart repair




Damage 3: Door - front right side: Door handle - outside - Scratch(es) - Smart repair




Damage 4: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 4: Sill - left side: Sill - Scratch(es) - Smart repair

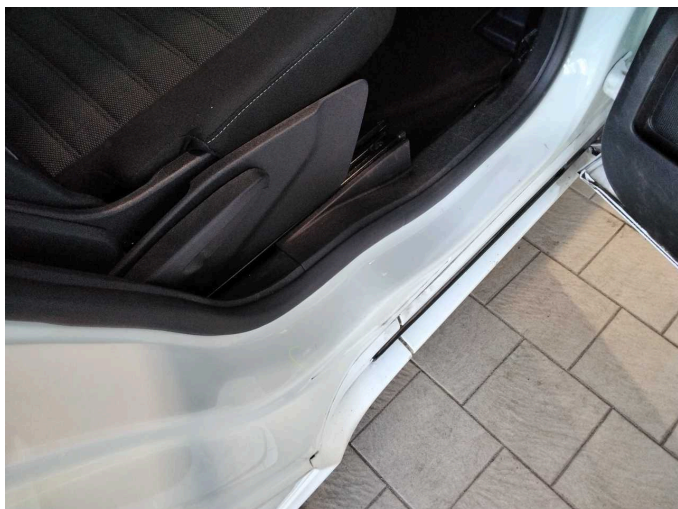

Damage 5: Side panel - rear right side: Sill - Scratch(es) - Smart repair

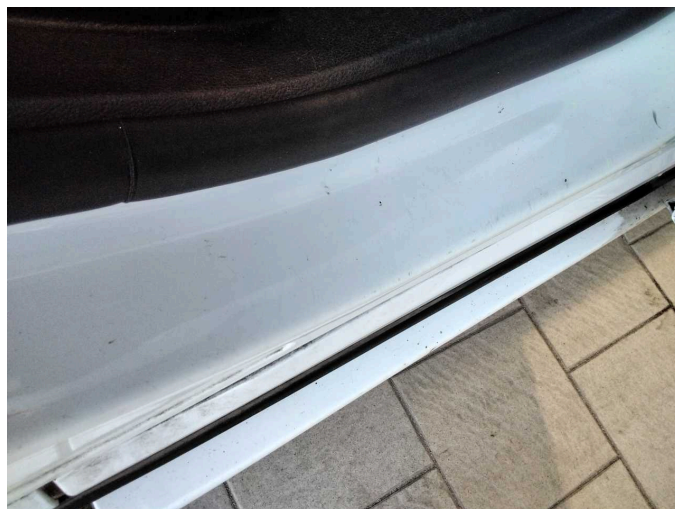

Damage 5: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 6: Body: C-pillar - left side - Dent / paintcoat damage - Smart repair



Damage 6: Body: C-pillar - left side - Dent / paintcoat damage - Smart repair



Damage 6: Body: C-pillar - left side - Dent / paintcoat damage - Smart repair




Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Smart repair




Damage 8: Front bumper: Front bumper - Scratch(es) - Smart repair

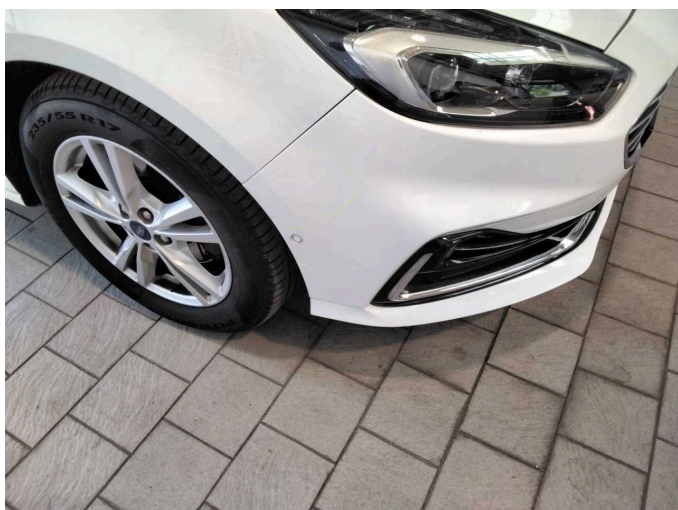

Damage 8: Front bumper: Front bumper - Scratch(es) - Smart repair




Damage 8: Front bumper: Front bumper - Scratch(es) - Smart repair

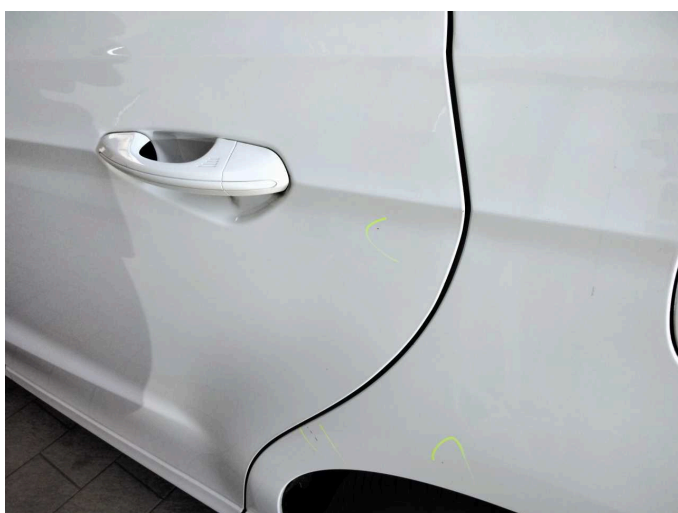

Damage 9: Door - rear left side: Door - Scratch(es) - Smart repair



Damage 9: Door - rear left side: Door - Scratch(es) - Smart repair

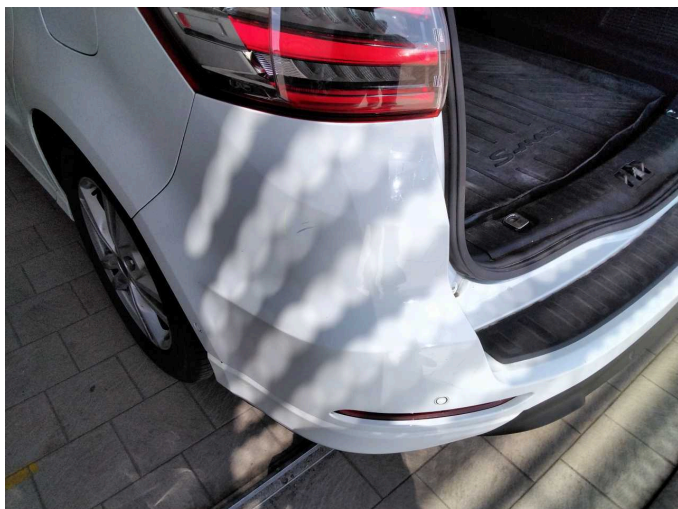

Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 11: Bonnet: Bonnet - Stone chips - Paint

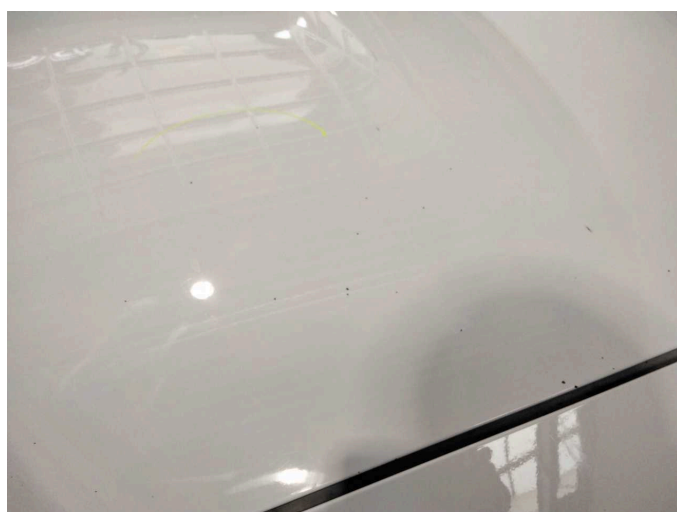

Damage 11: Bonnet: Bonnet - Stone chips - Paint




Damage 11: Bonnet: Bonnet - Stone chips - Paint




Damage 11: Bonnet: Bonnet - Stone chips - Paint




Damage 11: Bonnet: Bonnet - Stone chips - Paint

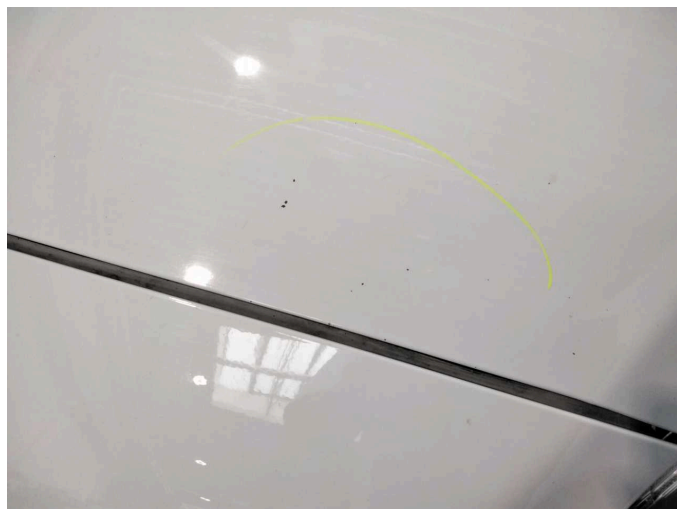

Damage 11: Bonnet: Bonnet - Stone chips - Paint

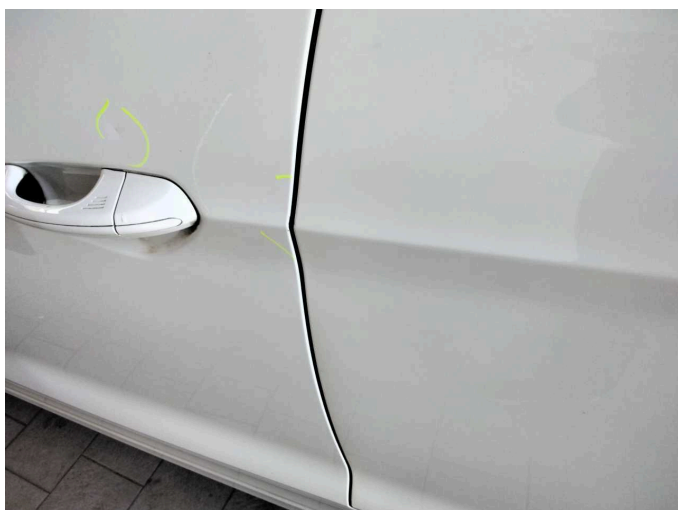

Damage 12: Door - front left side: Door - Dent / paintcoat damage - Paint

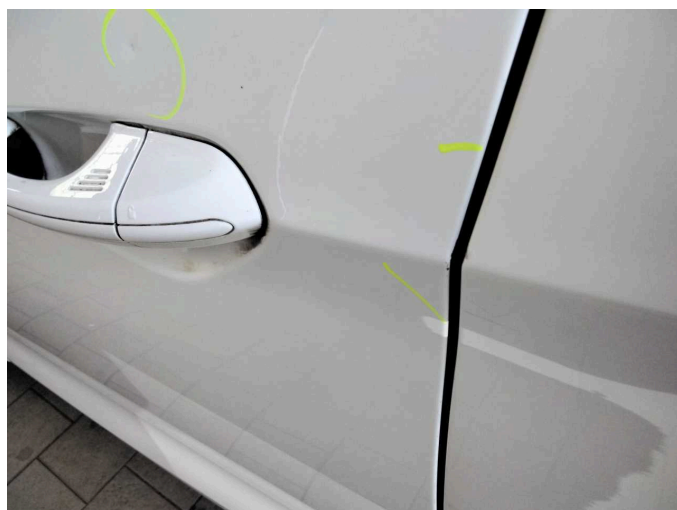

Damage 12: Door - front left side: Door - Dent / paintcoat damage - Paint



Damage 12: Door - front left side: Door - Dent / paintcoat damage - Paint



Damage 12: Door - front left side: Door - Dent / paintcoat damage - Paint



Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction



Repainting 1: Side panel - rear right side, Door - front right side




Repainting 1: Side panel - rear right side, Door - front right side



Side panel - rear right side: 279 µm



Side panel - rear right side: 279 µm

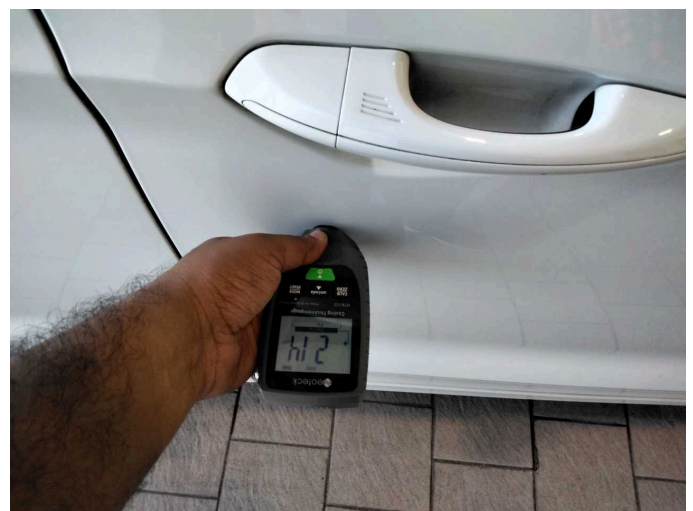

Door - front right side: 214 µm



Door - front right side: 214 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0JXXWPCJNS88933

Hersteller / Modell: FORD FORD S-Max 2.0 EcoBlue Aut. TITANIUM

Datum	KM-Stand	Beschreibung
23.04.2026	122.701	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
13.11.2025	105.495	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne
03.06.2025	94.176	AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.06.2024	60.995	Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
12.07.2023	30.360	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges