



Expertise

Protocol number: 46192327
Order No. / Reference: 26540128
Inspection date: 23 Jun 2026

Manufacturer: Volkswagen

Model: Tiguan 2.0 TDI SCR DSG URBAN SPORT

VIN: WVGZZZ5NZNW515807



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Tiguan 2.0 TDI SCR DSG URBAN SPORT	
Vehicle Identification number	WVGZZZ5NZNW515807
Mileage (Read)	128,077 km
First registration	5 Apr 2022
Number of holders	1
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Dolphin grey metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Anthracite-White



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	19,500 km
Last service on / at	08/2025 at 117,575 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH984063
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BZG 21600		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,170 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tires (with run-flat tires) on Light alloy	Pirelli	7mm / 7mm
2)	215/65 R17 99H	Winter tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99V	Summer tyres on Light alloy	Hankook	5mm / 5mm
2)	235/50 R19 99V	Summer tyres on Light alloy	Hankook	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments in the overhead console
- Airbag: Head airbag system for front and rear passengers including front side airbags
- Adaptive Cruise Control (ACC) (DSG)
- Exterior mirror housing black
- third brake light
- black roof rails
- Decorative inlays for special model
- Tachometer
- Door sill trims for special edition model
- Electronic Stability Program with counter-steering support
- Automatic headlight control, with LED daytime running lights
- Windscreen made of laminated safety glass, heat and sound insulating
- Transmission: 7-speed DSG
- rear window wiper
- Interior mirror automatically dimming
- Air conditioning system "Air Care Climatronic"
- Front headrests
- LED reading lights, 2 in the front and 2 in the rear
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- front center armrest
- Fatigue detection
- Emergency braking assistant "Front Assist"
- Package: Sports package
- Upholstery: Cloth
- Radio "Composition"
- Radio accessories: 2 USB-C ports at the front
- Rain sensor
- Wheels: AirStop tires 235/55 R 18, rolling resistance class A
- Gearshift knob in leather
- Drawers under the front seats
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Seats: Front seats with height adjustment
- Start-stop system with brake energy recuperation
- Bumpers in body color
- First aid kit, warning triangle and high-visibility vest
- Prepared for "We Connect" and "We Connect Plus"
- Central locking without safe locking, with remote control and 2 remote keys
- Airbag for driver and front passenger including knee airbag on the driver's side
- 30-color ambient lighting
- Electrically adjustable and heated exterior mirrors
- Vehicle tool kit
- Chrome applications on mirror adjustment switches, window regulator switches, door pull handles
- Diesel particulate filter
- Parking assistance
- Electronic parking brake including auto-hold function
- Cancellation of extended warranty
- Electric windows front and rear
- High beam control Light Assist
- Pedestrian detection
- Luggage compartment lighting
- Rear window heated
- Rear spoiler in R-style
- ISOFIX mounting points, also for i-Size child car seats
- Rear headrests (3)
- Paint finish: Solid
- LED headlights
- Light in the front footwell
- Makeup mirrors in the sun visors
- Multifunction display "Premium"
- Non-smoking version
- Emergency call service
- Pedals and footrest in brushed stainless steel
- Proactive occupant protection system in conjunction with "Front Assist"
- Radio accessories: 8 speakers
- Tire pressure monitoring system
- Wheels: Tire Mobility Set omitted
- Wheels: Alloy (4) "Sebring" 7 J x 18 in black
- Windows: Rear side windows and rear window tinted
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Comfort seats in the front
- Seats: Rear bench seat asymmetrically split
- Lane keeping assistant "Lane Assist"
- 12-volt socket
- Textile floor mats front and rear with decorative stitching in grey
- Electronic immobilizer



Extra equipment

- "Comfort" telephone interface with inductive charging function (operation and display via multifunction display and touchscreen of the radio or radio navigation system as well as via multifunction steering wheel - hands-free system - Bluetooth audio - external antenna connection with LTE support)
- App Connect (Volkswagen offers three interfaces for connecting smartphones with numerous possibilities: Apple CarPlay, Android Auto from Google and MirrorLink.)
- Keyless locking and starting system "Keyless Access" with safe locking mechanism
- Package: "Easy Open & Close" with safe locking mechanism ("Easy Open & Close" - tailgate with sensor-controlled opening and closing, with remote unlocking - keyless locking and starting system "Keyless Access" with safe locking mechanism)
- Package: Business Premium (DSG) (App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Leather multifunction steering wheel, heated, with shift paddles - Automatically heated front windscreen washer nozzles - Voice control - "Comfort" telephone interface with inductive charging function - Heated front seats)
- Steering wheel: Multifunction leather steering wheel, heated, with paddle shifters
- Anti-theft alarm system with safe locking (anti-theft alarm system with interior monitoring, backup horn and tow-away protection, central locking with safe locking, remote control and 2 remote folding keys)
- Mesh partition
- Navigation system "Discover Media" incl. "Streaming & Internet" (20.3 cm TFT touchscreen - FM radio reception - Dual tuner with phase diversity for best possible radio reception - Radio Data System (RDS) - Radio station logos - MP3 playback - USB-C interface with Apple compatibility - 4 x 20 watt output power - Map with 2D display - 3-band sound control - Telephone interface - Traffic sign recognition - Points of interest - DAB+ digital radio reception)
- Package: Winter (front windshield washer nozzles automatically heated - front seats heated)
- Paint finish: Metallic
- Power outlet: 2 USB-C ports on the front
- Voice control
- Wheels: Alloy (4) "Auckland" 7 J x 19, Volkswagen R (in Dark Graphite, polished surface - AirStop tires 235/50 R 19 - wheel locks with enhanced theft protection)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door edge - Scratch(es) - Smart repair
2	Body	C-pillar - right side - Scratch(es) - Smart repair
3	Trim / covers	Boot lid - interior trim - Scratch(es) - Replace
4	Door - rear right side	Brightware - lower - Scratch(es) - Replace
5	Rear bumper	Rear bumper - Dent / paintcoat damage - Repair and paint
6	Door - rear right side	Door - Dent / paintcoat damage - Repair and paint
7	Body	Body - Damage by hail - repair according to calculation



Wear and tear

No.	Component group	Description
1	Wing mirror - left side	Cap - Scratch(es) - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction
4	Door - front right side	Brightware - lower - Scratch(es) - No deduction
5	Side panel - rear right side	Wheel well extension - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

-Der montierte Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

Der kalkulierte Hagelschaden wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung, Mehrkosten und somit Abweichung der für den Schaden ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

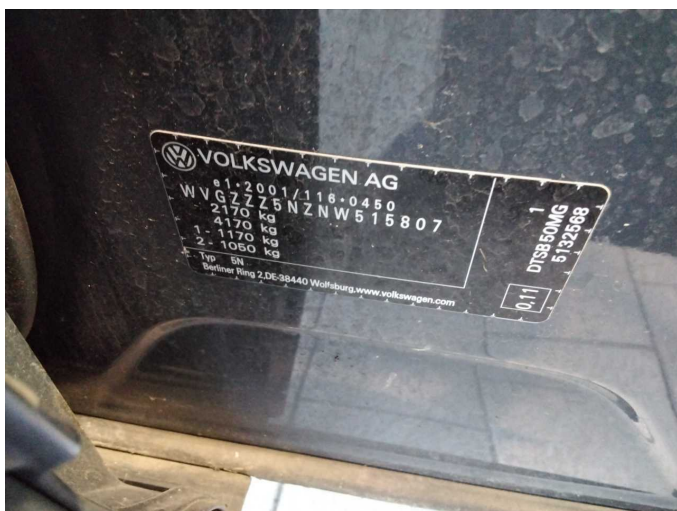


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

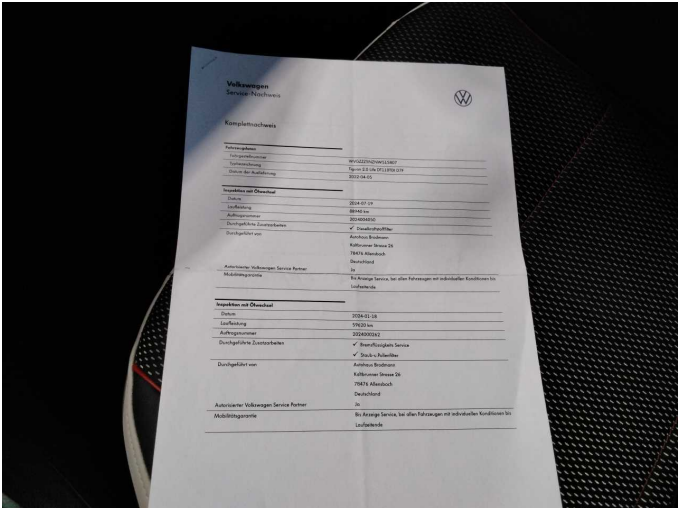


Figure 14: Documents

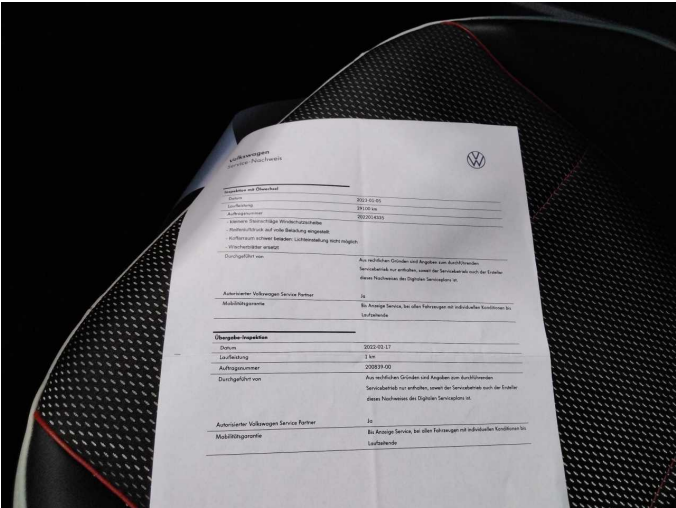


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.

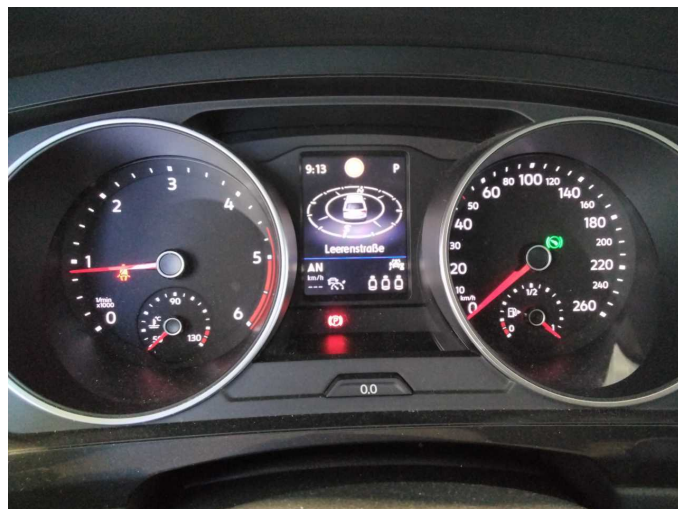


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

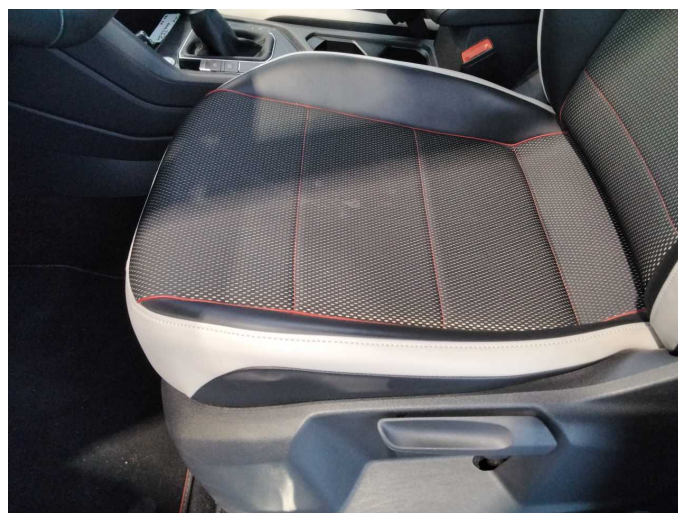


Figure 24: Misc.

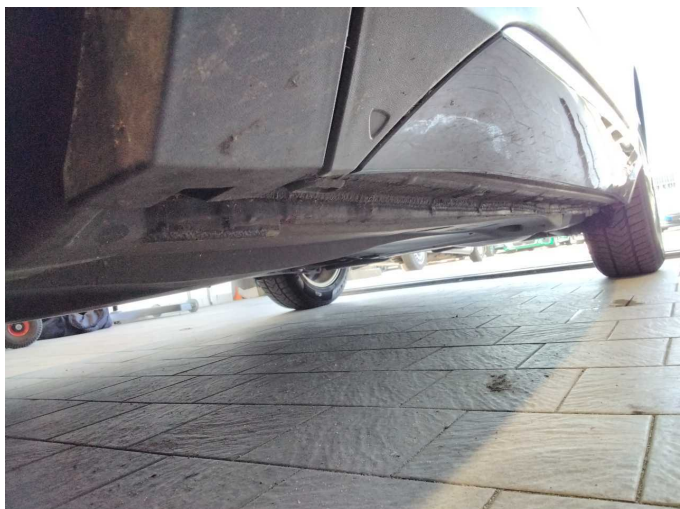


Figure 25: Misc.

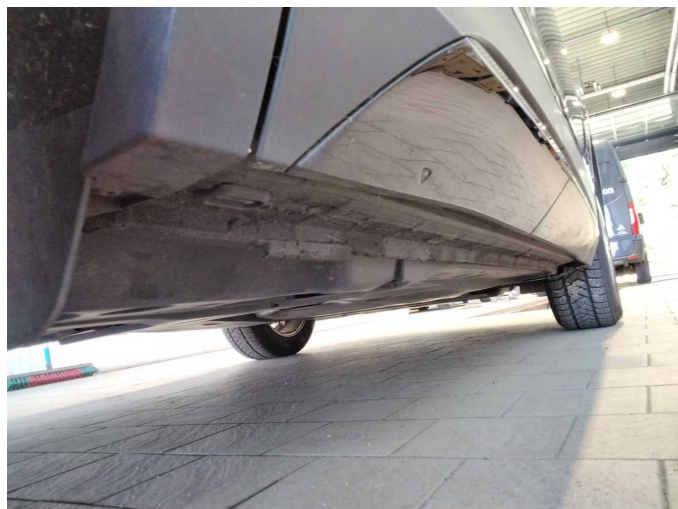


Figure 26: Misc.

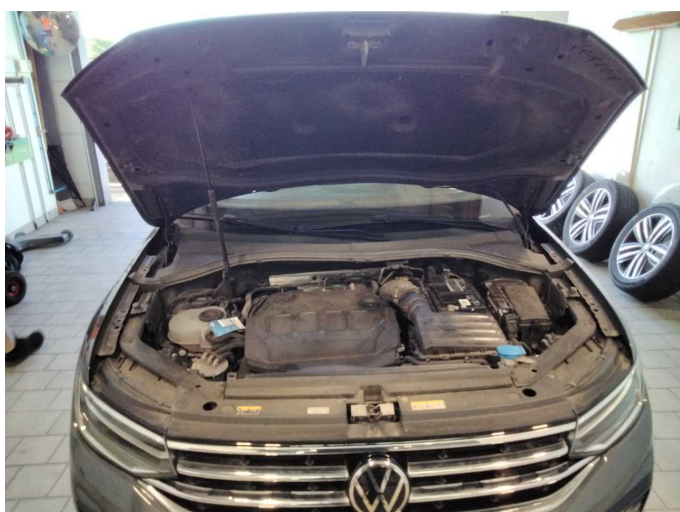


Figure 27: Misc.



Figure 28: Misc.


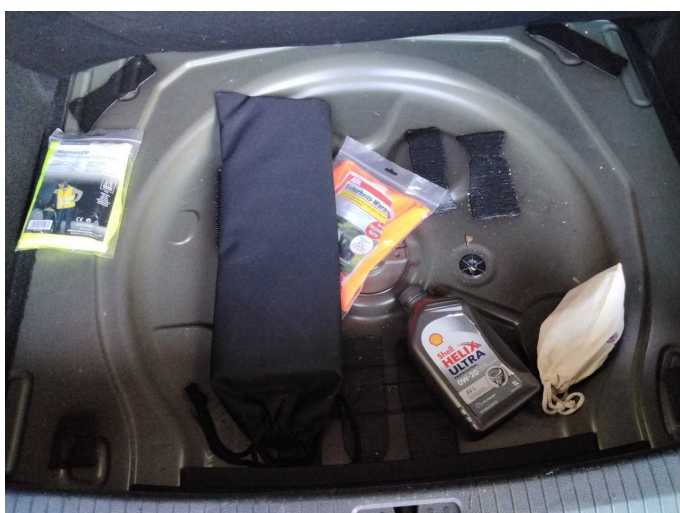


Figure 29: Misc.




Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair

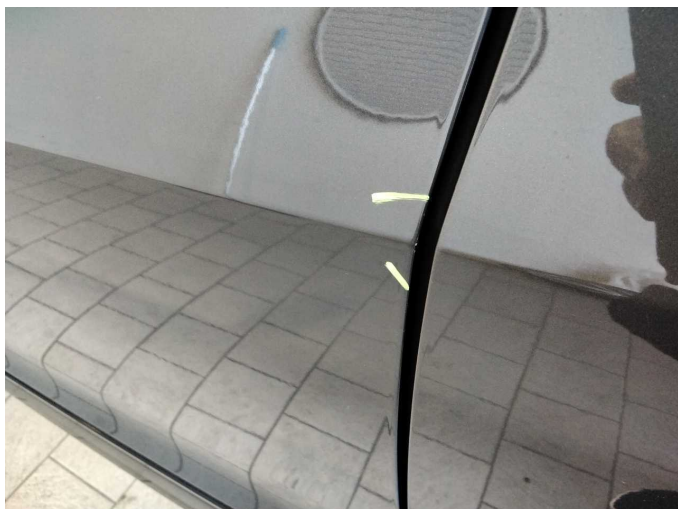

Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 2: Body: C-pillar - right side - Scratch(es) - Smart repair

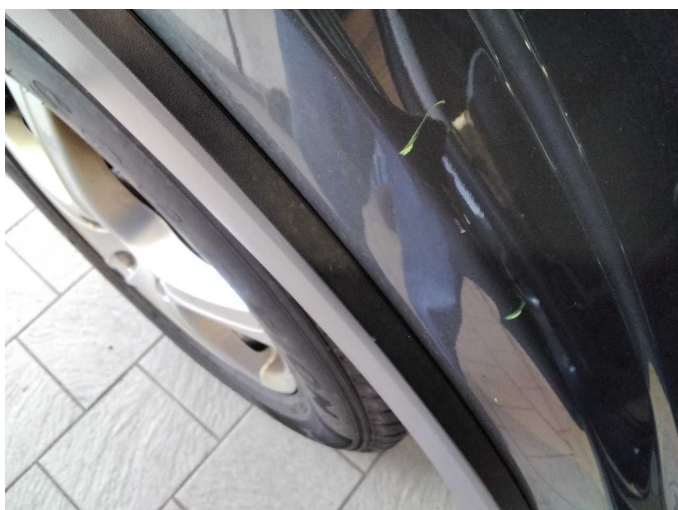

Damage 2: Body: C-pillar - right side - Scratch(es) - Smart repair



Damage 3: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace




Damage 3: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace




Damage 4: Door - rear right side: Brightware - lower - Scratch(es) - Replace



Damage 4: Door - rear right side: Brightware - lower - Scratch(es) - Replace

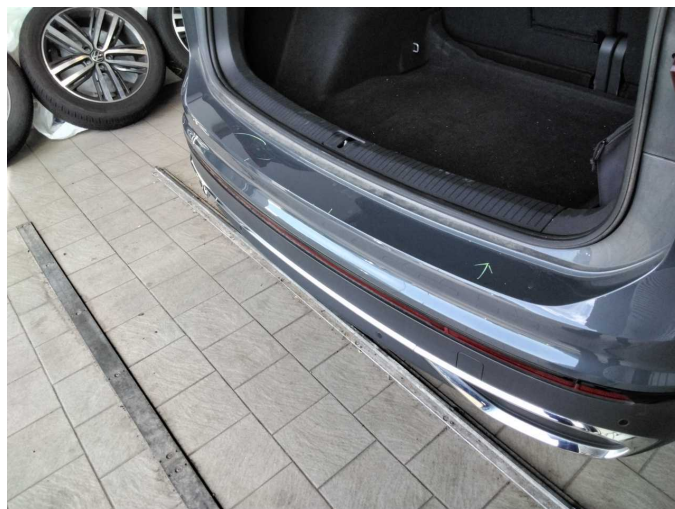

Damage 5: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

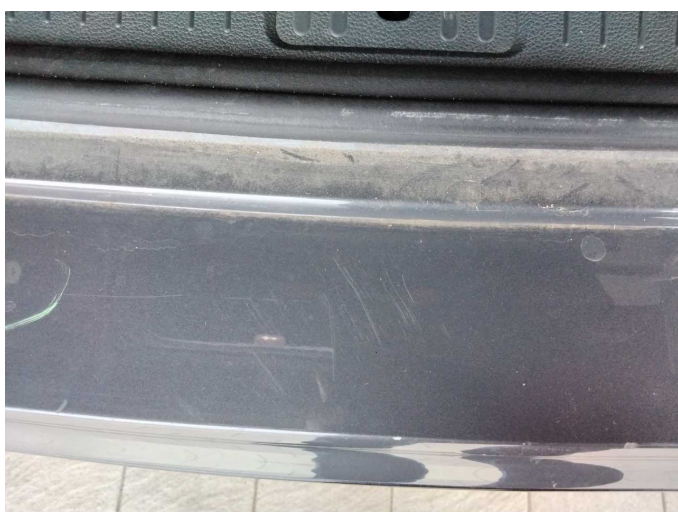


Damage 5: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 5: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 5: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

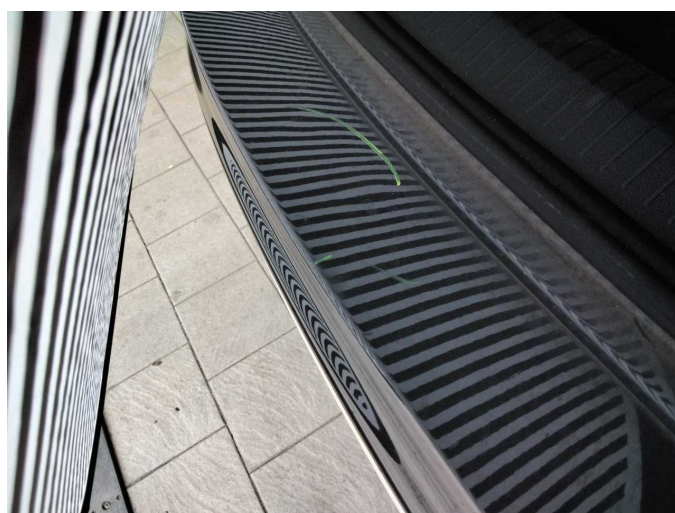

Damage 5: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

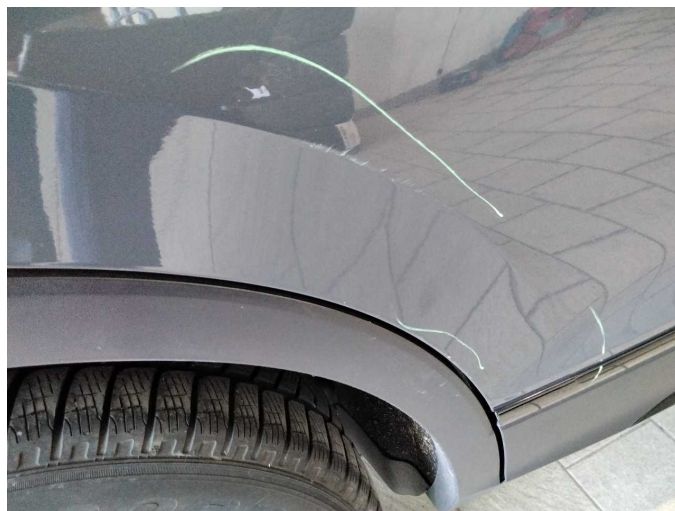


Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint




Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

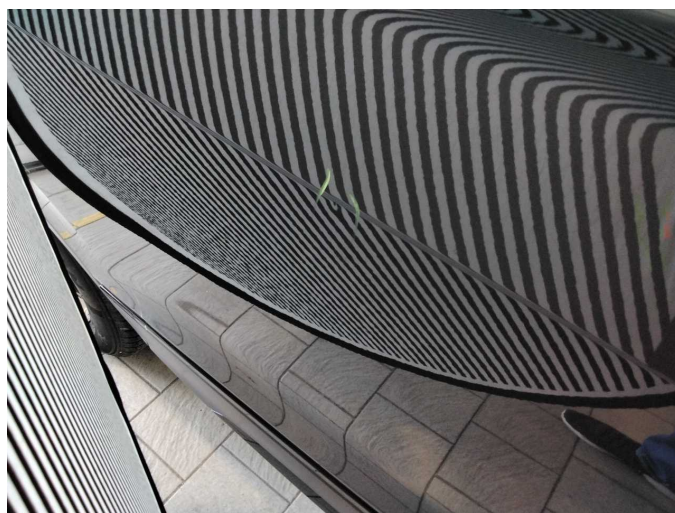

Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

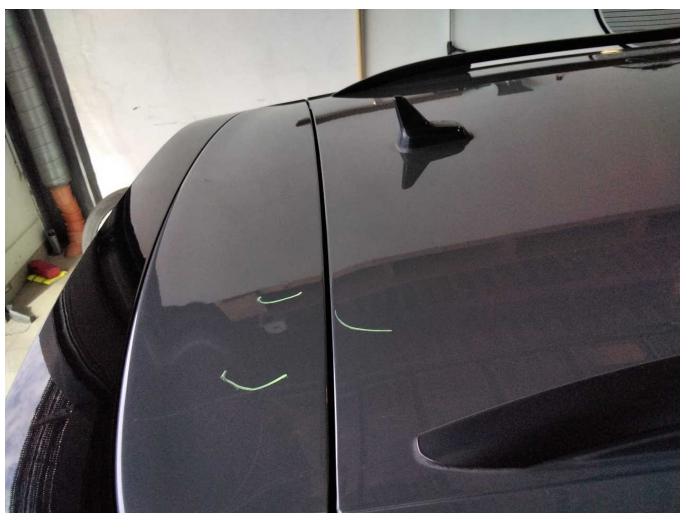

Damage 7: Body: Body - Damage by hail - repair according to calculation

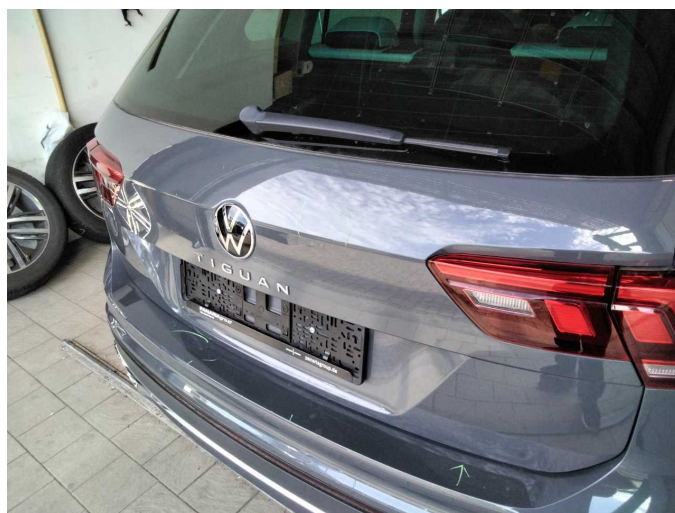

Damage 7: Body: Body - Damage by hail - repair according to calculation



Damage 7: Body: Body - Damage by hail - repair according to calculation




Damage 7: Body: Body - Damage by hail - repair according to calculation




Damage 7: Body: Body - Damage by hail - repair according to calculation



Damage 7: Body: Body - Damage by hail - repair according to calculation

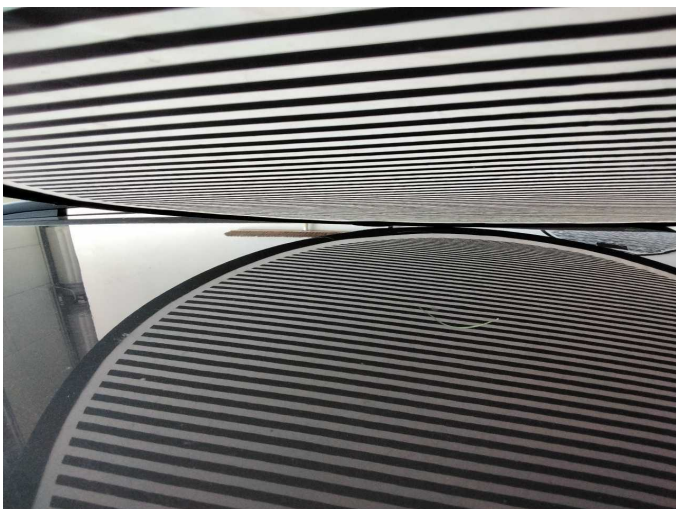

Damage 7: Body: Body - Damage by hail - repair according to calculation

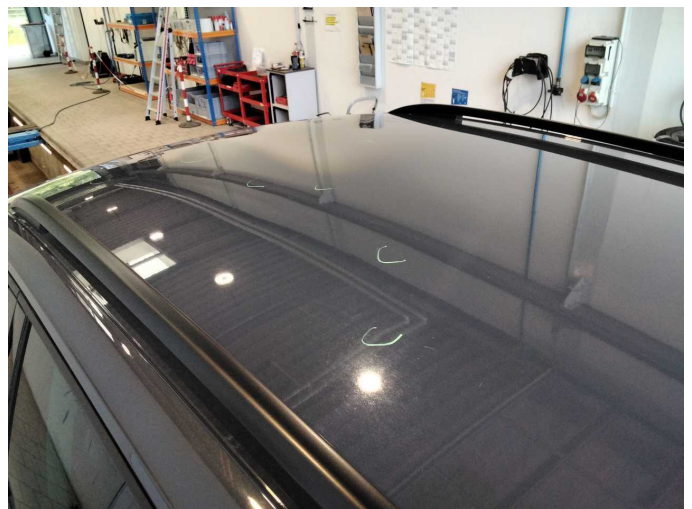

Damage 7: Body: Body - Damage by hail - repair according to calculation



Damage 7: Body: Body - Damage by hail - repair according to calculation




Damage 7: Body: Body - Damage by hail - repair according to calculation




Damage 7: Body: Body - Damage by hail - repair according to calculation



Damage 7: Body: Body - Damage by hail - repair according to calculation

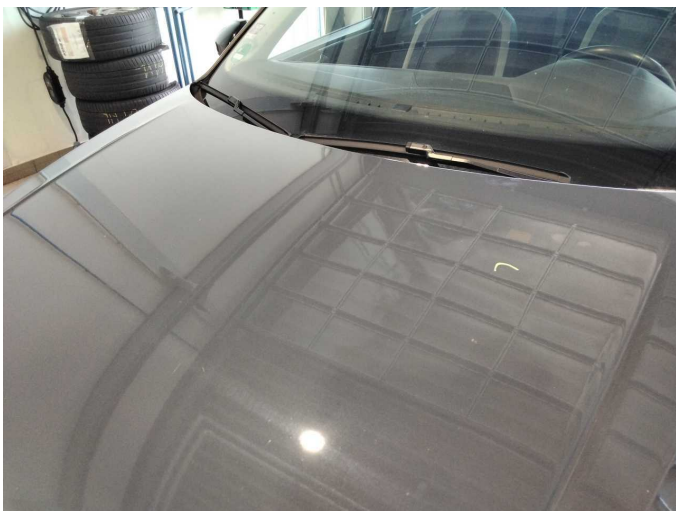


Damage 7: Body: Body - Damage by hail - repair according to calculation

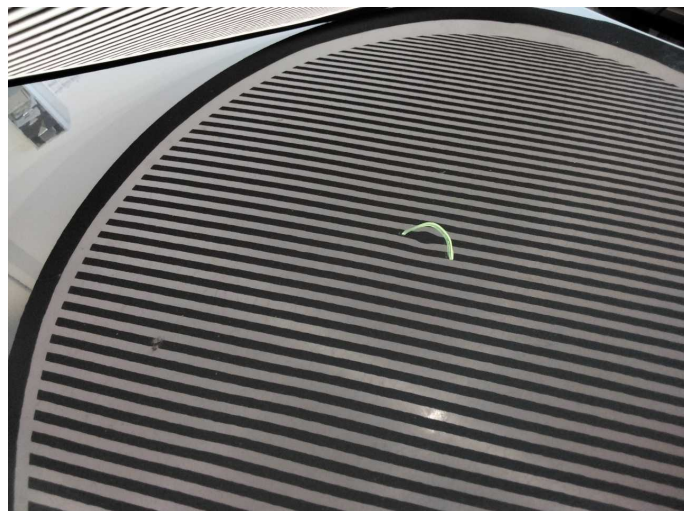

Damage 7: Body: Body - Damage by hail - repair according to calculation




Damage 7: Body: Body - Damage by hail - repair according to calculation

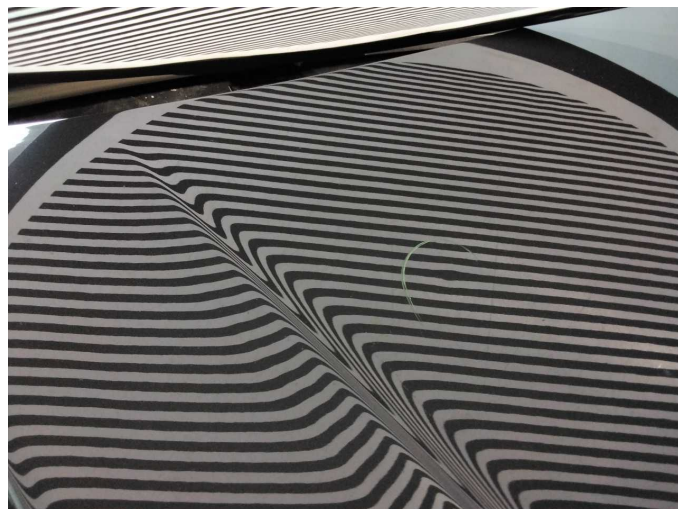

Damage 7: Body: Body - Damage by hail - repair according to calculation




Wear and tear 1: Wing mirror - left side: Cap - Scratch(es) - No deduction

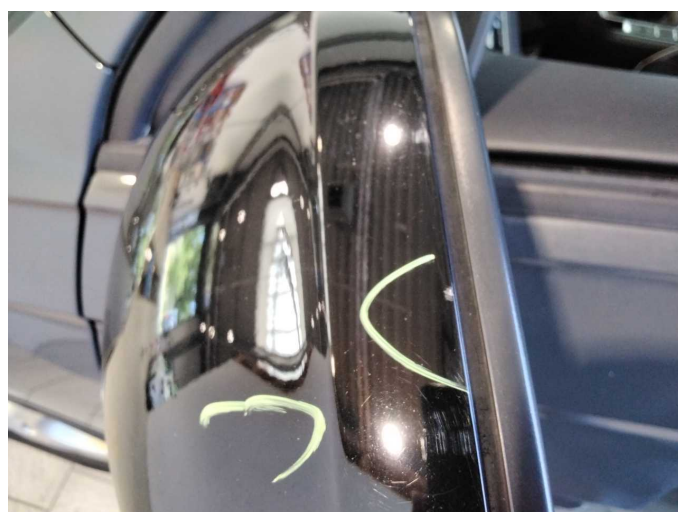

Wear and tear 1: Wing mirror - left side: Cap - Scratch(es) - No deduction



Wear and tear 2: Vehicle glazing: Windscreen - Stone chips - No deduction

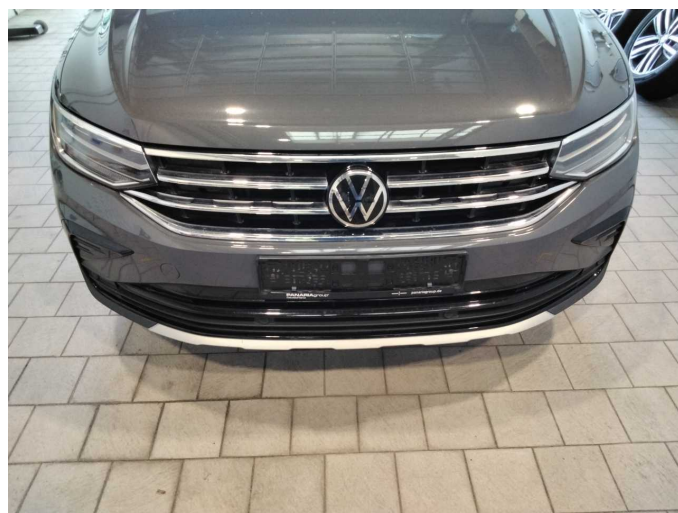

Wear and tear 3: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 5: Side panel - rear right side: Wheel well extension -
Scratch(es) - No deduction



Wear and tear 5: Side panel - rear right side: Wheel well extension -
Scratch(es) - No deduction