



Expertise

Protocol number: 46572196
Order No. / Reference: 26656952
Inspection date: 15 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1N4M1EB3PW272533

Model: GLB 220 d 8G-DCT AMG Line



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLB 220 d 8G-DCT AMG Line	
Vehicle Identification number	W1N4M1EB3PW272533
Mileage (Read)	158,940 km
First registration	3 Feb 2023
Number of holders	1
Next periodical technical inspection	06/2028
(Report on hand)	
Power / Engine displacement	140 kw / 1,950 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	GALAXYBLAU
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	194 Tag(e)
Last service on / at	01/2026 at 143,188 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GN001511
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / ASE 00137		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,195 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99W	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	235/50 R19 99W	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Michelin	5mm / 5mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Airbag for driver and front passenger
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- Active Lane Keeping Assist
- AMG sports pedal assembly (made of brushed stainless steel with rubber studs)
- Anti-lock braking system (ABS)
- Rear armrest
- Automatic passenger airbag deactivation
- Heated exterior mirrors on the left and right, electrically adjustable from the inside (with aspherically curved mirror glass and integrated turn signal light)
- Roof rails in polished aluminum
- Double cup holder
- Third brake light in LED technology
- ECO start/stop function
- Door sills with "Mercedes-Benz" lettering
- Electronic Stability Program (ESP)
- Chassis: Comfort chassis
- Electric window regulators (4)
- Luggage net on driver and passenger seatbacks
- Speed Limit Assist (The Speed Limit Assist makes it easy for you to comply with the regulations and avoid unnecessary speeding tickets. The system shows what is permitted: It can detect the current speed limit via the camera and display it in the instrument cluster. Additional restrictive signs for special weather conditions such as wet conditions are also detected.)
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control (1-zone climate control - automatically controlled air distribution - recirculation function - tunnel mode in conjunction with navigation system - fine dust filter)
- Headrests (2)
- Rear headrests (3)
- Loading floor height-adjustable and removable
- Steering wheel: Multifunction sports steering wheel in Nappa leather (The multifunction sports steering wheel in Nappa leather with chrome control panels is flattened at the bottom and perforated in the grip area – an excellent choice for sporty driving. Among other things, the touch control buttons on the left and right operate a variety of functions, including navigation, telephony, and entertainment. Last but not least, you can also set the cruise control and distance control: everything under control without taking your hands off the steering wheel.)
- Navigation accessories: Extended MBUX functions (personalization (profiles) and prediction functions - LINGUATRONIC with natural language understanding - activation via "Hey Mercedes" - Wi-Fi hotspot - internet radio)
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Brake Assist
- AMG floor mats (in black with "AMG" lettering)
- AMG Styling (AMG front apron with chrome front splitter - AMG rear apron with diffuser look - chrome trim element and two visible tailpipe trims)
- ATTENTION ASSIST (can detect typical signs of fatigue via steering behavior and can warn the driver of impending microsleep)
- On-board computer
- Brake assist
- Diesel particulate filter
- Tachometer
- DYNAMIC SELECT (Simply drive the way you want. At the touch of a button, DYNAMIC SELECT offers various driving programs that predefine, for example, the engine, transmission, suspension, or steering. Sport mode provides a decidedly dynamic driving experience, while the basic Comfort program offers a very balanced ride. ECO mode, on the other hand, prioritizes maximum efficiency, saving fuel and money.)
- Transmission: 8G-DCT dual-clutch automatic transmission, 8-speed
- Halogen headlights including integrated LED daytime running lights
- Rear window heated
- rear window wiper
- KEYLESS-GO start function
- Communication module (LTE) for the use of Mercedes me connect services (communication module with permanently installed SIM card of the mobile communications standard LTE - two mobile communications antennas)
- Fuel tank with larger volume 60 l
- Cargo area cover (roller blind) (stores under the cargo floor)
- Steering column mechanically adjustable lengthwise and heightwise.
- Mercedes-Benz Emergency Call System (The Mercedes-Benz Emergency Call System can provide a crucial time advantage in an emergency. A communication module with its own SIM card automatically triggers an emergency call upon detection of an accident, which can shorten the time until emergency services arrive. The emergency call can also be triggered manually to organize assistance.)
- Package: Light and Sight Package (Overhead control unit with 4 light elements (including glasses compartment) - Interior light/reading light rear in mounting plate (rear/left/right) - Touchpad lighting (front) - Reading lights (front/left/right), console ambient light - Make-up lights (front/left/right) - Signal and ambient light - Exit signal light (front/left/right) - Footwell lighting (front/left/right) - Cupholder/storage compartment lighting - Occasional storage compartment lighting)



- Package: Seating comfort (height adjustment for passenger seat - seat cushion tilt adjustment for driver and passenger seats - seat cushion depth adjustment for improved seating comfort through a 60 mm wider thigh support area - specific seat design)
 - Upholstery: ARTICO leatherette/MICROCUT microfiber
 - Radio accessories: Digital radio
 - Radio accessories: Touchpad (integrated into the center console, including a hand rest - single and multi-finger gestures, swiping movements and zoom gestures by spreading and pinching the fingers - recognizes handwritten characters: letters, special characters and numbers - clear haptic feedback)
 - Rain and light sensor
 - Tire pressure monitoring system (TPMS)
 - Remote Services Plus (The Remote Services Plus package transforms mobility into a new experience, offering greater comfort and safety. Status queries provide information about the remaining range. You can remotely control certain functions and locate your vehicle. Services such as maintenance management coordinate service appointments, saving you valuable time.)
 - Seats: Sports seats (with adjustable headrest)
 - 12V power outlet in center console
 - High-visibility vest for drivers
 - Immobiliser
 - Decorative elements carbon structure
- Radio: MBUX multimedia system (instrument display with 17.78 cm (7") diagonal - media display with 17.78 cm (7") diagonal and touch function - touch control buttons on the steering wheel - radio (FM/AM) - USB interface in the center console under the armrest - Bluetooth telephony with contact transfer and audio streaming of music data - display of vehicle functions (driver assistance system, driving programs and vehicle settings) - favorites memory - smartphone-related voice control - activated by long press on the voice button on the steering wheel)
 - Wheels: 48.3 cm (19") AMG light-alloy wheels, 4-piece set in 5-twin-spoke design (aerodynamically optimized, painted tantalum grey and polished, 235/50 R19 with 7.5 J x 19 ET 53)
 - Windscreen wipers with rain sensor
 - Power steering
 - Seats: Rear seat backrests foldable (in a 40/20/40 ratio and adjustable to 7 tilt positions)
 - Cruise control (Drive relaxed and fuel-efficiently, especially on longer journeys. Simply select your desired speed and your vehicle will regulate it. In addition to the cruising speed, the speed limiter helps you maintain a maximum speed. This increases road safety and protects you from expensive speeding tickets.)



Extra equipment

- Storage compartment in center console with roller blind (The roller blind for the storage compartment in the center console offers you an elegant privacy screen made of high-quality material. This looks good, the interior appears even tidier, and everything important is within easy reach. Typical everyday items such as a smartphone, wallet, or various keys fit into the practical storage compartment.)
- EASY-PACK tailgate (electrically opening and closing tailgate - switch for electrically opening the tailgate in the driver's door - switch for electrically closing the tailgate at the bottom edge of the tailgate - manual cargo cover for covering the cargo area)
- GUARD 360° Vehicle Protection Plus (Anti-theft alarm system - Tow-away protection with visual and audible warning in case of detected change in position - Alarm siren - Interior monitoring (triggers upon movement inside the vehicle) - Location tracking of stolen vehicles, free for 3 years from activation - Theft and parking collision detection, free for 3 years from activation - URBAN GUARD label on the front side windows)
- Package: Business (Hard drive navigation - Smartphone integration - Traffic sign assistant - Preparation for digital key handover - Connectivity package navigation - Seat heating for driver and front passenger - Parking assistant with PARKTRONIC - Preparation for live traffic information)
- Package: Driving Assistance Package (Active Distance Assist DISTRONIC - Active Steering Assist - Active Speed Limit Assist - Active Brake Assist with Cross-Traffic Function - Evasive Steering Assist - Active Blind Spot Assist - Active Lane Keeping Assist - Active Emergency Stop Assist - Route-Based Speed Adaptation - Extended Automatic Restart on Motorways)
- Package: Night (AMG Line) (Door trim in black with inlay in running board design in high-gloss black - Exterior mirror housings in black - Belt edge trim and window line trim strip in high-gloss black - Roof rails in black - Heat-insulating dark tinted glass - 48.3 cm (19") AMG light alloy wheels in 5-twin-spoke design, aerodynamically optimized, high-gloss black and glossy, with 235/50 R 19 tires on 7.5 J x 19 ET 53 - Diamond grille with chrome pins, individual flames in black and chrome inlays, as well as AMG-specific front airbags with inlays in high-gloss black - AMG rear airbags with trim elements in high-gloss black)
- Package: Mirror package (Exterior mirrors electrically fold in and out via a button in the driver's door control panel - the menu allows you to set the exterior mirrors to fold in automatically when locking the vehicle and unfold again when unlocking - the exterior mirror on the driver's side and the interior mirror dim automatically and continuously depending on the incident glare and ambient light)
- Panoramic sunroof
- Seats: 4-way lumbar support for driver and front passenger
- Heated seats for driver and front passenger
- Cargo net (This feature protects you from loose items in the luggage compartment. The cargo net is very easy to use. You can attach or remove it in just a few steps.)
- Airbag: Side airbag in the rear
- Ambient lighting (in 64 colors, all colors are individually selectable - eight color worlds consisting of two colors each - the colors are statically set or slowly exchange each other in dynamic mode - the brightness of the LEDs can be adjusted in ten steps and three zones - the interior of the air vents is finished in silver chrome and illuminated - AMG Line and Progressive: additional lighting of the piping of the instrument panel above the trim element and in the doors)
- Door sill trims with Mercedes-Benz lettering, illuminated and with interchangeable cover
- Head-up display
- Black fabric headliner
- Paint finish: Metallic
- MULTIBEAM LED (18 individually controllable high-performance LEDs per MULTIBEAM LED module for creating a column-shaped high beam with 16 controllable individual segments - Low beam and high beam in LED projection technology - Adaptive Highbeam Assist Plus (glare-free permanent high beam) - Cornering lights or cornering lights with roundabout and intersection function (only in conjunction with hard drive navigation) - Active curve illumination when high beam is activated - City light, country road light and motorway light - Adaptive full-LED rear lights)
- Package: Cargo area (12V socket - reversible mat - nets on the left and right sides (left net is omitted in conjunction with 3rd row of seats for 2 persons (847)) - open compartment under net on the left - tension straps on the left and right sides - chrome loading sill protector)
- Package: MBUX High-End Package (Hard drive navigation - Smartphone integration - Wireless charging system for mobile devices - Preparation for digital key handover - Connectivity package navigation - Central Media Display 10.25" - Fully digital instrument display with high-resolution 10.25" display - MBUX Augmented Reality for navigation - Traffic sign assistant - Preparation for live traffic information)
- Package: Parking package with 360° camera (Active Parking Assist including PARKTRONIC with visual and acoustic warnings of detected obstacles, notification of detected parking spaces in the instrument cluster via arrow display, convenient parking in and out of parallel and perpendicular parking spaces - 360° camera with four networked close-range cameras in the radiator grille, in the tailgate release handle and in the exterior mirror housings, displaying all four sides of the vehicle and visualizing the vehicle and its surroundings from a bird's-eye view in the multimedia system display)
- Wheels: 48.3 cm (19") AMG light-alloy wheels, 4 in 5-twin-spoke design
- Phone accessories: Wireless charging system for mobile devices
- Ambient lighting with projection of the brand logo (one LED projector in each front door - taking over the function of the exit lights)



- Type designation removed from luggage compartment lid

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Interior	Sun visor - left side (Licht) - Non-operational - Replace
2	Mudguard - left side	Wheel well extension - Malposition - Un- / install
3	Door - front left side	Door handle - inside - Abrasion - Loss in value
4	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
5	Door - rear left side	Door edge - Scratch(es) - Smart repair
6	Door - front left side	Door edge - Scratch(es) - Smart repair
7	Door - front right side	Door edge - Scratch(es) - Smart repair
8	Door - rear right side	Door edge - Scratch(es) - Smart repair
9	Interior	Interior (Alcantara) - Soiled - Clean
10	Front axle	Axles / undercarriage (wegen der beschädigten Felge) - Specify findings - Measure
11	Wheel / tyres	Alloy rim - front right side - Scratched - Replace
12	Front bumper	Front bumper - Scratch(es) - Paint
13	Vehicle glazing	Windscreen with lane departure assistant - Broken / torn - repair according to calculation

Wear and tear

No.	Component group	Description
1	Trim / covers	Floor mats - Holes - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

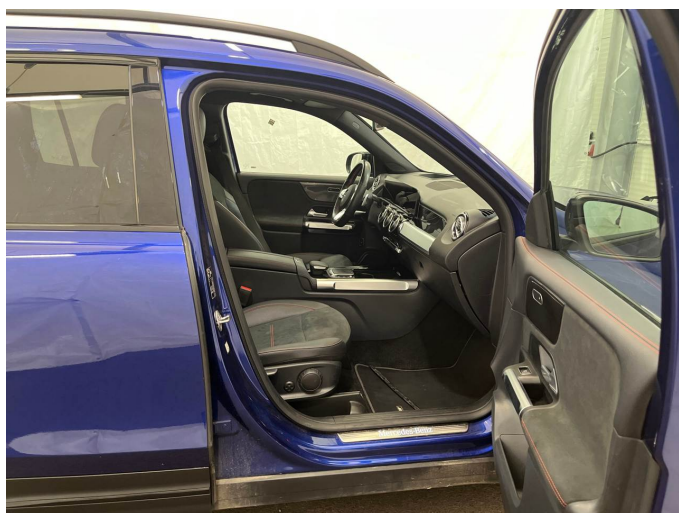


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

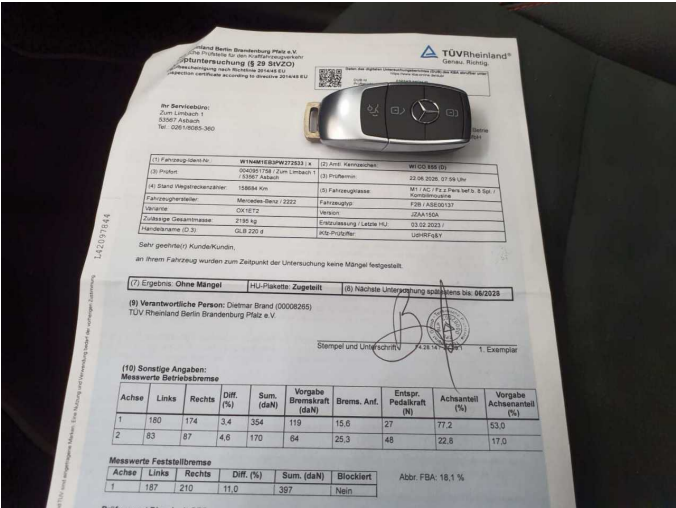


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

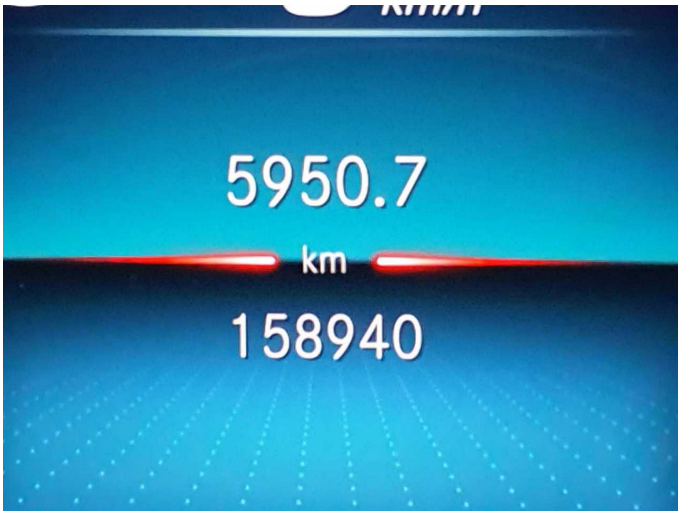


Figure 27: Misc.



Figure 28: Misc.

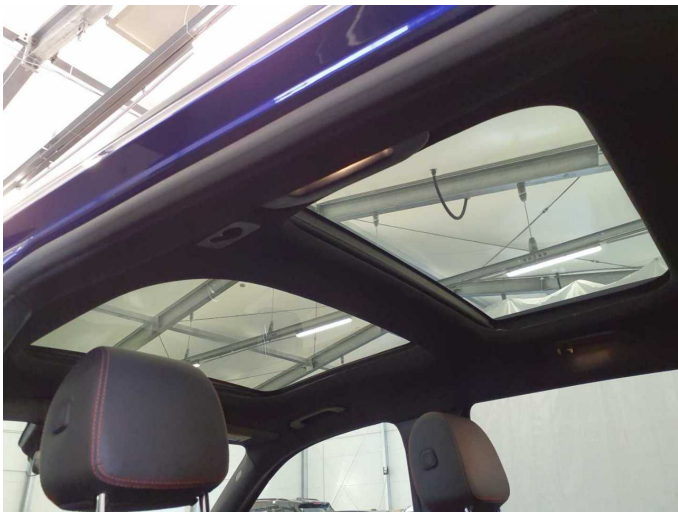


Figure 29: Misc.

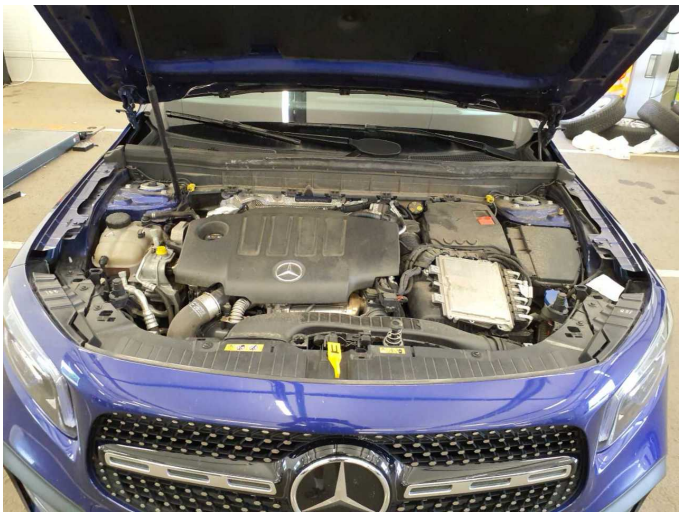


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.




Figure 33: Misc.



Figure 34: Misc.




Damage 1: Interior: Sun visor - left side (Licht) - Non-operational - Replace

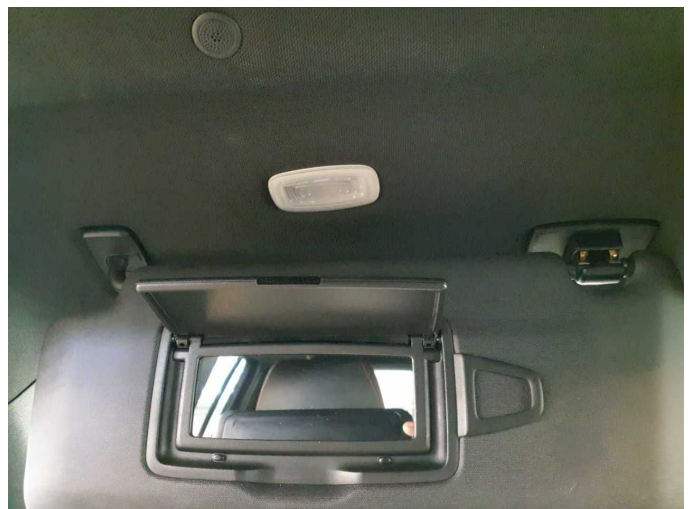

Damage 1: Interior: Sun visor - left side (Licht) - Non-operational - Replace



Damage 2: Mudguard - left side: Wheel well extension - Malposition - Un- / install

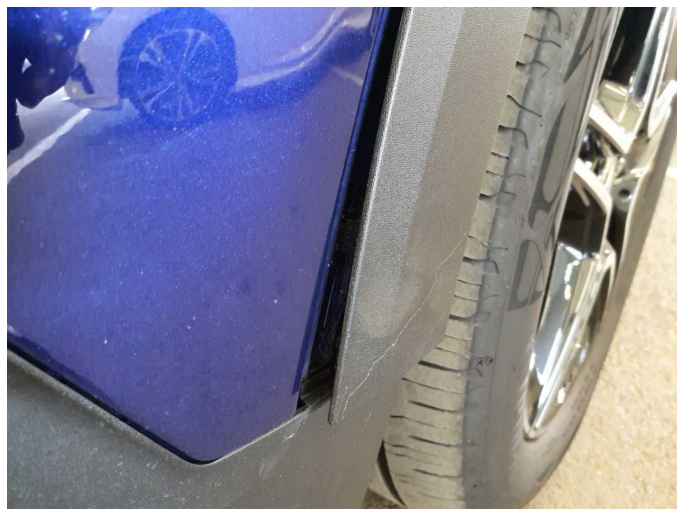

Damage 2: Mudguard - left side: Wheel well extension - Malposition - Un- / install




Damage 3: Door - front left side: Door handle - inside - Abrasion - Loss in value




Damage 3: Door - front left side: Door handle - inside - Abrasion - Loss in value




Damage 4: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise

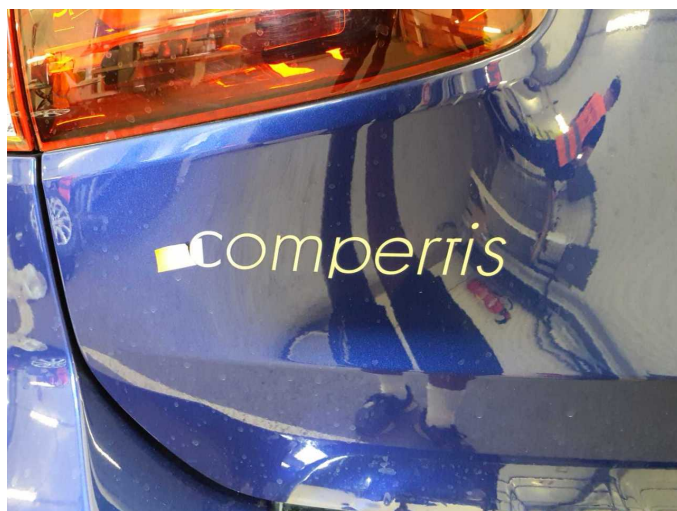

Damage 4: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise

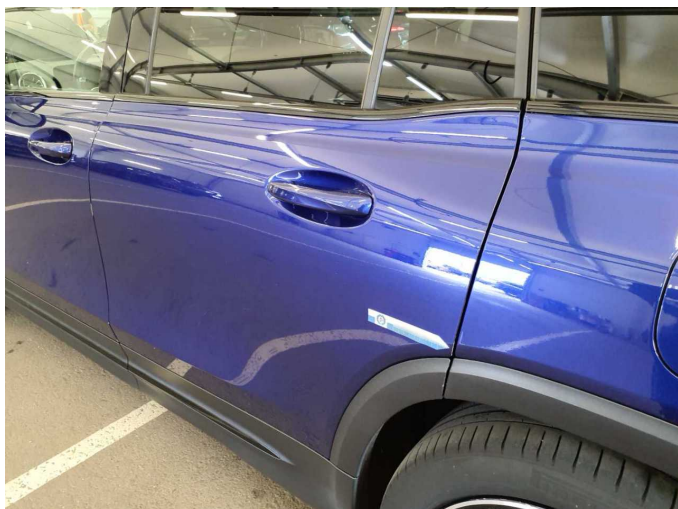

Damage 5: Door - rear left side: Door edge - Scratch(es) - Smart repair

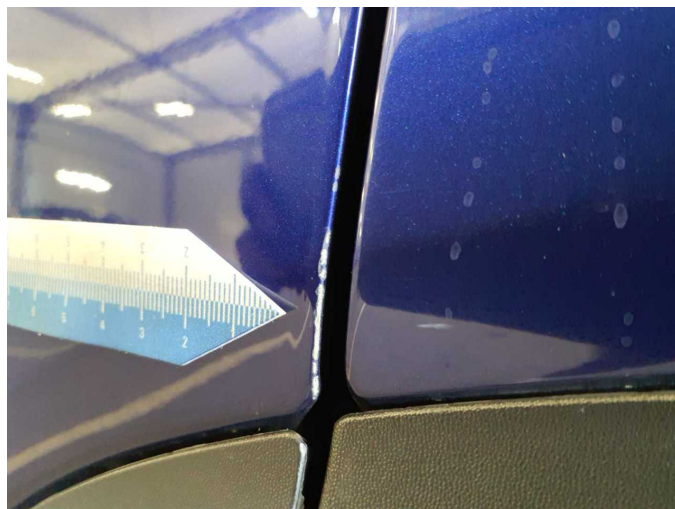

Damage 5: Door - rear left side: Door edge - Scratch(es) - Smart repair



Damage 6: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 6: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 6: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 7: Door - front right side: Door edge - Scratch(es) - Smart repair



Damage 7: Door - front right side: Door edge - Scratch(es) - Smart repair



Damage 8: Door - rear right side: Door edge - Scratch(es) - Smart repair

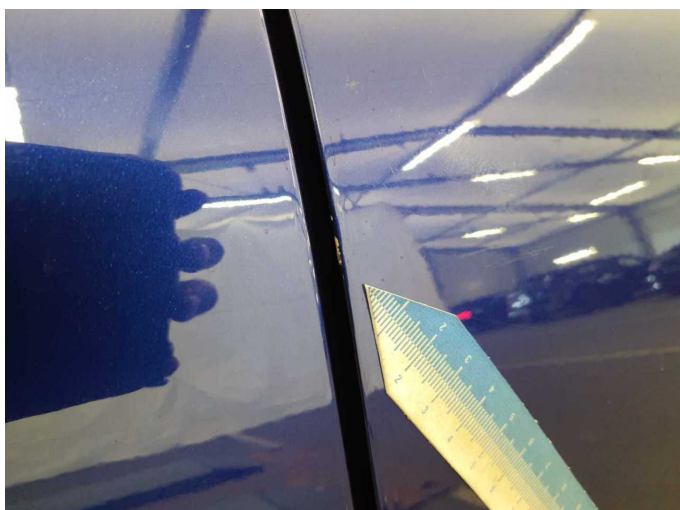


Damage 8: Door - rear right side: Door edge - Scratch(es) - Smart repair



Damage 8: Door - rear right side: Door edge - Scratch(es) - Smart repair



Damage 9: Interior: Interior (Alcantara) - Soiled - Clean

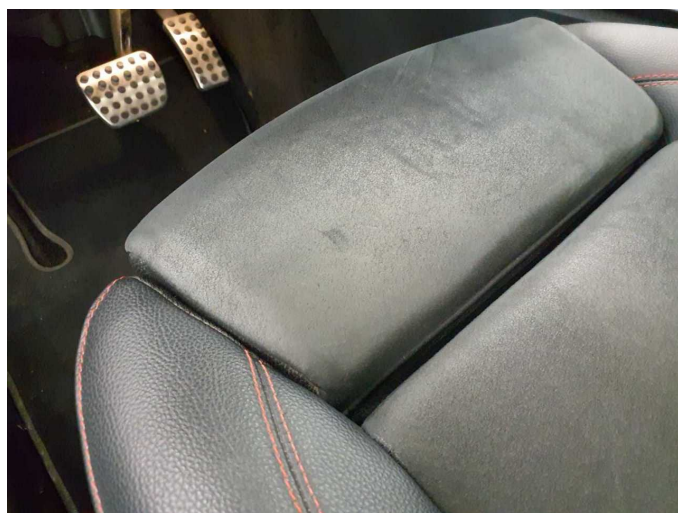

Damage 9: Interior: Interior (Alcantara) - Soiled - Clean



Damage 9: Interior: Interior (Alcantara) - Soiled - Clean




Damage 9: Interior: Interior (Alcantara) - Soiled - Clean



Damage 11: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 11: Wheel / tyres: Alloy rim - front right side - Scratched - Replace

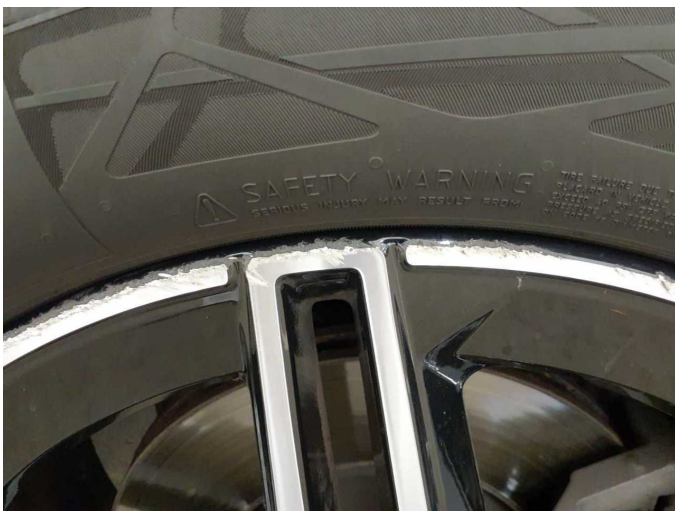


Damage 11: Wheel / tyres: Alloy rim - front right side - Scratched - Replace




Damage 11: Wheel / tyres: Alloy rim - front right side - Scratched - Replace




Damage 12: Front bumper: Front bumper - Scratch(es) - Paint

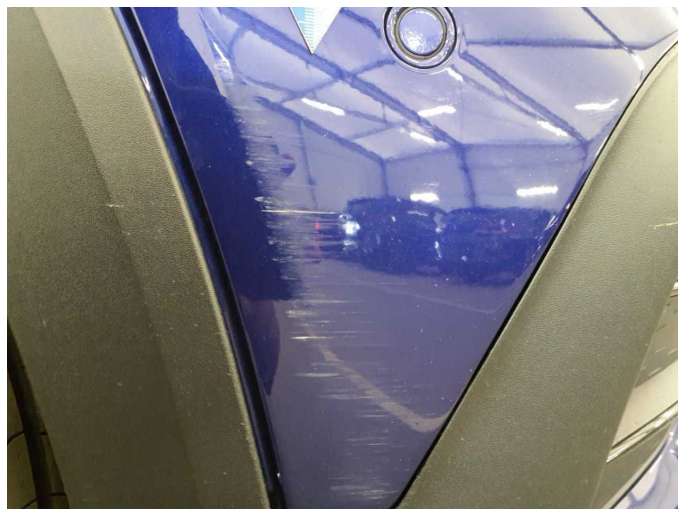

Damage 12: Front bumper: Front bumper - Scratch(es) - Paint

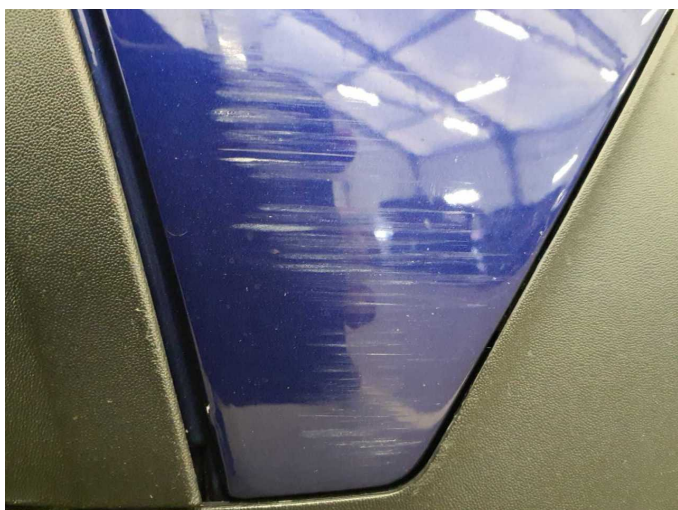

Damage 12: Front bumper: Front bumper - Scratch(es) - Paint

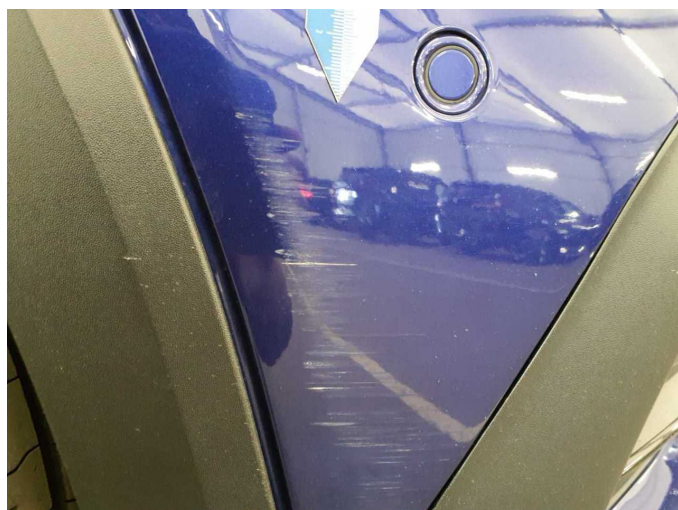


Damage 12: Front bumper: Front bumper - Scratch(es) - Paint




Damage 13: Vehicle glazing: Windscreen with lane departure assistant - Broken / torn - repair according to calculation



Damage 13: Vehicle glazing: Windscreen with lane departure assistant - Broken / torn - repair according to calculation

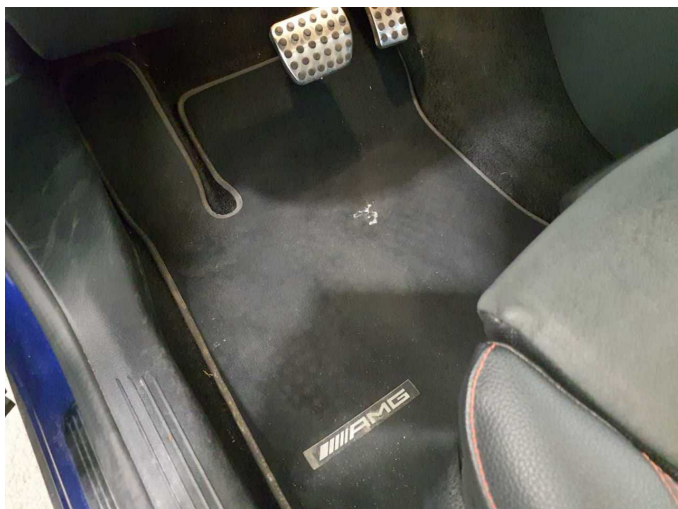

Wear and tear 1: Trim / covers: Floor mats - Holes - No deduction

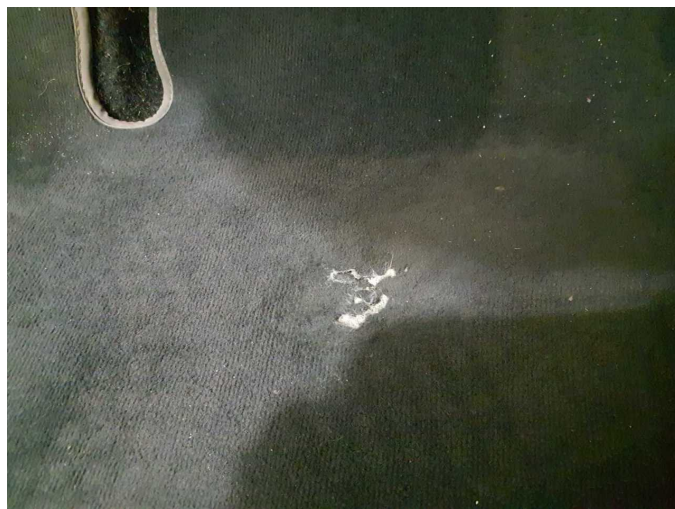

Wear and tear 1: Trim / covers: Floor mats - Holes - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N4M1EB3PW272533

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLB 220 d 8G-DCT AMG
Line

Datum	KM-Stand	Beschreibung
01.06.2026	156.443	Bremsentest; Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremssattel ern/inst; Systemtest/Eigendiagnose
23.01.2026	143.188	Reparatur Sonstiges
21.01.2026	143.188	Bremsinspektion vo + hi; Regelwartungsdienst
19.01.2026	143.168	Systemtest/Eigendiagnose
02.07.2025	118.604	Regelwartungsdienst
31.03.2025	106.486	Bremsinspektion vo + hi
20.11.2024	87.841	Regelwartungsdienst
17.04.2024	60.160	Bremsinspektion vo + hi; Regelwartungsdienst
04.09.2023	29.664	Regelwartungsdienst