



Expertise

Protocol number: 46380454  
Order No. / Reference: 26345381-1  
Inspection date: 7 Jul 2026

Manufacturer: Mercedes-Benz  
VIN: W1N2539531V282007

Model: GLC 300 e 4Matic 9G-TRONIC



| Vehicle details                          |                       |
|------------------------------------------|-----------------------|
| Manufacturer / Type / Model / Equipment  |                       |
| Mercedes-Benz GLC 300 e 4Matic 9G-TRONIC |                       |
| Vehicle Identification number            | W1N2539531V282007     |
| Mileage (Read)                           | 76,165 km             |
| First registration                       | 14 Jan 2021           |
| Number of holders                        | 1                     |
| Next periodical technical inspection     | 04/2028               |
| (Report on hand)                         |                       |
| Power / Engine displacement              | 155 kw / 1,991 ccm    |
| Fuel type / Cylinder                     | Hybr.B/E ext.aufl / 4 |
| Gearbox / Number of gears                | Automatic / 9         |
| Type of drive                            | All-wheel drive       |
| Type of vehicle                          | SUV                   |
| Colour / colour code                     | Polarweiss            |
| Doors / Seats                            | 5 / 5                 |
| Upholstery type                          | Artificial leather    |
| Colour of upholstery                     | Black                 |



## Vehicle details

|                                                  |                               |                                |                                                            |
|--------------------------------------------------|-------------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>               | digital evidence / incomplete | <b>Next maintenance in</b>     | -11 Tag(e)                                                 |
| <b>Last service on / at</b>                      | 05/2025 at 71,842 km          |                                |                                                            |
| <b>Key is / should be</b>                        | 2 / 2                         | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                  |                               | <b>Letter No.</b>              | FX743295                                                   |
| <b>Previous damage / Accident</b>                | None detectable               | <b>Repainting</b>              | None detectable                                            |
| <b>Inspection conditions</b>                     | sufficient                    | <b>Lifting equipment / pit</b> | No                                                         |
| <b>Test drive</b>                                | Not performed                 | <b>Engine function test</b>    | Performed                                                  |
| <b>Manufacturer key number/ type code number</b> | 2222 / AKU 00025              |                                |                                                            |
| <b>Emission standard</b>                         | EURO6;WLTP;AP;PI/CI; M, N1 I  | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                    | 2,615 kg                      | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 235/60 R18 103H | Winter tyres on Light alloy | Bridgestone  | 5mm / 5mm   |
| 2) | 235/60 R18 103H | Winter tyres on Light alloy | Bridgestone  | 4mm / 4mm   |

### Additional tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 235/60 R18 103W | Summer tyres on Light alloy | Bridgestone  | 5mm / 5mm   |
| 2) | 235/60 R18 103W | Summer tyres on Light alloy | Bridgestone  | 5mm / 5mm   |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

## Equipment

### Standard equipment

- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- 4MATIC all-wheel drive
- ATTENTION ASSIST
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Roof rails in polished aluminum
- Third brake light in LED technology
- EASY-Pack cargo cover (removable)
- Driving light assistant
- Electric windows (4-way)
- Velour floor mats in interior color
- Rear window heated
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control with 2 climate zones
- Communication module (LTE) for the use of Mercedes me connect services
- Paint finish: Solid
- LED High Performance Headlights
- Steering column mechanically adjustable in height and length
- Navigation accessories: Extended MBUX functions
- Package: Storage
- Package: Interior light
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Remote Services Plus
- Windscreen wipers with rain sensor
- Seats: Rear seat backrests foldable
- Seats: Front seats electrically adjustable
- High-visibility vest for drivers
- Central locking
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Acoustic environmental protection
- Anti-lock braking system (ABS)
- Automatic passenger airbag deactivation
- On-board computer
- Brake system with larger brake discs on the front axle
- Tachometer
- DYNAMIC SELECT
- Electronic Stability Program (ESP)
- Chassis with higher ground clearance
- electric parking brake
- Transmission: 9G-TRONIC
- rear window wiper
- KEYLESS-GO start function
- Remote trunk lid release
- Instrument cluster with 2 tubular round instruments, 13.97 cm (5.5") multifunction display
- Headrests 5-way
- Charging system: AC on-board charger (AC charging)
- Steering wheel: Multifunction sports steering wheel in 3-spoke design in black leather
- Mercedes-Benz emergency call system
- Otto particulate filter
- Package: Chrome
- Upholstery: Aberdeen fabric, black
- Radio accessories: Digital radio
- Tire pressure monitoring system (TPMS)
- Wheels: 45.7 cm (18") alloy wheels, 4-spoke design
- Power steering
- Seats: i-Size child restraint system on the outer rear seats
- Cruise control
- Immobiliser
- Decorative elements: piano black finish



## Extra equipment

- Head-up display
- Charging cable for household socket, 5m, smooth (This charging cable, also called Mode 2 cable, allows you to charge the vehicle battery at the household socket with up to 2.3 kW (230 V, 1-phase, 10 A) and fits sockets of type E/F CEE 7/7.)
- Navigation accessories: Pre-installation for Live Traffic Information (With Live Traffic Information, your navigation system receives real-time traffic data and optimizes dynamic route guidance. Thanks to precise and up-to-date information on traffic jams, stop-and-go traffic, and more, you are supported in reducing travel times.)
- Package: High End Assistance (Mirror package: Electrically folding exterior mirrors, lowering right exterior mirror, automatic dimming function; Driving assistance package: Active Distance Assist DISTRONIC, Active Steering Assist, Active Brake Assist, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, PRE-SAFE PLUS)
- Package: High-end infotainment (Media display with touch operation, smartphone integration: Apple CarPlay and Android Auto, connectivity package, navigation, traffic sign assistant: thanks to intelligent linking of camera and map data, it can recognize not only speed limits, no-overtaking zones and their cancellation, but also MBUX augmented reality for navigation, fully digital instrument display, wireless charging system for mobile devices in the storage compartment)
- Package: OFF-ROAD Exterior (lower part of the front bumper silver-chromed, radiator grille with chrome trim strips, 45.7 cm (18") 5-spoke alloy wheels painted tremolite grey and polished with 235/60 R 18 tires on 8 J x 18 ET 38 rims, suspension with increased ground clearance, front bumper with increased approach angle)
- Wheels: 45.7 cm (18") alloy wheels, 4-spoke design (tremolite grey painted and polished with 235/60 R18 tires, 8 J x 18 ET 38)
- Decorative elements: open-pored brown ash wood
- Paint finish: Special paint finish, solid color
- Charging cable for wallbox and public charging stations, 8m, smooth (This charging cable, also called Mode 3 cable, allows you to charge the vehicle battery at the wallbox or at public charging stations with up to 7.4 kW (Type 2, 3-phase, 20 A).)
- Package: Advanced Comfort (Seat heating for driver and front passenger, driver's seat electrically adjustable with memory function, front right seat electrically adjustable with memory function)
- Package: Business (for plug-in hybrid vehicles) (Advanced Parking Package: Active Parking Assist PARKTRONIC with reversing camera; Advanced Infotainment Package: Media display with touch operation, smartphone integration - Apple CarPlay and Android Auto, connectivity package navigation, traffic sign assist; Comfort Package: Heated seats for driver and front passenger, seat comfort package - electric and manual adjustment options for the front seats)
- Package: High-end light
- Package: High End Park (Parking package with 360° camera, Active Parking Assist with PARKTRONIC)
- Package: KEYLESS-GO Comfort (vehicle key with KEYLESS-GO functionality - KEYLESS-GO access and drive authorization system - start/stop button - comfort opening and closing - door handles with chrome inlay - HANDS-FREE ACCESS - handle recess lighting - remote trunk lid closing - EASY-PACK trunk lid)
- Package: Public Charging (includes the Mercedes me Charge service and the Mode 3 charging cable)
- Panoramic sunroof
- Upholstery: ARTICO man-made leather
- Remote and Charging Services Plus (The Remote and Charging Services Plus package connects you to the vehicle. You can locate it if desired and remotely control selected functions. With Mercedes me Charge, you can charge your vehicle at many public charging stations with maximum cost transparency. You only need to register once and receive a single, centralized bill.)

## Brief expert findings

|                      |                                                                                                                                                                                                                                               |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)                                                                  |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.                                                                     |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent. |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                                                                                         |
| Engine function test | An engine test run was performed.                                                                                                                                                                                                             |



## Value reducing factors

| No. | Component group | Description                                                                                       |
|-----|-----------------|---------------------------------------------------------------------------------------------------|
| 1   | Misc.           | Inspection / maintenance (Nachweis unvollständig, Service A7 fällig) - No evidence - No deduction |
| 2   | 2nd wheel set   | 1 alloy rim - Scratched - Loss in value                                                           |
| 3   | Misc.           | Inspection / maintenance - Due - Perform                                                          |
| 4   | Rear bumper     | Rear bumper - Scratched - Repair and paint                                                        |

## Wear and tear

| No. | Component group | Description                               |
|-----|-----------------|-------------------------------------------|
| 1   | Front bumper    | Front bumper - Stone chips - No deduction |
| 2   | Bonnet          | Bonnet - Stone chips - No deduction       |
| 3   | Vehicle glazing | Windscreen - Stone chips - No deduction   |
| 4   | Interior        | Interior - Soiled - No deduction          |

The vehicle shows signs of wear and tear commensurate with its age and use.

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



## Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.
- Der angegebene Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

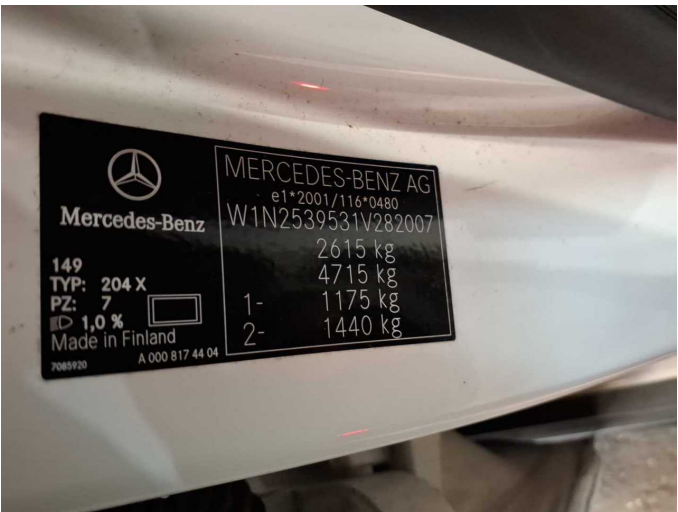


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

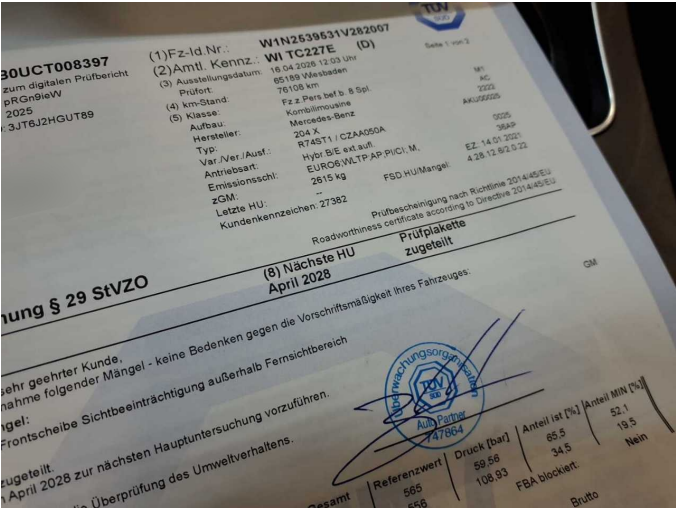


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation

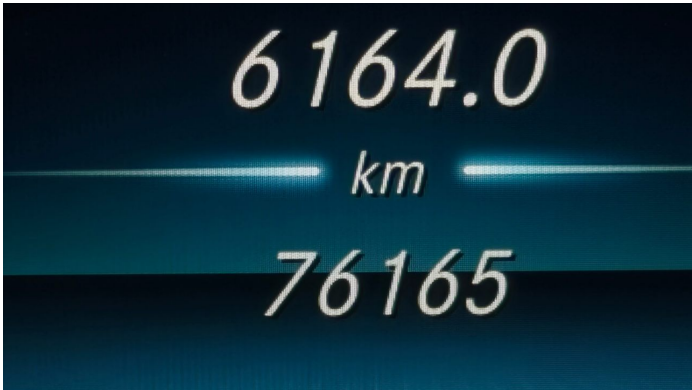


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



**Figure 25:** Misc.



**Figure 26:** Misc.



**Figure 27:** Misc.



**Damage 2:** 2nd wheel set: 1 alloy rim - Scratched - Loss in value



**Damage 2:** 2nd wheel set: 1 alloy rim - Scratched - Loss in value



**Damage 2:** 2nd wheel set: 1 alloy rim - Scratched - Loss in value



**Damage 3:** Misc.: Inspection / maintenance - Due - Perform



**Damage 4:** Rear bumper: Rear bumper - Scratched - Repair and paint



**Damage 4:** Rear bumper: Rear bumper - Scratched - Repair and paint