



RENAULT CLIO: GK-345-LR

Vinnumber:	VF1RJA00269640255	Versionname:	RENAULT CLIO Business E-Tech hybride 140 -21N VP [5P] bva 6-140CH-5cv (bi-corps)
First Registrationdate:	9/11/2022	Fiscalpower:	
Expertise Mileage:	110293	Power Kw:	103
Bodytype:	Berline	Body colour:	White
Gearbox:	Automatic	Paint type:	Opaque
Transmission:	Front	Interior colour:	Anthracite
Fueltype:	Hybrid	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Anthracite
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Steel		
Category:	Passenger Car		

Options

Number of keys total	1	Radio	
Number keys remote	1	Headlights Xenon/LED/Laser	
GPS big screen color		Rear parking sensors	
Windows electric F		Seat cover lining	Lining Other
Cruise Control			
Steering wheel multifunctional			
Steering wheel leather			
Type of climate control	Manual climate control		

Tyres

	195/55/16/87 H			
Summer tyres:	Fr.L.	Continental: 25%	Fr.R.	Continental: 30%
	Re.L.	Continental: 30%	Re.R.	Continental: 30%
Tyre profile depth FL	6.7			
Tyre profile depth FR	6.3			
Tyre profile depth RL	6.1			
Tyre profile depth RR	6.2			
Tyre size FL	195/55 R 16 87 H			
Tyre size FR	195/55 R 16 87 H			
Tyre size RL	195/55 R 16 87 H			
Tyre size RR	195/55 R 16 87 H			
Tyre type FL	Summer			
Tyre type FR	Summer			
Tyre type RL	Summer			
Tyre type RR	Summer			
Tyre make FL	256			
Tyre make FR	256			
Tyre make RL	256			
Tyre make RR	256			

Assistance equipment

Remote ignition key, Missing, Repair/replace (lump sum)



Interior, Stain, Cleaning



Door panel FR, Scratch(es), Replace



Armrest F M, Broken, Replace



Wheel cover RR, Missing, Replace



Outside rear-view mirror housing L, Scratch(es), Polish



Door FL, Scratch(es), Paint



Outer door handle FL, Incomplete, Replace



Bumper F, Scratch(es), Paint



Bumper R, Deformed / Strained, Replace and paint



Tailgate / Boot, Dent(s), Repair and paint (complete)



Luggage compartment cover, Missing, Replace




Rear roof pillar covering L, Broken, Replace



Rear roof pillar covering R, Broken, Replace



Rear bulkhead lining, Scratch(es), Replace

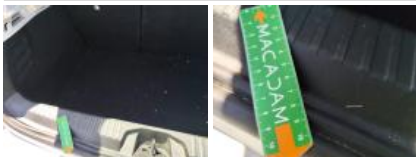

Bodywork, Not original part, Sticker removal small



Historique Maintenance

Immatriculation: **GK-345-LR** Date de 1ère immatriculation: **09/11/2022**

Modèle: **Renault CLIO Business E-Tech hybride 140 -21N VP [5P] bva 6-140CH-5cv (bi-corps)**

Date	Kilométrage	Fournisseur	Descriptif
07/04/2026	103.566	FLEET SOLUTIONS FRANCE	GARDIENNAGE
	0		GARDIENNAGE
02/04/2026	103.562	FLEET SOLUTIONS FRANCE	PERMUTATIONS PNEUS
	0		PERMUTATIONS PNEUS
	0		PERMUTATIONS PNEUS
	0		PERMUTATIONS PNEUS
11/02/2026	97.438	FLEET SOLUTIONS FRANCE	REPLACEMENT PNEUS HIVER
	0		GARDIENNAGE
09/12/2025	95.865	CONTITRADE FRANCE	REPLACEMENT PNEUS ETE
24/07/2025	87.949	TOULON SERVICES AUTOMOBILES	DISQUES PLAQUETTES AV RPLT
	0		BALAI ESSUIE GLACE AR
	0		BALAI ESSUIE GLACE AV
	0		REVISION
24/07/2025	87.949	TOULON SERVICES AUTOMOBILES	JANTE RPLT
	0		POSE EQUILIBRAGE ROUES
12/06/2025	82.702	EUROFLEET TYRES AND SERVICES	REPLACEMENT PNEUS ETE
12/06/2025	82.702	EUROFLEET TYRES AND SERVICES	GEOMETRIE CTRL
07/11/2024	61.751	TOULON SERVICES AUTOMOBILES	PLAQUETTES AV RPLT
	0		REVISION ET CLIM ET AIR ET BOUGIES
23/05/2024	52.032	EUROFLEET TYRES AND SERVICES	REPARATION DE ROUE
31/10/2023	31.485	AUTO CHALLENGE	REVISION ET CLIM
	0		RECYCLAGE
06/09/2023	24.644	EUROFLEET TYRES AND SERVICES	REPLACEMENT PNEUS ETE