



Expertise

Protocol number: 46475470
Order No. / Reference: 26572969
Inspection date: 13 Jul 2026

Manufacturer: Volkswagen

Model: ID. BUZZ PRO LR

VIN: WV2ZZZEB0SH042766



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen ID. BUZZ PRO LR	
Vehicle Identification number	WV2ZZZEB0SH042766
Mileage (Read)	18,176 km
First registration	10 Jun 2025
Number of holders	1
Next periodical technical inspection	06/2028
(Report not on hand)	
Power / Engine displacement	89 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	Van
Colour / colour code	Candy-Weiß/Starlight Blue Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Grey-White
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	375 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HJ798682
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0603 / CVG 00011		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	3,125 kg	Empty weight	
Dimensions	4962 x 1985 x 1907		

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R20 104T	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	265/45 R20 108T	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103T	Winter tyres on Light alloy	Goodyear	7mm / 7mm
2)	255/55 R18 105T	Winter tyres on Light alloy	Goodyear	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Distraction and fatigue detection
- Airbag for driver and front passenger
- Armrests for front seats (inside)
- Evasive steering assist and turn assist
- Exterior mirrors, driver's side convex, passenger's side convex
- Battery (58 Ah/340 A)
- On-board tools and tire mobility set
- CCS charging socket
- Design badges for the D-pillar in black and white
- Three-point automatic seat belts at the front with belt and end fitting tensioners and height adjustment
- Black trim around the central controls
- Single-tone signal horn
- ESP
- Window: Rear window
- Window: Fixed side window in the passenger compartment, front right
- Electric windows, front
- Total weight: Permissible total weight 3,125 kg
- Transmission: Direct drive, 1-speed
- Tailgate closing without interior unlocking function
- Interior lighting in the front and rear footwells
- Intelligent Speed Assist including speed limiter
- Air conditioning system "Air Care Climatronic" with active combination filter
- Mode 3 Type 2 charging cable, 16 A
- LED taillights
- Steering wheel: Multifunction steering wheel with touch controls
- Multifunctional camera
- Emergency braking assistant "Front Assist"
- exhaust
- Proactive occupant protection system in conjunction with "Front Assist"
- Radio: Diversity antenna for FM reception
- Radio accessories: 2 USB-C ports in the dashboard and 1 USB-C charging port for the passenger.
- Legal transactions
- Wheels/Tires: Tire pressure monitoring system
- Wheels/Tires: 18" steel wheels in black
- Rear seat bench and backrest can be folded down in a split configuration
- Sliding door, left side in the passenger/cargo area
- Keys for locking system: 2 vehicle keys
- Seatbelt check
- Seats on the left and right, in the first row
- Sun visors with mirrors, illuminated
- Bumpers in body color
- Telephone: Mobile phone interface with inductive charging function
- Rear drum brakes 13", with electric parking brake
- First aid kit, warning triangle and high-visibility vest
- ABS
- Airbag: Side and head airbags for driver and front passenger
- Electrically adjustable and heated exterior mirrors
- Exterior mirror housings in black and door handles in body color
- Operating voltage 12 V
- third brake light
- DC/DC converter 3.0 KW
- Three-point automatic seat belts, rear outer seats, with ECE label
- e-Sound
- Parking aid - warning signals for obstacles in the front and rear area
- Chassis: Rear damping
- Window: Fixed side window in the passenger compartment, front left
- Windows: Green heat-insulating glass
- Windscreen in heat-insulating glass
- Cruise control system in conjunction with online services
- Tailgate with window cutout
- Rear window wiper/washer system with intermittent function
- ISOFIX and Top Tether child seat anchorages for seats in the passenger compartment
- Headrests (5)
- LED luggage compartment lighting
- LED headlights
- Headlight range control
- Left-hand drive
- Non-smoking version
- eCall emergency call system
- Upholstery: Cloth
- Radio: App-Connect incl. App-Connect Wireless
- Radio: Digital radio reception (DAB+)
- Radio: "Ready 2 Discover" radio with 32.8 cm (12.9-inch) color touchscreen
- Radio accessories: 9 speakers (5 front speakers and 4 rear speakers)
- Wheels/Tires: 18" tires
- Wheels/Tires: Full wheel covers in bicolor (black/silver)
- 18" front disc brakes
- Windscreen wiper intermittent control
- Sliding door, on the right in the passenger/cargo area
- Speed-sensitive power steering (Servotronic)
- dimmable interior safety mirror
- Seats: Height adjustment for both front seats, manual
- Lane keeping assistant "Lane Assist"
- Phone: Car2X
- Carpet flooring (Dilours), reinforced
- Traction control
- Door trim in plastic with insert, armrest in fabric
- Traffic sign recognition
- Prepared for We Connect (Plus) or VW Connect (Plus); online update capability
- Electronic immobilizer



- Prepared for later activation: "Discover Pro" navigation function
- Preparation Alcohol Interlock
- Central locking with keyless start system "Keyless Start" without safe locking

Extra equipment

- Towbar, foldable (with electric release)
- Premium Style "Plus" interior with black steering wheel in V with comfort package (electrically adjustable front seats with memory function, reinforced carpet, leather multifunction steering wheel with touch controls, heated, comfort seats left/right, front, armrests for both front seats, adjustable lumbar support, massage function, 30-color ambient lighting, black trim around infotainment display and controls, plastic door panels with inserts, leatherette armrests, individually adjustable front seat heating, ArtVelours Eco microfleece seat centers in the front and rear seats)
- Package: Design Package "Plus" (illuminated strip between the headlights - stainless steel pedals in "Play/Pause" design - Dynamic Light Assist high beam control for LED matrix headlights - IQ.LIGHT - LED matrix headlights with automatic headlight control, bad weather light, welcome function - dynamic headlight range control with dynamic cornering lights - LED taillights with dynamic turn signals - "Smart Glass" panoramic roof)
- Package: Comfort Package "Plus" (ID. Buzz Box - USB-C - Multifunction leather steering wheel with touch controls, heated - Heated front seats, separately controlled - Automatically dimming rearview mirror - Intermittent windshield wipers with rain sensor - Heated windshield washer nozzles, front - Electrically adjustable, folding, and heated exterior mirrors with passenger-side mirror dipping function - High-gloss black exterior mirror housings, body-colored door handles - Luggage compartment cover - Ambient lighting - 3-zone Air Care Climatronic climate control - Multiflexboard, 2 folding storage boxes - Cargo net partition)
- Heated seats for the front seats and the outer seats
- Power outlet: 12-volt operating voltage and 230-volt socket on the passenger seat frame
- First aid kit, warning triangle and 5 high-visibility vests
- heat pump
- Windows: Front pane made of heat-insulating glass, heated
- Paint finish: Solid/Metallic (two-tone)
- Package: Assistance Package "Plus" including "Travel Assist" and Surround View including reversing camera (Lane Change Assist, Side Assist, Parking Assist, Exit Warning - Driver Assistance Travel Assist, Lane Keeping Assist, Emergency Assist - Surround View including reversing camera - Park Assist Plus with memory function, parking aid - Multifunction leather steering wheel, touch controls, heated - Illuminated door handle recesses - Central locking with keyless entry and start system Keyless Advanced with safe locking - Anti-theft alarm, interior monitoring, backup horn, tow-away protection - ACC Stop&Go)
- Package: Infotainment package "Plus" (IDA voice assistant - "Discover Pro" navigation system - "Harman Kardon" sound system, 12+1 speakers, 700 watts total power, digital 16-channel amplifier, subwoofer - "Comfort" mobile phone interface with inductive charging function - Head-Up Display)
- Package: Open & Close Package "Plus" (illuminated door handle recesses - central locking with keyless locking and starting system "Keyless Advanced" with safe locking - electric tailgate (opening and closing) with "Easy Open" and "Easy Close" function - electric sliding doors left and right with "easy open" and "easy close" function - anti-theft alarm system with interior monitoring, backup horn and tow-away protection - rear approach lighting)
- Wheels/Tires: 20" "Stockton" alloy wheels (4 "Stockton" alloy wheels 8 J x 20 front, 10 J x 20 rear, in silver, with black plastic trim - Airstop tires 235/50 R 20 104 T XL front, Airstop tires 265/45 R 20 108 T XL rear - On-board tools - Black plastic trim - Wheel bolts with enhanced theft protection)
- Laminated safety glass with noise reduction for side windows (rear window and rear side windows tinted)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Electronic systems	Electronic systems (SOS) - Functional / admissibility - Perform diagnosis
2	Side panel - rear right side	Side panel - Scratch(es) - Smart repair

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Für den montierten Radsatz wurde kein Nachweis erbracht.
- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

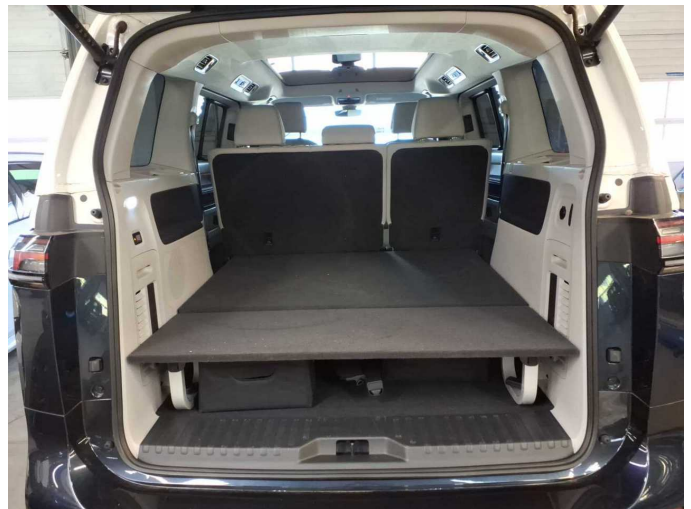


Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres

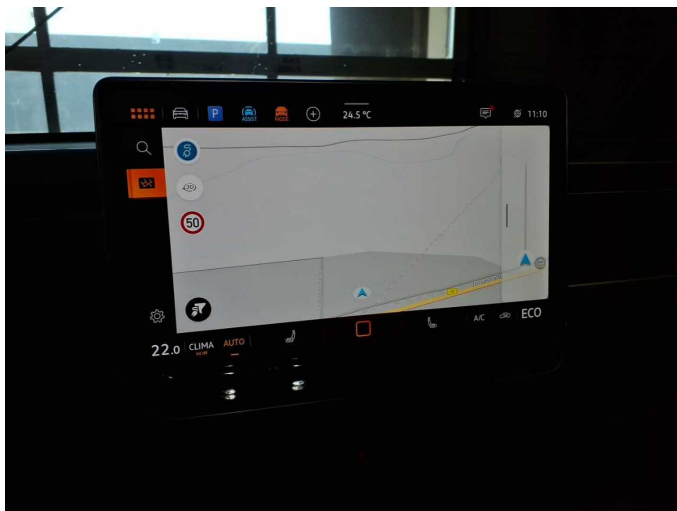


Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.

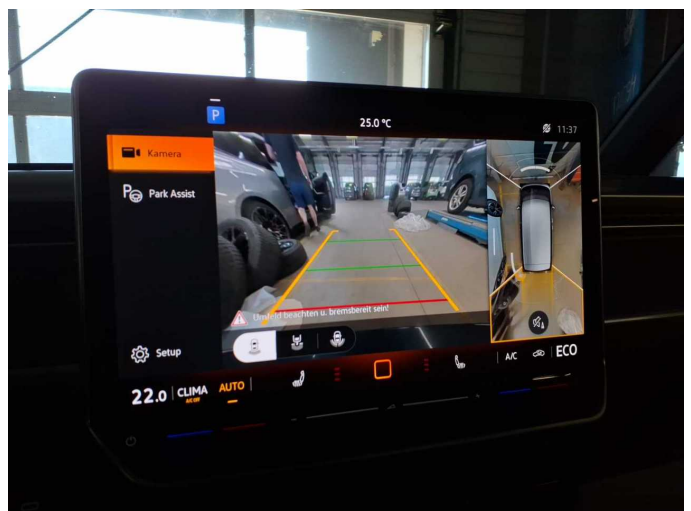


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

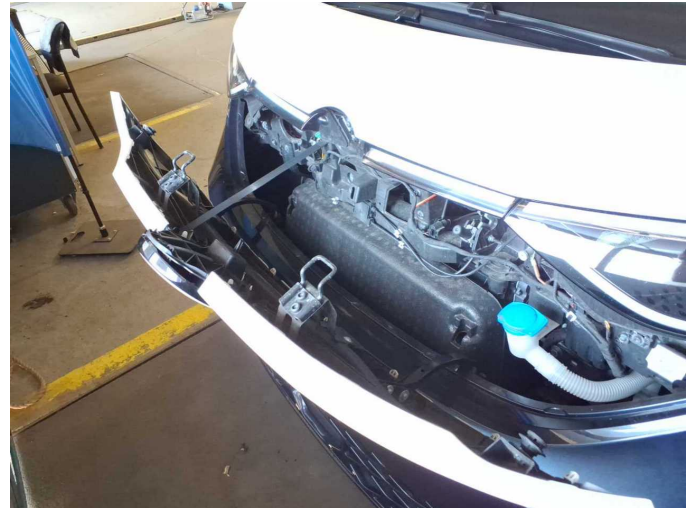



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

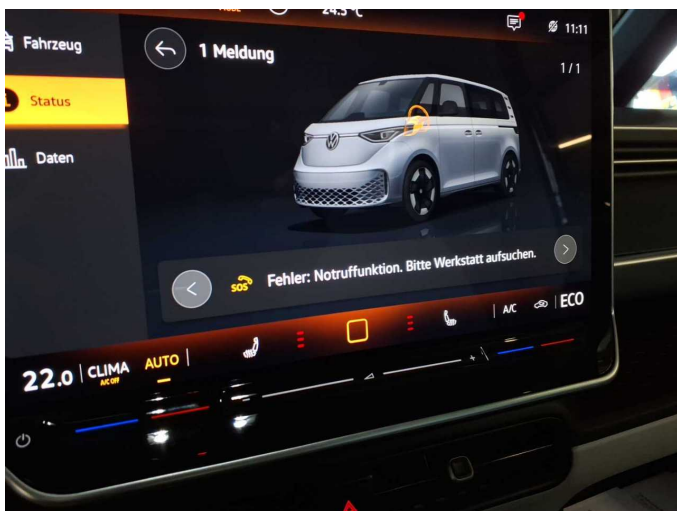

Damage 1: Electronic systems: Electronic systems (SOS) - Functional / admissibility - Perform diagnosis



Damage 2: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 2: Side panel - rear right side: Side panel - Scratch(es) - Smart repair