



Expertise

Protocol number: 46917837
Order No. / Reference: 26754529
Inspection date: 4 Aug 2026

Manufacturer: Volkswagen

Model: Passat Variant 2.0 TDI SCR DSG 4Motion Business

VIN: WVVZZZ3CZPE058034



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Passat Variant 2.0 TDI SCR DSG 4Motion Business	
Vehicle Identification number	WVVZZZ3CZPE058034
Mileage (Read)	108,884 km
First registration	30 May 2023
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	147 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Deep Black Perleffekt (C9X)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Grey-Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	15,700 km
Last service on / at	01/2026 at 94,533 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS542511
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / COP 02559		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,270 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/40 R19 96W	Summer tires (with run-flat tires) on Light alloy	Pirelli	3mm / 3mm
2)	235/40 R19 96W	Summer tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99H	Winter tires (with run-flat tires) on Light alloy	Continental	4mm / 4mm
2)	215/60 R16 99H	Winter tires (with run-flat tires) on Light alloy	Continental	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger (airbag deactivation switch on the passenger side)
- Permanent all-wheel drive
- App-Connect (Volkswagen offers three interfaces for connecting smartphones with numerous possibilities: - Apple CarPlay - Android Auto from Google - MirrorLink)
- Cup holders (2) front
- Hill start assist
- third brake light
- Headliner in Mistral Grey
- Diesel particulate filter
- Parking aid - warning signals for obstacles in the front and rear area
- Electronic stability program and electromechanical brake booster
- Remote release for luggage compartment lid
- Windscreen made of laminated safety glass, heat and sound insulating
- Transmission: 7-speed DSG (7-speed dual-clutch transmission DSG)
- Interior lights with delayed shut-off and dimming function (2 LED reading lights each at the front and rear)
- Air conditioning (with active combination filter)
- Front headrests (safety-optimized, longitudinally and height-adjustable)
- LED headlights with daytime running lights
- Headlight range control
- Front center armrest, height and length adjustable, with storage box (2 rear air vents with chrome slats)
- Fatigue detection (detects signs of possible driver fatigue based on characteristic steering behavior, time of day and driving duration and issues a visual and audible warning)
- Mesh partition
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Package: Light and Sight Package "Plus" (LED lights in the front footwell - Electrically adjustable and heated exterior mirrors, automatically dimming on the driver's side - Entry/warning lights in the front doors, in LED technology - Automatic headlight control, with daytime running lights, "Leaving Home" function and manual "Coming Home" function - Interior light with delayed shut-off and dimming function, 2 LED reading lights each in the front and rear - Automatically dimming interior mirror - Illuminated vanity mirrors - Extendable sun visors - Rain sensor)
- Radio accessories: Digital radio reception DAB+ (reception of digitally broadcast radio stations and traffic information in addition to the analog station offering - reception depends on the local availability of digital networks - expanded range of radio programs - improved reception performance)
- Wheels: AirStop tires 215/55 R 17
- Airbag, head airbag system for front and rear passengers (including front side airbags)
- Anti-lock braking system (ABS)
- Adaptive Cruise Control (ACC) "stop & go", including speed limiter
- Electrically adjustable and heated exterior mirrors, ambient lighting (automatically dimming on the driver's side)
- Chrome trim on the side windows
- black roof rails
- Tachometer
- Entry/warning lights in LED technology in the front doors
- Electronic parking brake including auto-hold function
- Automatic headlight control (with daytime running lights, "Leaving home" function and manual "Coming home" function)
- Pedestrian detection
- Adjustable luggage compartment floor
- Rear window heated
- rear window wiper
- ISOFIX mounting points (for attaching 2 child seats to the rear seats, also for i-Size child seats)
- Rear headrests (3)
- LED fog lights and cornering lights
- LED taillights
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- Multifunction display "Premium" with multi-color display (showing, among other things: - Outside temperature - Average consumption - Average speed - Trip distance - Trip time - Gear recommendation - Speed warning - Comfort - Current consumption - Range - Service - Time with extended display options, e.g.: - Digital speedometer - Digital oil temperature display - Lights & visibility - Language - Auxiliary heater - Winter tires)
- Emergency call service (no registration required, service is activated upon delivery)
- Upholstery: Fabric "Business" (seat center panels of the front seats and the outer rear seats in fabric "Weave")
- Proactive occupant protection system in conjunction with "Front Assist" (detects critical traffic situations with increased accident potential - prepares vehicle occupants and the vehicle for a possible accident by tightening the front, fastened seat belts and securing the driver and front passenger, and closing open windows and the sunroof except for a gap)
- Radio "Composition" (touchscreen with 16.5 cm screen diagonal - 8 speakers - output power 4 x 20 watts - diversity antenna for FM reception - dual tuner - RDS - MP3 playback - USB-C interface - 3-way tone control)
- Tire pressure monitoring system (passive)
- Wheels: 4 "Istanbul" alloy wheels 7 J x 17 (painted in sterling silver)
- Wheels: Tire Mobility Set omitted
- Gearshift knob in leather
- Keyless start system without safe locking



- Rear bench seat undivided, backrest asymmetrically split and foldable, with center armrest (and pass-through option)
- Seat belts: Three-point automatic seat belt (seat belt for middle rear seat - seat belts for outer rear seats - front seat belts with height adjustment and belt tensioner)
- Seats: Front seats are height-adjustable (ergoComfort seat on the driver's side - with electric backrest adjustment)
- 12V power outlet on the rear center console (and in the luggage compartment)
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking with remote control

Extra equipment

- Towbar, foldable (with electric release)
- Paint finish: Pearl effect
- Package: "Business Premium" package incl. navigation (from Business trim level) (2 USB-C ports in the front, USB-C charging socket in the rear, 230V socket, App-Connect incl. wireless, Apple CarPlay, Android Auto, "Travel Assist" driver assistance system and "Lane Assist" lane keeping assist system, Air Care Climatronic with 3-zone temperature control, active combination filter and rear controls, lumbar support in the front, electric on the driver's side, massage function on the driver's side, "Rear View" reversing camera, heated windshield washer nozzles, Comfort telephone interface, inductive charging function, heated front seats)
- Package: R-Line Sport package (progressive steering - rear side windows and rear window tinted, 65% light-absorbing - electronic differential lock XDS - sport suspension, body lowered by approx. 15mm)
- Rear View reversing camera
- "Comfort" telephone interface with inductive charging function (hands-free system)

- Power steering (electromechanical, speed-dependent)
- Seats: Comfort seats in the front
- Seats: Lumbar support in the front (driver's side electrically adjustable)
- Lane Assist (warns with a corrective steering intervention if the vehicle unintentionally leaves the lane)
- Start-stop system (with brake energy recuperation)
- Telephone interface
- Textile floor mats (front and rear)
- Warning tone and light for unfastened seat belts front and rear

- App-Connect Wireless
- Navigation system "Discover Media" incl. "Streaming & Internet" (4x20 watts, user interface with proximity sensor, dual tuner with phase diversity, vehicle menu, speed, volume adjustment, map, 2D display, tone control, 3-way TFT display with touchscreen operation, navigation "Discover Media" incl. "Streaming & Internet", MP3 radio, telephone contact addresses for navigation, telephone interface, 2 USB ports also for iPod/iPhone, traffic sign recognition "VW Media Control", We Connect Plus, 3 years, incl. We Connect route guidance, dynamic RDS, TMC tuner)
- Package: Climate and Energy Package "Rear" (Air Care Climatronic air conditioning with 3-zone temperature control, active combination filter and rear controls - 2 USB-C interfaces in the front, 1 USB-C charging socket on the rear center console, charging power up to 45 W)
- Wheels: 4 alloy wheels 8 J x 19 "Verona" Volkswagen R (AirStop tires 235/40 R 19 - wheel locks with enhanced theft protection)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Screen cleaning	Wiper arm - rear (Inklusive Wischerblatt) - Broken / torn - Replace
3	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
4	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
5	Front bumper	Front bumper - Scratch(es) - Smart repair
6	Door - rear left side	Door - Dent / paintcoat damage - Smart repair
7	Door - rear right side	Door - Dent / paintcoat damage - Smart repair
8	Trim / covers	Door trim - rear left side - Broken / torn - Smart repair
9	Mudguard - right side	Mudguard - right side - Dent / paintcoat damage - Smart repair
10	Side panel - rear right side	Elbow - Dent / paintcoat damage - Smart repair
11	Front structure	Emblem - Broken / torn - Replace
12	Instrument panel	Instrument cluster - Scratch(es) - Loss in value
13	Boot lid / rear door	Boot lid - Scratch(es) - Paint
14	Rear bumper	Rear bumper - Dent / paintcoat damage - Repair and paint
15	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
16	Vehicle glazing	Windscreen (Randbereich) - Stone chips - repair according to calculation
17	Roof	Roof - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Instrument panel	Centre console - front - Soiled - No deduction
2	Wheel / tyres	Alloy rim - front left side - Scratch(es) - No deduction
3	Sill - right side	Trim - Scratch(es) - No deduction
4	2nd wheel set	1 tyre - Damaged - No deduction
5	2nd wheel set	1 tyre - does not meet manufacturer specifications - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

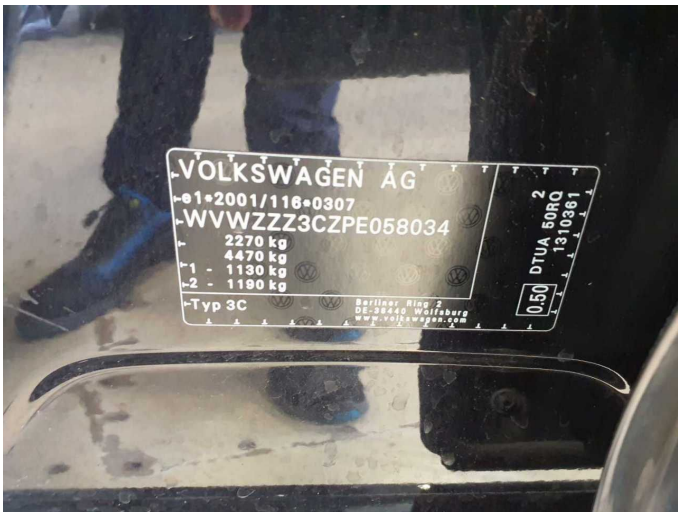


Figure 11: VIN



Figure 12: Mounted tyres

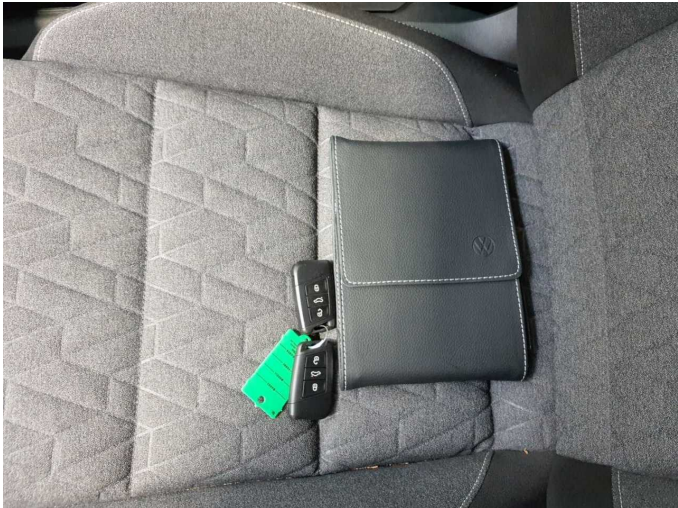


Figure 13: Documents

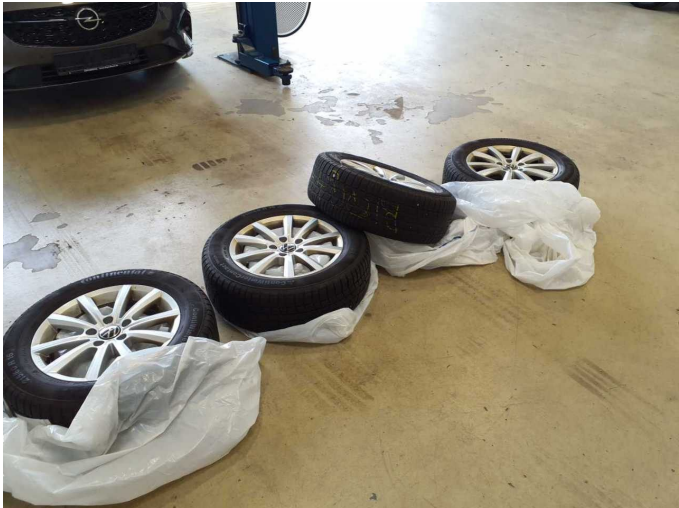


Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

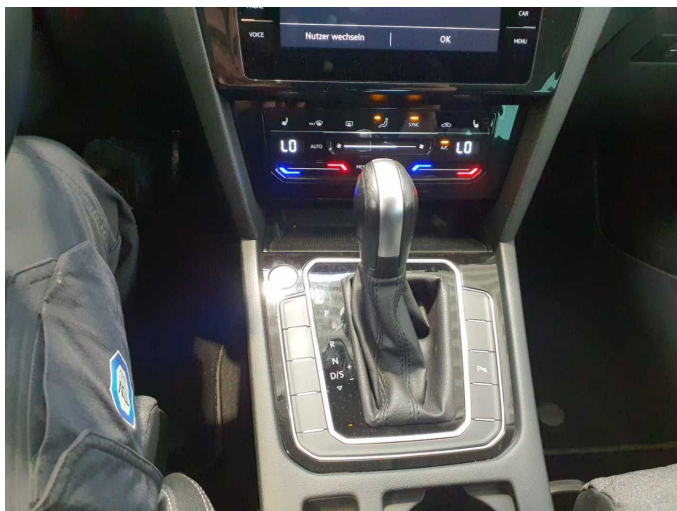


Figure 21: Misc.



Figure 22: Misc.

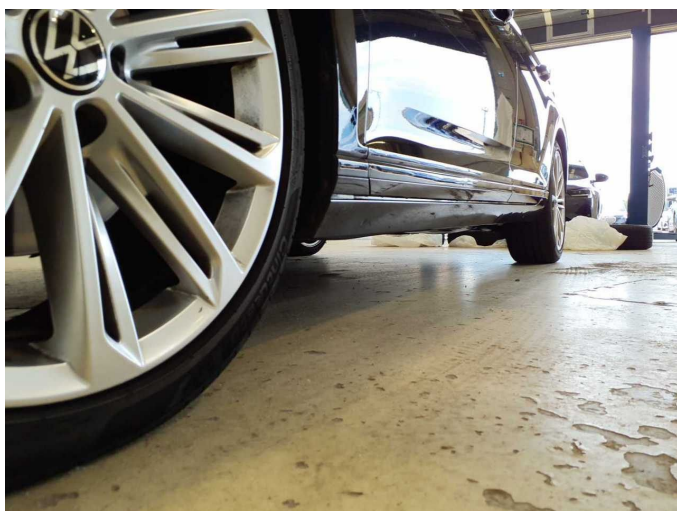


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

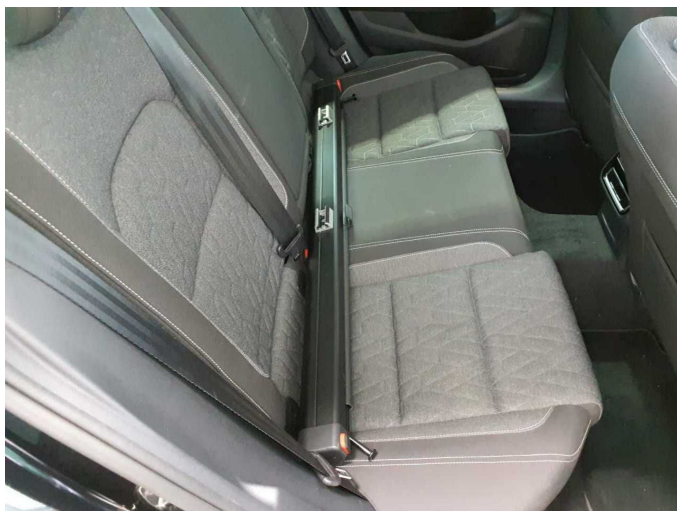


Figure 27: Misc.


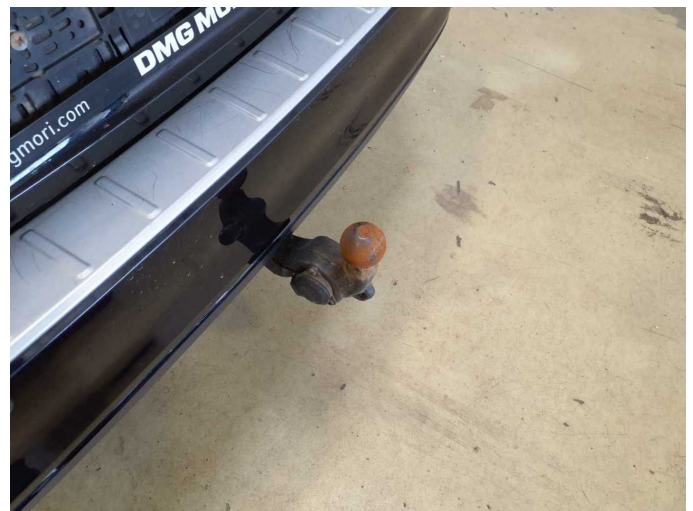


Figure 28: Misc.




Figure 29: Misc.

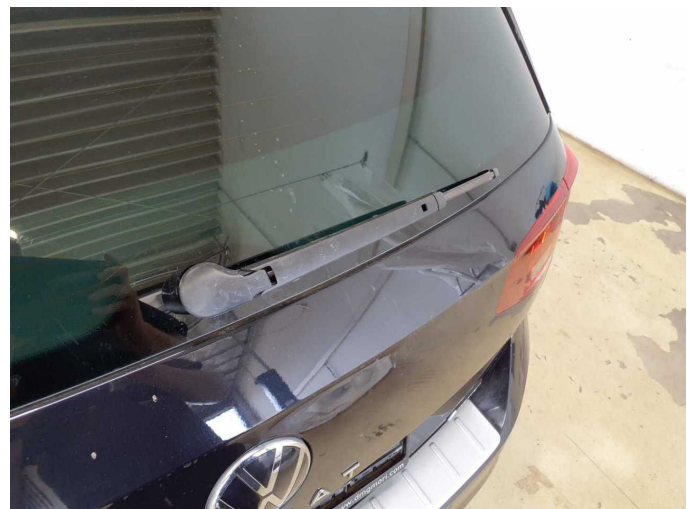


Damage 2: Screen cleaning: Wiper arm - rear (Inklusive Wischerblatt) - Broken / torn - Replace




Damage 2: Screen cleaning: Wiper arm - rear (Inklusive Wischerblatt) - Broken / torn - Replace

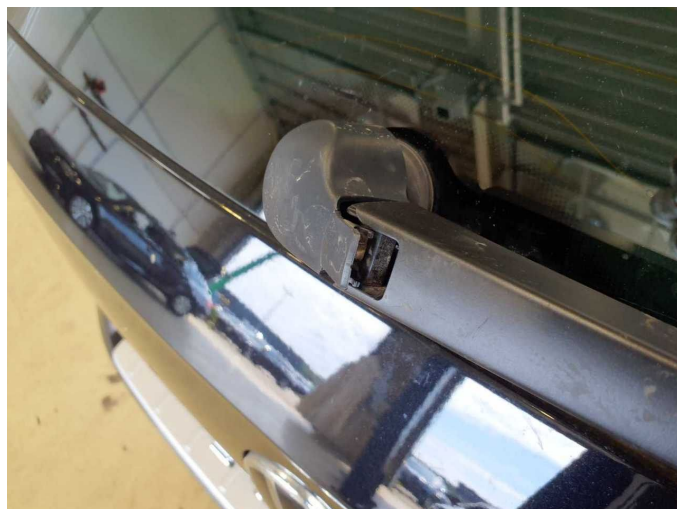


Damage 2: Screen cleaning: Wiper arm - rear (Inklusive Wischerblatt) - Broken / torn - Replace

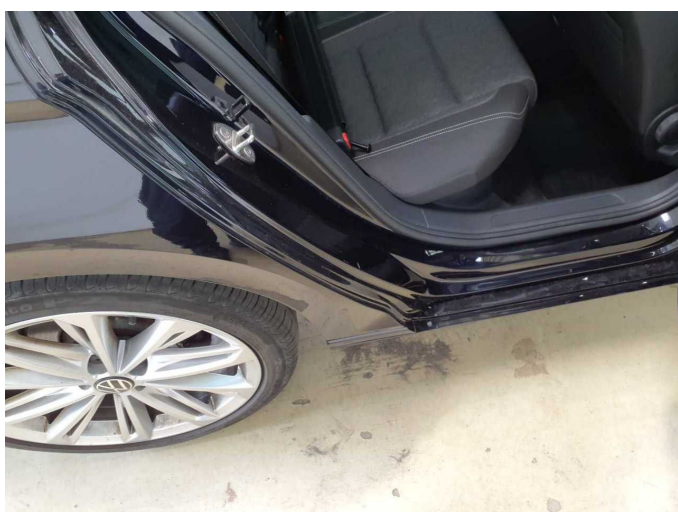

Damage 3: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

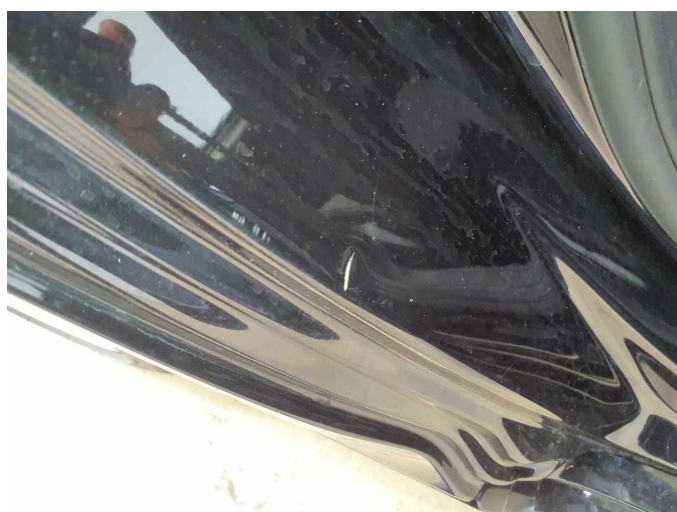


Damage 3: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

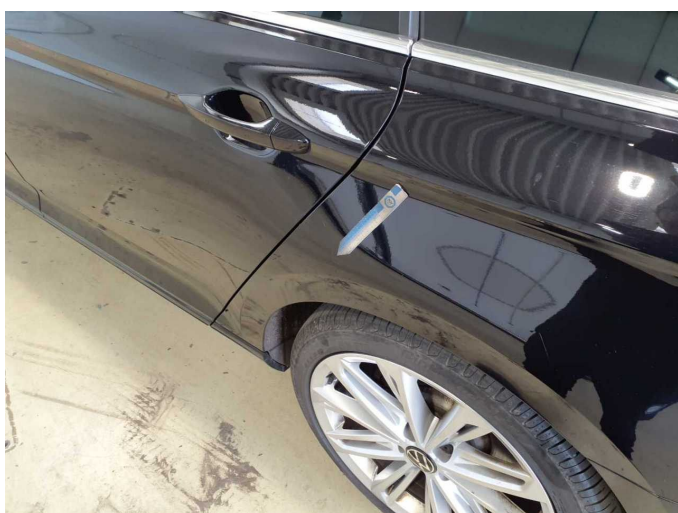


Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

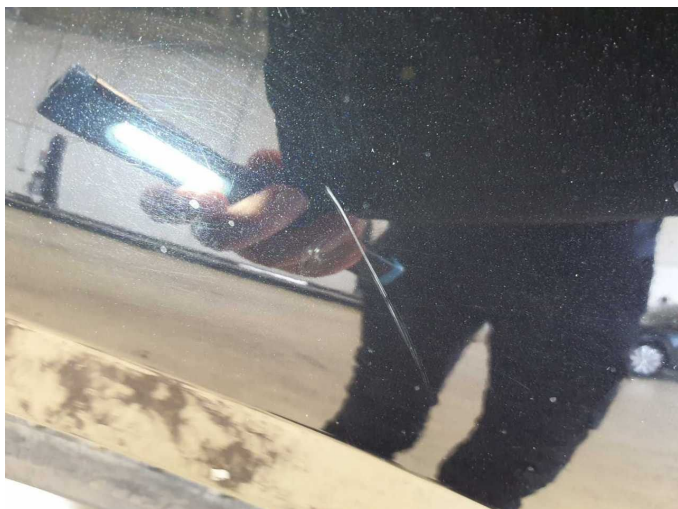

Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

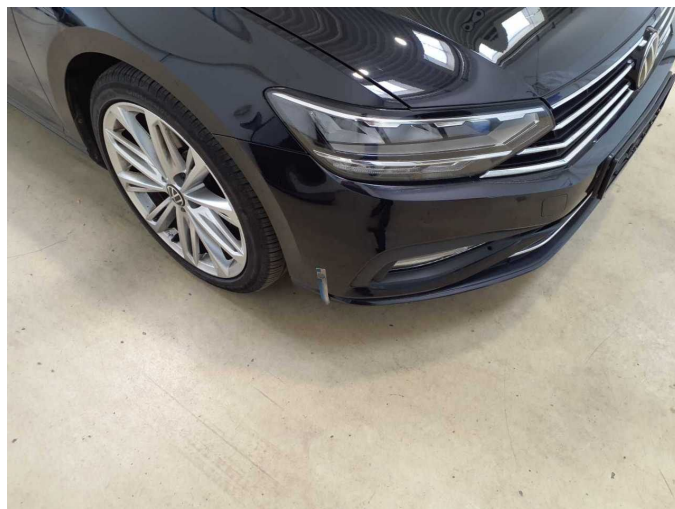


Damage 5: Front bumper: Front bumper - Scratch(es) - Smart repair




Damage 5: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 6: Door - rear left side: Door - Dent / paintcoat damage - Smart repair

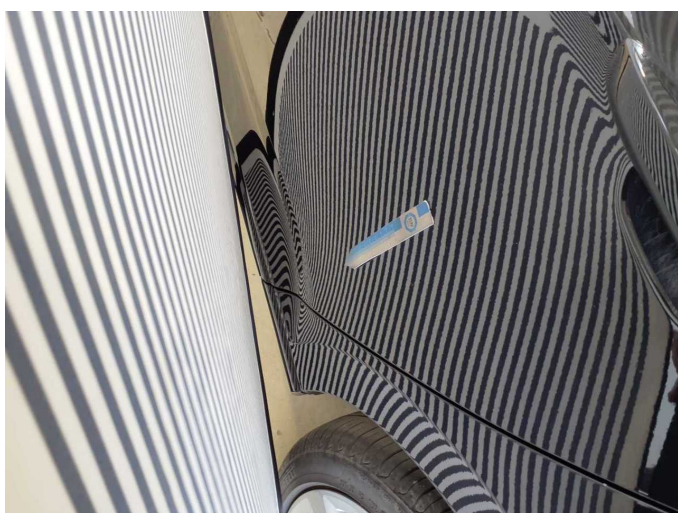


Damage 6: Door - rear left side: Door - Dent / paintcoat damage - Smart repair

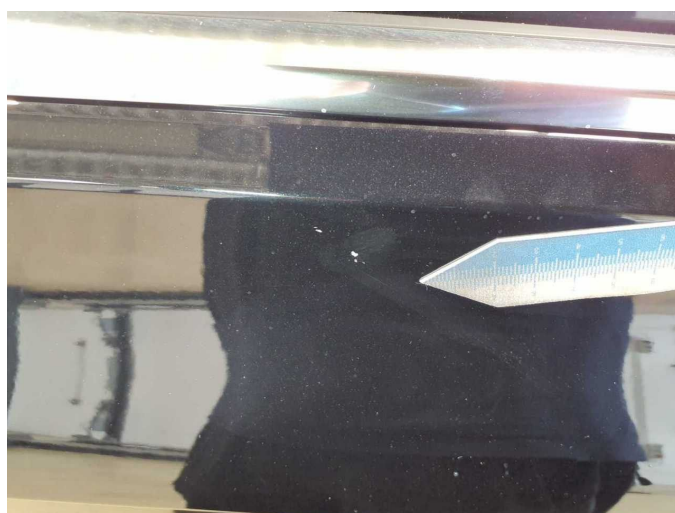

Damage 6: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage 7: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

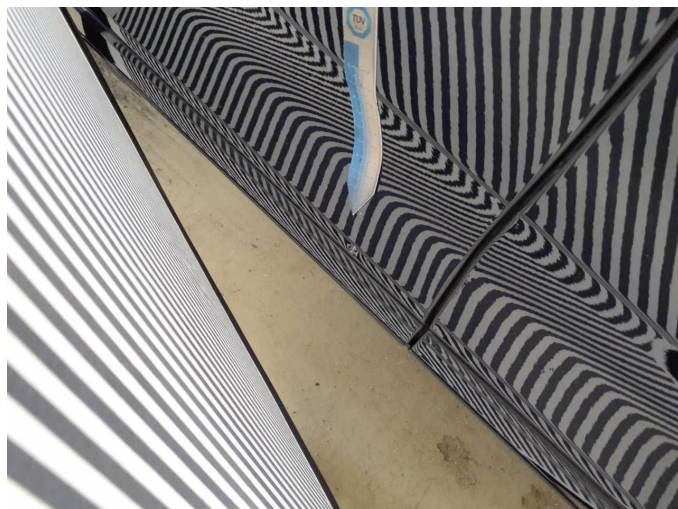


Damage 7: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 7: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 8: Trim / covers: Door trim - rear left side - Broken / torn - Smart repair

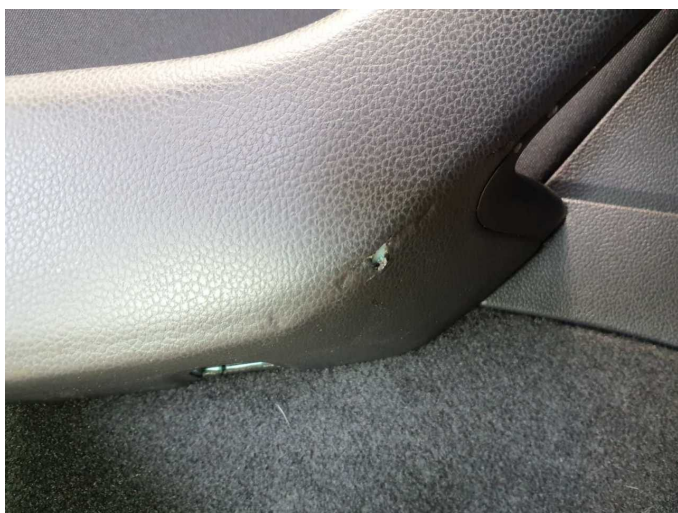

Damage 8: Trim / covers: Door trim - rear left side - Broken / torn - Smart repair



Damage 9: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Smart repair



Damage 9: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Smart repair



Damage 9: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Smart repair




Damage 10: Side panel - rear right side: Elbow - Dent / paintcoat damage - Smart repair



Damage 10: Side panel - rear right side: Elbow - Dent / paintcoat damage - Smart repair



Damage 10: Side panel - rear right side: Elbow - Dent / paintcoat damage - Smart repair

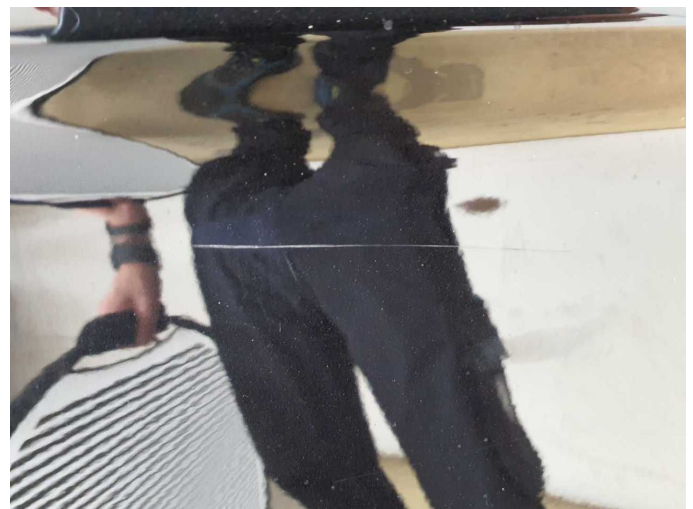

Damage 10: Side panel - rear right side: Elbow - Dent / paintcoat damage - Smart repair



Damage 11: Front structure: Emblem - Broken / torn - Replace




Damage 11: Front structure: Emblem - Broken / torn - Replace



Damage 12: Instrument panel: Instrument cluster - Scratch(es) - Loss in value




Damage 12: Instrument panel: Instrument cluster - Scratch(es) - Loss in value

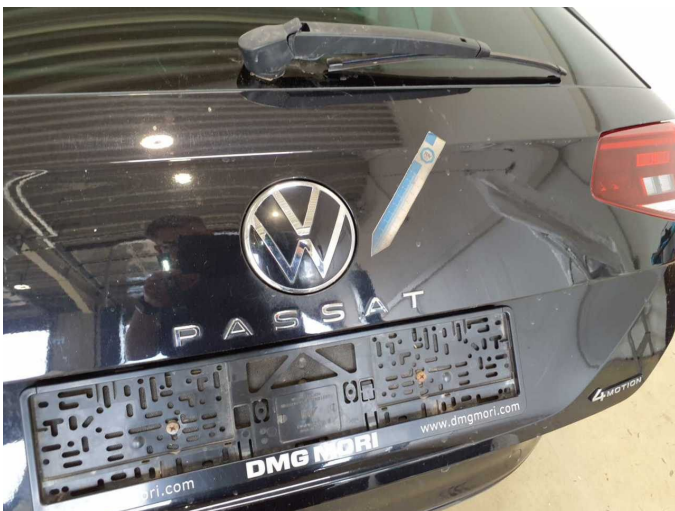


Damage 13: Boot lid / rear door: Boot lid - Scratch(es) - Paint




Damage 13: Boot lid / rear door: Boot lid - Scratch(es) - Paint

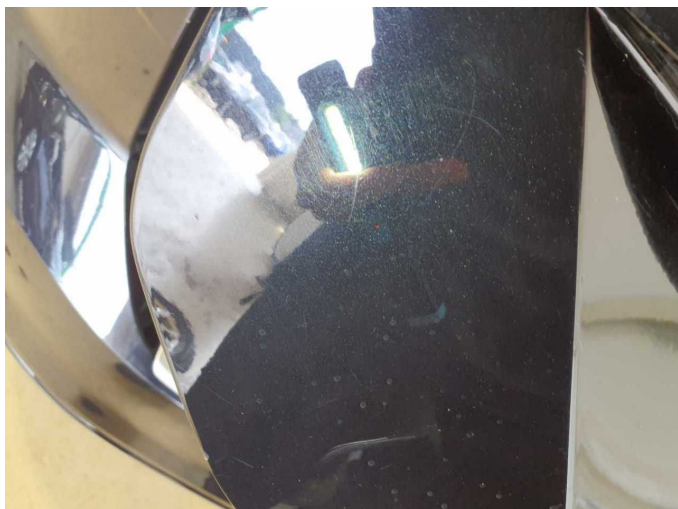


Damage 13: Boot lid / rear door: Boot lid - Scratch(es) - Paint

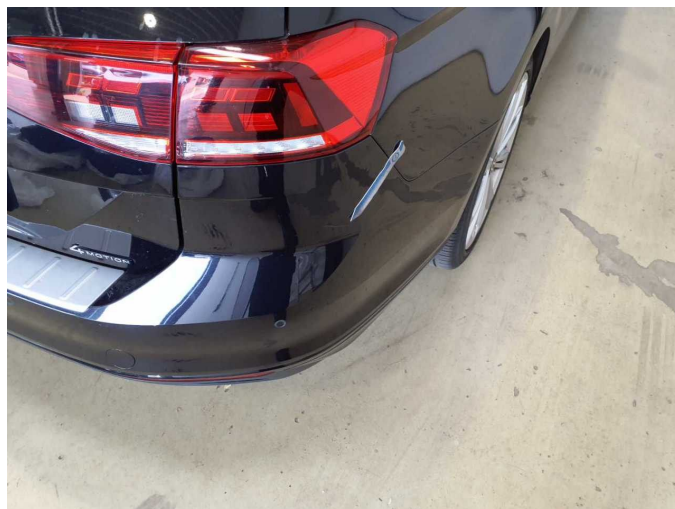

Damage 14: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

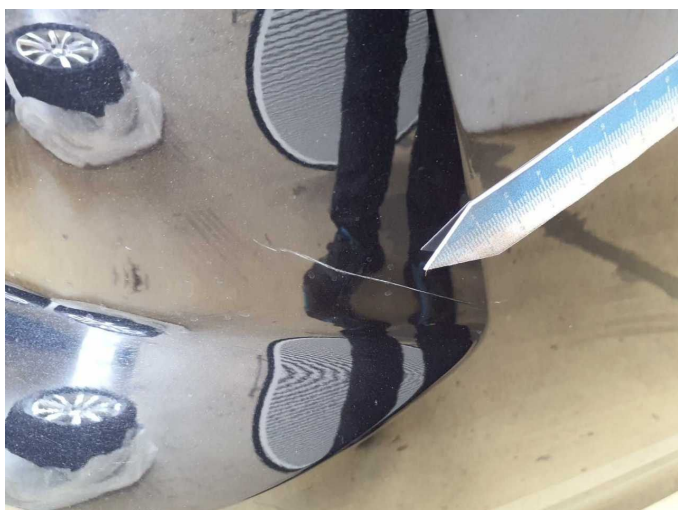

Damage 14: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

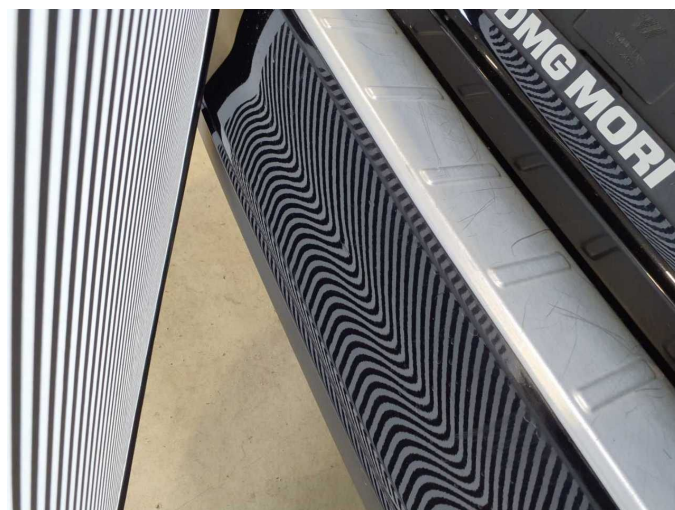

Damage 14: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 14: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 15: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 15: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 15: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 15: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

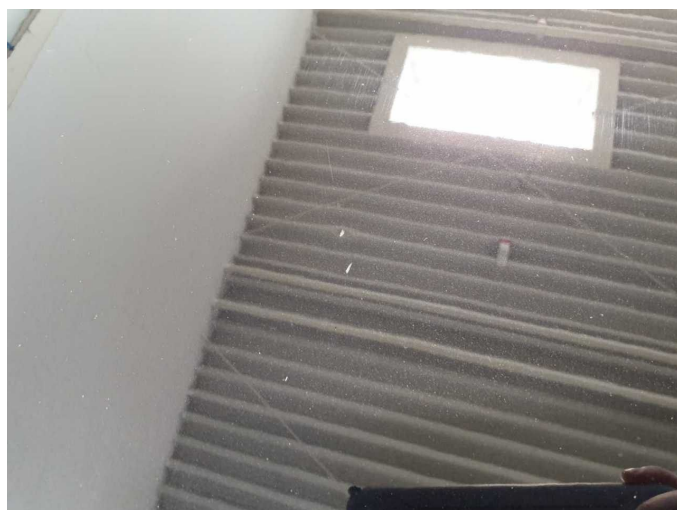


Damage 15: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

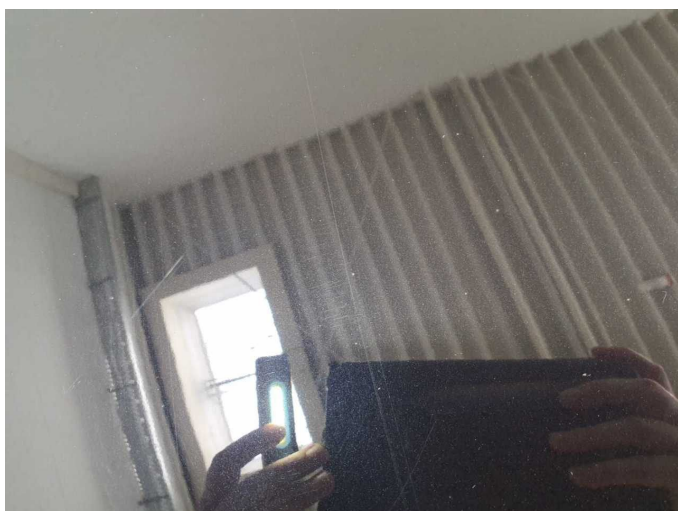

Damage 15: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 16: Vehicle glazing: Windscreen (Randbereich) - Stone chips - repair according to calculation

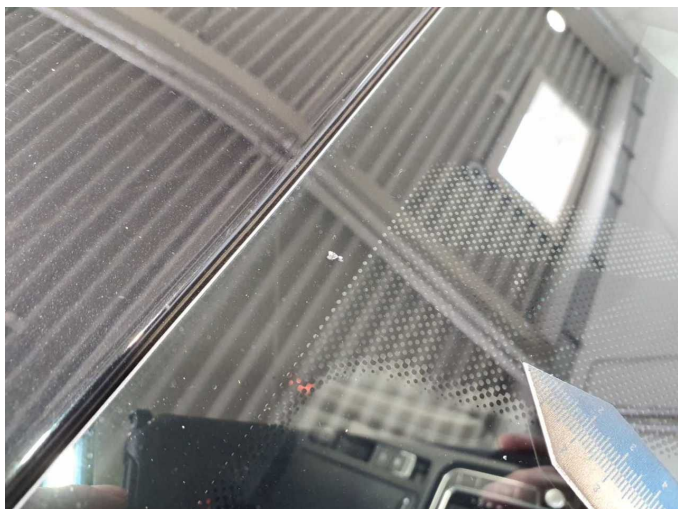

Damage 16: Vehicle glazing: Windscreen (Randbereich) - Stone chips - repair according to calculation



Damage 17: Roof: Roof - Dent / paintcoat damage - Repair and paint

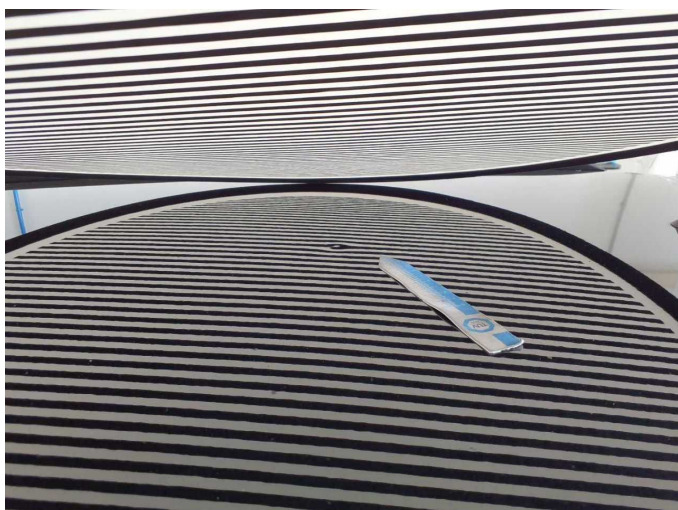

Damage 17: Roof: Roof - Dent / paintcoat damage - Repair and paint



Damage 17: Roof: Roof - Dent / paintcoat damage - Repair and paint



Wear and tear 1: Instrument panel: Centre console - front - Soiled - No deduction



Wear and tear 4: 2nd wheel set: 1 tyre - Damaged - No deduction



Wear and tear 4: 2nd wheel set: 1 tyre - Damaged - No deduction



Wear and tear 5: 2nd wheel set: 1 tyre - does not meet manufacturer specifications - No deduction