



Expertise

Protocol number: 46355924
Order No. / Reference: 26610925
Inspection date: 6 Jul 2026

Manufacturer: Audi
VIN: WAUZZZGY1PA114247

Model: A3 35 TDI Sportback S tronic



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A3 35 TDI Sportback S tronic	
Vehicle Identification number	WAUZZZGY1PA114247
Mileage (Read)	41,614 km
First registration	31 May 2023
Number of holders	1
Next periodical technical inspection	05/2028
(Report not on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Brillantschwarz
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Grey-Black
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	14,500 km
Last service on / at	04/2026 at 41,068 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS562788
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0588 / BZQ 01925		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,965 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91V	Summer tyres on Light alloy	Falken	4mm / 4mm
2)	205/55 R16 91V	Summer tyres on Light alloy	Falken	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Airbag for driver and front passenger (with front passenger airbag deactivation)
- Anti-lock braking system (ABS) (with electronic brake force distribution (EBD), hydraulic brake assist)
- Traction control ASR (prevents wheel spin by reducing engine power, thus providing more stability and improved traction on the road)
- Audi pre sense front (within system limits, uses a front radar to detect the area in front of the vehicle and warns the driver with visual and acoustic signals to indicate a potential hazard from vehicles ahead, whether moving or stationary – pedestrian and cyclist detection registers, within system limits, when a pedestrian or cyclist is moving on or crossing the road. The system then warns the driver with an acoustic and visual signal)
- Exterior mirror housings in body color
- third brake light
- Headliner in steel grey fabric
- Roof edge spoiler
- Digital instrument cluster - fully digital instrument cluster in 10.25 inches (speed, time, mileage, outside temperature, fuel warning with remaining range, shift indicator (for manual and automatic transmissions in manual mode), current radio station or music track, radio and media lists, classic-style display; if available: telephone menu (in conjunction with multifunction steering wheel), trip computer with short- and long-term memory, fuel-saving tips for more economical driving including break recommendations)
- Electric windows front and rear
- Remote key (without Safe-Lock) (locks and unlocks doors, luggage compartment and fuel filler flap - including comfort closing/opening of windows)
- Transmission: S tronic 7-speed
- rear window wiper
- Interior lighting (front and rear roof module, including reading lights (incandescent bulbs) - glove box lighting (incandescent bulb) - LED trunk lighting right)
- Manual air conditioning (cools or heats the vehicle interior - air distribution and fan manually adjustable - manual recirculation mode - particle filter - dust and odor separating cabin air filter, which ensures a lower burden of dust particles, odors and allergens in the vehicle interior)
- Light and rain sensor
- Non-smoking version (with 12-volt socket and storage compartment)
- Wheel: Alloy wheels - 16 inch - 5-double arm (7.0 J × 16, tire 205/55 R 16)
- Airbag: Front side airbags with head airbag system and front interaction airbag (In addition to the front side airbags and the head airbags, an interaction airbag is installed at the front, which deploys within the system boundaries between the driver and front passenger seats if required)
- Audi connect Emergency Call & Service with m.connect Remote & Control (The Audi connect Emergency Call & Service services ensure a safe feeling on every journey. - Emergency call - Online breakdown call - Audi damage service - Audi service appointment online Audi connect Remote & Control: - Vehicle status - Remote locking/unlocking - Parking position - Remote control of auxiliary heating - Push notification of anti-theft alarm system)
- Electrically adjustable and heated exterior mirrors (with integrated LED indicator lights - left mirror glass aspherical, right convex - including heated windshield washer nozzles)
- Additive-free diesel particulate filter (DPF)
- Tachometer
- Electric auxiliary air heater
- Electromechanical parking brake (includes parking brake function when stationary, starting aid by automatic release when starting off and emergency braking function while driving via all four wheels)
- Electronic Differential Lock (EDS)
- Electronic Stability Control (ESC)
- Chassis: Standard chassis (Standard comfort chassis with balanced tuning, for very good ride comfort with good driving dynamics.)
- Front and rear floor mats (made of velour in black)
- Removable luggage compartment cover
- Speed limiter (assists you in maintaining a constant driving style and adhering to speed limits by adjusting the maximum speed)
- Electrically operated child safety lock
- i-Size child seat attachment and top tether for the outer rear seats
- Rear headrests (3)
- Front headrests
- Paint finish: Solid
- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction controls and shift paddles (The steering wheel's height and reach are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with six multifunction buttons. Shift paddles allow manual gear changes.)
- Tire pressure monitoring system (visual and audible warning in case of pressure loss in one or more wheels)
- Tire repair kit (with tire sealant and compressor)
- Electromechanical power steering (with speed-dependent steering assistance)
- 3-point automatic seat belts (3-point automatic seat belts for all seats, pyrotechnic belt tensioners, belt height adjustment at the front, belt force limiters on all outer seats)
- Seat covers in fabric (seat center panel in fabric - seat side bolsters, front center armrest (if ordered) and headrests in solid black fabric)



- Radio: MMI Radio plus (10.1-inch color display (1,540 x 720) including MMI touch operation, digital instrument cluster with 10.25-inch color display, Audi music interface with two USB-C ports, each with data and charging function, Bluetooth interface (hands-free calling and audio streaming), passive speakers with 4 speakers in the front and 2 in the rear (80 watts), AM/FM phase diversity, DAB+ speed-dependent volume adjustment, voice control system for controlling infotainment and vehicle functions, WLAN hardware)
- Seats: Rear seat backrest foldable (split, in a 40:60 ratio or fully foldable)
- Lane Departure Warning (Within system limits, this helps prevent unintentional lane departures. If the system is activated, operational, and no turn signal has been used, the Lane Departure Warning assists by making corrective steering interventions to prevent crossing detected lane markings. Additional steering wheel vibration can be activated upon driver request. The system is functional from approximately 60 km/h.)
- Start-stop system
- 12-volt power outlet in the rear
- 12V socket
- Daytime running light
- Glazing: Green tinted heat-insulating glazing (for rear window, door and side windows - rear window heated, with timer)
- Electronic immobilizer



Extra equipment

- 3-zone automatic climate control (electronically regulates air temperature, volume and distribution - separate temperature distribution for driver, front passenger and rear - sun position-dependent control - automatic recirculation control - dust and odor separating allergen filter - air vents in the rear center console - separate defroster button for faster defrosting of the front and side windows)
- Adaptive cruise control (assists with acceleration, braking, and maintaining speed and distance. The adjustable speed limiter helps, for example, to prevent exceeding a preset maximum speed within built-up areas from approximately 30 km/h. Audi pre sense front uses a front radar to detect the area in front of the vehicle within the system's limits and warns of potential hazards with visual and audible signals.)
- Business package (USB ports with charging function in the rear - Audi connect Navigation & Infotainment plus - Audi phone box - Audi virtual cockpit plus - Smartphone interface (Android Auto and Apple CarPlay) - MMI Navigation plus with MMI touch - Cruise control)
- Lane change warning with exit warning and rear cross-traffic alert (The lane change warning system uses two radar sensors to measure the distance and speed difference of vehicles approaching from behind. The system warns the driver of a potential hazard when changing lanes by displaying an indicator on the respective exterior mirror. If the driver activates the turn signal to initiate a lane change, the indicator flashes as an additional warning. The system operates at speeds between approximately 15 km/h and 250 km/h and can be activated via the MMI car menu.)
- Seats: Driver's seat electrically adjustable, passenger seat manually adjustable (with electric adjustment of seat height, seat longitudinal position, seat and backrest tilt for the driver's seat)
- Seats: Front sports seats (with manual adjustment of seat height, seat longitudinal position, seat tilt, backrest tilt and belt height - with visually integrated headrests of the front seats and with pronounced seat side bolsters for better lateral support in curves)
- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction plus and shift paddles (The steering wheel's height and reach are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with twelve multifunction buttons. Shift paddles allow manual gear changes.)
- Accessory package
- Comfort key without Safelock (The vehicle can be unlocked at all doors and the tailgate via wireless communication. The comfort key simply needs to be carried and does not need to be actively used. The vehicle can be locked again using the sensors on the door handles. The engine is started and stopped using the engine start/stop button.)
- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides (with integrated LED turn signal and curb view function for the passenger-side exterior mirror - mirror glass left aspherical, right convex - including heated windshield washer nozzles)
- Front center armrest (adjustable in tilt, movable in length)
- Front seat heating (heats seat and backrest center section (standard seats in fabric), otherwise seat and backrest center section as well as seat side bolsters - individually adjustable in 3 stages for driver and front passenger via direct selection button on the climate control unit)
- Hold assist (holds the vehicle after stopping on inclines and declines typical in road traffic for an unlimited time).
- Interior mirror, automatically dimming, frameless
- LED headlights and LED taillights with dynamic turn signals (daytime running lights, low beam, high beam, position lights, turn signals, cornering lights, all-weather lights (to reduce glare in poor visibility conditions), motorway lights, static cornering lights, maneuvering lights (illumination of the maneuvering area at the front and sides when reversing), automatic dynamic headlight range control, intersection lights (in conjunction with MMI Nav. plus), dynamic rear turn signals, brake lights, tail lights, rear license plate lights, reversing lights)
- Parking assistant with parking aid plus (Using ultrasonic sensors, the system searches for suitable parallel or perpendicular parking spaces. For perpendicular spaces, the system calculates the parking path (forwards and backwards); for parallel spaces, it calculates the entry and exit paths. The driver must accelerate, shift gears, and brake, as well as monitor the parking process. The system handles the steering. Within the system's limits, the surround view displays warnings of obstacles around the vehicle, depending on the driving path. Multi-stage parking maneuvers are supported.)
- Seats: 4-way lumbar support (electrically adjustable, horizontally and vertically)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Headlight	Headlight cleaning nozzle - left side (Waschwasserdüse) - Missing - Replace
2	Door - front left side	Door edge - Scratch(es) - Smart repair
3	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
4	Door - rear left side	Door handle - outside - Scratch(es) - Smart repair
5	Roof	Roof rail - right side - Scratch(es) - Paint
6	Door - rear left side	Door - Scratch(es) - Paint
7	Side panel - rear left side	Side panel (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint
8	Side panel - rear right side	Side panel (Blasen im Lack) - Unprofessionally repaired - Repair and paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 11 Feb 2026	2.154,50 €
2	Rear, Provided by user / customer, from 25 Mar 2025	3.911,67 €
3	Front, Provided by user / customer, from 5 Apr 2025	4.662,21 €
4	Side - left, not professionally repaired	
5	Side right, not professionally repaired	

Repainting

No.	Repainting
1	Roof rail - left side, Roof rail - right side, Door - rear right side, Professionally carried out
2	Side panel - rear left side, Side panel - rear right side, Unprofessionally carried out

Paint coat thickness measurement

Roof rail - left side	166 µm	Roof rail - right side	164 µm
Side panel - rear left side	290 µm	Side panel - rear right side	461 µm
Door - rear right side	190 µm		



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

An unprofessionally repaired previous damage was found at the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Navigation



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.

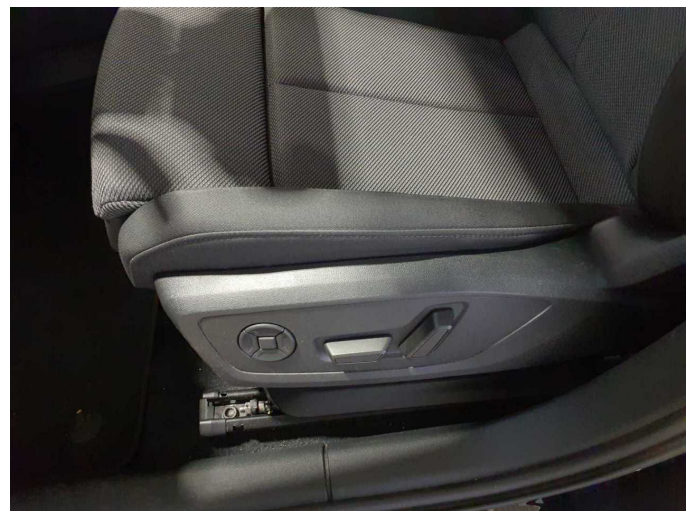


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

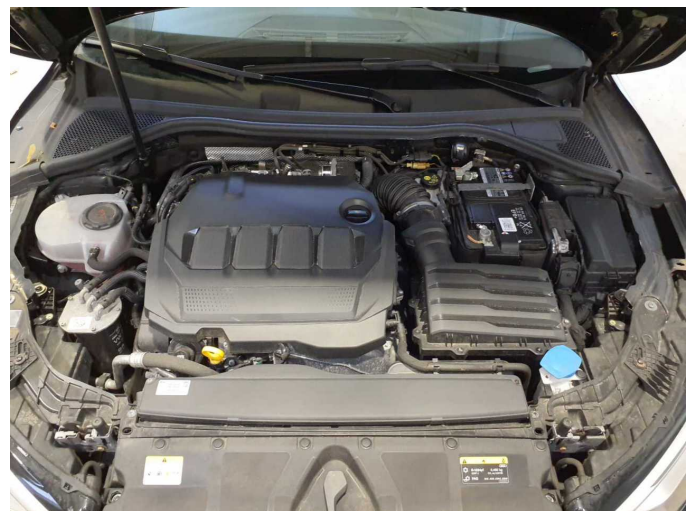


Figure 22: Misc.



Figure 23: Misc.

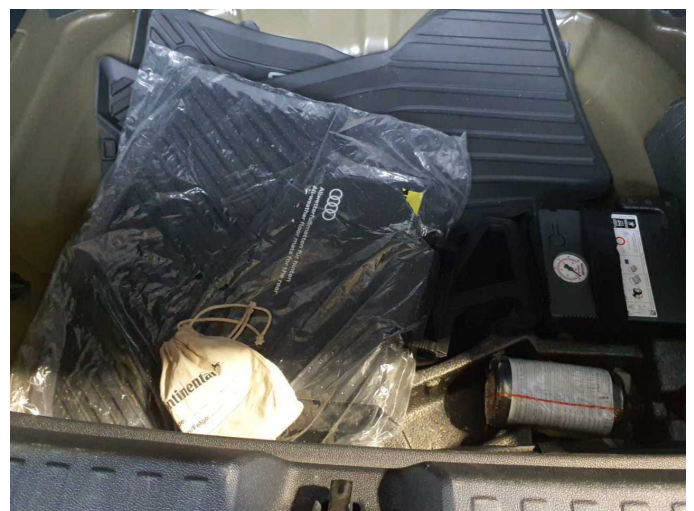


Figure 24: Misc.




Damage 1: Headlight: Headlight cleaning nozzle - left side (Waschwasserdüse) - Missing - Replace




Damage 1: Headlight: Headlight cleaning nozzle - left side (Waschwasserdüse) - Missing - Replace




Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair

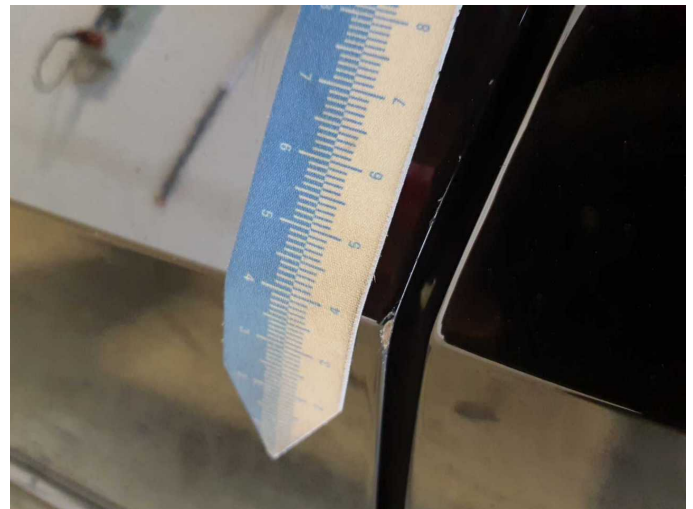

Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair

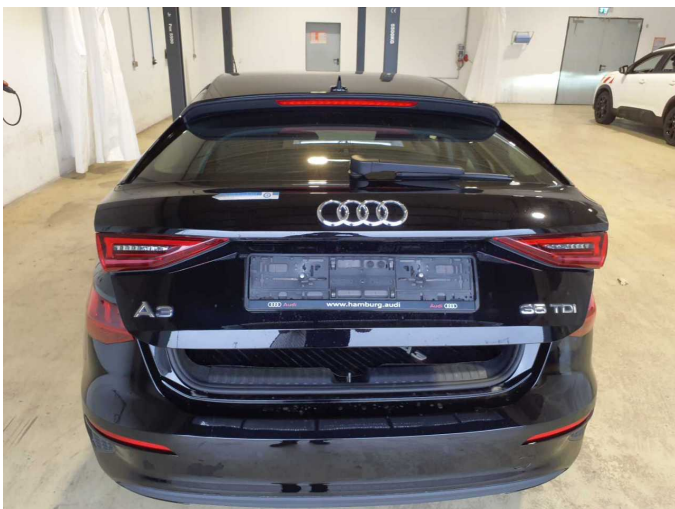

Damage 3: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

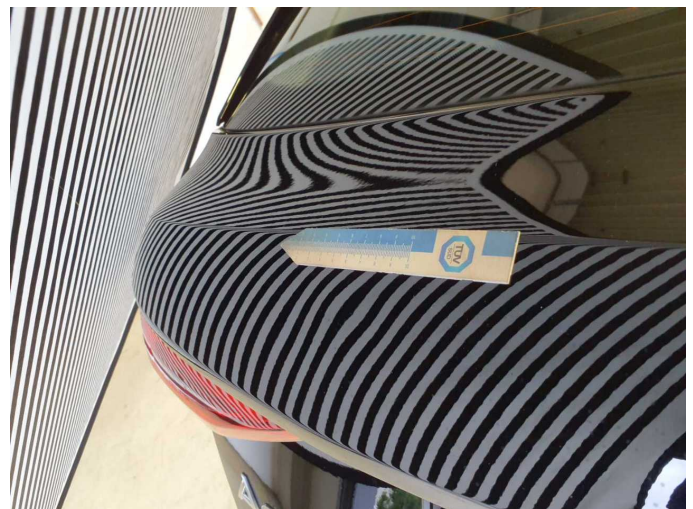

Damage 3: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work




Damage 3: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work




Damage 3: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 4: Door - rear left side: Door handle - outside - Scratch(es) - Smart repair

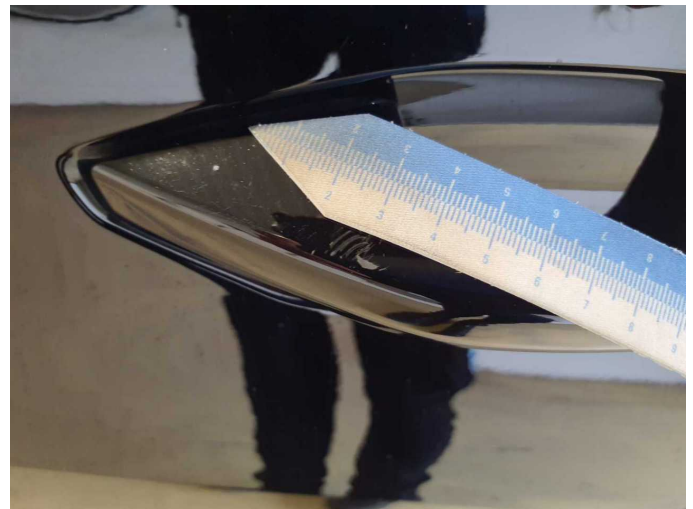

Damage 4: Door - rear left side: Door handle - outside - Scratch(es) - Smart repair

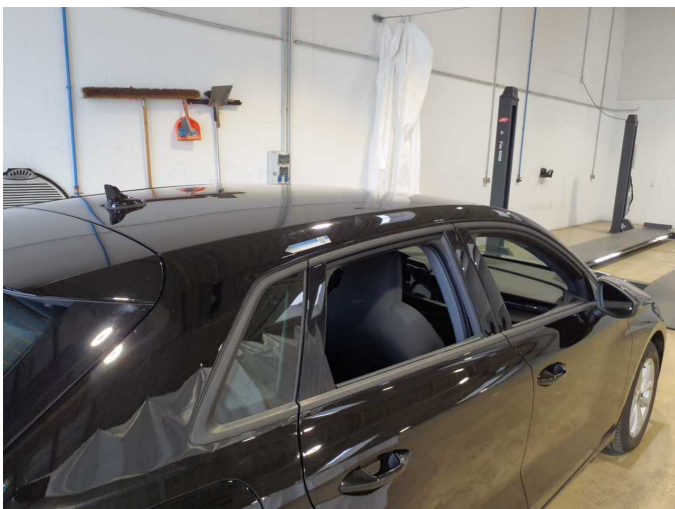

Damage 5: Roof: Roof rail - right side - Scratch(es) - Paint




Damage 5: Roof: Roof rail - right side - Scratch(es) - Paint



Damage 5: Roof: Roof rail - right side - Scratch(es) - Paint



Damage 6: Door - rear left side: Door - Scratch(es) - Paint

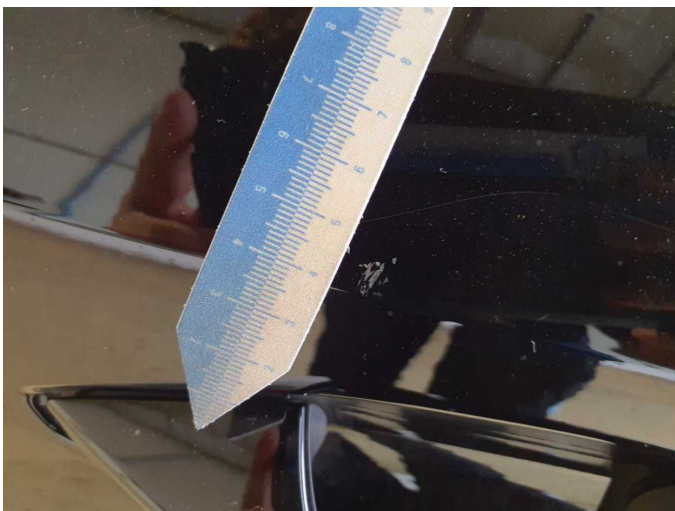

Damage 6: Door - rear left side: Door - Scratch(es) - Paint



Damage 6: Door - rear left side: Door - Scratch(es) - Paint




Damage 7: Side panel - rear left side: Side panel (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint



Damage 7: Side panel - rear left side: Side panel (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint




Damage 7: Side panel - rear left side: Side panel (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint

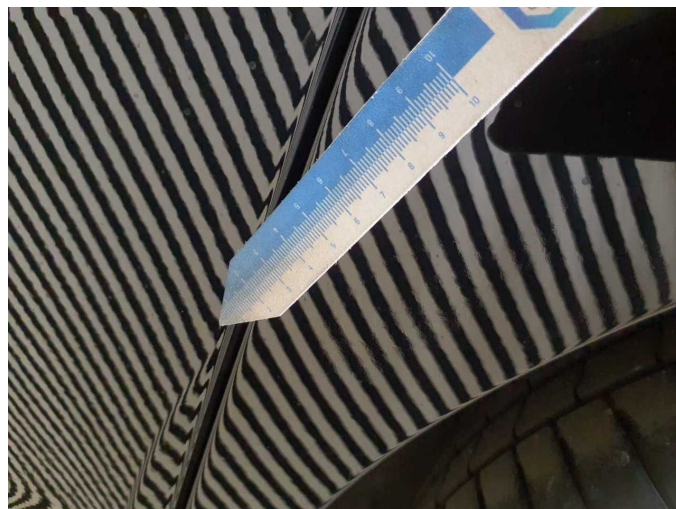

Damage 7: Side panel - rear left side: Side panel (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint



Damage 8: Side panel - rear right side: Side panel (Blasen im Lack) - Unprofessionally repaired - Repair and paint

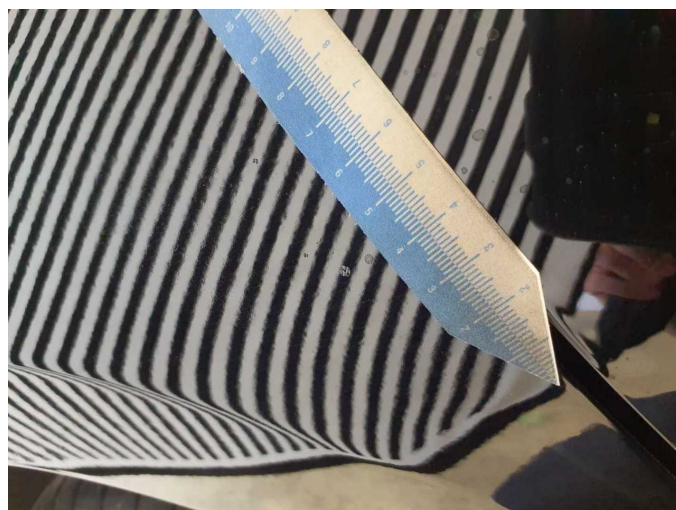

Damage 8: Side panel - rear right side: Side panel (Blasen im Lack) - Unprofessionally repaired - Repair and paint



Repainting 1: Roof rail - left side, Roof rail - right side, Door - rear right side



Repainting 1: Roof rail - left side, Roof rail - right side, Door - rear right side



Repainting 1: Roof rail - left side, Roof rail - right side, Door - rear right side



Repainting 1: Roof rail - left side, Roof rail - right side, Door - rear right side



Repainting 1: Roof rail - left side, Roof rail - right side, Door - rear right side



Repainting 1: Roof rail - left side, Roof rail - right side, Door - rear right side



Repainting 2: Side panel - rear left side, Side panel - rear right side



Repainting 2: Side panel - rear left side, Side panel - rear right side



Repainting 2: Side panel - rear left side, Side panel - rear right side



Repainting 2: Side panel - rear left side, Side panel - rear right side