



Renault Trafic: 2CLU544

Vinnumber:	VF1FL000869284174	Versionname:	
First Registrationdate:	8/09/2022	Fiscalpower:	
Expertise Mileage:	122286	Power Kw:	110
Bodytype:		Body colour:	White
Gearbox:	Automatic	Type of rims (mounted):	Steel
Transmission:		Parking lot:	3622
Fueltype:	Diesel		
Type of rims (mounted):	Steel		
Certificate of Conformity:	Yes		
Category:	Light Commercial Vehicle		
Registration Certificate Car (BE):	Yes		
Registration Certificate Home (BE):	No		

Options

Number of keys total:	2	Luggage cover:	
Steering wheel multifunctional:		Front parking sensors:	
Radio multimedia:		Rear parking sensors:	
Type of headlighting:	Headlighting Halogen	Type of Tow bar:	No Tow bar
Type of GPS:	GPS base		
Type of Lining:	Lining fabrics		
Type of climate control:	Autom climate control		

Limited Technical Inspection

Tyres

215/60/16/95 V				
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Continental: 4 mm	Re.R.	Continental: 4 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				4.0
Tyre profile depth RR				4.0
Tyre size FL				215/60 R 16 95 V
Tyre size FR				215/60 R 16 95 V
Tyre size RL				215/60 R 16 95 V
Tyre size RR				215/65 R 16 101 T
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				256
Tyre make FR				256
Tyre make RL				256
Tyre make RR				256

Assistance equipment

Emergency spare wheel:	Yes	Jack:	Yes
Number of charging cables (normal):	0		
Number of charging cables (rapid charge):	0		

Total cost ex VAT:	2923,34
Interior, Damaged, Acceptable:	0,00



Instrument panel, complete, Not functioning (well), Check	0,00
---	------



Bumper F, Broken, Replace and paint	872,83
-------------------------------------	--------



Grille, Broken, Replace	223,01
-------------------------	--------



Bumper moulding F, Broken, Replace	129,63
------------------------------------	--------



Bumper moulding F, Dent(s) and scratch(es), Replace	129,63
---	--------



Bumper moulding F, Broken, Replace	129,63
------------------------------------	--------





Wing FL, Chemical polution, Polish	0,00
------------------------------------	------



Bumper R, Scratch(es), Repair and paint (complete)	0,00
--	------




Boot door panel RL, Dent(s), Paintless dent repair	95,47
--	-------



Wheel cover RR, Missing, Replace	50,30
----------------------------------	-------



Wing trim RR, Missing, Replace	86,90
--------------------------------	-------

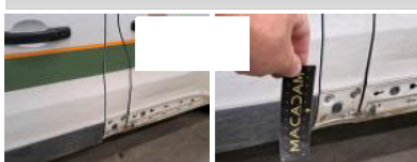


Door trim FR, Missing, Replace	120,16
--------------------------------	--------




Door FR, Dent(s) and scratch(es), Repair and paint (complete)	334,34
---	--------



Outer sill R, Dent(s) and scratch(es), Repair and paint (complete)	326,10
--	--------

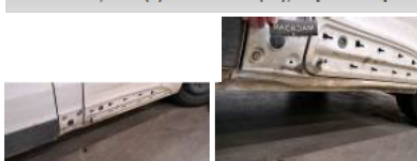


Wing FR, Dent(s) and scratch(es), Repair and paint (complete)	231,22
---	--------

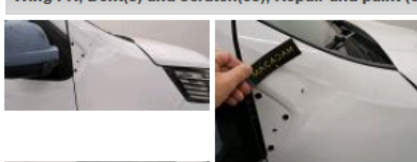

Wing trim FR, Missing, Replace	32,31
--------------------------------	-------



Outside rear-view mirror housing R, Bad repair, Repair and paint (complete)	161,81
---	--------

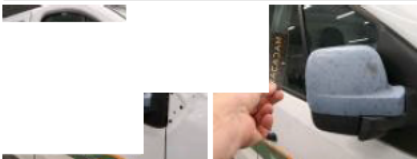

Bodywork, Accident, Check	0,00
---------------------------	------



Bodywork, Not original part, Remove lettering	0,00
---	------

