



RENAULT Clio: 1034-KRC

Vinnumber:	VF1R9800661563020	Versionname:	Sport Tou. Limited En. TCe 66kW (90CV) familiar
First Registrationdate:	24/10/2018	Fiscalpower:	66kW 5P manual
Expertise Mileage:	54392	Power Kw:	
Bodytype:	Break	Body colour	White
Gearbox:	MAN 5 VIT	Type of rims (mounted)	Aluminium
Transmission:			
Fueltype:	Petrol		
Engine functioning	Yes		
Battery functioning	Yes		
Vehicle running	Yes		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	1	Luggage cover
Number keys remote	1	Roof bar alu
GPS big screen color		
Windows electric F		
Cruise Control		
Steering wheel multifunctional		
Steering wheel leather		
Radio multimedia		
Type of climate control	Autom climate control	

Tyres

	195/55/16/87 H			
Summer tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Goodyear: 4 mm	Re.R.	Goodyear: 4 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				4.0
Tyre profile depth RR				4.0
Tyre size FL				195/55 R 16 87 H
Tyre size FR				195/55 R 16 87 H
Tyre size RL				195/55 R 16 87 H
Tyre size RR				195/55 R 16 87 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				259
Tyre make FR				259
Tyre make RL				259
Tyre make RR				259

Assistance equipment

Repair kit	Yes
------------	------------

Boot lid covering R, Scratch(es), Replace



Interior, Dirty, Cleaning



Ignition key, Missing, Repair/replace (lump sum)



Door panel FR, Scratch(es), Replace



Rear light L, Crack, Replace



Outer door handle FL, Scratch(es), Paint



Wing RL, Scratch(es), Repair and paint (complete)



Door RL, Scratch(es), Repair and paint (complete)



Bumper F, Scratch(es), Repair and paint (complete)



Wing RR, Scratch(es), Repair and paint (complete)



Door RR, Scratch(es), Repair and paint (complete)



Boot moulding, Scratch(es), Paint




Tailgate / Boot, Scratch(es), Repair and paint (complete)



Bumper corner RR, Scratch(es), Repair and paint (complete)



Bumper corner RL, Scratch(es), Repair and paint (complete)

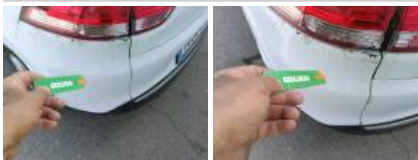

Rear light L tailgate, Crack, Replace




Bumper R, Scratch(es), Repair and paint (complete)



Reflector, Crack, Replace



Tyres, No damage, Check

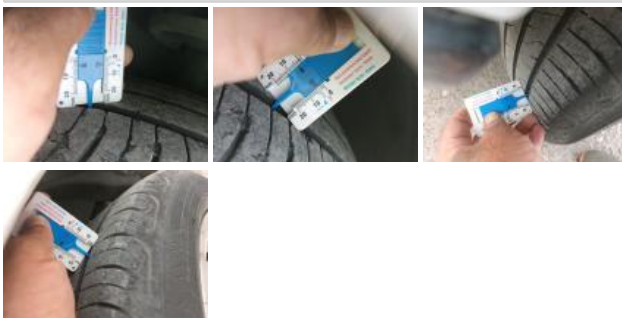

Datos del vehículo

Marca

Modelo

Versión

Matrícula

VIN

Histórico

Fecha	Descripción	Kilómetros	Taller

Datos del vehículo

Marca

Modelo

Versión

Matrícula

VIN

Histórico

Fecha	Descripción	Kilómetros	Taller