



Expertise

Protocol number: 46539964
Order No. / Reference: 26566913
Inspection date: 10 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1NKM5GB7PF038939

Model: GLC 300 e 4Matic 9G-TRONIC Avantgarde Advanced



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLC 300 e 4Matic 9G-TRONIC Avantgarde Advanced	
Vehicle Identification number	W1NKM5GB7PF038939
Mileage (Read)	83,518 km
First registration	15 May 2023
Number of holders	1
Next periodical technical inspection	05/2028
(Report on hand)	
Power / Engine displacement	150 kw / 1,999 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufll / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Schwarz
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	320 Tag(e)
Last service on / at	05/2026 at 81,324 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV672956
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BLC 00001		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,890 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103W	Summer tyres on Light alloy	Goodyear	6mm / 6mm
2)	255/55 R18 109W	Summer tyres on Light alloy	Goodyear	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 107V	Winter tyres on Light alloy	Pirelli	6mm / 6mm
2)	255/55 R18 109V	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Adaptive Highbeam Assist
- Airbag: Kneebag for driver
- Airbag: Windowbag
- Active Lane Keeping Assist
- Ambient lighting
- Traction control (ASR)
- Automatic passenger airbag deactivation
- Brake system with larger brake discs on the front axle
- Double cup holder
- Tachometer
- EASY-PACK tailgate
- Electronic Stability Program (ESP)
- Chassis: Comfort chassis
- Velour floor mats
- Rear window heated
- Instrument panel in black with contrasting decorative stitching
- Paint finish: Solid
- Charging cable for wallbox and public charging station, 5m, smooth (This charging cable, also called Mode 3 cable, allows you to charge the vehicle battery at the wallbox or at public charging stations with up to 11 kW (Type 2, 3-phase, 16 A).)
- LED High Performance Headlights
- Steering wheel: Multifunction sports steering wheel in leather
- Navigation accessories: Extended MBUX functions
- Otto particulate filter
- Package: Avantgarde Advanced (for hybrid models) (P14 AVANTGARDE Interior - P15 AVANTGARDE Exterior - 38U Remote and Charging Services Plus - 70B Warning vest for driver - 9B2 Charging cable for wallbox and public charging station, 5m, smooth - PBG MBUX Navigation Premium - PDA Advanced package)
- Package: USB package
- Radio accessories: Digital radio (DAB)
- Tire pressure loss warning
- Wheels: 45.7 cm (18") alloy wheels in a 5-spoke design
- Wheel accessories: TIREFIT with tire inflator compressor
- Power steering
- Phone accessories: Wireless charging system for mobile devices
- Pre-installation for digital key handover
- Immobiliser
- Central display
- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- 4MATIC all-wheel drive
- Anti-lock braking system (ABS)
- ATTENTION ASSIST
- Basic services
- Roof rails made of glossy anodized aluminum
- Downhill Speed Regulation (DSR)
- Dynamic front bumper with visual underguard
- EASY-Pack: Cargo area cover
- Driver display
- Fingerprint scanner
- Transmission: 9G-TRONIC
- Rear window wiper/washer system
- Climate: THERMATIC automatic climate control
- Radiator grille with integrated Mercedes star
- Charging cable for household socket, 5m, smooth (This charging cable, also called Mode 2 cable, allows you to charge the vehicle battery at the household socket with up to 1.8 kW (230 V, 1-phase, 8 A) and fits sockets of type E/F CEE 7/7.)
- Charging system: Alternating current charging system (AC charging) up to 11 kW (3-phase)
- Mercedes-Benz emergency call system
- Center console in high-gloss black
- Navigation: MBUX Navigation Premium
- Package: Storage
- Package: Chrome Interior Package
- Package: Interior light
- Package: Boot Comfort Package
- Package: Parking package with reversing camera
- Package: Seating comfort
- Package: Mirror Package
- Upholstery: ARTICO leatherette/fabric
- Radio accessories: MBUX multimedia system
- Remote and Charging Services Plus
- Wheels: Summer tires
- Windscreen wipers with rain sensor
- Heated seats for driver and front passenger
- Phone accessories: Smartphone integration
- Cruise control
- High-visibility vest for drivers
- Heat-insulating dark tinted glass
- Central locking with remote control



Extra equipment

- Active Distance Assist DISTRONIC (radar sensor in the radiator grille - automatically acting assistance system - active up to a speed of 160 km/h - visual and acoustic warning if you as the driver need to intervene - depending on the driving program, the vehicle accelerates faster or slower to the desired speed - detected speed limits can be conveniently adopted by pressing a button on the steering wheel (only in conjunction with Traffic Sign Assist or Speed Limit Assist))
- Black fabric headliner
- Center console metal structure
- Package: Parking package with 360° camera (12 ultrasonic sensors: 6 each in the front and rear bumpers - 360° camera: four networked cameras, display on the media display, trailer mode - Active Parking Assist PARKTRONIC: detects parking spaces, assisted parking, assisted exiting, visual and acoustic warning of detected obstacles, display of camera and ultrasonic data on the central display, button for Active Parking Assist with PARKTRONIC - cross traffic warning - maneuvering brake - drive-away assist)
- Decorative elements: metal structure
- ENERGIZING AIR CONTROL (Air quality sensor and separate fine dust sensors for indoor and outdoor use detect harmful inhalable gases in the outdoor air as well as fine dust (PM2.5) in the outdoor and indoor air - Fine dust filtration with 2 filters, consisting of a fine dust pre-filter and an indoor air filter - Indoor air filter in the air conditioner based on activated carbon with filter layers against fine dust (PM2.5) and nitrogen oxides (NOx) or sulfur dioxide (SO2) as well as pollen, allergens and soot particles - automatic recirculation)
- Package: Avantgarde Advanced Plus (electrically adjustable driver's seat with memory function - Blind Spot Assist - Illuminated door sills with "Mercedes-Benz" lettering - Traffic Sign Assist - Advanced Plus Package)
- Package: USB Package Plus (Two USB-C ports in the center console, fast charging and suitable for data transfer - Two USB-C ports under the front center armrest, fast charging and suitable for data transfer - Two USB-C ports for the rear at the back of the center armrest, fast charging - Two 12-volt sockets, one in the front and one in the rear)
- Sunroof: Panoramic sunroof (large glass module made of heat-insulating safety glass - mesh wind deflector in the front area - electric sunshade with one-touch operation - comprehensive protection concept: anti-pinch protection, automatic rain closing, automatic closing when the recirculation function is activated, PRE-SAFE closing function (only in conjunction with PRE-SAFE system))

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front right side	Door - dent(s) - Smooth repair work
2	Door - front right side	Door edge - Scratch(es) - Smart repair
3	Door - rear left side	Door edge - Scratch(es) - Smart repair
4	Door - front left side	Door - Scratch(es) - Smart repair
5	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
6	Rear bumper	Rear bumper - Scratch(es) - Paint
7	Bonnet	Bonnet - Stone chips - Paint
8	Door - rear right side	Door - Scratch(es) - Paint
9	Front bumper	Front bumper - Scratch(es) - Paint



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

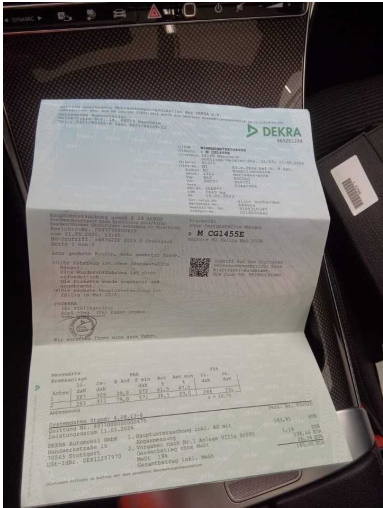


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

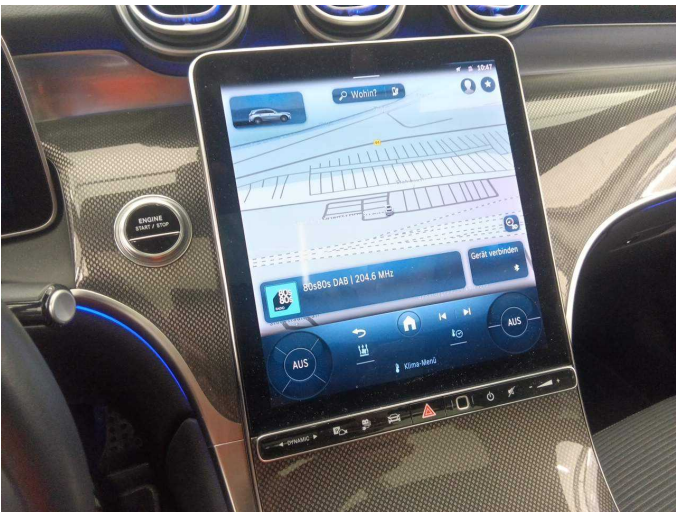


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

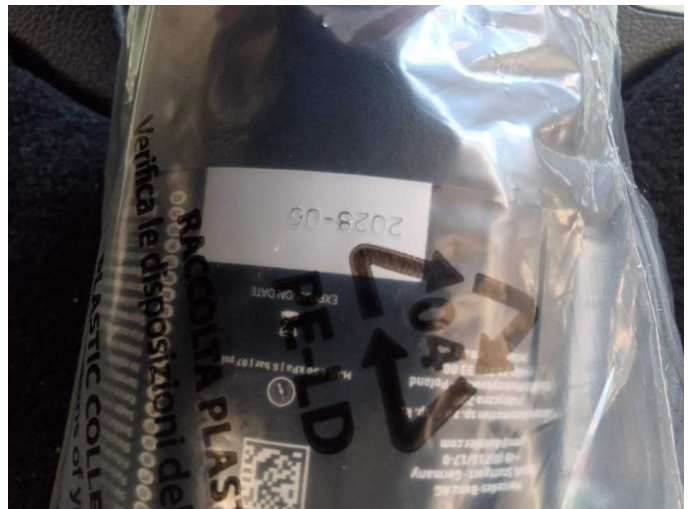


Figure 22: Misc.



Figure 23: Misc.

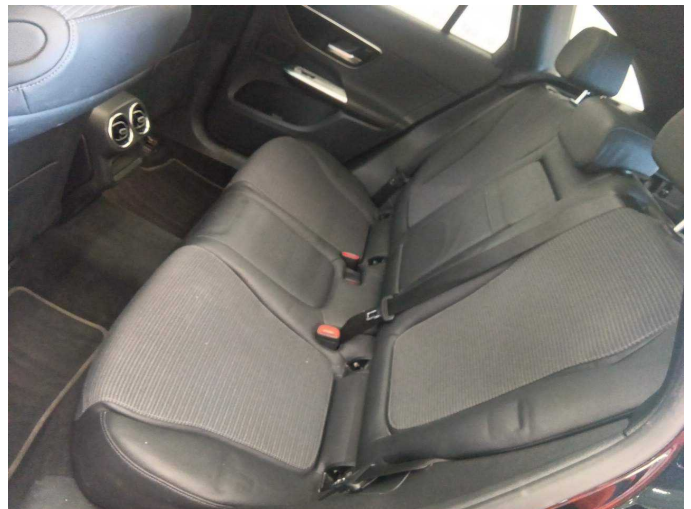


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

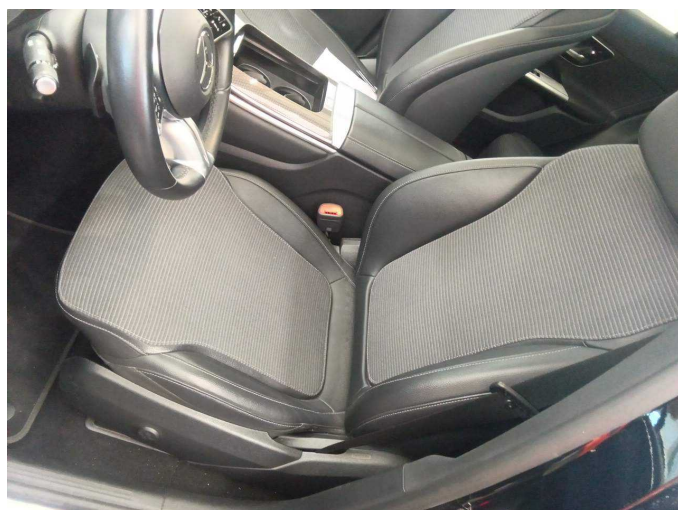


Figure 28: Misc.

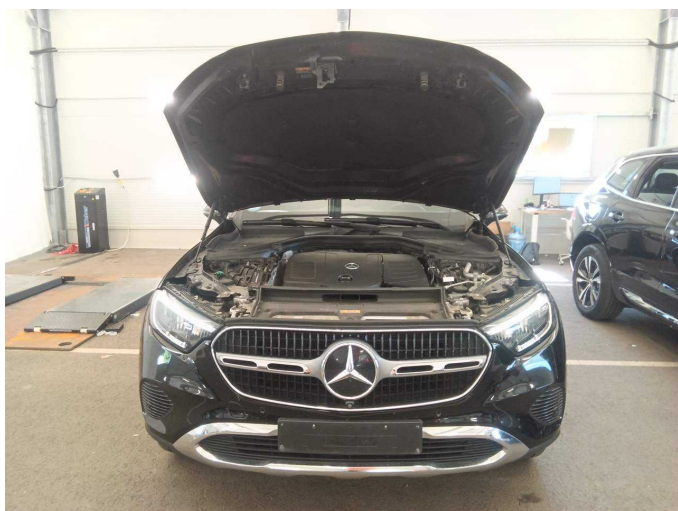


Figure 29: Misc.

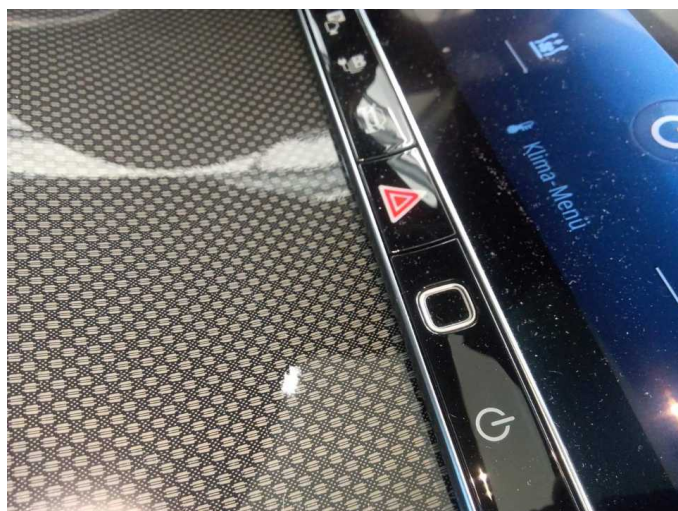


Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.




Damage 1: Door - front right side: Door - dent(s) - Smooth repair work

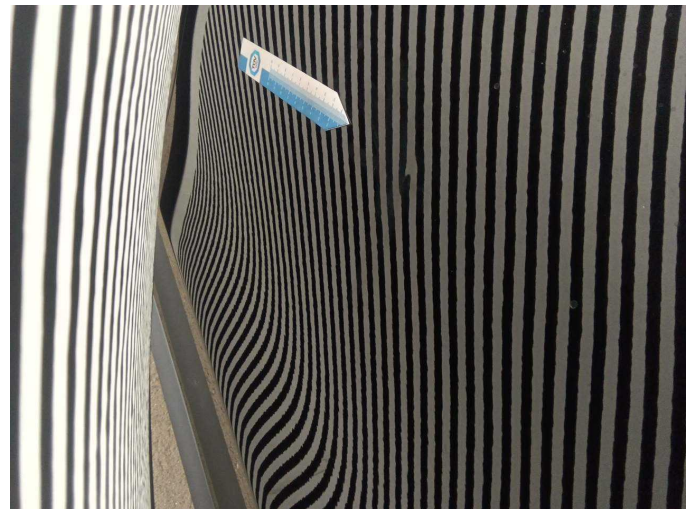

Damage 1: Door - front right side: Door - dent(s) - Smooth repair work



Damage 2: Door - front right side: Door edge - Scratch(es) - Smart repair

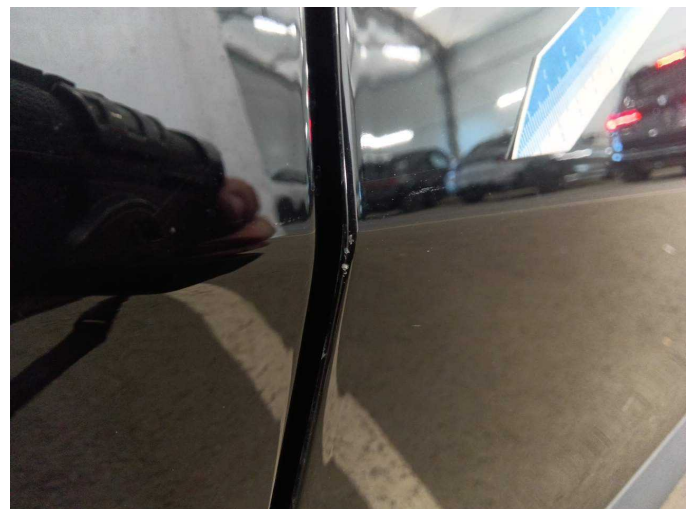

Damage 2: Door - front right side: Door edge - Scratch(es) - Smart repair



Damage 2: Door - front right side: Door edge - Scratch(es) - Smart repair



Damage 3: Door - rear left side: Door edge - Scratch(es) - Smart repair




Damage 3: Door - rear left side: Door edge - Scratch(es) - Smart repair



Damage 4: Door - front left side: Door - Scratch(es) - Smart repair



Damage 4: Door - front left side: Door - Scratch(es) - Smart repair

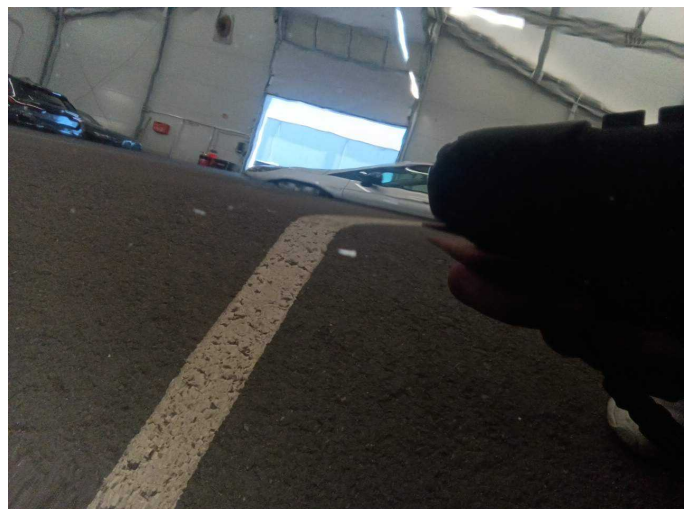

Damage 4: Door - front left side: Door - Scratch(es) - Smart repair



Damage 4: Door - front left side: Door - Scratch(es) - Smart repair



Damage 5: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair




Damage 5: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 5: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint

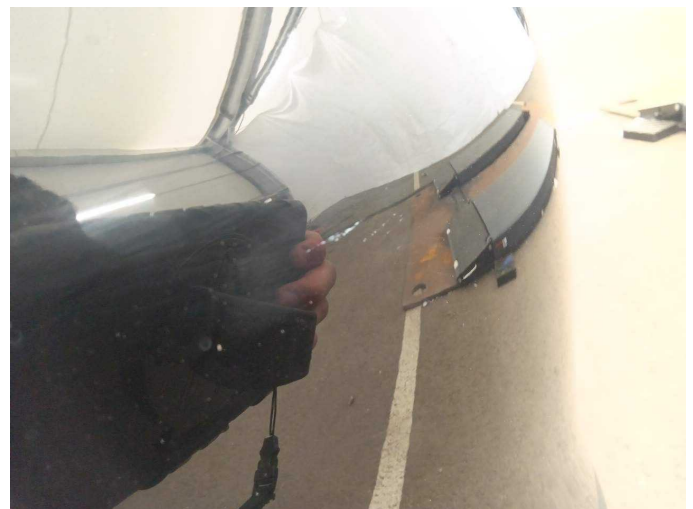

Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 7: Bonnet: Bonnet - Stone chips - Paint



Damage 7: Bonnet: Bonnet - Stone chips - Paint



Damage 7: Bonnet: Bonnet - Stone chips - Paint



Damage 7: Bonnet: Bonnet - Stone chips - Paint



Damage 7: Bonnet: Bonnet - Stone chips - Paint




Damage 8: Door - rear right side: Door - Scratch(es) - Paint




Damage 8: Door - rear right side: Door - Scratch(es) - Paint




Damage 8: Door - rear right side: Door - Scratch(es) - Paint

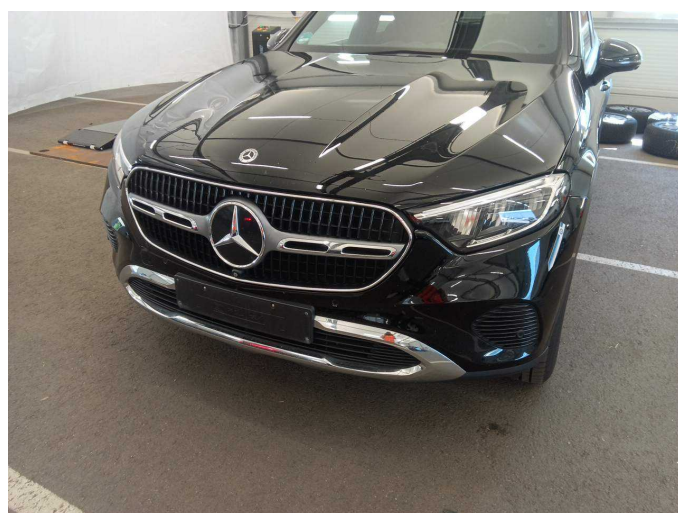


Damage 9: Front bumper: Front bumper - Scratch(es) - Paint

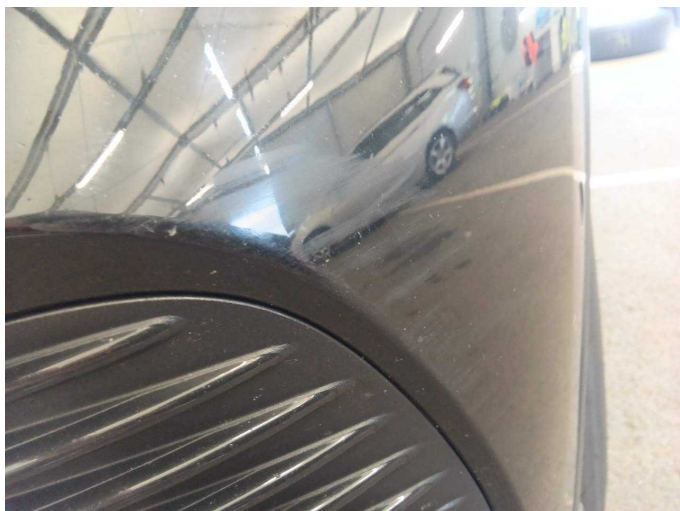

Damage 9: Front bumper: Front bumper - Scratch(es) - Paint

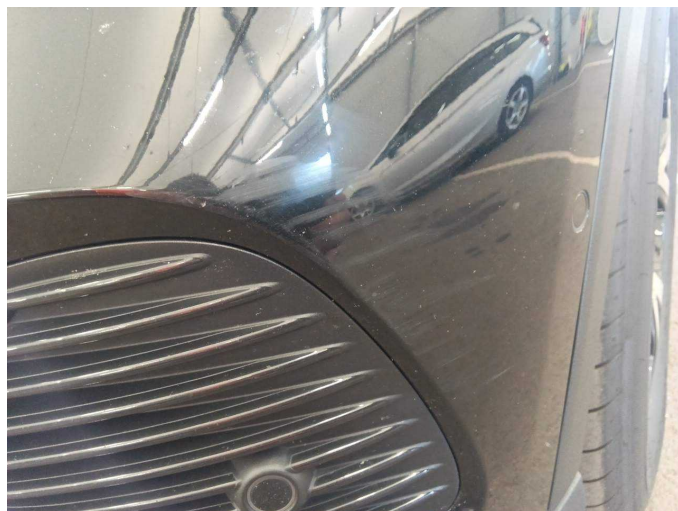

Damage 9: Front bumper: Front bumper - Scratch(es) - Paint

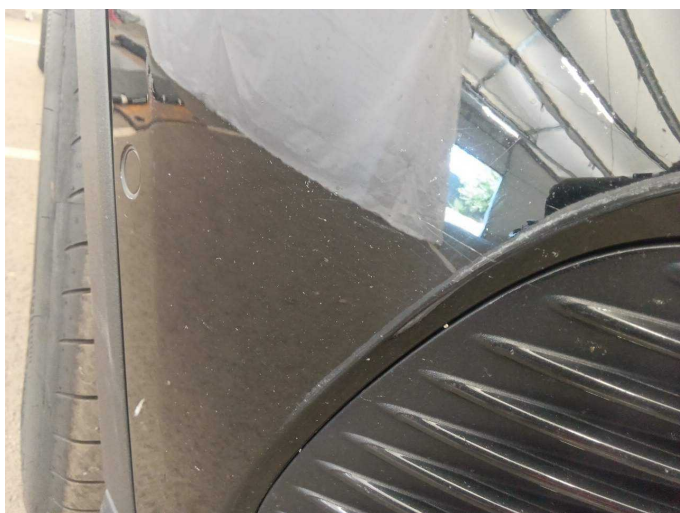

Damage 9: Front bumper: Front bumper - Scratch(es) - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1NKM5GB7PF038939

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLC 300 e 4Matic 9G-TRONIC Avantgarde Advanced

Datum	KM-Stand	Beschreibung
11.05.2026	81.324	HU + AU
05.05.2026	81.324	Regelwartungsdienst
23.05.2025	55.304	Regelwartungsdienst
22.04.2024	30.143	Regelwartungsdienst