



Skoda Karoq (UKL): 2BQU791

Vinnumber:	TMBJJ7NU0N5038036	Versionname:	Karoq Clever 2.0TDi 150pk/cv 5p
First Registrationdate:	18/02/2022	Fiscalpower:	
Expertise Mileage:	109106	Power Kw:	110
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	MAN 6 VIT		
Transmission:			
Fueltype:			
Maintenance	OK		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
GPS		Type of Tow bar	Tow bar removable
Type of Maintenance book	Digital maintenance		
Type of GPS storage	HD		

Tyres

	215/60/16/99 V			
Summer tyres:	Fr.L.	Bridgestone: 7 mm	Fr.R.	Bridgestone: 7 mm
	Re.L.	Bridgestone: 8 mm	Re.R.	Bridgestone: 8 mm
Tyre profile depth FL				7.0
Tyre profile depth FR				7.0
Tyre profile depth RL				8.0
Tyre profile depth RR				8.0
Tyre size FL				215/60 R 16 99 V
Tyre size FR				215/60 R 16 99 V
Tyre size RL				215/60 R 16 99 V
Tyre size RR				215/60 R 16 99 V
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				255
Tyre make FR				255
Tyre make RL				255
Tyre make RR				255

Assistance equipment

Emergency spare wheel	Yes
Repair kit	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

MOT certificate, Non-conforme, Replace



Instrument panel, complete, Not functioning (well), Check



Interior, Dirty, Cleaning



Fog lamp L, Broken, Acceptable



Fog lamp R, Broken, Acceptable



Bumper F, Scratch(es), Repair and paint (complete)



Bumper moulding F, Broken, Replace



Bumper moulding F, Scratch(es), Replace



Windscreen, Stone chip(s), Replace



Wing FL, Dent(s) and scratch(es), Repair and paint (complete)



Door FL, Scratch(es), Acceptable



Door RL, Scratch(es), Acceptable




Wing RL, Dent(s) and scratch(es), Repair and paint (complete)



Boot lid covering R, Scratch(es), Replace



Bumper R, Scratch(es), Spot repair

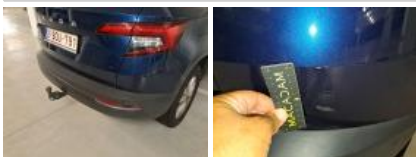

Tailgate / Boot, Scratch(es), Acceptable



Bumper trim R, Scratch(es), Acceptable



Door RR, Scratch(es), Repair and paint (complete)



Door FR, Scratch(es), Acceptable



Bodywork, Not original part, Remove lettering



Kenteken	2BQU791
Merk Model	Skoda Karoq Clever 2.0TDi 150pk/cv 5p
Brandstofsoort	Diesel
Datum deel1	2/18/22

Datum reparatie	Kilometerstand	Reparatie omschrijving	Bewerking
6/24/26	109,107	accu	Vervangen
10/15/24	87,232	brandstof hoofdfilter	Vervangen
10/15/24	87,232	Inspectie met olie vervanging (vast in	Uitvoeren
10/15/24	87,232	klein materiaal	
10/15/24	87,232	koelwatervloeistof	Bijvullen/-laden
10/15/24	87,232	luchtfilter	Vervangen
10/15/24	87,232	remblokken achter	Vervangen
10/15/24	87,232	ruitenswisserrubber achter	Vervangen
10/15/24	87,232	ruitenswisserrubber vooraan	Vervangen
10/15/24	87,232	ruitenswisservloeistof	Bijvullen/-laden
10/15/24	87,232	waterafvoer open dak	Reinigen
1/10/24	61,277	batterij	Vervangen
1/10/24	61,277	klein materiaal	
1/10/24	61,277	koelwatervloeistof	Bijvullen/-laden
1/10/24	61,277	luchtfilter interieur	Vervangen
1/10/24	61,277	Onderhoudsbeurt met oliewissel (variab	Uitvoeren
1/10/24	61,277	remvloeistof	Vervangen
1/10/24	61,277	ruitenswisservloeistof	Bijvullen/-laden
4/6/23	32,669	batterij	Vervangen
4/6/23	32,669	Inspectie met olie vervanging (vast in	Uitvoeren
4/6/23	32,669	klein materiaal	
4/6/23	32,669	koelwatervloeistof	Bijvullen/-laden
4/6/23	32,669	ruitenswisserrubber achter	Vervangen
4/6/23	32,669	ruitenswisserrubber vooraan	Vervangen
4/6/23	32,669	ruitenswisservloeistof	Bijvullen/-laden
4/6/23	32,669	waterafvoer open dak	Reinigen
2/16/23	28,002	controle niveaus	Uitvoeren
2/16/23	28,002	klein materiaal	
2/16/23	28,002	ruitenswisservloeistof	Bijvullen/-laden