



Expertise

Protocol number: 46334615
Order No. / Reference: 26417707
Inspection date: 6 Jul 2026

Manufacturer: Opel

Model: Grandland 1.5 D Automatik Elegance

VIN: W0VZCYHZ4P6022046



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Grandland 1.5 D Automatik Elegance	
Vehicle Identification number	W0VZCYHZ4P6022046
Mileage (Read)	77,718 km
First registration	23 Jun 2023
Number of holders	2
Power / Engine displacement	96 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Jade Weiß
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	2,600 km
Last service on / at	08/2025 at 63,028 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS846420
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AHG 00256		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,000 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102V	Summer tyres on Light alloy	Michelin	3mm / 3mm
2)	225/55 R18 102V	Summer tyres on Light alloy	Michelin	3mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/70 R16 100T	Winter tyres on Light alloy	Dunlop	5mm / 5mm
2)	215/70 R16 100T	Winter tyres on Light alloy	Dunlop	7mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 12/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 2 ignition keys, both foldable
- Driver and passenger side airbags
- Airbag: Front and side airbags
- Airbag: Head airbags, front and rear outer
- Ambient lighting, center console and in the front door pockets
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Automatic activation of the hazard warning lights (and unlocking of the doors after deployment of the airbag and seatbelt tensioner)
- Hill Start Assist
- Roof design line in chrome
- Decorative strips, Erino/Palladium Medium
- Third brake light
- Electronic brake force distribution (EBD)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Luggage compartment cover
- Cruise control with intelligent speed limiter (The intelligent speed limiter, in conjunction with traffic sign recognition, allows for rapid speed adjustment)
- Interior lighting, front and rear (with reading lights front and rear - luggage compartment lighting)
- Dual-zone automatic climate control including rear footwell heating (with separate temperature control for driver and front passenger - manual recirculation - automatic air distribution - sun sensor - particle and odor filter)
- Leather steering wheel, flat-bottomed, with steering wheel remote control
- Center armrest, sliding, front, including storage compartment and cup holder
- Park & Go (reversing camera - automatic parking assistant (recognition of parallel and perpendicular parking spaces at speeds below 20 km/h, exiting parallel parking spaces, automatic steering of the vehicle), including parking pilot, front and rear parking aid with audiovisual warning - electrically folding exterior mirrors - blind spot warning in both exterior mirrors (active between 12 km/h and 140 km/h))
- Quickheat heating system
- Radio accessories: Digital radio reception DAB+ (Offers a wider selection of radio programs. Digitally broadcast radio stations and traffic information can be received.)
- Rain sensor
- Tire pressure warning
- Wheels: Light alloy 7.5 J x 18 with 5 double spokes in BiColor/Black (with tires 225/55 R 18)
- Wheels: Tire repair kit (with tire sealant and 12-volt compressor (without jack))
- Rear view camera
- Storage compartments (storage compartment in the instrument panel, driver's side - storage compartment in the center console, front - storage compartment in the front doors, suitable for 1.5-liter beverage bottles - storage compartment in the rear doors, suitable for 1.0-liter beverage bottles - illuminated glove compartment with cooling and heating function - bag hooks, on the side in the luggage compartment - lashing eyes in the luggage compartment)
- Exterior mirrors, electrically adjustable and heated, electrically folding (exterior mirror housing in black)
- On-board computer
- Decor: Opel Vizor with chrome frame
- Diesel particulate filter with SCR and oxidation catalyst
- Electric parking brake
- Electronic Stability Program Plus (ESP Plus)
- Front collision warning (with automatic emergency braking, pedestrian detection, active lane keeping assist, traffic sign recognition, driver drowsiness detection)
- Transmission: 8-speed automatic
- Heated rear window
- Rear window wiper
- Interior rearview mirror, automatically dimming
- Child safety lock in the rear doors, manual
- Rear headrests (3), height adjustable
- Front headrests, height adjustable
- LED headlights (LED taillights - LED front turn signals - manual headlight range control - high beam assist)
- Steering wheel, height and reach adjustable
- Illuminated makeup mirror in sun visor, for driver and front passenger
- Package: Comfort package (Park pilot, front and rear parking aid with acoustic warning signal - electrically folding exterior mirrors)
- Automatic parking assistant (detection of parallel and perpendicular parking spaces at a driving speed below 20 km/h - exiting from parallel parking spaces, automatic steering of the vehicle - incl. park pilot, front and rear parking aid, with audiovisual warning)
- Front and rear parking sensors
- Radio: Multimedia Radio Pro (with 10" touchscreen and fully digital 12" driver information display - Bluetooth audio streaming - Automatic music recognition - Hands-free system - Phonebook and call list display - Smartphone integration via Apple CarPlay and Android Auto - Display and operation of selected apps and functions via the 7" touchscreen or voice control, e.g., navigation, music, telephone - Text message reading and dictation - Steering wheel controls - 6 speakers, 4 x 20 watts, FM/AM - USB - Dual tuner - Graphic equalizer)
- Speed-sensitive power steering
- Seats: Rear seat backrest split 40:60 and foldable
- Solar Protect heat-insulating glazing (heavily tinted, in the rear)
- Lane departure warning (warning in case of unintentional lane departure from 60 km/h via warning tone and indicator light in the driver information display)



- Seat belts (three-point seat belts in all seats - height-adjustable seat belts, front - belt force limiters, front and rear outer seats - double belt tensioners, front - belt tensioners, rear outer seats - warning tone and light for unfastened seat belts, front and rear)
- Start/Stop System (Reinforced starter motor - High-performance battery - Switch to deactivate the start/stop function)
- Blind spot warning system
- Immobiliser
- Central locking with remote control and interior switches

- 12-volt power outlet (in the center console, front)
- Bumpers and side panels in high-gloss black
- Pre-wiring for ISOFIX child seat mounting system, including top tether attachment points, rear outer (and for ISOFIX child seat mounting system on the front passenger seat)

Extra equipment

- Paint finish: Uni Jade White
- safety net
- Seats: Ergonomic active seats with AGR seal of approval, driver and front passenger (length, height and backrest angle manually adjustable - seat tilt electrically adjustable - lumbar support, electro-pneumatically adjustable in height and length - extendable thigh support, manually adjustable - pocket on front seat back - all seats in Alcantara, black including seat contact surfaces and partial door panels (second row center seat, headrests, seat bolsters in imitation leather) - FlexFold rear seat backrest split 40:60 and foldable - winter equipment)

- Package: Business Premium Package (IntelliLux LED Pixel Matrix Light: Adaptive LED matrix headlights with individual light distribution and the following functions: City light, motorway light, country road light, static cornering light, turning light, parking function light, high beam: traffic-dependent dimming taking into account preceding and oncoming road users, automatic headlight range control, fog lights - Multimedia Navi Pro)
- Phone: Wireless Charging (Wireless charging of smartphones in the center console)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid (Mehrkosten nach Demontage möglich) - Glued / labelled - De-glue / neutralise
2	Body	Firewall trim (Mehrkosten möglich) - Damage caused by marten / rodent - Replace
3	Rear bumper	Rear bumper - Scratch(es) - Smart repair
4	Side panel - rear right side	Side panel - Scratch(es) - Smart repair
5	Side panel - rear right side	Wheel well extension - Scratched - Paint
6	Wheel / tyres	Alloy rim - rear right side - Scratched - Replace
7	Seat - front	Seat cover - left side - Broken / torn - Replace
8	Door - rear right side	Door (inkl. Zierleiste Tür unten erneuern) - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim (kein Bestandteil der Ausstattung) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side - left, Provided by user / customer, from 11 Dec 2024	8.985,06 €

Repainting

No.	Repainting
1	Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - left side	133 µm	Side panel - rear left side	193 µm
Door - rear left side	262 µm	Door - front left side	164 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Comments

- Der Winterradsatz ist kein Bestandteil der Ausstattungsliste.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

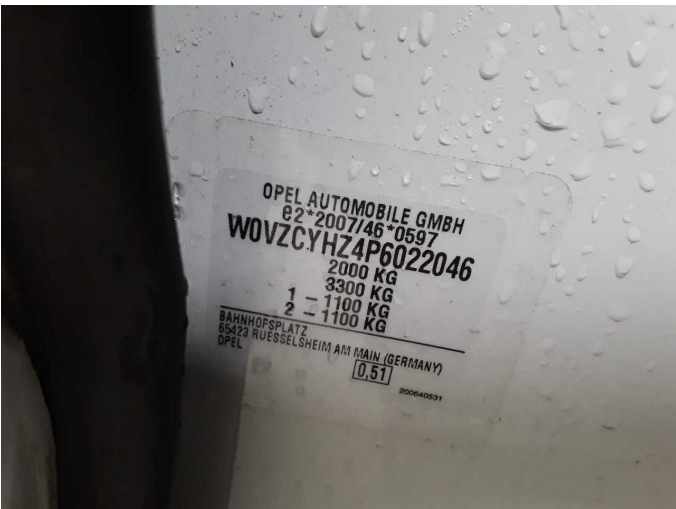


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres

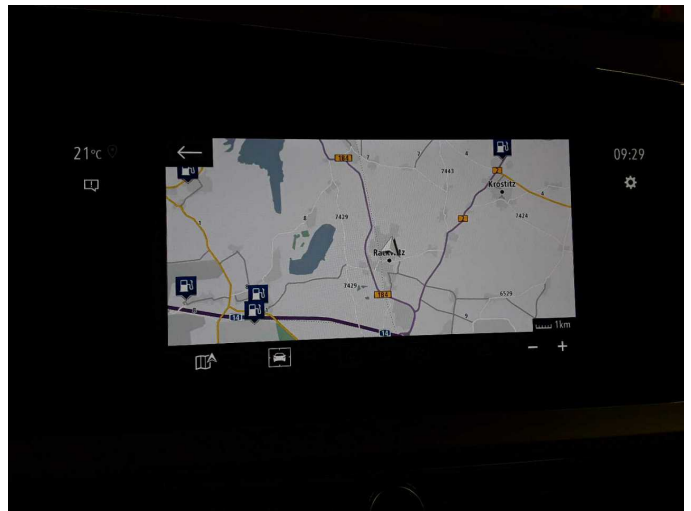


Figure 16: Navigation



Figure 17: Misc.

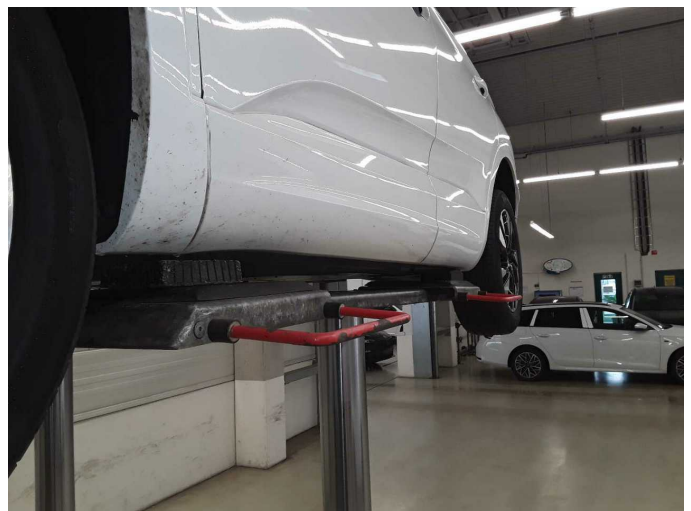


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

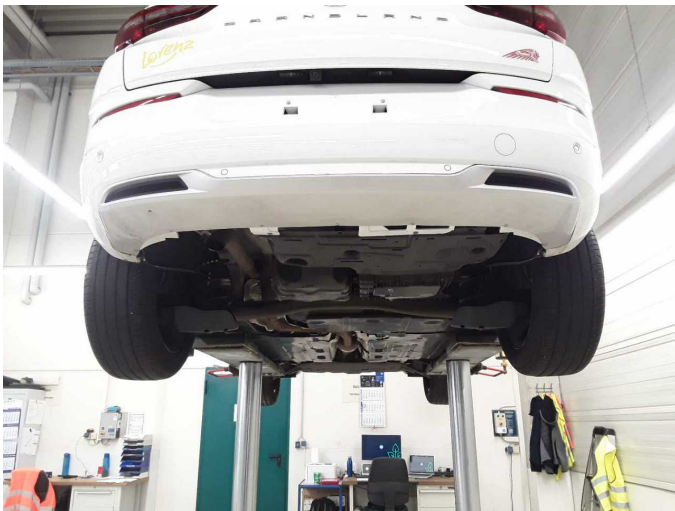


Figure 21: Misc.

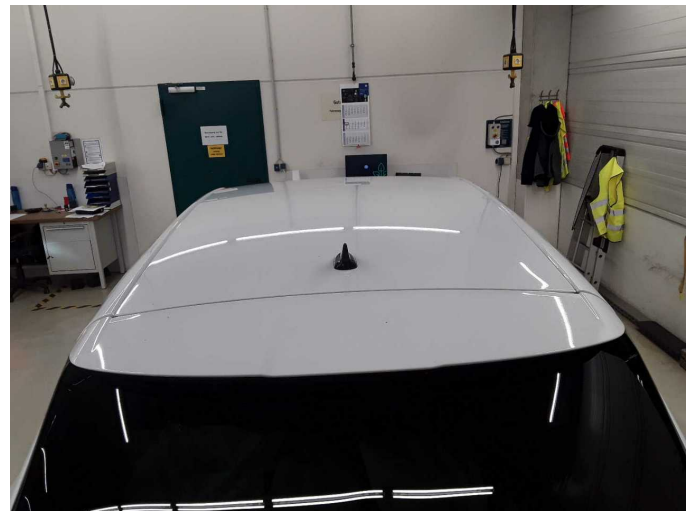


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.




Damage 1: Boot lid / rear door: Boot lid (Mehrkosten nach Demontage möglich) - Glued / labelled - De-glue / neutralise




Damage 1: Boot lid / rear door: Boot lid (Mehrkosten nach Demontage möglich) - Glued / labelled - De-glue / neutralise



Damage 1: Boot lid / rear door: Boot lid (Mehrkosten nach Demontage möglich) - Glued / labelled - De-glue / neutralise

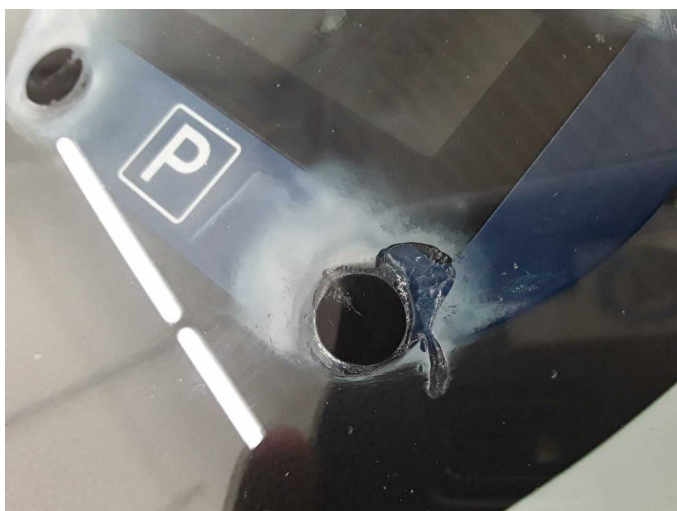

Damage 1: Boot lid / rear door: Boot lid (Mehrkosten nach Demontage möglich) - Glued / labelled - De-glue / neutralise

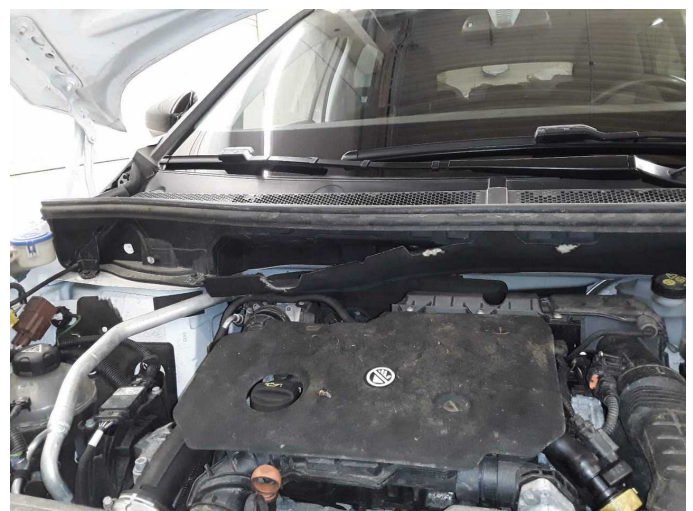

Damage 2: Body: Firewall trim (Mehrkosten möglich) - Damage caused by marten / rodent - Replace



Damage 2: Body: Firewall trim (Mehrkosten möglich) - Damage caused by marten / rodent - Replace



Damage 2: Body: Firewall trim (Mehrkosten möglich) - Damage caused by marten / rodent - Replace



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Smart repair




Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 5: Side panel - rear right side: Wheel well extension - Scratched - Paint



Damage 5: Side panel - rear right side: Wheel well extension - Scratched - Paint

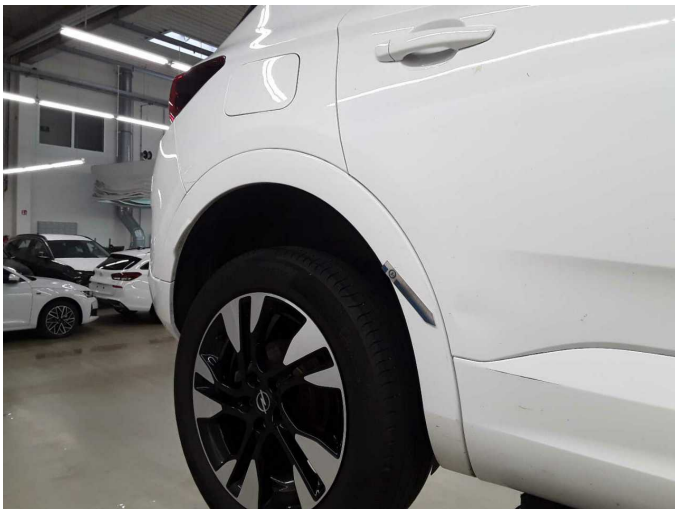

Damage 5: Side panel - rear right side: Wheel well extension - Scratched - Paint



Damage 5: Side panel - rear right side: Wheel well extension - Scratched - Paint



Damage 5: Side panel - rear right side: Wheel well extension - Scratched - Paint



Damage 6: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Damage 6: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace




Damage 7: Seat - front: Seat cover - left side - Broken / torn - Replace




Damage 7: Seat - front: Seat cover - left side - Broken / torn - Replace



Damage 7: Seat - front: Seat cover - left side - Broken / torn - Replace

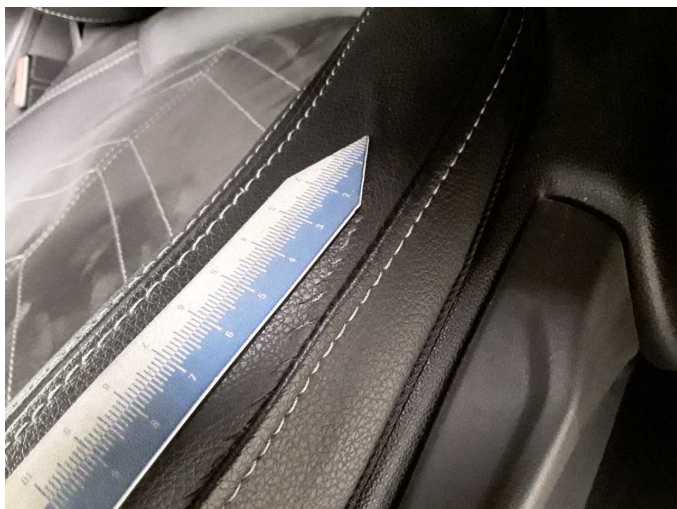

Damage 7: Seat - front: Seat cover - left side - Broken / torn - Replace

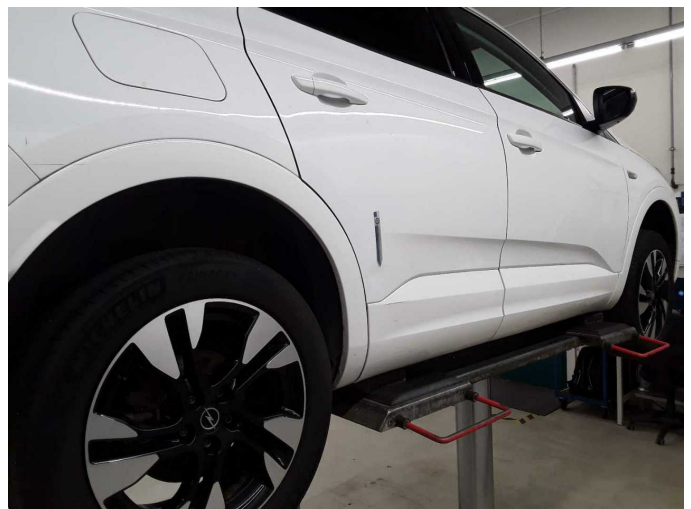

Damage 8: Door - rear right side: Door (inkl. Zierleiste Tür unten erneuern) - Dent / paintcoat damage - Repair and paint



Damage 8: Door - rear right side: Door (inkl. Zierleiste Tür unten erneuern) - Dent / paintcoat damage - Repair and paint




Damage 8: Door - rear right side: Door (inkl. Zierleiste Tür unten erneuern) - Dent / paintcoat damage - Repair and paint



Damage 8: Door - rear right side: Door (inkl. Zierleiste Tür unten erneuern) - Dent / paintcoat damage - Repair and paint



Wear and tear 1: 2nd wheel set: 1 alloy rim (kein Bestandteil der Ausstattung) - Scratch(es) - No deduction

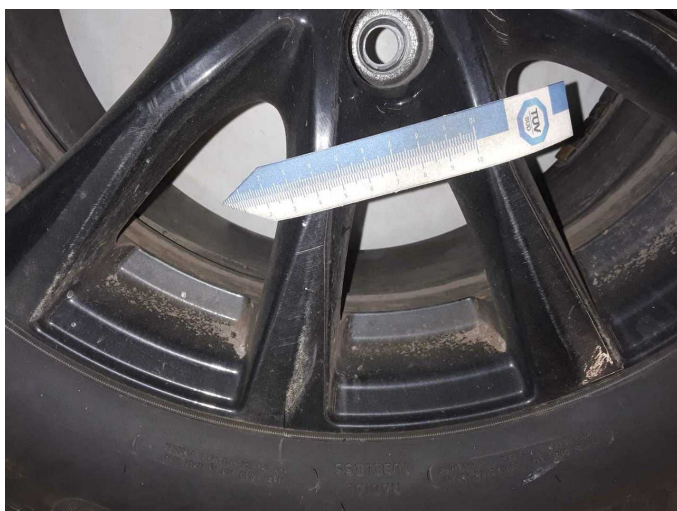

Wear and tear 1: 2nd wheel set: 1 alloy rim (kein Bestandteil der Ausstattung) - Scratch(es) - No deduction



Repainting 1: Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side



Mudguard - left side: 133 µm



Side panel - rear left side: 193 µm



Side panel - rear left side: 193 µm



Door - rear left side: 262 µm



Door - rear left side: 262 µm



Door - front left side: 164 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VZCYHZ4P6022046

Hersteller / Modell: OPEL OPEL Grandland 1.5 D Automatik Business Elegance

Datum	KM-Stand	Beschreibung
04.02.2026	73.318	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
27.08.2025	63.028	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
22.11.2024	52.621	Kraftstofffilter ern; Luftfiltereinsatz ern; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
03.05.2024	40.953	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
26.02.2024	30.819	Regelwartungsdienst
18.12.2023	21.483	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges