



Expertise

Protocol number: 46471221
Order No. / Reference: 26611787
Inspection date: 13 Jul 2026

Manufacturer: Opel

Model: Grandland Plug-in-Hybrid 1.6 DI Automatik Elegance

VIN: W0VZ4DGZ5P6005182



ALPHABET



ALPHABET

Vehicle details

Manufacturer / Type / Model / Equipment

Opel Grandland Plug-in-Hybrid 1.6 DI Automatik Elegance

Vehicle Identification number	W0VZ4DGZ5P6005182
Mileage (Read)	92,915 km
First registration	21 Feb 2023
Number of holders	1
Next periodical technical inspection	01/2028
(Report on hand)	

Power / Engine displacement	133 kw / 1,598 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV

Colour / colour code	Quarz Silber
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black

Re-import	no
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	7 Monat(e)
Last service on / at	01/2026 at 82,233 km		
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ369755
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	1844 / ALW 00036		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,310 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102Y	Summer tyres on Light alloy	Pirelli	7mm / 7mm
2)	225/55 R18 102Y	Summer tyres on Light alloy	Pirelli	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102V	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/55 R18 102V	Winter tyres on Light alloy	Pirelli	3mm / 3mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 2 ignition keys, both foldable
- Driver and passenger side airbags
- Airbag: Front and side airbags
- Airbag: Head airbags, front and rear outer
- Active pedestrian warning tone (AVAS) (ambient noise up to a driving speed of 50 km/h)
- Aluminum sports pedals
- Ambient lighting, center console and in the front doors
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Exterior mirrors, electrically adjustable and heated, electrically folding (exterior mirror housing in black)
- Hill Start Assist
- Roof design line in chrome
- Decor: Opel Vizor with chrome frame
- Decoration: Hybrid lettering
- Display: Fully digital 12" color driver information display (specific plug-in hybrid displays - charging time, driving mode information, range and overall charge status - energy consumption display and energy flow diagram - charging area and consumption statistics - battery charge level indicators - charging stations via navigation)
- Electronic brake force distribution (EBD) and (ESP Plus) as well as (TC Plus) ((EBD) and Electronic Stability Program Plus (ESP Plus) as well as traction control (TC Plus))
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Luggage compartment cover
- Transmission: 8-speed automatic
- Rear window wiper
- Interior lighting, front and rear (with reading lights front and rear - luggage compartment lighting)
- Interior rearview mirror, automatically dimming
- Child safety lock in the rear doors, manual
- Dual-zone automatic climate control including rear footwell heating (with separate temperature control for driver and front passenger - manual recirculation - automatic air distribution - sun sensor - particle and odor filter)
- Charging cable: Mode 2 charging cable (Type 2, up to 1.8 kW/8 A), 6 m length, for household sockets)
- LED headlights (LED taillights - LED front turn signals - manual headlight range control - high beam assist)
- Steering wheel, height and reach adjustable
- Illuminated makeup mirror in sun visor, for driver and front passenger
- My Opel App (with hybrid-specific functions: - Battery charge level indicator, charging time and range monitoring - Remote control of climate control and charging settings - E-Mobility Coaching)
- Storage compartments (storage compartment in the instrument panel, driver's side - storage compartment in the center console, front - storage compartment in the front doors, suitable for 1.5-liter beverage bottles - storage compartment in the rear doors, suitable for 1.0-liter beverage bottles - illuminated glove compartment with cooling and heating function - bag hooks, on the side in the luggage compartment - lashing eyes in the luggage compartment)
- Automatic activation of the hazard warning lights (and unlocking of the doors after deployment of the airbag and seatbelt tensioner)
- On-board computer
- Decor: Opel Blitz, "Grandland" lettering on the rear and high-gloss black surround for air intakes
- Decorative strips, Erino/Palladium Medium
- Tachometer
- Third brake light
- Electric parking brake
- Electric air conditioning compressor and heater (remote control of the air conditioning, heating or cooling of the interior during the charging process to relieve the battery at the start of the journey)
- Chassis: Driving modes (with 4 adjustable driving modes: Electric mode (standard mode), Sport mode, Hybrid mode and All-wheel drive mode (All-wheel drive mode not with front-wheel drive))
- Forward Collision Warning (monitors the distance (close, medium, far) to the vehicle ahead; if approaching a vehicle ahead or a pedestrian too quickly, a warning tone is sounded and a message appears in the driver information display. - with automatic emergency braking and pedestrian detection - Lane Keeping Assist: warns if the vehicle unintentionally leaves its lane - Traffic Sign Recognition - Driver Drowsiness Detection - Automatic Speed Assist with Stop Function)
- Rear headrests (3), height adjustable
- Front headrests, height adjustable
- Paint finish: Metallic Ruby Red
- Charging port (rear left with access to the power charging socket)
- Flat-bottomed leather steering wheel with steering wheel remote control and paddle shifters.
- Steering wheel: Heated leather steering wheel
- Center armrest, sliding, front, including storage compartment and cup holder
- Onboard charger (vehicle-integrated charging unit, single-phase (max. 3.7 kW/16 A))
- Otto particulate filter
- Park & Go (reversing camera - automatic parking assistant (recognition of parallel and perpendicular parking spaces at speeds below 20 km/h, exiting parallel parking spaces, automatic steering of the vehicle), including parking pilot, front and rear parking aid with audiovisual warning - electrically folding exterior mirrors - blind spot warning in both exterior mirrors (active between 12 km/h and 140 km/h))



- Radio: Multimedia Radio Pro (with 10" touchscreen and fully digital 12" driver information display - Bluetooth audio streaming - Automatic music recognition - Hands-free system - Phonebook and call list display - Smartphone integration via Apple CarPlay and Android Auto - Display and operation of selected apps and functions via the 7" touchscreen or voice control, e.g., navigation, music, telephone - Text message reading and dictation - Steering wheel controls - 6 speakers, 4 x 20 watts, FM/AM - USB - Dual tuner - Graphic equalizer)
- Regenerative braking system
- Tire pressure warning
- Wheels: Tire repair kit (with tire sealant and 12-volt compressor (without jack))
- Speed-sensitive power steering
- Seats: Ergonomic active seat with AGR seal of approval, driver (length, height and backrest angle manually adjustable - seat tilt electrically adjustable - lumbar support electropneumatically adjustable in height and length - extendable thigh support, manually adjustable - pocket on front seat back - all seats in Track Black fabric)
- Specific electric shift lever
- Start/Stop System (Reinforced starter motor - High-performance battery - Switch to deactivate the start/stop function)
- Pre-wiring for ISOFIX child seat mounting system, including top tether attachment points, rear outer (and for ISOFIX child seat mounting system on the front passenger seat)

Extra equipment

- Package: Ultimate Package (Roof and exterior mirrors, diamond black - Keyless locking and start system "Keyless open & start" - IntelliLux LED Pixel Matrix lights - Navi 5.0 Intellilink - Decorative trim strips, Dax/Palladium Medium)
- Seats: Ergonomic active seats with AGR seal of approval, driver and front passenger (length, height, and backrest angle manually adjustable; seat tilt electrically adjustable; electro-pneumatic lumbar support adjustable in height and length; extendable thigh support, manually adjustable; pocket on front seat back; all seats in black Track fabric; FlexFold rear seat backrest, 40:60 split and foldable, rear center armrest + pass-through for winter storage; front seat heating, multi-stage; partially heated windshield (with wipers); heated steering wheel)

- Radio accessories: Digital radio reception DAB+ (Offers a wider selection of radio programs. Digitally broadcast radio stations and traffic information can be received.)
- Rain sensor
- Wheels: Light alloy 7.5 J x 18 with 5 double spokes in BiColor/Black (with tires 225/55 R 18)
- Keyless Start system
- Seat belts (three-point seat belts in all seats - height-adjustable seat belts, front - belt force limiters, front and rear outer seats - double belt tensioners, front - belt tensioners, rear outer seats - warning tone and light for unfastened seat belts, front and rear)
- Seats: Rear seat backrest split 40:60 and foldable
- Solar Protect heat-insulating glazing (heavily tinted, in the rear)
- 12-volt power outlet (in the center console, front)
- Bumpers and side panels in high-gloss black
- Underride protection look, front and rear, in silver
- Immobiliser
- Central locking with remote control and interior switches

- Detachable trailer hitch (trailer stability program)
- Onboard charger (vehicle-integrated charging unit, single-phase (max. 7.4 kW/32 A))
- Package: Design Package (Roof in Diamond Black - Roof rails in Diamond Black)
- Package: Technology Package (Keyless locking and starting system "Keyless open & start" - Electric tailgate)
- Phone: Wireless Charging (Wireless charging of smartphones in the center console)
- safety net
- Wheels: Light alloy 7.5 J x 18 with 5 spokes in grey (all-weather tires 225/55 R 18)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Front bumper	Spoiler - Scratched - Cover / polish
2	Door - front left side	Door - Scratch(es) - Smart repair
3	Front bumper	Front bumper - Scratched - Smart repair
4	Wing mirror - right side	Cap - Scratch(es) - Paint
5	Front bumper	Spoiler (Zierleiste re) - Scratched - Paint
6	Mudguard - right side	Mudguard - right side - Scratch(es) - Paint
7	Side panel - rear left side	Side panel - Scratch(es) - Paint
8	Bonnet	Bonnet - Dent / paintcoat damage - Paint

Wear and tear

No.	Component group	Description
1	2nd wheel set	2 tyres - Does not meet the leasing specifications - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 25 Mar 2026	1.705,56 €
2	Rear, Provided by user / customer, from 20 Mar 2026	3.081,58 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN

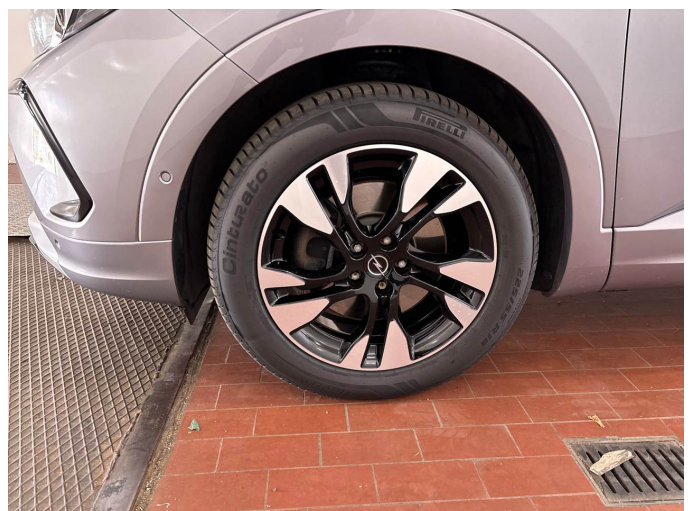


Figure 12: Mounted tyres



Figure 13: Documents

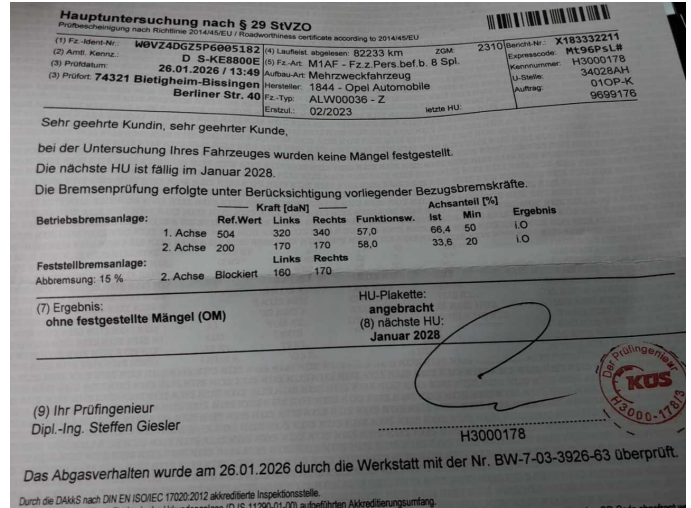


Figure 14: Documents



Figure 15: Documents

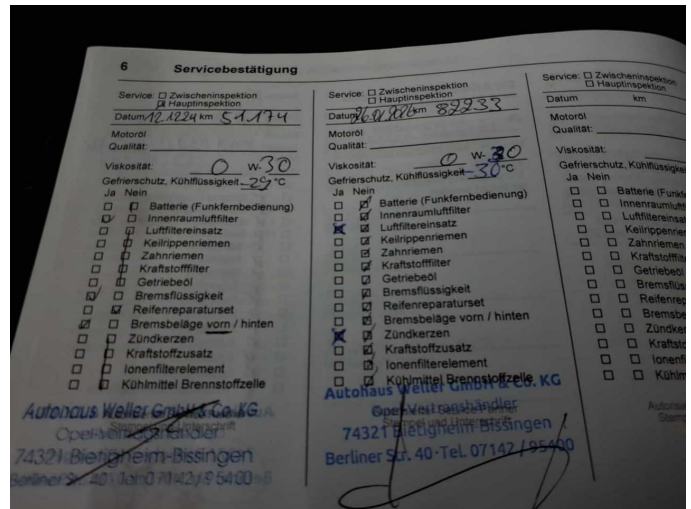


Figure 16: Documents

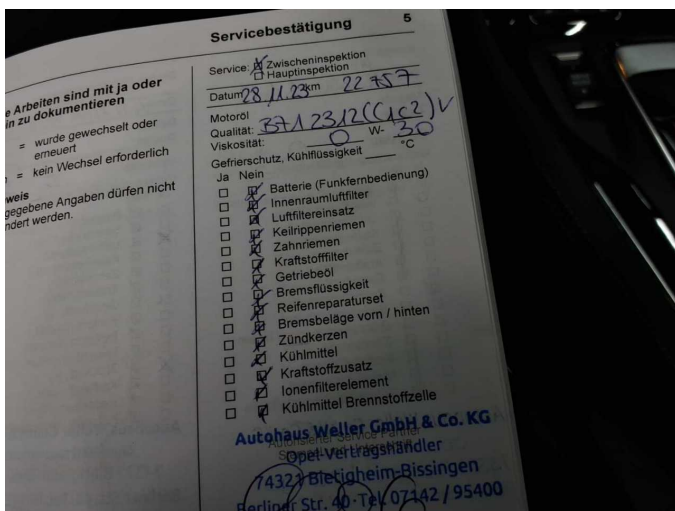


Figure 17: Documents

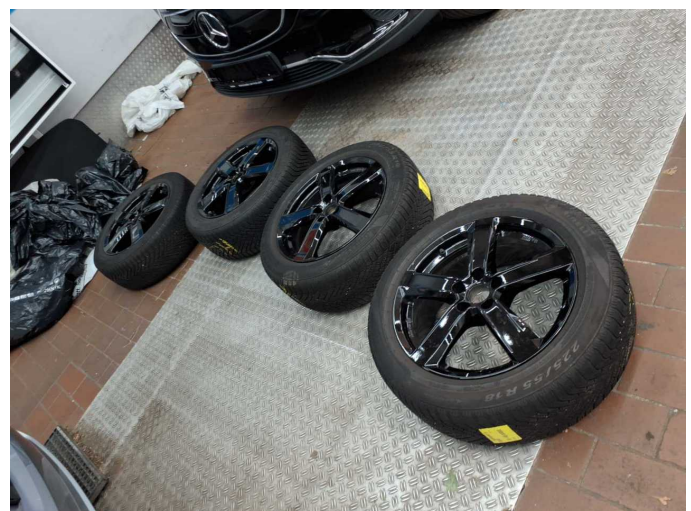


Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.

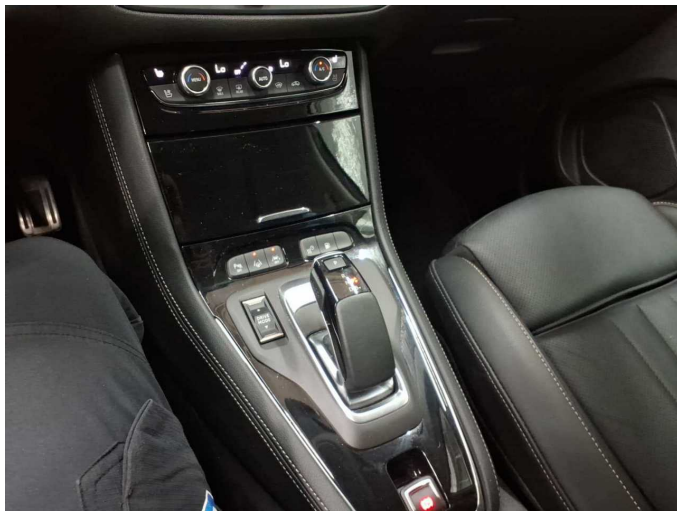


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

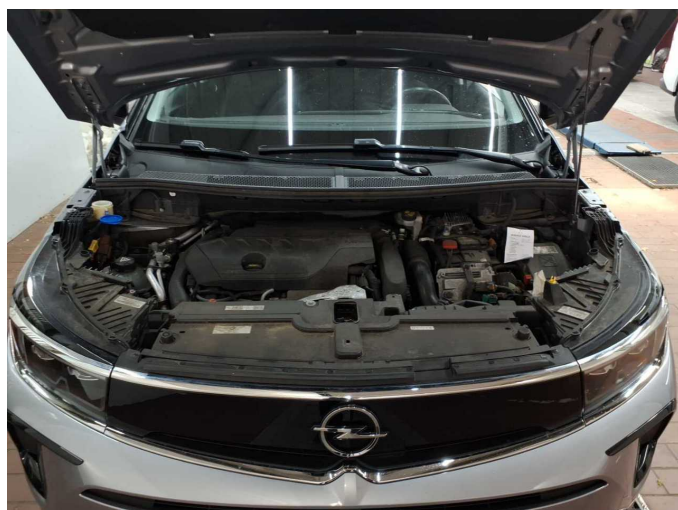


Figure 28: Misc.

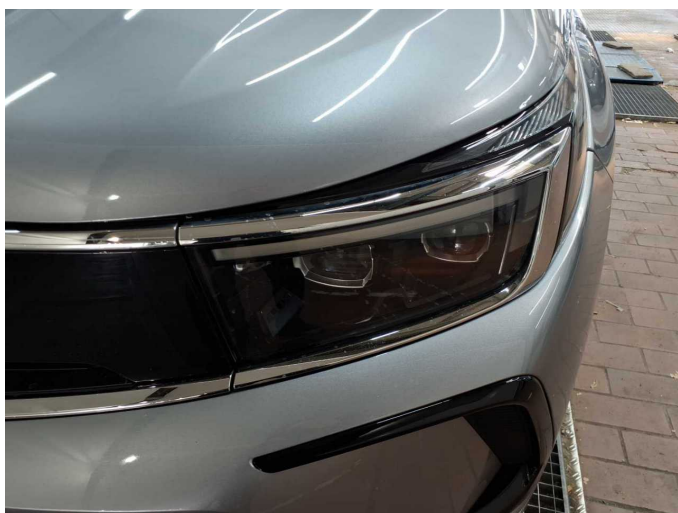


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

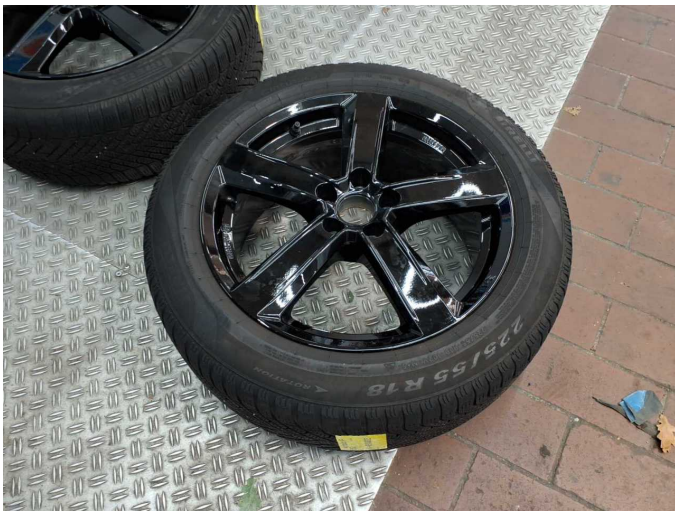


Figure 33: Misc.



Figure 34: Misc.




Figure 35: Misc.



Damage 1: Front bumper: Spoiler - Scratched - Cover / polish



Damage 1: Front bumper: Spoiler - Scratched - Cover / polish

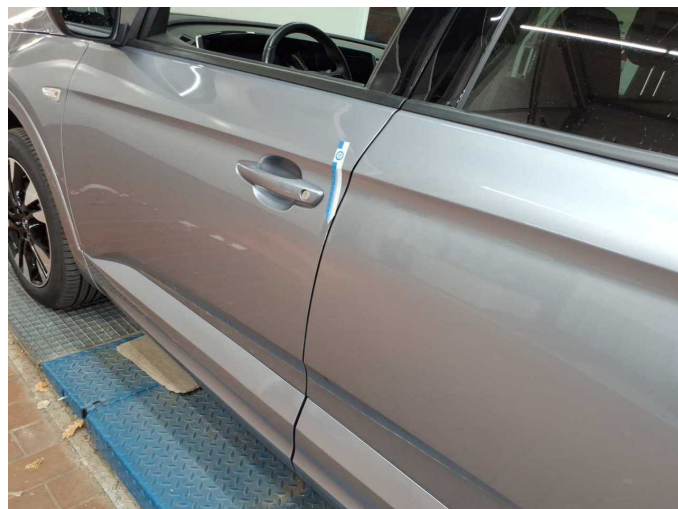

Damage 2: Door - front left side: Door - Scratch(es) - Smart repair



Damage 2: Door - front left side: Door - Scratch(es) - Smart repair



Damage 3: Front bumper: Front bumper - Scratched - Smart repair




Damage 3: Front bumper: Front bumper - Scratched - Smart repair



Damage 4: Wing mirror - right side: Cap - Scratch(es) - Paint



Damage 4: Wing mirror - right side: Cap - Scratch(es) - Paint

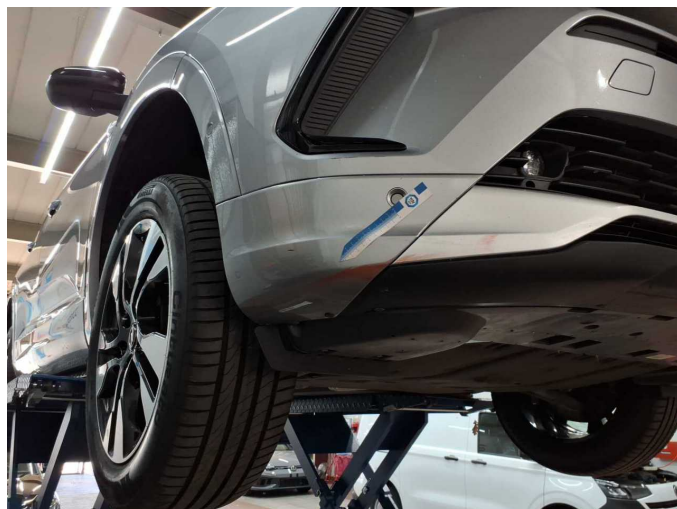

Damage 5: Front bumper: Spoiler (Zierleiste re) - Scratched - Paint



Damage 5: Front bumper: Spoiler (Zierleiste re) - Scratched - Paint



Damage 6: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint



Damage 6: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint



Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 8: Bonnet: Bonnet - Dent / paintcoat damage - Paint



Damage 8: Bonnet: Bonnet - Dent / paintcoat damage - Paint



Damage 8: Bonnet: Bonnet - Dent / paintcoat damage - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VZ4DGZ5P6005182

Hersteller / Modell: OPEL OPEL Grandland Plug-in-Hybrid 1.6 DI Automatik Ultimate

Datum	KM-Stand	Beschreibung
26.01.2026	82.233	AU; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
12.12.2024	51.174	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
28.11.2023	22.757	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges