



Expertise

Protocol number: 46880776
Order No. / Reference: 26702420
Inspection date: 5 Aug 2026

Manufacturer: Skoda
VIN: TMBJJ7NS2N8035474

Model: Kodiaq 2.0 TDI DSG Sportline



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiaq 2.0 TDI DSG Sportline	
Vehicle Identification number	TMBJJ7NS2N8035474
Mileage (Read)	207,838 km
First registration	17 Mar 2022
Number of holders	1
Next periodical technical inspection	04/2027
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Race Blau Metallic
Doors / Seats	5 / 7
Upholstery type	Cloth / leather combination
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	5,200 km
Last service on / at	01/2026 at 183,010 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ962503
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / ART 02976		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,360 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99V	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/50 R19 99V	Summer tyres on Light alloy	Pirelli	7mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Pirelli	4mm / 4mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Pirelli	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- 12V socket in the center console and in the trunk
- Storage compartments behind the wheel arches in the trunk
- Airbag, driver's knee airbag
- Airbag, head airbags
- Allergen filter
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and driver's side mirrors with automatic dimming
- Hill start assist
- Hydraulic brake assist (HBA)
- Black headliner
- Roof rails, black
- Diesel particulate filter
- Third brake light (in the rear spoiler (LED))
- eCall (automatic emergency call function in case of an accident with airbag deployment)
- ESC Electronic Stability Control
- Driving profile selection
- Chassis: Adaptive chassis DCC including driving profile selection
- High Beam Assist (Light Assist)
- front and rear floor mats
- Closed storage compartment on the driver's side
- Transmission: 7-speed dual-clutch transmission (DSG)
- Illuminated glove compartment
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger, including humidity sensor, odor and allergen filter and air-conditioned glove compartment)
- Paint finish: Special paint finish, solid color
- LED matrix headlights and dynamic high beam assist (Light Assist)
- LED taillights in crystal glass look & LED license plate lights
- Reading lights at the front of the headliner
- Rear center armrest with cup holders and pass-through option
- Engine drag torque control (MSR)
- Multi-collision brake
- Rear parking sensors
- Upholstery: Microfiber Sport-Black
- Radio: Bolero infotainment system (Bolero music system - 8" capacitive color display - voice control)
- Radio accessories: SmartLink (MirrorLink, Android Auto and Apple CarPlay)
- Wheels: 19" alloy wheels Triglav anthracite polished (7Jx19 tires 235/50 R19 99V ET43)
- Rear seat backrest split 60:40, foldable, longitudinally adjustable, backrest angle adjustable
- Electromechanical power steering
- Seats: Heated front and outer rear seats
- Seats: Adjustable lumbar support in the front seats
- Seats: Electrically adjustable front seats with memory function
- Seats: Remote release of the rear seat backrests (2nd row) in the boot
- Storage compartment on the left wheel arch
- front aero windshield wipers
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black with microfiber inlay
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Care Connect: Proactive services (10-year term) (Remote Access (1-year term))
- Dark carbon decorative inlay
- Tachometer
- Easy Start (start-stop button)
- Electronic parking brake including auto-hold function
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor ((tunnel light, coming and leaving home function))
- Electric windows front and rear (including anti-pinch protection and child safety lock)
- Front radar assistant including city emergency braking function with pedestrian detection
- Cruise control
- Tinted windows
- Isofix anchorage on the outer rear seats including top tether
- Boot cover, roll-up and removable
- Front headrests are fixed, rear headrests are height-adjustable.
- LED ambient lighting (decorative strips in the door panels with selectable color climate, LED reading lights in the front, LED lighting for the make-up mirrors in the sun visors)
- Steering wheel: Sport leather steering wheel with multifunction buttons including shift paddles (gear lever with leather elements)
- Front center armrest, including storage compartment
- Multifunction display in the instrument cluster, color
- Fog lights with integrated LED daytime running lights
- Stainless steel pedal design
- Progressive steering
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Wireless SmartLink
- Tire pressure monitoring
- Wheels: RunFlat tires with Seal technology (self-sealing tires)
- Heated windshield washer nozzles, front
- Headlights washer / wiper system
- Kodiahq safety belts (Height-adjustable three-point seat belts in the front, with belt tensioners - Three three-point seat belts in the rear - Belt fastening indicator in the front and in the second row of seats)
- Seats: Height-adjustable front seats



- Sun visor on driver and passenger side with illuminated vanity mirror
- Speed limiter
- Sunset (rear window and rear side windows tinted dark)
- Telephone: Comfort hands-free telephone system including phone box (with inductive charging function (connection via external antenna))
- Front door sill trims
- Lashing eyes in the trunk
- Central locking with remote control (two vehicle keys)

- Skoda Care Connect (SOS emergency call function (eCall, including automatic activation in the event of an accident with airbag deployment) - Mobility service (connection for rapid assistance in case of breakdown) - Information service (connection to the hotline for all questions regarding vehicle functions) - Free remote vehicle access for one year with access to vehicle data/functions via smartphone, e.g., parking position, activating hazard warning lights, current fuel level, etc.)
- Variable fastening concept in the trunk
- Immobiliser

Extra equipment

- Package: Business Columbus (Sportline, RS) (Dynamic radio-navigation system Columbus - 9.2" capacitive color display - Digital instrument cluster (Virtual Cockpit) - Driver fatigue detection - 230V socket and USB charging port (Type-C) on the back of the front center armrest - Acoustic glazing in the front doors - KESSY keyless entry - Electric tailgate operation including comfort opening - Luggage net partition - Infotainment Online (3-year subscription))
- Traveller Plus (DSG) assistance system (Adaptive Cruise Control ACC (control range up to 210 km/h) - Lane Assist, Blind Spot Detection and Parking Assist, Exit Warning - Adaptive Lane Guidance - Park Assist - Traffic Jam and Emergency Assist - Traffic Sign Recognition)
- 360° surround view camera (area view) including reversing camera
- Anti-theft alarm system with SAFE system incl. Kessy & Easy Start (interior monitoring and tilt sensor incl. Kessy & Easy Start)
- Paint finish: Metallic / Pearl effect
- Seats: 3rd row of seats (7-seater), cargo cover in the trunk
- Swiveling trailer hitch (with electric release, including trailer stabilization)
- Trailer Assist (Parking Assist)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trailer hitch	Trailer hitch (lässt sich nicht ausklappen) - Functional / admissibility - Perform diagnosis
2	Side panel - rear right side	Sill - Scratch(es) - Smart repair
3	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
4	Side panel - rear left side	Sill - Dent / paintcoat damage - Repair and paint
5	Rear bumper	Bumper with Parktronic - Scratched - Paint
6	Wheel / tyres	Tyres - complete set (keine Run-Flat verbaut) - Differs from the original configuration - Replace
7	Side panel - rear left side	Side panel - Scratch(es) - Paint
8	Side panel - rear right side	Side panel - Scratch(es) - Paint
9	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint
10	Bonnet	Bonnet (Einätzungen + Dellen) - Paint defect - Repair and paint
11	Roof	Roof (Einätzungen + Dellen) - Paint defect - Repair and paint
12	Vehicle glazing	Windscreen with lane departure assistant - Broken / torn - Replace



Wear and tear

No.	Component group	Description
1	Trim / covers	Trim / covers (Laderaum) - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 29 Apr 2024	1.938,06 €
2	Front, Side right, Provided by user / customer, from 24 Jun 2025	2.611,88 €

Repainting

No.	Repainting
1	Mudguard - right side, Professionally carried out

Paint coat thickness measurement

Mudguard - right side	209 µm
-----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

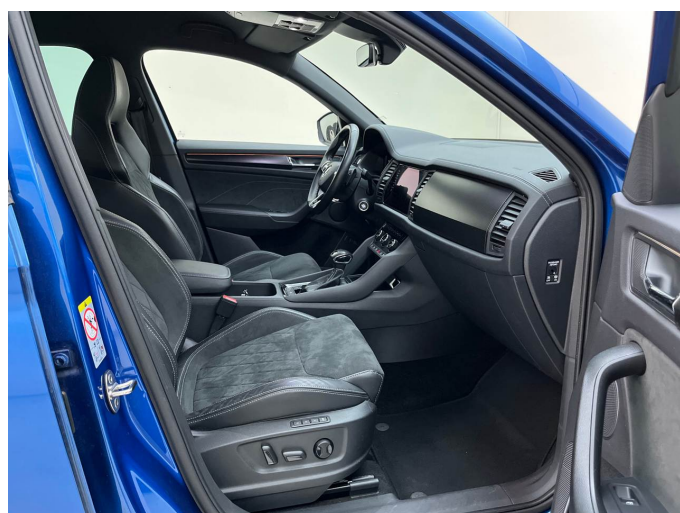


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

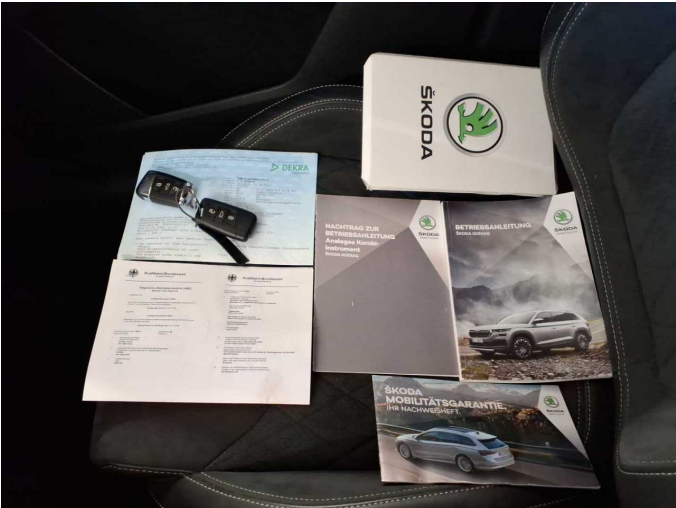


Figure 13: Documents



Figure 14: Documents

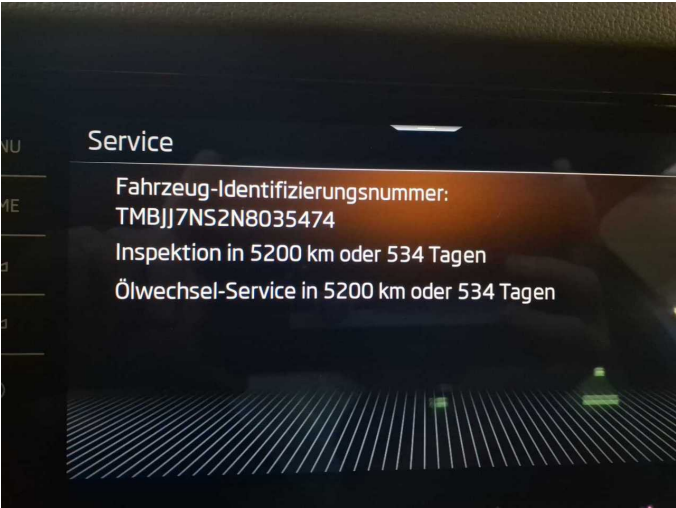


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation

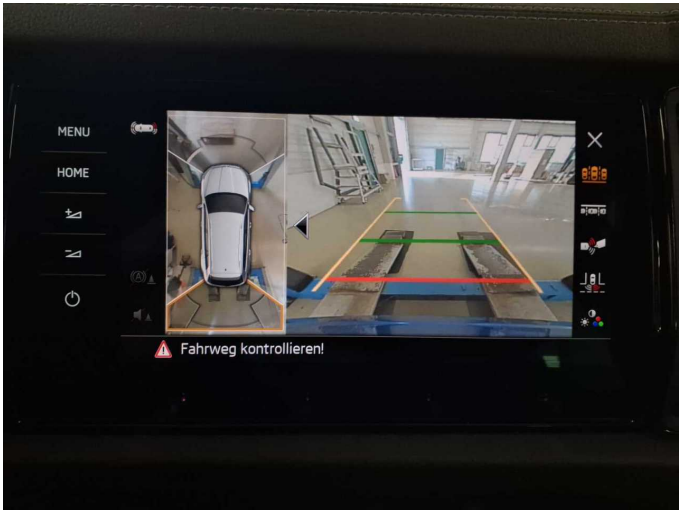


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

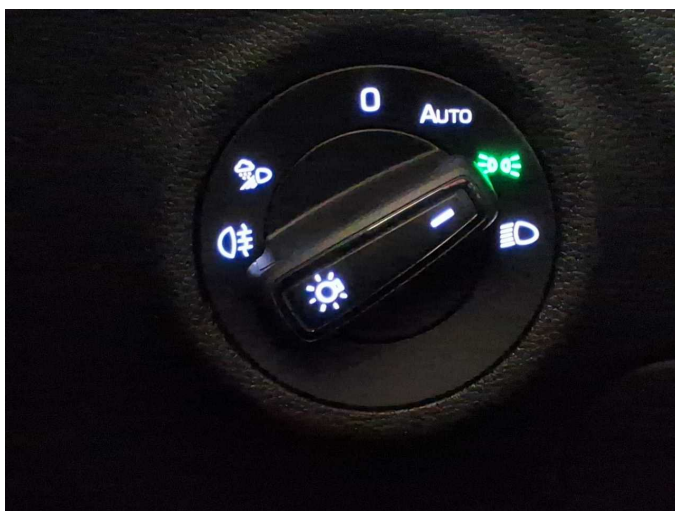


Figure 23: Misc.



Figure 24: Misc.

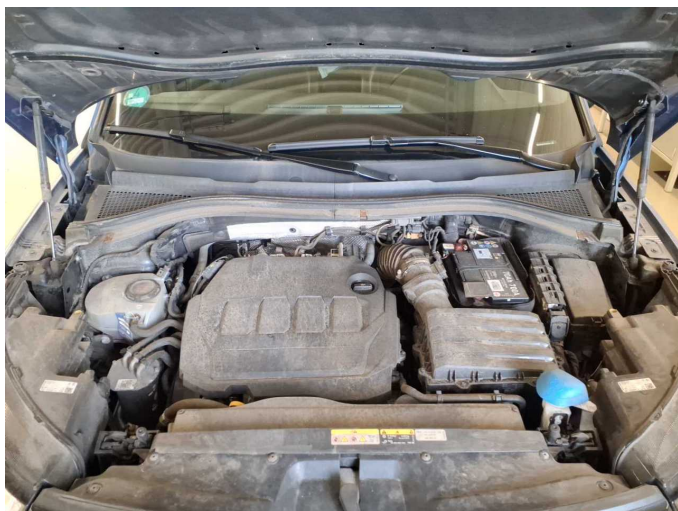


Figure 25: Misc.

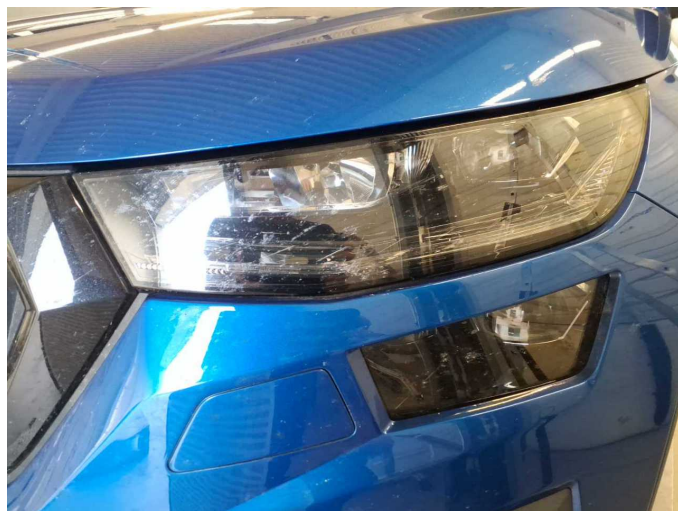


Figure 26: Misc.



Figure 27: Misc.

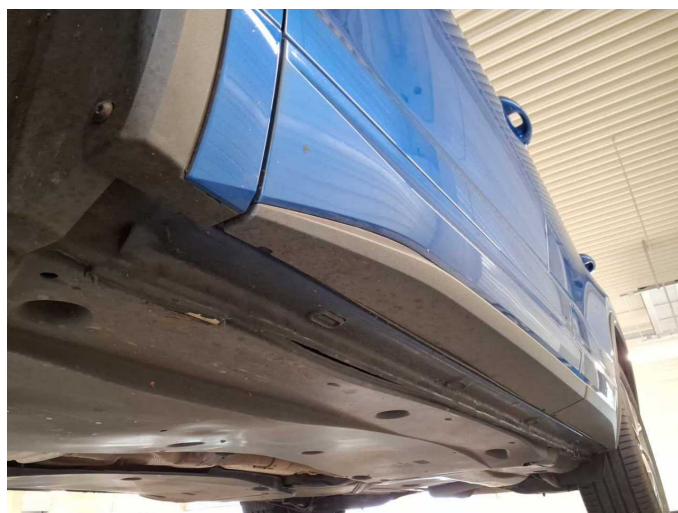


Figure 28: Misc.



Figure 29: Misc.




Figure 30: Misc.




Figure 31: Misc.



Damage 1: Trailer hitch: Trailer hitch (lässt sich nicht ausklappen) - Functional / admissibility - Perform diagnosis

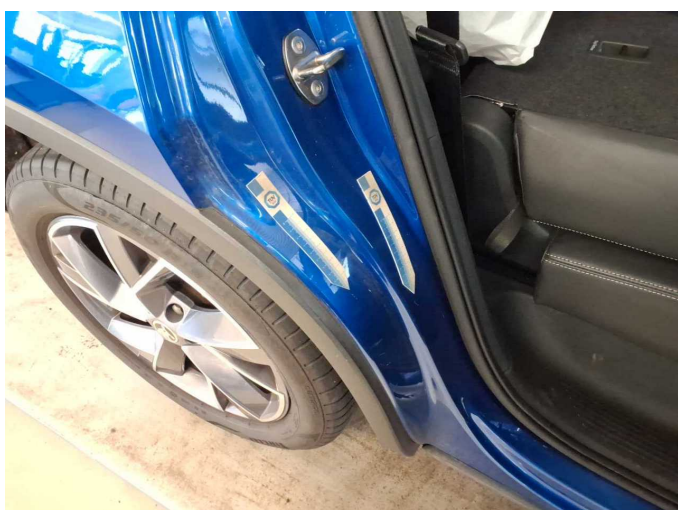

Damage 2: Side panel - rear right side: Sill - Scratch(es) - Smart repair

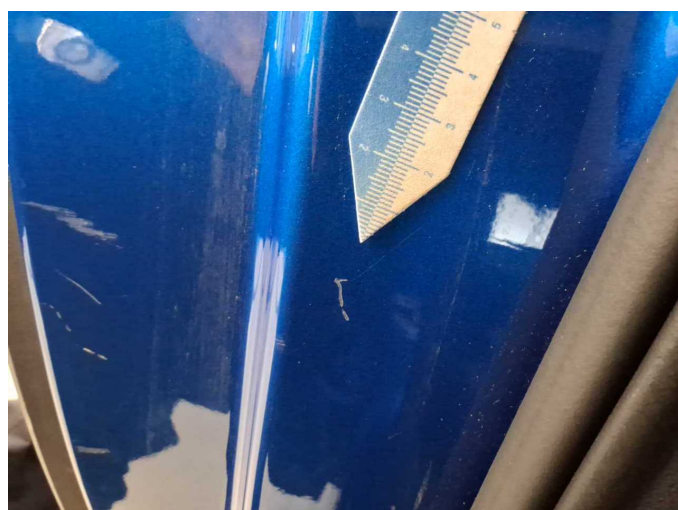

Damage 2: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 2: Side panel - rear right side: Sill - Scratch(es) - Smart repair




Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 4: Side panel - rear left side: Sill - Dent / paintcoat damage - Repair and paint

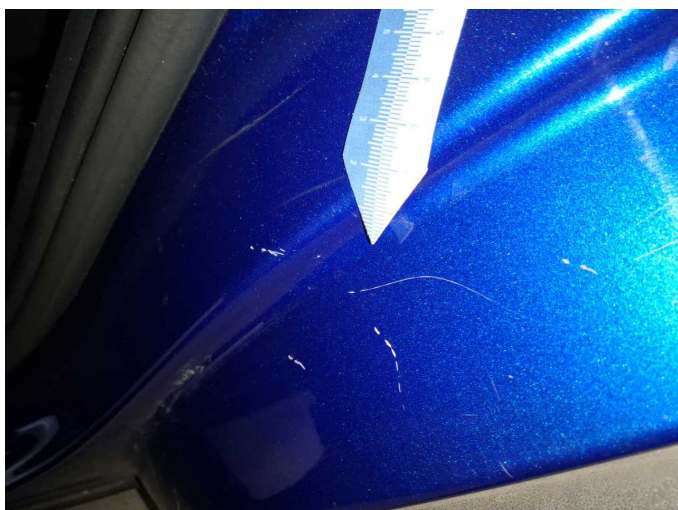

Damage 4: Side panel - rear left side: Sill - Dent / paintcoat damage - Repair and paint



Damage 4: Side panel - rear left side: Sill - Dent / paintcoat damage - Repair and paint




Damage 5: Rear bumper: Bumper with Parktronic - Scratched - Paint




Damage 5: Rear bumper: Bumper with Parktronic - Scratched - Paint



Damage 5: Rear bumper: Bumper with Parktronic - Scratched - Paint

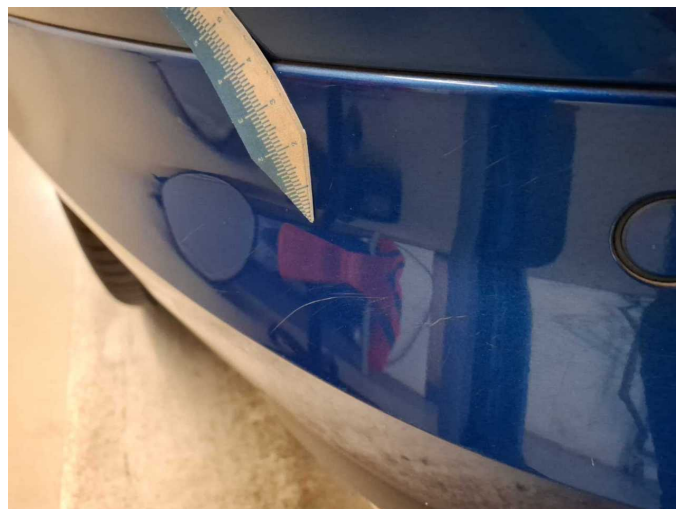

Damage 5: Rear bumper: Bumper with Parktronic - Scratched - Paint

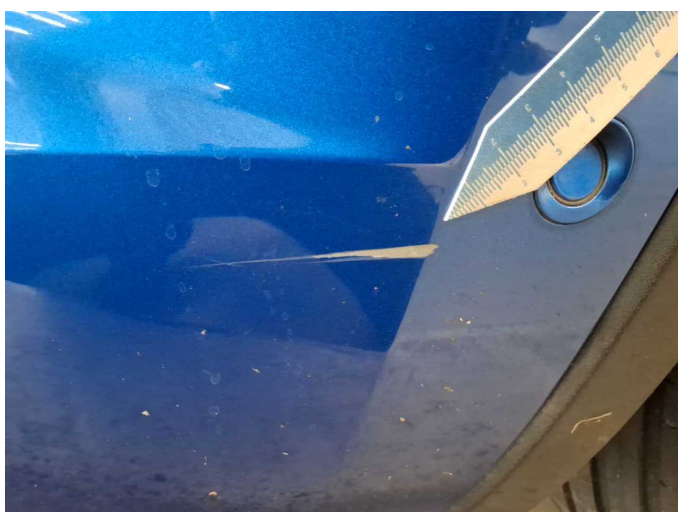

Damage 5: Rear bumper: Bumper with Parktronic - Scratched - Paint



Damage 6: Wheel / tyres: Tyres - complete set (keine Run-Flat verbaut) - Differs from the original configuration - Replace




Damage 6: Wheel / tyres: Tyres - complete set (keine Run-Flat verbaut) - Differs from the original configuration - Replace




Damage 6: Wheel / tyres: Tyres - complete set (keine Run-Flat verbaut) - Differs from the original configuration - Replace




Damage 6: Wheel / tyres: Tyres - complete set (keine Run-Flat verbaut) - Differs from the original configuration - Replace

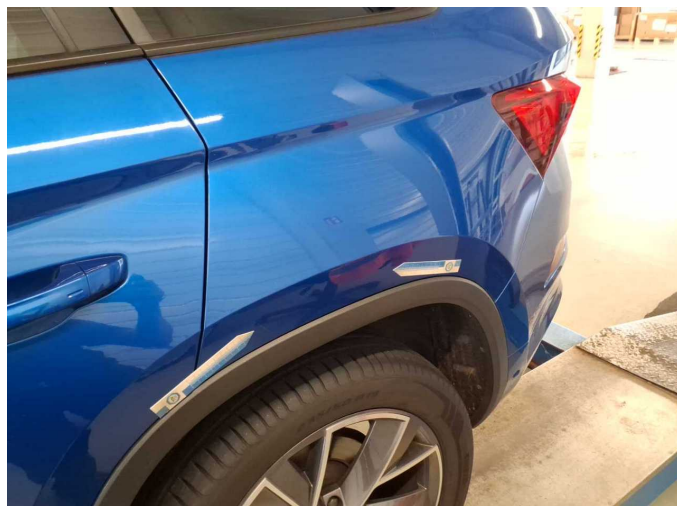

Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint

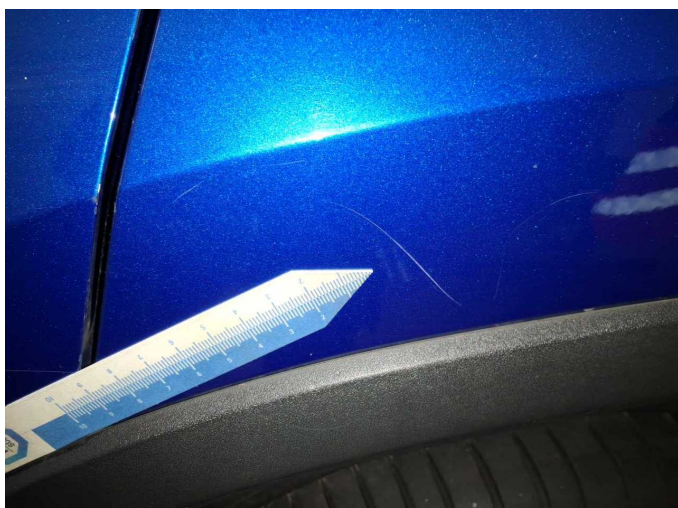

Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint

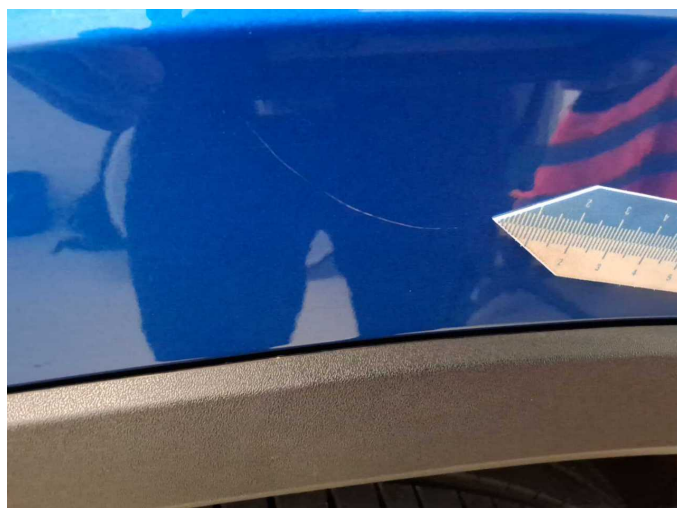


Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 8: Side panel - rear right side: Side panel - Scratch(es) - Paint




Damage 8: Side panel - rear right side: Side panel - Scratch(es) - Paint

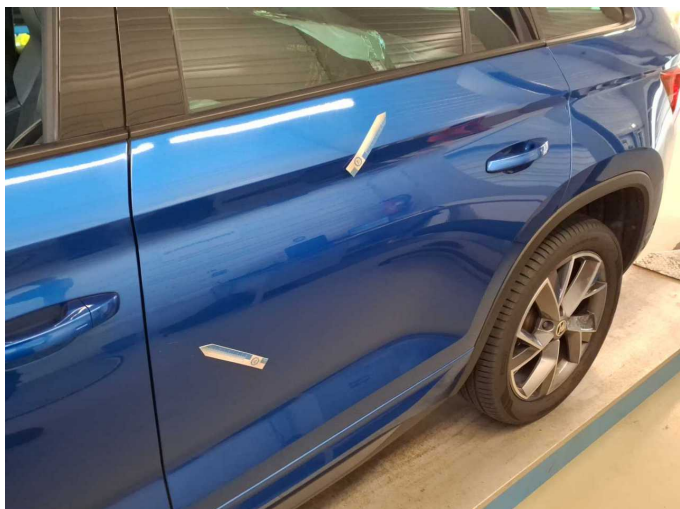


Damage 9: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 9: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

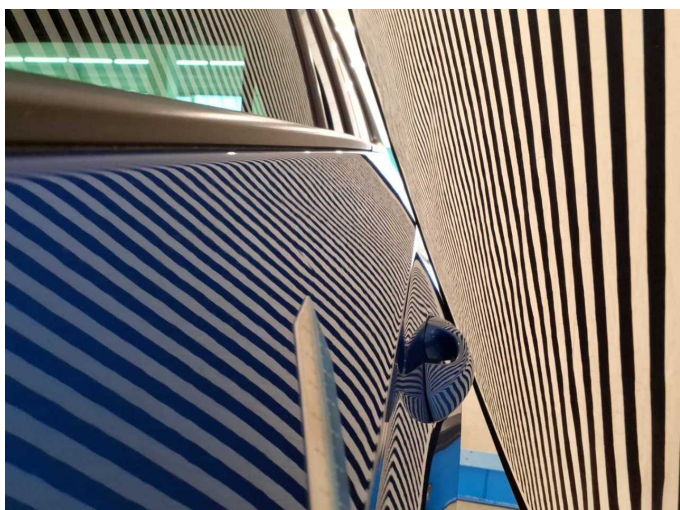

Damage 9: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

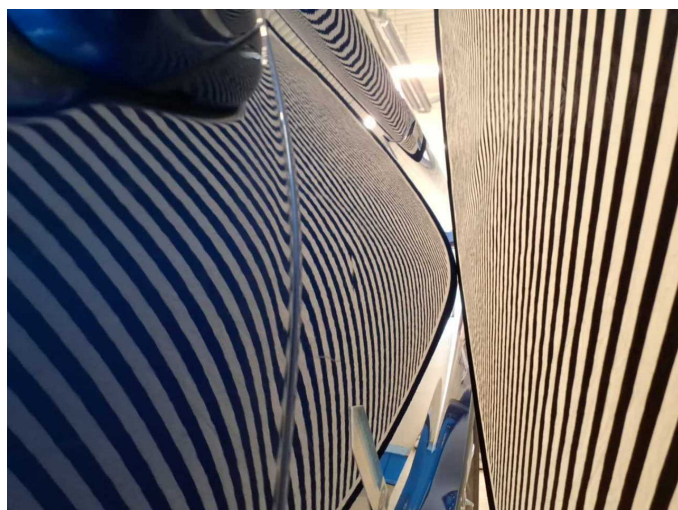


Damage 9: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

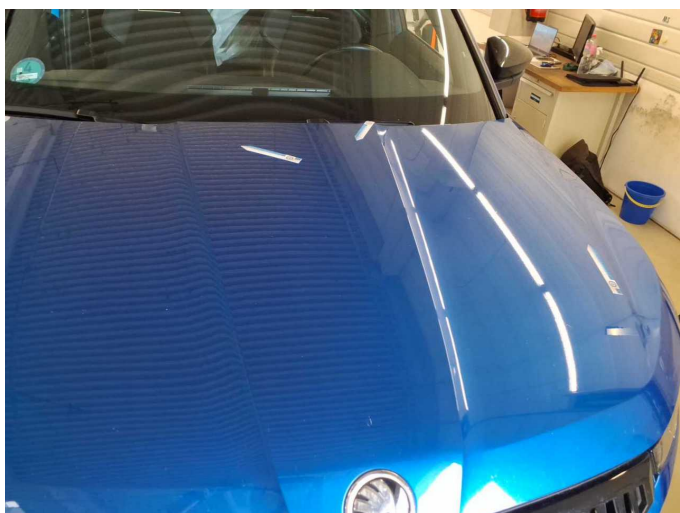

Damage 10: Bonnet: Bonnet (Einätzungen + Dellen) - Paint defect - Repair and paint



Damage 10: Bonnet: Bonnet (Einätzungen + Dellen) - Paint defect - Repair and paint

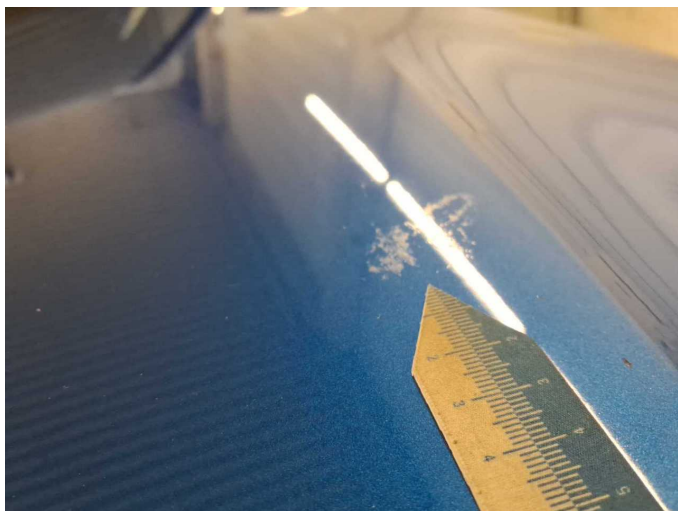

Damage 10: Bonnet: Bonnet (Einätzungen + Dellen) - Paint defect - Repair and paint




Damage 10: Bonnet: Bonnet (Einätzungen + Dellen) - Paint defect - Repair and paint




Damage 11: Roof: Roof (Einätzungen + Dellen) - Paint defect - Repair and paint




Damage 11: Roof: Roof (Einätzungen + Dellen) - Paint defect - Repair and paint

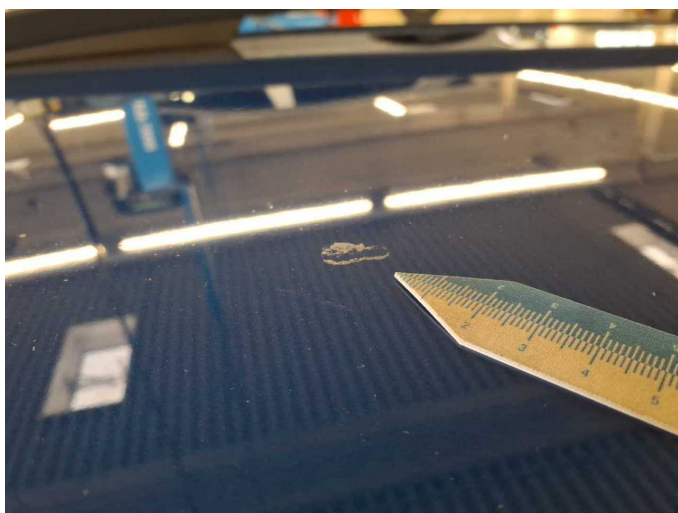


Damage 11: Roof: Roof (Einätzungen + Dellen) - Paint defect - Repair and paint

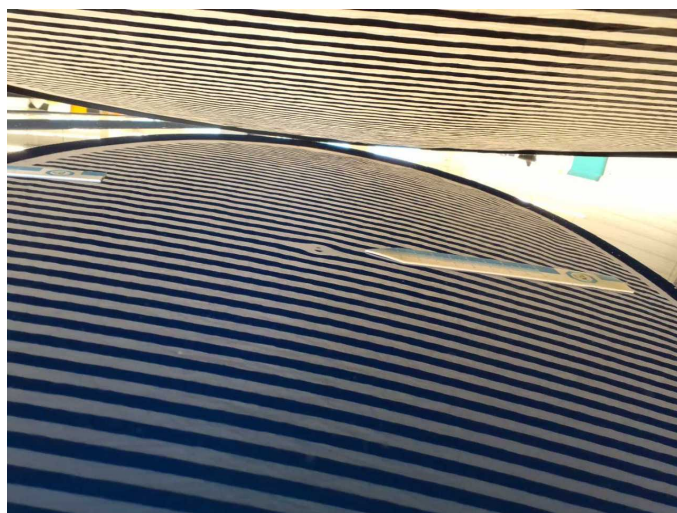

Damage 11: Roof: Roof (Einätzungen + Dellen) - Paint defect - Repair and paint

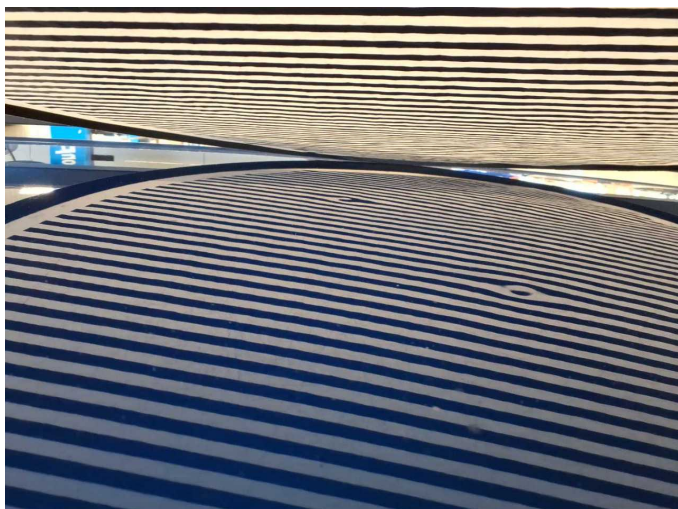

Damage 11: Roof: Roof (Einätzungen + Dellen) - Paint defect - Repair and paint

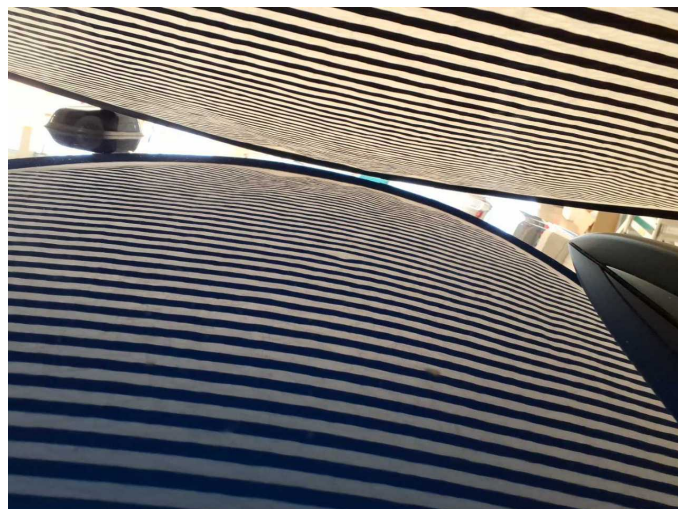


Damage 11: Roof: Roof (Einätzungen + Dellen) - Paint defect - Repair and paint



Damage 11: Roof: Roof (Einätzungen + Dellen) - Paint defect - Repair and paint



Damage 12: Vehicle glazing: Windscreen with lane departure assistant - Broken / torn - Replace

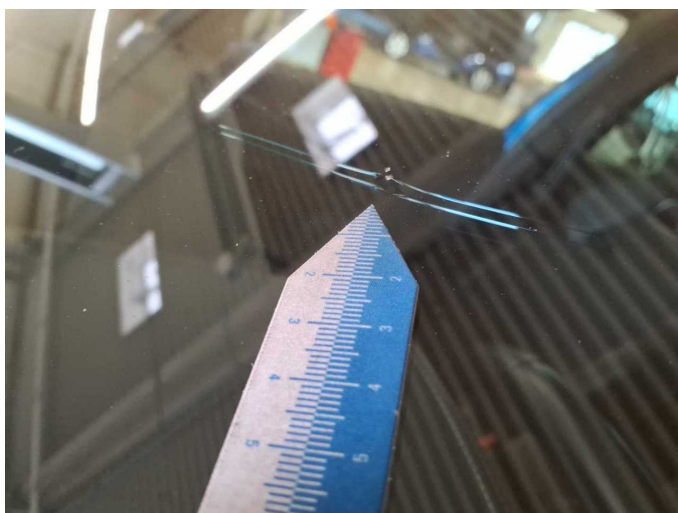

Damage 12: Vehicle glazing: Windscreen with lane departure assistant - Broken / torn - Replace



Mudguard - right side: 209 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJJ7NS2N8035474
Hersteller / Modell: SKODA SKODA Kodiaq 2.0 TDI DSG Sportline

Datum	KM-Stand	Beschreibung
21.01.2026	183.010	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
30.12.2025	181.979	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne
09.10.2025	172.514	Batterie ern; Systemtest/Eigendiagnose
22.04.2025	151.547	HU + AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
27.09.2024	122.681	Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
01.02.2024	93.481	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
05.07.2023	65.803	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
17.11.2022	32.509	Motoröl b. Wartung; Regelwartungsdienst