



Expertise

Protocol number: 46373642
Order No. / Reference: 26547034
Inspection date: 3 Jul 2026

Manufacturer: Skoda
VIN: TMBJC9NYXNF055784

Model: Enyaq iV 80



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Enyaq iV 80	
Vehicle Identification number	TMBJC9NYXNF055784
Mileage (Read)	78,534 km
First registration	1 Aug 2022
Number of holders	1
Next periodical technical inspection	07/2027
(Report on hand)	
Power / Engine displacement	150 kw / 0 ccm
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	Station wagon
Colour / colour code	Black Magic Perleffekt
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	21 Tag(e)
Last service on / at	07/2025 at 61,428 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ941532
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWS 00100		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,600 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101T	Summer tyres on Light alloy	Bridgestone	6mm / 6mm
2)	255/50 R19 103T	Summer tyres on Light alloy	Bridgestone	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105V	Winter tyres on Light alloy	Bridgestone	5mm / 5mm
2)	255/50 R19 107V	Winter tyres on Light alloy	Bridgestone	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Design Selection Loft (seat covers in fabric/faux leather - decorative trim strips "brushed aluminum" - headliner in grey - front center armrest, including storage compartment - rear center armrest with cup holders and pass-through - floor mats - ambient lighting for front door panels, multicoloured - footwell lighting and illuminated door handle recesses - umbrella)
- Front radar assist with pedestrian and cyclist detection and city emergency braking function (The front radar assist is a safety system with collision warning: If confronted with an unavoidable collision, it brakes the vehicle to minimize the consequences. It also performs emergency braking if a pedestrian or cyclist attempts to cross the vehicle's path. The front radar assist recognizes from the way the driver moves the vehicle that they are attempting to avoid an obstacle and actively intervenes in the steering to steer around it.)
- Child safety locks on the rear doors
- Removable boot cover
- Front and rear headrests are height-adjustable.
- Charging cable for AC charging stations (Mode 3 charging cable, Type 2, 16A) (Fast charging connector (CCS / Combo 2))
- Manual headlight range adjustment
- Navigation system
- Front and rear parking sensors
- Radio: Infotainment system with capacitive 13" color display (8 speakers - 2 x USB ports (Type-C) at the front - Navigation system preparation - DAB+ digital radio reception - Bluetooth hands-free phone system - Voice control - SmartLink (MirrorLink, Apple CarPlay, Android Auto) - Wireless SmartLink for Apple CarPlay and Android Auto)
- Wheels: 19" Proteus Silver alloy wheels (8Jx19 tires 235/55 R19 101T front, 255/50 R19 103T rear)
- Power steering
- Safety lights in the front side doors
- Seats: Front seats are height-adjustable, including manually adjustable lumbar support.
- Speed limiter
- Lane keeping assistant (Lane Assist)
- 12V socket - in the trunk
- Traffic sign recognition
- Immobiliser
- Central locking including remote control integrated into the key (EASY START (keyless start-stop system))
- Storage compartments (Four roof grab handles, rear with coat hooks - Warning vest compartment in the doors - Storage compartments in the front door panels with 1.5l bottle holders - Storage compartments in the rear door panels - Umbrella compartments in the front doors - Ticket holder on the windshield - Ice scraper in the tailgate panel - Coat hooks on the B-pillars - Cup holder in the front center console - Storage compartments in the trunk)
- Traction control (ASR)
- Digital instrument cluster (Virtual Cockpit)
- Third brake light
- E-Sound (external speaker for generating a driving sound)
- Electronic parking brake including auto-hold function
- Increased battery charging power max. 125 kW
- ESC Electronic Stability Control
- Electric windows front and rear (including anti-pinch protection and child safety lock)
- Cruise control
- Transmission: 1-speed (EV)
- Tinted windows
- Heated rear window
- Rear window wiper including windshield washer system
- Automatic interior mirror dimming
- Isofix anchorage on the front passenger seat
- Isofix anchorage on the outer rear seats including top tether
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger, including odor and allergen filter)
- LED headlights with daytime running lights
- LED taillights
- Steering wheel adjustable for height and reach
- Multi-collision brake
- Package: Chrome (chrome trim strips on the outside of the side windows - AERO anodized roof rails)
- Radio accessories: SmartLink (Android Auto and Apple CarPlay)
- Radio accessories: Wireless SmartLink
- Rain sensor and driving light assistant with coming and leaving home function
- Tire mobility kit (tire repair spray incl. compressor)
- Tire pressure monitoring
- Rear view camera
- Rear seat backrest split 60:40, foldable
- Seat belts (Height-adjustable three-point seat belts in the front - Three three-point seat belts in the rear - Seat belt reminder indicators on the front and rear seats)
- Skoda Care Connect (SOS emergency call function (eCall including automatic activation in the event of an accident with airbag deployment) - Free remote vehicle access to iV-specific functions for 10 years (iV Remote Services Basic) such as starting and stopping the charging process, creating charging plans, setting the interior climate control before starting the journey, etc. - Mobility service - Information service - Free remote vehicle access for 3 years (Remote Access) - Skoda Infotainment Online)
- Airbag, center airbag front
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, front and rear head airbags
- Airbag, front side airbags
- acoustic windscreen



- Electrically adjustable, heated and folding exterior mirrors, including automatic dimming.
- Outdoor temperature display
- Hill start assist
- Grey headliner

- Anti-lock braking system (ABS)
- Evasive steering assist including turning assistant (The turning assistant monitors oncoming vehicles when you turn left (for left-hand drive vehicles). If there is an immediate danger, it brings the vehicle to a standstill and a warning signal sounds.)
- AERO anodized roof rails

Extra equipment

- Design Selection Suite (leather seat covers - "Piano black" trim strips - grey headliner - front center armrest including storage compartment - rear center armrest with cup holders and pass-through - floor mats - multi-coloured ambient lighting for instrument panel and front door trim - footwell lighting and illuminated door handle recesses - umbrella)
- Panoramic sunroof, electric (deletion of the glasses compartment in the headliner)
- Wheels: 19" Regulus AERO alloy wheels, anthracite polished (8Jx19, tires 235/55 R19 101T front, 255/50 R19 103T rear)
- heat pump
- Swiveling trailer hitch (including trailer stabilization)

- Luggage net partition
- Paint finish: Pearl effect
- Mobile charging station "iV Universal Charger" with interchangeable connection adapters
- Package: MAXX in conjunction with anti-theft alarm system (Convenience PLUS - Driving Assistance PLUS - Climate Control PLUS - Family BASIC - Light & Sight PLUS - Seat Comfort PLUS - Infotainment PLUS - Parking PLUS - Preparation for a trailer hitch including trailer stabilization (standard on RS) - CANTON sound system - Rear side airbags - Drive SPORT PLUS - Anti-theft alarm system including safe system with interior monitoring and tilt sensor)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Mudguard - right side	Mudguard - right side - Scratch(es) - Smart repair
3	Rear bumper	Rear bumper - Scratch(es) - Smart repair
4	Door - rear right side	Door - dent(s) - Smart repair
5	Side panel - rear left side	Side panel - dent(s) - Smart repair
6	Door - front right side	Door - Scratch(es) - Paint

Repainting

No.	Repainting
1	Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent
2	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
3	Door - front right side, Professionally carried out, Invoice of repair done Non-existent



Paint coat thickness measurement

Boot lid / rear door	212 µm	Door - rear right side	204 µm
Door - front right side	296 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.
- Der beiliegende Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

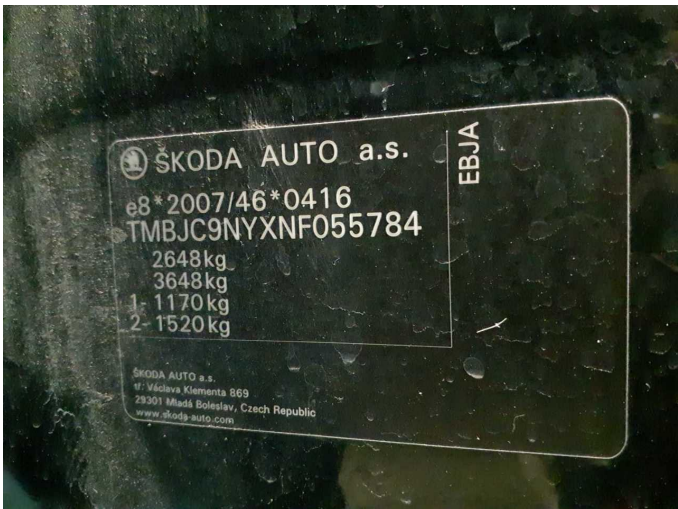


Figure 11: VIN



Figure 12: Mounted tyres

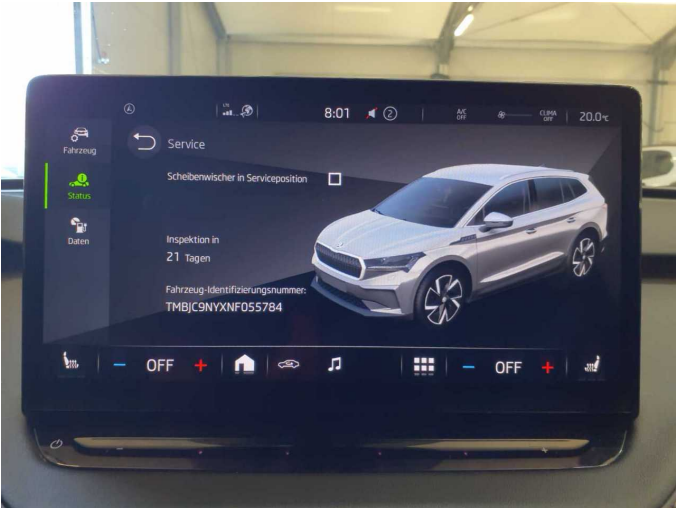


Figure 13: Documents

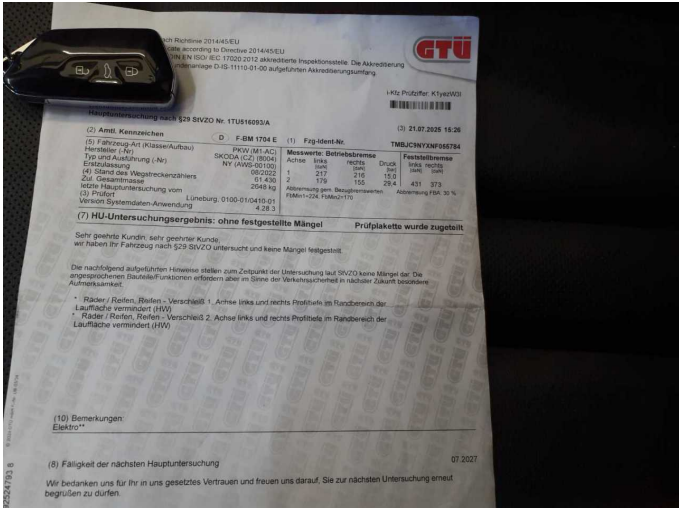


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

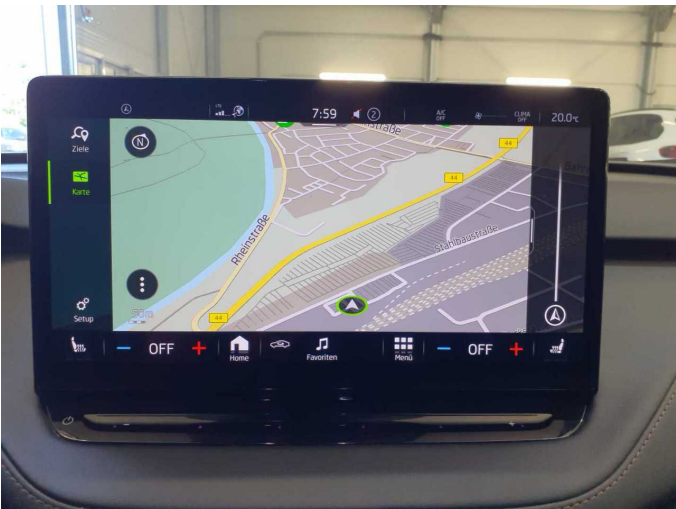


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

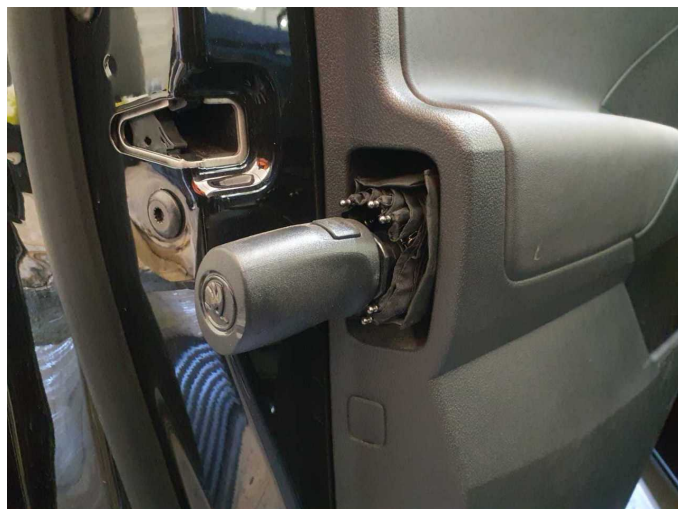


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

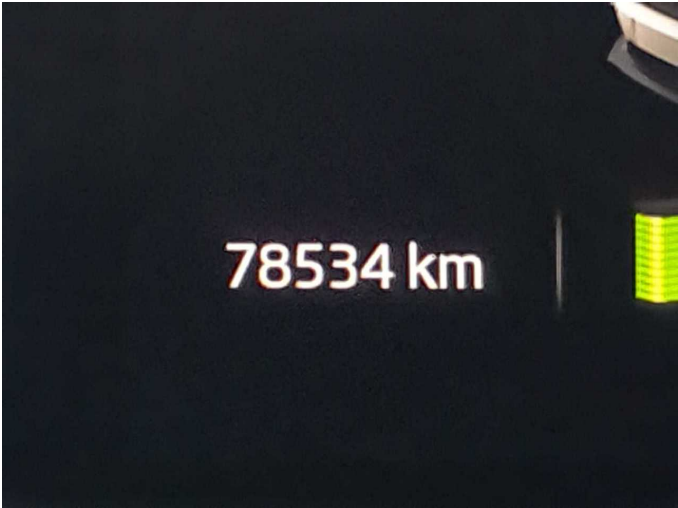


Figure 28: Misc.

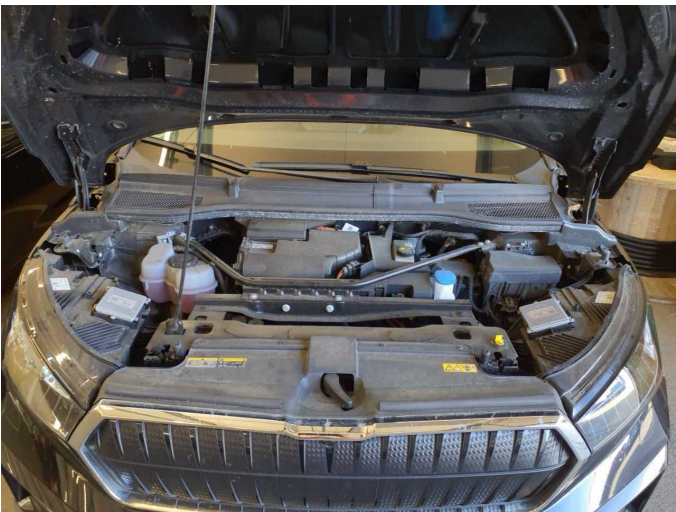


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.

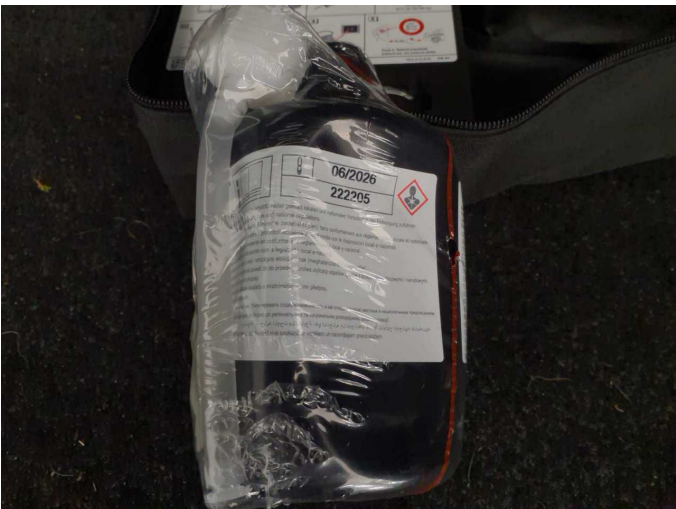


Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.



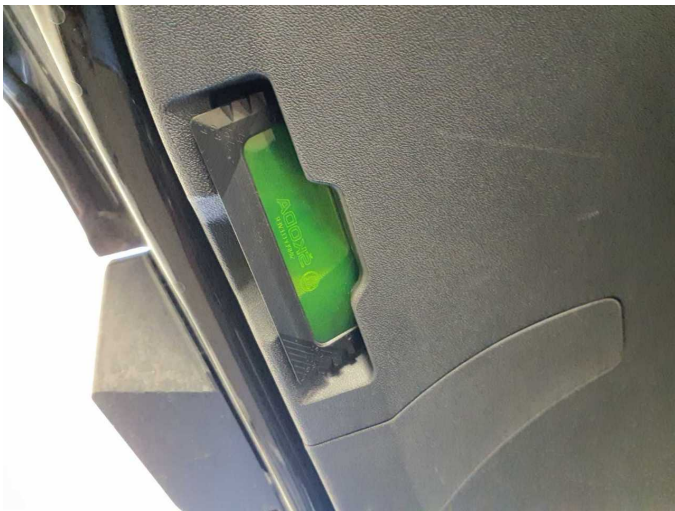



Figure 39: Misc.

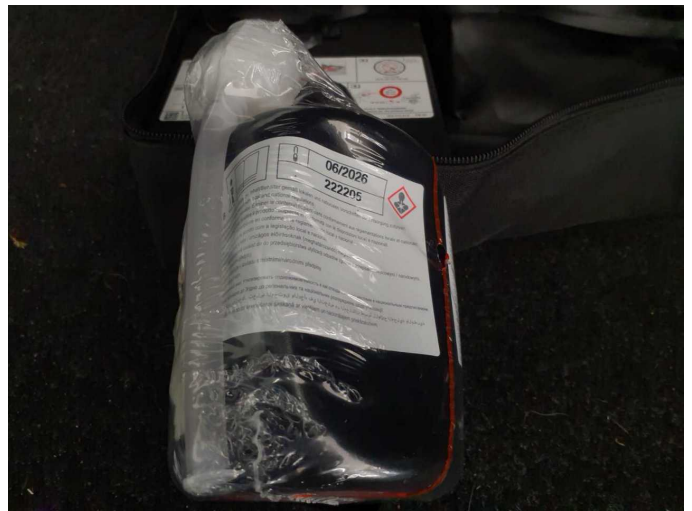


Damage 1: Equipment: Tirefit filler - Expired - Replace

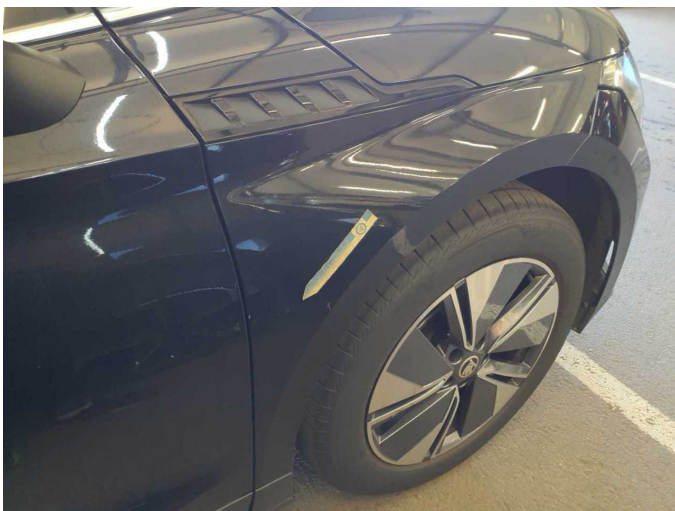

Damage 2: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair

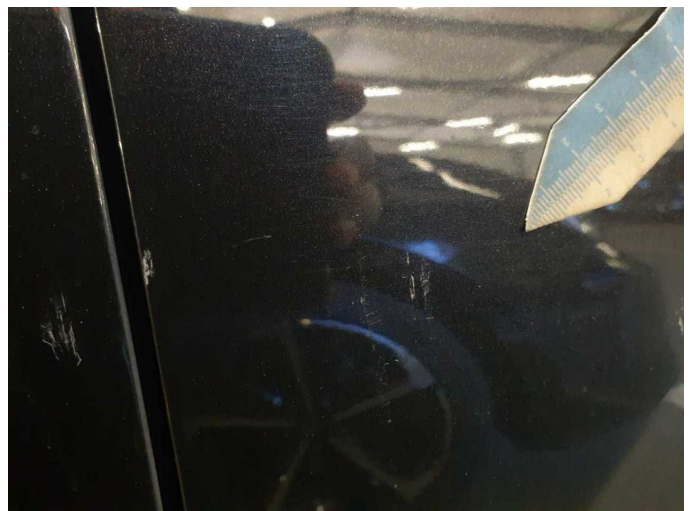


Damage 2: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair

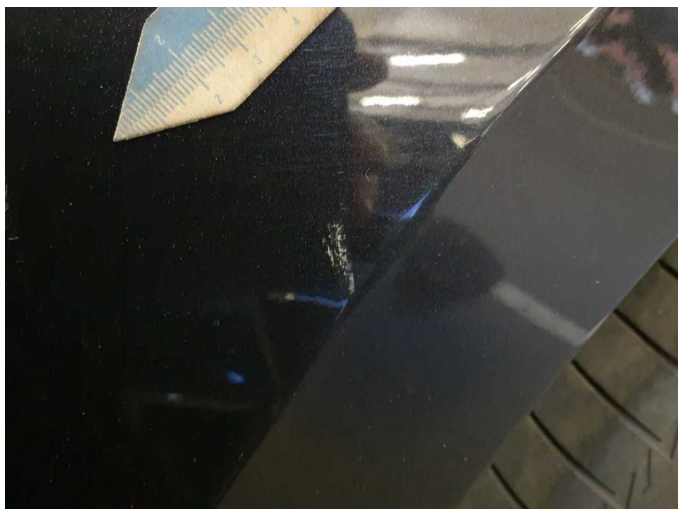

Damage 2: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair

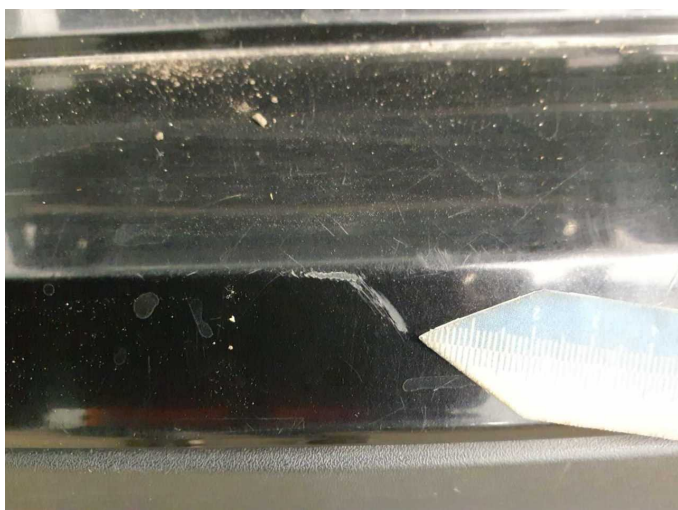


Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 4: Door - rear right side: Door - dent(s) - Smart repair

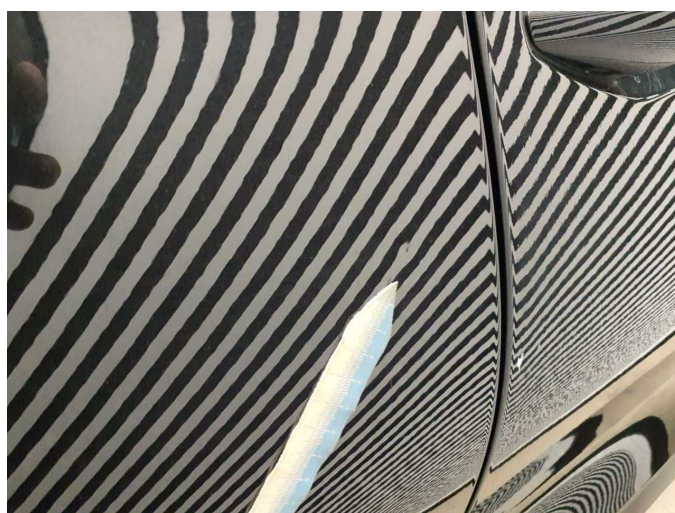

Damage 4: Door - rear right side: Door - dent(s) - Smart repair



Damage 5: Side panel - rear left side: Side panel - dent(s) - Smart repair

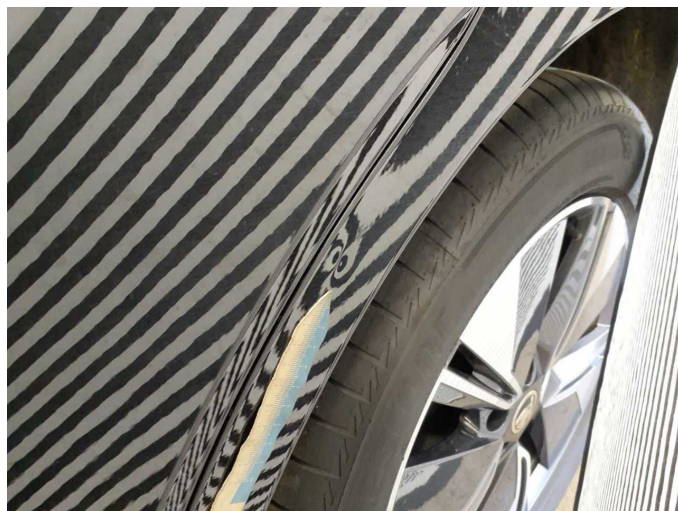

Damage 5: Side panel - rear left side: Side panel - dent(s) - Smart repair



Damage 6: Door - front right side: Door - Scratch(es) - Paint



Damage 6: Door - front right side: Door - Scratch(es) - Paint



Damage 6: Door - front right side: Door - Scratch(es) - Paint




Damage 6: Door - front right side: Door - Scratch(es) - Paint



Repainting 1: Boot lid / rear door




Repainting 1: Boot lid / rear door

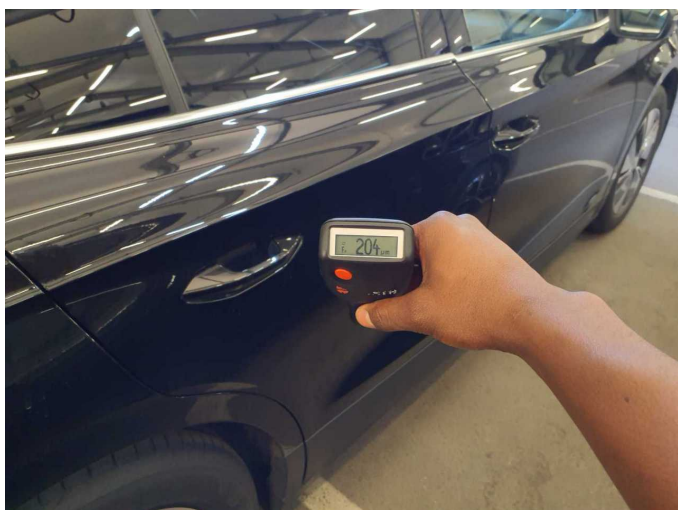

Repainting 2: Door - rear right side



Repainting 2: Door - rear right side

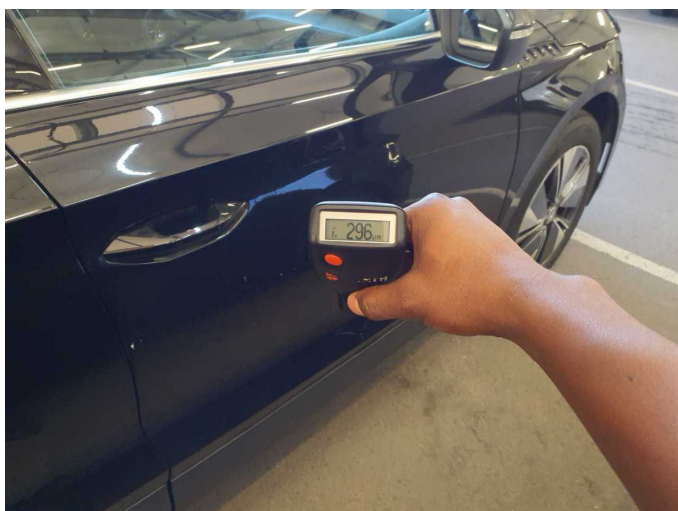

Repainting 3: Door - front right side



Repainting 3: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJC9NYXNF055784

Hersteller / Modell: SKODA SKODA Enyaq iV 80

Datum	KM-Stand	Beschreibung
22.07.2025	61.428	Systemtest/Eigendiagnose
25.07.2024	38.238	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst