



Expertise

Protocol number: 46373695  
Order No. / Reference: 26504852  
Inspection date: 7 Jul 2026

Manufacturer: Volkswagen

Model: Golf Variant 2.0 TDI SCR DSG Style

VIN: WVVZZZCD0PW524613



| Vehicle details                               |                        |
|-----------------------------------------------|------------------------|
| Manufacturer / Type / Model / Equipment       |                        |
| Volkswagen Golf Variant 2.0 TDI SCR DSG Style |                        |
| Vehicle Identification number                 | WVVZZZCD0PW524613      |
| Mileage (Read)                                | 47,793 km              |
| First registration                            | 10 Feb 2023            |
| Number of holders                             | 1                      |
| Next periodical technical inspection          | 03/2028                |
| (Report on hand)                              |                        |
| Power / Engine displacement                   | 110 kw / 1,968 ccm     |
| Fuel type / Cylinder                          | Diesel / 4             |
| Gearbox / Number of gears                     | Automatic / 7          |
| Type of drive                                 | Front drive            |
| Type of vehicle                               | Station wagon          |
| Colour / colour code                          | Atlantic Blue Metallic |
| Doors / Seats                                 | 5 / 5                  |
| Upholstery type                               | Alcantara / cloth      |
| Colour of upholstery                          | Black                  |



| Vehicle details                              |                              |                         |                                                            |
|----------------------------------------------|------------------------------|-------------------------|------------------------------------------------------------|
| Maintenance booklet / proof                  | digital proof / complete     | Next maintenance in     | 11,500 km                                                  |
| Last service on / at                         | 11/2025 at 40,365 km         |                         |                                                            |
| Key is / should be                           | 2 / 2                        | FZG documents           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                              |                              | Letter No.              | GS371930                                                   |
| Previous damage / Accident                   | None detectable              | Repainting              | Detectable                                                 |
| Inspection conditions                        | sufficient                   | Lifting equipment / pit | No                                                         |
| Test drive                                   | Not performed                | Engine function test    | Performed                                                  |
| Manufacturer key number/<br>type code number | 0603 / CNN 01869             |                         |                                                            |
| Emission standard                            | EURO6;WLTP;AP;PI/CI; M, N1 I | fine dust sticker       |                                                            |
| Permitted total weight                       | 2,060 kg                     | Empty weight            |                                                            |

| Tyres            |                |                             |              |             |
|------------------|----------------|-----------------------------|--------------|-------------|
| Mounted tyres    |                |                             |              |             |
| #                | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
| 1)               | 205/50 R17 93H | Winter tyres on Light alloy | Pirelli      | 4mm / 4mm   |
| 2)               | 205/50 R17 93H | Winter tyres on Light alloy | Pirelli      | 6mm / 6mm   |
| Additional tyres |                |                             |              |             |
| #                | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
| 1)               | 225/40 R18 92Y | Summer tyres on Light alloy | Bridgestone  | 4mm / 4mm   |
| 2)               | 225/40 R18 92Y | Summer tyres on Light alloy | Bridgestone  | 5mm / 5mm   |
| Replacement      |                |                             |              |             |
| Typ              | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|                  | Tirefit        | Expiration date 11/2026     |              |             |

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

## Equipment

### Standard equipment

- 2 USB-C ports on the front
- Airbag for driver and front passenger
- 30-color ambient lighting
- App-Connect
- Electrically adjustable and heated exterior mirrors with memory function and passenger-side mirror lowering function.
- Chrome strip at the bottom of the side windows
- Decorative inlays "New Brushed Dark Metal"
- Digital Cockpit Pro, multicolor
- Electronic differential lock XDS
- Electronic stability program and electromechanical brake booster
- Automatic headlight control, with LED daytime running lights
- Pedestrian protection measures expanded
- luggage compartment cover
- Rear window heated
- Rear spoiler in car color
- Air conditioning system "Air Care Climatronic"
- Front headrests
- LED Plus headlights (LED headlights for low and high beam - dynamic headlight range control - bad weather light and cornering light)
- Steering wheel: Multifunction leather steering wheel with paddle shifters
- Non-smoking version
- Emergency call service
- Tire pressure monitoring system (passive)
- Rear bench seat undivided, backrest asymmetrically split and foldable with center armrest
- Seat belts: Three-point automatic seat belt for the middle rear seat
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Start-stop system
- Bumpers in body color
- Textile floor mats front and rear
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote folding keys
- 2 USB charging ports on the rear of the center console
- Airbags: Front and rear head airbags, front side airbags, center airbag
- Adaptive Cruise Control (ACC) "stop & go"
- Exterior mirror housings and door handles in body color
- third brake light
- Car2X
- black roof rails
- Diesel particulate filter and SCR catalyst
- Parking assistance
- Electronic parking brake including auto-hold function
- Driving assistant "Travel Assist" and lane keeping assistant "Lane Assist"
- Electric windows, front and rear
- Windscreen made of laminated safety glass, heat and sound insulating
- Transmission: 7-speed DSG
- Rear window wiper with intermittent function
- ISOFIX mounting points
- Rear headrests (3)
- LED reading lights at the front (2) and 2 at the rear
- LED taillights
- Illuminated strip between headlights and door handle recesses
- Front center armrest adjustable in height and length
- Fatigue detection
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Wheels: Tire Mobility Set
- Keyless start system without safe locking
- electromechanical power steering
- Seat belts: Three-point automatic seat belts for the outer rear seats
- Seats: ergoActive seat with 14-way adjustment and memory function on the driver's side
- 12-volt power outlet in the luggage compartment
- Telephone interface with inductive charging function
- Ambient lighting with logo projection
- Green thermal insulation glazing, sides and rear



## Extra equipment

- Airbag: Front and rear side airbags including proactive occupant protection system (front and rear head and side airbags, center airbag - proactive occupant protection system in conjunction with "Front Assist")
- Paint finish: Metallic
- Navigation system "Discover Pro" incl. "Streaming & Internet" (6+1 speakers - App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Navigation system "Discover Pro" incl. "Streaming & Internet" - Radio - Voice control - Traffic sign recognition)
- Package: Light and Sight Package incl. High Beam Control "Light Assist" (High Beam Control "Light Assist" - Automatically Dimming Interior Mirror - Multifunction Camera - Rain Sensor)
- Package: Winter (DSG) (Multifunction steering wheel in leather, heated, with shift paddles - Windscreen washer nozzles automatically heated - Front seats heated)
- Wheels: Alloy wheels (4) "Bergamo" 7.5 J x 18 in black with sporty driving dynamics (tires 225/40 R 18 - with individual installation - wheel locks with extended theft protection)
- Rear View reversing camera
- Towbar, foldable with electric release
- Roof rails, silver anodized
- Anti-theft alarm system "Plus" (anti-theft alarm system with interior monitoring, backup horn and tow-away protection - keyless start system "Keyless Start" with safe locking)
- Package: Business Premium incl. navigation system (DSG) (6+1 speakers, App-Connect incl. App-Connect Wireless for Apple CarPlay, Android Auto, automatic distance control, adaptive cruise control (ACC) stop/go, speed limiter, emergency brake, pedestrian detection, travel assist, lane assist, emergency assist, leather multifunction steering wheel, heated, with shift paddles, multifunction camera, Discover Media navigation incl. streaming & internet (MP3, touchscreen, USB), cargo net partition, radio, heated windshield washer system, voice control, telephone interface, Comfort with inductive charging, textile floor mats, traffic sign recognition, heated front seats)
- Wheels: Winter wheels (additional), alloy, "Nottingham" 6.5 J x 17 (4 alloy wheels 6.5 J x 17 - wheel wrench and jack - winter tires 205/50 R 17 H)
- Rear side windows and rear window tinted

## Brief expert findings

|                      |                                                                                                                                                                                                                                               |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)                                                                  |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.                                                                     |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent. |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                                                                                         |
| Engine function test | An engine test run was performed.                                                                                                                                                                                                             |

## Value reducing factors

| No. | Component group              | Description                                    |
|-----|------------------------------|------------------------------------------------|
| 1   | Body                         | Body - Glued / labelled - De-glue / neutralise |
| 2   | Side panel - rear left side  | Sill - Scratch(es) - Smart repair              |
| 3   | Sill - left side             | Sill - Scratch(es) - Smart repair              |
| 4   | Side panel - rear right side | Sill - Scratch(es) - Smart repair              |
| 5   | Front bumper                 | Front bumper - Scratch(es) - Paint             |



## Repainting

### No. Repainting

- 1 Mudguard - left side, Professionally carried out, Invoice of repair done Non-existent
- 2 Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
- 3 Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
- 4 Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
- 5 Door - front left side, Professionally carried out, Invoice of repair done Non-existent
- 6 Door - front right side, Professionally carried out, Invoice of repair done Non-existent

## Paint coat thickness measurement

|                        |        |                         |        |
|------------------------|--------|-------------------------|--------|
| Mudguard - left side   | 203 µm | Mudguard - right side   | 213 µm |
| Door - rear left side  | 203 µm | Door - rear right side  | 216 µm |
| Door - front left side | 228 µm | Door - front right side | 212 µm |

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

## Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.





**Figure 1:** Diagonal front (left)



**Figure 2:** Diagonal front (right)



**Figure 3:** Diagonal rear (left)



**Figure 4:** Diagonal rear (right)



**Figure 5:** Interior - front



**Figure 6:** Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

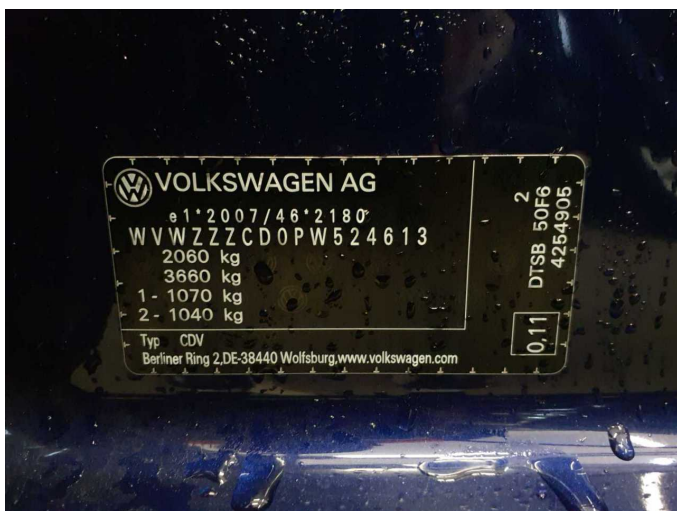


Figure 11: VIN

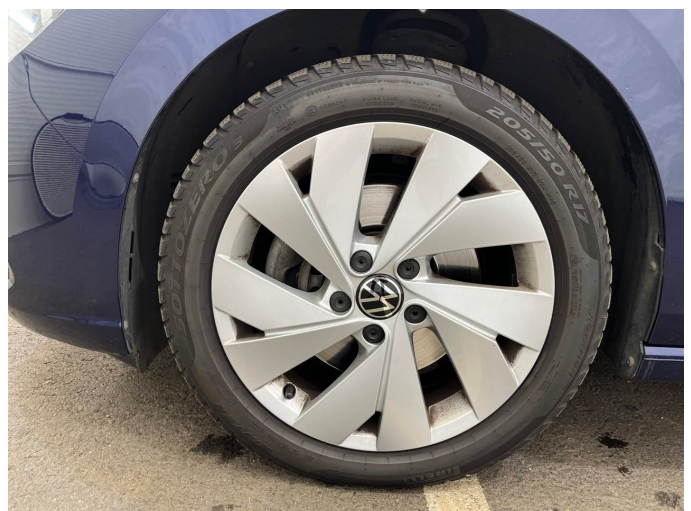


Figure 12: Mounted tyres



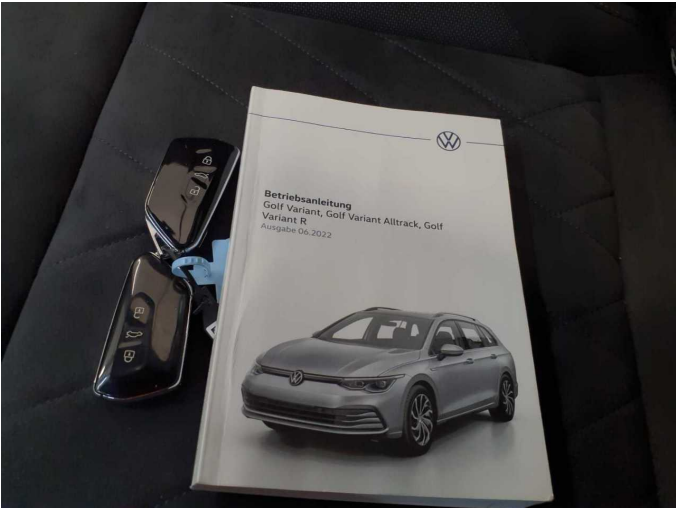


Figure 13: Documents

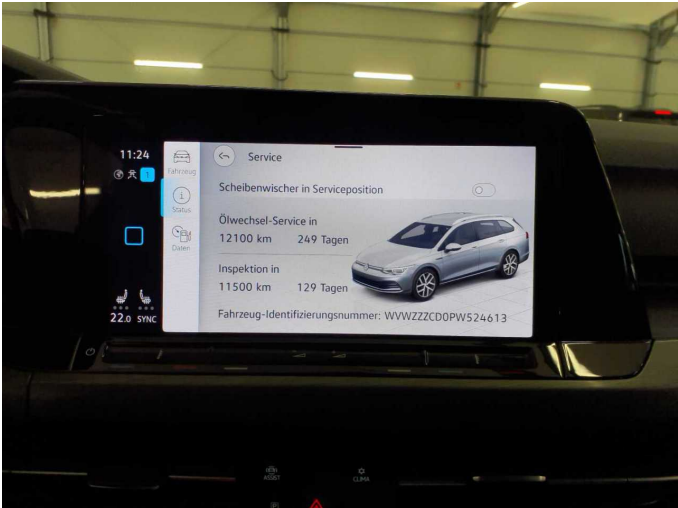


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

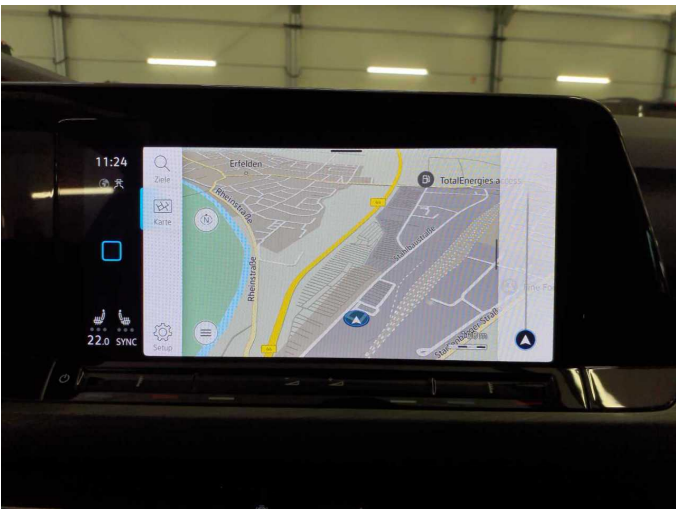


Figure 17: Navigation



Figure 18: Misc.





Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

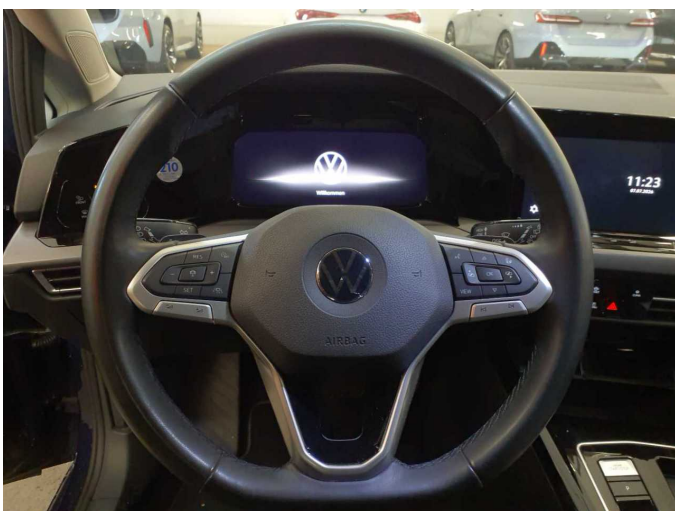


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

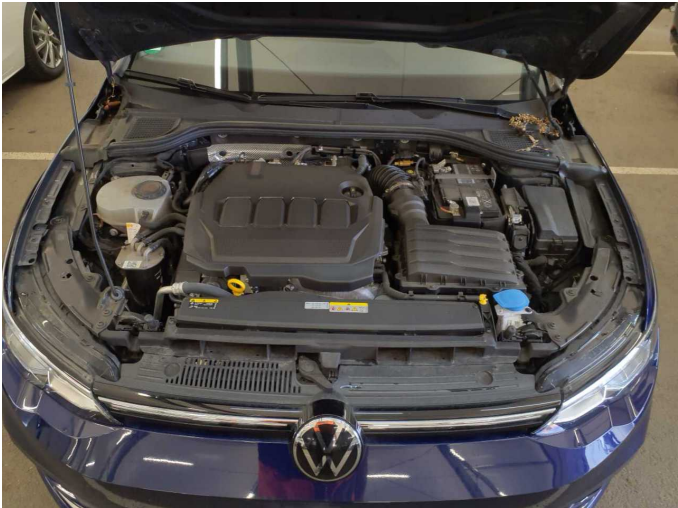


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.





Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.




Damage 1: Body: Body - Glued / labelled - De-glue / neutralise






**Damage 1:** Body: Body - Glued / labelled - De-glue / neutralise

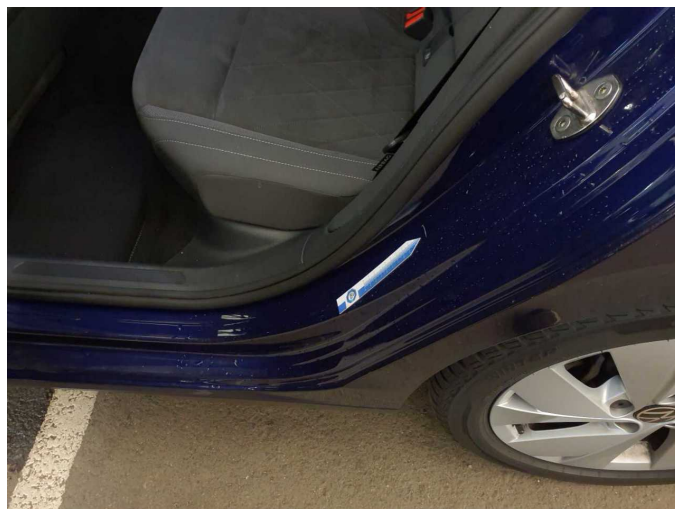

**Damage 2:** Side panel - rear left side: Sill - Scratch(es) - Smart repair

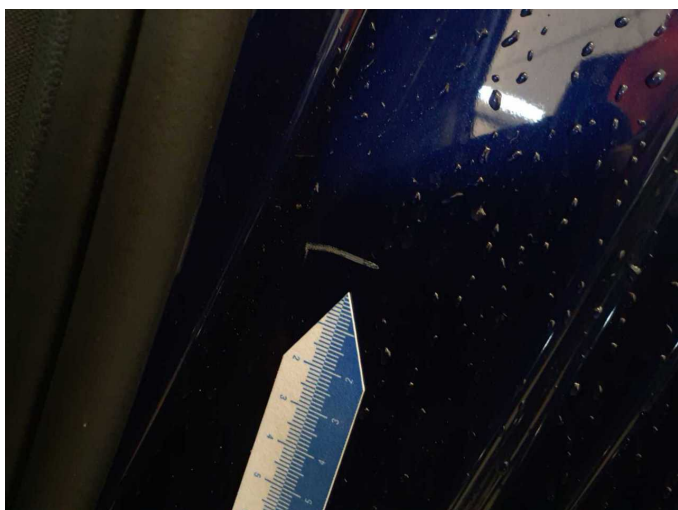

**Damage 2:** Side panel - rear left side: Sill - Scratch(es) - Smart repair



**Damage 3:** Sill - left side: Sill - Scratch(es) - Smart repair




**Damage 3:** Sill - left side: Sill - Scratch(es) - Smart repair




**Damage 3:** Sill - left side: Sill - Scratch(es) - Smart repair




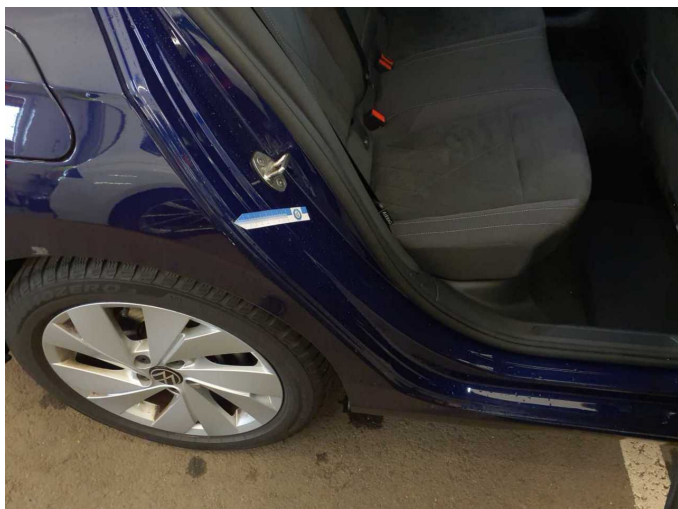

**Damage 4:** Side panel - rear right side: Sill - Scratch(es) - Smart repair

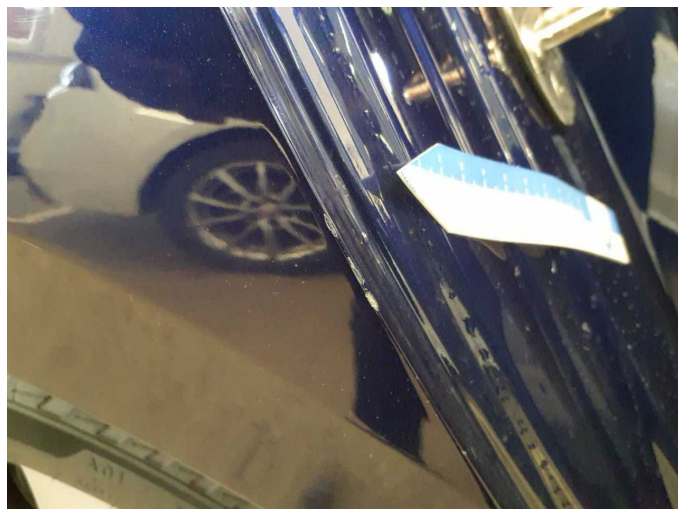


**Damage 4:** Side panel - rear right side: Sill - Scratch(es) - Smart repair

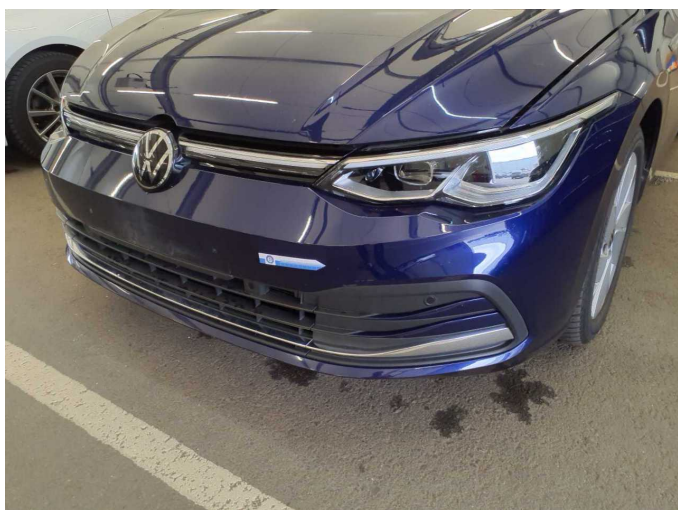

**Damage 5:** Front bumper: Front bumper - Scratch(es) - Paint



**Damage 5:** Front bumper: Front bumper - Scratch(es) - Paint

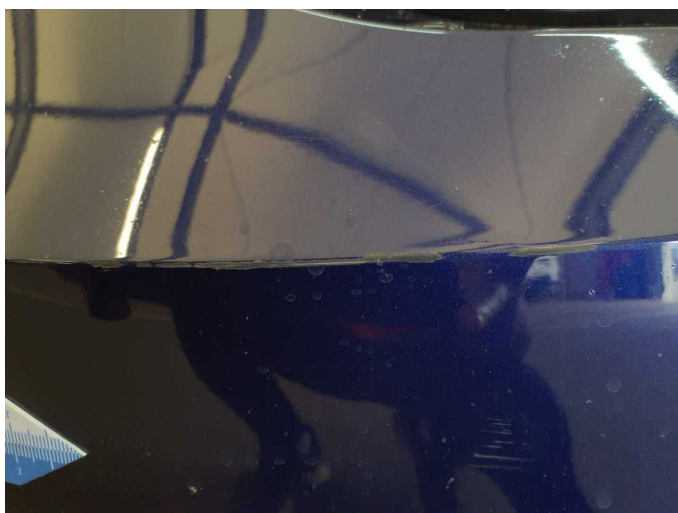

**Damage 5:** Front bumper: Front bumper - Scratch(es) - Paint



**Damage 5:** Front bumper: Front bumper - Scratch(es) - Paint





**Repainting 1:** Mudguard - left side



**Repainting 1:** Mudguard - left side



**Repainting 2:** Mudguard - right side



**Repainting 2:** Mudguard - right side



**Repainting 3:** Door - rear left side



**Repainting 3:** Door - rear left side



**Repainting 4:** Door - rear right side



**Repainting 4:** Door - rear right side



**Repainting 5:** Door - front left side



**Repainting 5:** Door - front left side



**Repainting 6:** Door - front right side



**Repainting 6:** Door - front right side





# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZCD0PW524613

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Golf Variant 2.0 TDI SCR DSG  
Style

| Datum      | KM-Stand | Beschreibung                                                                                           |
|------------|----------|--------------------------------------------------------------------------------------------------------|
| 24.11.2025 | 40.365   | Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges |
| 13.11.2024 | 29.216   | Regelwartungsdienst; Wartung Sonstiges                                                                 |
| 08.07.2024 | 19.849   | Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges                                         |