



## Ford Focus:

Vinnumber:	<b>WF0PXXGCHPMC69601</b>	Versionname:	
First Registrationdate:	<b>17/09/2021</b>	Fiscalpower:	
Expertise Mileage:	<b>134266</b>	Power Kw:	
Bodytype:		Body colour:	<b>Blue</b>
Gearbox:	<b>MAN 6 VIT</b>	Type of rims (mounted):	<b>Aluminium</b>
Transmission:		Parking lot:	<b>1233</b>
Fueltype:	<b>Hybrid Petrol</b>		
Type of rims (mounted):	<b>Aluminium</b>		
Certificate of Conformity:	<b>Yes</b>		
Category:	<b>Passenger Car</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

## Options

Number of keys total:	<b>2</b>	Luggage cover:	
Cruise Control:		Front parking sensors:	
Steering wheel multifunctional:		Rear parking sensors:	
Radio multimedia:		Type of Tow bar:	<b>Tow bar removable</b>
Type of headlighting:	<b>Headlighting LED</b>		
Type of GPS:	<b>GPS big screen color</b>		
Type of Lining:	<b>Lining fabrics</b>		
Type of climate control:	<b>Manual climate control</b>		

## Limited Technical Inspection

## Tyres

205/60/16/92 H				
Summer tyres:	Fr.L.	Vredestein: 5 mm	Fr.R.	Vredestein: 5 mm
	Re.L.	Fulda: 5 mm	Re.R.	Fulda: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				205/60 R 16 92 H
Tyre size FR				205/60 R 16 92 H
Tyre size RL				205/60 R 16 92 H
Tyre size RR				205/60 R 16 92 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				2480
Tyre make FR				2480
Tyre make RL				2484
Tyre make RR				2484

## Assistance equipment

Repair kit:	<b>Yes</b>	Compressor:	<b>Yes</b>
Number of charging cables (normal):	<b>0</b>		
Number of charging cables (rapid charge):	<b>0</b>		

Total cost ex VAT:	2632,18
Shutter / cover F, Deformed / Strained, Replace:	116,56



Wing RL, Scratch(es), Repair and paint (complete) 431,58



Door RL, Scratch(es), Repair and paint (complete) 445,79



Door FL, Scratch(es), Repair and paint (complete) 445,79



Wing FL, Scratch(es), Repair and paint (complete) 308,32




Bumper R, Scratch(es), Acceptable 0,00



Rear window, Scratch(es), Replace 438,35



Tailgate / Boot, Dent(s), Acceptable 0,00

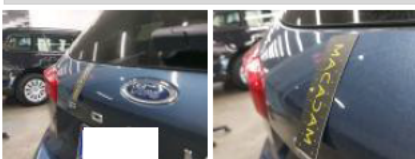

Wing FR, Dent(s) and scratch(es), Acceptable 0,00



Door FR, Dent(s) and scratch(es), Repair and paint (complete)

445,79

