



## VOLVO XC40:

Vinnumber:	<b>YV1XZBWVFM2579316</b>	Versionname:	<b>T4 Recharge Geartronic Inscription Expr.</b>
First Registrationdate:	<b>9/04/2021</b>	Fiscalpower:	
Expertise Mileage:	<b>100383</b>	Power Kw:	
Bodytype:		Body colour	<b>Black</b>
Gearbox:	<b>Automatic</b>	Type of rims (mounted)	<b>Aluminium</b>
Transmission:		Parking lot	<b>.2806</b>
Fueltype:	<b>Hybrid Petrol</b>		
Maintenance	<b>OK</b>		
Maintenance	<b>5194.0</b>		
Maintenance	<b>98 days</b>		
Type of rims (mounted)	<b>Aluminium</b>		
Certificate of Conformity	<b>Yes</b>		
Category	<b>Passenger Car</b>		
Registration Certificate Car (BE)	<b>Yes</b>		
Registration Certificate Home (BE)	<b>No</b>		

## Options

Number of keys total	<b>2</b>	Sun Roof electric	
Cruise Control		Panoramic roof	
Steering wheel multifunctional		Luggage cover	
Seats F heated		Front parking sensors	
Radio multimedia		Rear parking sensors	
Type of headlighting	<b>Headlighting LED</b>	Type of Tow bar	<b>Tow bar collapsible</b>
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining artificial leather</b>		
Type of climate control	<b>Autom climate control</b>		
Adaptive cruise control			
Type of GPS storage	<b>HD</b>		

## Limited Technical Inspection

## Tyres

<b>235/55/18/100 V</b>				
Summer tyres:	Fr.L.	<b>Uniroyal: 6,2 mm</b>	Fr.R.	<b>Uniroyal: 6,5 mm</b>
	Re.L.	<b>Uniroyal: 8 mm</b>	Re.R.	<b>Uniroyal: 7,8 mm</b>
Tyre profile depth FL				<b>6.2</b>
Tyre profile depth FR				<b>6.5</b>
Tyre profile depth RL				<b>8.0</b>
Tyre profile depth RR				<b>7.8</b>
Tyre size FL				<b>235/55 R 18 100 V</b>
Tyre size FR				<b>235/55 R 18 100 V</b>
Tyre size RL				<b>235/55 R 18 100 V</b>
Tyre size RR				<b>235/55 R 18 100 V</b>
Tyre type FL				<b>Summer</b>
Tyre type FR				<b>Summer</b>
Tyre type RL				<b>Summer</b>
Tyre type RR				<b>Summer</b>
Tyre make FL				<b>265</b>
Tyre make FR				<b>265</b>
Tyre make RL				<b>265</b>
Tyre make RR				<b>265</b>

## Assistance equipment

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Number of charging cables (normal)	<b>1</b>		
Number of charging cables (rapid charge)	<b>1</b>		

Total cost ex VAT

1214,84


Door panel RL, Scratch(es), Smart repair 116,69



Backrest cover FL, Worn, Acceptable 0,00



Backrest cover RR, Worn, Acceptable 0,00

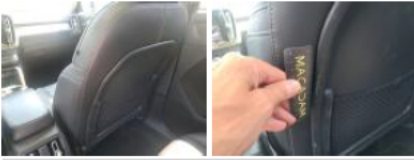

Door panel RR, Tear, Replace 65,34



Bonnet, Scratch(es), Repair and paint (complete) 487,44



Bumper F, Stone chip(s), Acceptable 0,00



Alloy rim RL polished, Scratch(es), Repair and paint (complete) 204,21



Door FL, Scratch(es), Acceptable 0,00



Door RL, Scratch(es), Repair and paint (complete) 0,00



Boot cover, Broken, Replace 222,05



Boot lid covering R, Scratch(es), Replace 119,11



Tailgate / Boot, Scratch(es), Repair and paint (complete) 0,00



Bumper R, Dent(s) and scratch(es), Repair and paint (complete) 0,00



Fog light RL, Crack, Replace 0,00



Bumper trim R, Dent(s) and scratch(es), Replace 0,00



Alloy rim FR polished, Scratch(es), Acceptable 0,00



Door RR, Dent(s) and scratch(es), Repair and paint (complete) 0,00



Wing trim RR, Scratch(es), Replace 0,00



Door FR, Scratch(es), Repair and paint (complete)

0,00



Door trim FR, Scratch(es), Replace

0,00

