



## Renault Mégane:

Vinnumber:	<b>VF1RFB00268507430</b>	Versionname:	
First Registrationdate:	<b>28/01/2022</b>	Fiscalpower:	
Expertise Mileage:	<b>149086</b>	Power Kw:	<b>85</b>
Bodytype:		Body colour:	<b>Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Type of rims (mounted):	<b>Steel</b>
Transmission:		Parking lot:	<b>1204</b>
Fueltype:	<b>Diesel</b>		
Type of rims (mounted):	<b>Steel</b>		
Certificate of Conformity:	<b>Yes</b>		
Category:	<b>Passenger Car</b>		
Registration Certificate Car (BE):	<b>Yes</b>		
Registration Certificate Home (BE):	<b>No</b>		

## Options

Number of keys total:	<b>2</b>	Luggage cover:	
Cruise Control:		Front parking sensors:	
Radio multimedia:		Rear parking sensors:	
Type of headlighting:	<b>Headlighting LED</b>	Type of Tow bar:	<b>No Tow bar</b>
Type of GPS:	<b>GPS big screen color</b>		
Type of Lining:	<b>Lining fabrics</b>		
Type of climate control:	<b>Autom climate control</b>		

## Limited Technical Inspection


## Tyres

205/55/16/91 H				
Summer tyres:	Fr.L.	<b>Goodyear: 4 mm</b>	Fr.R.	<b>Goodyear: 4 mm</b>
	Re.L.	<b>Michelin: 4 mm</b>	Re.R.	<b>Nexen: 4 mm</b>
Tyre profile depth FL				<b>4.0</b>
Tyre profile depth FR				<b>4.0</b>
Tyre profile depth RL				<b>4.0</b>
Tyre profile depth RR				<b>4.0</b>
Tyre size FL				<b>205/55 R 16 91 H</b>
Tyre size FR				<b>205/55 R 16 91 H</b>
Tyre size RL				<b>205/55 R 16 91 H</b>
Tyre size RR				<b>205/55 R 16 91 H</b>
Tyre type FL				<b>Summer</b>
Tyre type FR				<b>Summer</b>
Tyre type RL				<b>Summer</b>
Tyre type RR				<b>Summer</b>
Tyre make FL				<b>259</b>
Tyre make FR				<b>259</b>
Tyre make RL				<b>261</b>
Tyre make RR				<b>1957072</b>

## Assistance equipment

Emergency spare wheel:	<b>Yes</b>	Jack:	<b>Yes</b>
Number of charging cables (normal):	<b>0</b>		
Number of charging cables (rapid charge):	<b>0</b>		

Total cost ex VAT:	<b>1268,37</b>
Bonnet, Chemical pollution, Repair and paint (complete):	<b>406,19</b>

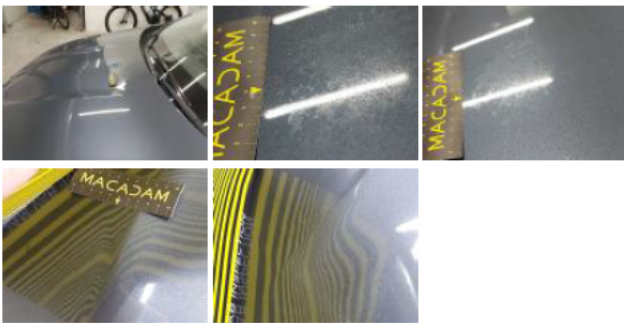

Bumper R, Scratch(es), Repair and paint (complete) 296,58



Tailgate / Boot, Scratch(es), Acceptable 0,00



Rear light L tailgate, Scratch(es), Acceptable 0,00



Wing FR, Scratch(es), Repair and paint (complete) 308,32



Outside rear-view mirror housing R, Scratch(es), Repair and paint (complete) 161,81




Door RR, Scratch(es), Acceptable 0,00



Wing RR, Dent(s) and scratch(es), Acceptable 0,00



Wheel cover RR, Scratch(es), Acceptable 0,00

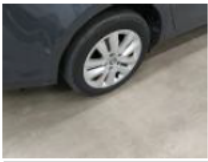

Roof, Dent(s), Paintless dent repair

95,47

