



Expertise

Protocol number: 46294442
Order No. / Reference: 26605426
Inspection date: 30 Jun 2026

Manufacturer: Audi
VIN: WAUZZZF53NA026983

Model: A5 Sportback 40 TDI S tronic



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A5 Sportback 40 TDI S tronic	
Vehicle Identification number	WAUZZZF53NA026983
Mileage (Read)	149,009 km
First registration	4 May 2022
Number of holders	1
Power / Engine displacement	150 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Ibisweiss
Doors / Seats	5 / 4
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Vehicle with smoke odor	Yes (not ozone-treated)



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	1,500 km
Last service on / at	03/2026 at 146,854 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ028896
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BWN 00257		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,125 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/40 R18 93H	Summer tyres on Light alloy	Goodyear	6mm / 6mm
2)	245/40 R18 93H	Summer tyres on Light alloy	Goodyear	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 94H	Winter tyres on Light alloy	Pirelli	4mm / 4mm
2)	225/50 R17 94H	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 12/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system (front side airbags integrated into the seatbacks; with additional head airbag system; deploys in front of the side window area and thus helps to protect front and outer rear passengers in the event of a side impact)
- Drive slip control
- Audi drive select (adjustment of vehicle characteristics in the available modes auto, comfort, dynamic, individual by adapting the steering assistance, accelerator pedal and shift characteristics and other optional equipment. The individual mode allows the combination of different settings of the respective systems.)
- Audi pre sense city (Within system limits, an impending collision with vehicles and pedestrians can be detected at speeds up to approximately 85 km/h. In this case, the system warns the driver visually, audibly, and, if necessary, with a braking jolt. It can initiate full deceleration if required to reduce the collision speed or, if possible, avoid the collision altogether.)
- Decorative inlays diamond lacquer silver grey (for dashboard, door panels and center console)
- Tachometer
- Rear parking aid (supports reversing by acoustically indicating the distance to a detected object behind the vehicle; measured by discreetly integrated ultrasonic sensors in the bumper, active when reverse gear is engaged)
- Electronic Stability Control (ESC) (networks ABS, EBV, ASR and EDS with its own sensors and compares the driving data with reference data; ensures greater stability at any speed by selectively braking individual wheels and intervening in engine management)
- Chassis: Standard chassis (The standard chassis combines very good ride comfort with good driving dynamics. Shock absorbers and coil springs on the front and rear axles - with 5-link lightweight front axle, stabilizer bar; front axle carrier rigidly bolted to the body - with 5-link lightweight rear axle with independent suspension, stabilizer bar; rear axle carrier elastically mounted)
- Front and rear floor mats (made of velour in black; in conjunction with interior design selection, interior S line or in the S model with contrast stitching color-matched to the respective interior color)
- Cruise control with adjustable speed limiter (The cruise control maintains the individually set speed above 20 km/h, provided the engine power allows it. The adjustable speed limiter helps to prevent exceeding a previously set maximum speed from approximately 30 km/h, e.g., within built-up areas.)
- Transmission: S tronic (7-speed)
- Interior lighting (front and rear roof module including capacitively operated front reading lights, illuminated make-up mirror, ambient light on center console, glove compartment light)
- ISOFIX and Top Tether child seat anchorage for the outer rear seats (standard mounting for practical attachment of ISOFIX child seats - Incl. additional attachment point (Top Tether) - The recommended child seats are available from your Audi partner)
- Airbag for driver and front passenger (full-size airbag, with front passenger airbag deactivation)
- Accent surfaces in matte black (for dashboard, trim panels in door sills and center console insert)
- Anti-lock braking system (ABS) (with electronic brake force distribution (EBD) and brake assist)
- Audi connect Emergency Call & Service including vehicle control (Emergency Call & Service: - Emergency call - Online breakdown call - Audi damage service - Audi service appointment online Vehicle control: - Vehicle status report - Remote control locking/unlocking - Parking position - Remote control auxiliary heater - Anti-theft alarm notification)
- Electrically adjustable/heated exterior mirrors (with integrated LED indicator, convex, flat or aspherical mirror glass, including heated windshield washer nozzles)
- Exterior mirror housings in body color
- Outdoor temperature display
- third brake light
- Headliner in fabric (atlas beige or titanium grey, color-matched to the respective interior color)
- Diesel particulate filter (DPF) with DeNox catalyst and AdBlue tank
- Door sill trims with aluminum inlay (on the door sills)
- Electromechanical parking brake (includes parking brake function when stationary - starting aid by automatic release when starting and emergency braking function while driving via all four wheels)
- Driver information system (with high-resolution 5-inch monochrome display, display content: speed (digital speedometer), time, mileage, outside temperature, fuel warning with remaining range, gear shift recommendation, current radio station or music track, radio and media lists, telephone menu, navigation information (if available). The integrated efficiency program supports the driver with consumption data overviews and fuel-saving tips for more economical driving; including break recommendation.)
- Electric front windows (with one-touch up/down function (including excess force limitation) and comfort operation)
- Remote key, without Safe-Lock (locks and unlocks doors, luggage compartment and fuel filler flap - including Keyless-Go - including comfort closing/opening of windows)
- Electrically opening and closing tailgate (opening via the button on the vehicle key, the button in the driver's door panel, or the soft-touch button in the tailgate handle recess, or by a foot gesture (kick movement) in conjunction with the comfort key including sensor-controlled tailgate release; closing via the button on the inside of the tailgate, the button in the driver's door, or via the comfort key (continuous press), or by a foot gesture (kick movement) in conjunction with the comfort key including sensor-controlled tailgate release)
- Interior mirror dimming
- Manual child lock



- boot floor mat
- Headrests (4) (height adjustable front and rear)
- LED rear lights (indicator, brake, tail, reversing and rear license plate lights in LED technology. Brake lights in LED technology enable earlier detection by following traffic due to faster activation.)
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction (with 6 multifunction buttons for operating the basic functions of the existing infotainment system; height and distance adjustable, with full-size airbag; leather steering wheel rim)
- front center armrest
- Non-smoking version (one 12-volt socket each in the center console at the front in front of the gearshift/selector lever and at the rear for the 2nd row of seats - no cigarette lighter)
- Gloss package (roof frame and window channel strips in anodized aluminum)
- Wheel: Alloy wheels "15-spoke design" (7.5 J x 17 with tires 225/50 R 17)
- Wheel: Tire pressure monitoring system (visual and audible warning in case of pressure loss in one or more wheels)
- Radio: MMI Radio Plus (10.1" color display (1,540 × 720) including MMI touch operation - Driver information system with 5" mono display - Audi music interface with 1 USB-A and 1 USB-C port, each with data and charging function - Bluetooth interface (hands-free calling and audio streaming) - 8 passive speakers - AM/FM phase diversity - speed-dependent volume adjustment - voice control system with natural language for controlling infotainment and vehicle functions - WLAN hardware - DAB+ digital radio)
- Front seats (standard seats) (with manual adjustment of seat height, seat longitudinal position, backrest angle, headrest and seat belt height)
- Telephone: Bluetooth interface (The smartphone can be connected to the vehicle via Bluetooth to play music or make phone calls. Two mobile phones can be connected simultaneously for hands-free calling. Complete contact data is only displayed from the first primary phone registered in the MMI. Depending on the smartphone model, emails and SMS messages can also be displayed in the MMI via Bluetooth.)
- Electronic immobilizer (integrated into engine control unit, activated by vehicle key)
- Automatic climate control (1-zone - electronically regulates air temperature, volume and distribution, sun position-dependent control - air distribution can be set using 5 main positions - 3 LEDs integrated into the seat heating/ventilation buttons provide feedback on the selected setting (optional) - buttons for defrosting the front and rear windows - manual recirculation control - with key recognition and humidity sensor - dust and odor-removing cabin air filter)
- LED headlights (using LED technology; low beam, high beam, daytime running lights and position lights in LED; turn signals in incandescent technology, with all-weather light)
- Mild hybrid (Mild hybrid features an enhanced start-stop function, extended energy recuperation during braking to charge the starter battery, and additional lithium-ion storage. This allows the system to recover more energy and switch off the engine more frequently. A supplementary belt-driven starter generator (BSG) is conceptually included for mild hybrid systems. Purely electric driving is not possible.)
- Upholstery: Fabric upholstery Index (for standard seats: - Seat center panels in fabric Index rock grey or black - Seat side bolsters, headrests and center armrest in fabric solid rock grey or black)
- Wheel: Tire repair kit (12V compressor and tire sealant, maximum speed 80 km/h)
- Wheel: Low rolling resistance tires, speed-limited (size 225/50 R17, maximum permissible speed 210 km/h)
- Radio accessories: 8 speakers
- Radio accessories: Data module Europe
- Rear seat backrest foldable (split in a 40:20:40 ratio or fully foldable, with center armrest)
- Electromechanical power steering (maintenance-free rack and pinion steering with speed-dependent steering assistance; precise steering feel at high speeds, excellent support when parking.)
- Seat belts: Three-point automatic seat belts for all seats (front seat belt wearer detection, color-coordinated with the interior, front belt force limiter, front belt tensioner)
- Start-stop system (helps reduce fuel consumption and CO2 emissions by switching off the engine during stationary phases, e.g. at traffic lights. For restarting, the starting process is initiated as soon as the foot brake is released. Can be deactivated at any time via a button.)
- First aid kit with warning triangle (warning triangle - first aid kit - 2 high-visibility vests)
- Glazing: Windscreen in heat-insulating and acoustic glazing (windscreen in heat-insulating glazing, green tinted - improved external noise insulation)
- Green heat-insulating glazing (green tinted - for rear window, door and side windows - rear window heated, with timer)



Extra equipment

- AdBlue tank (24 liters)
- Deletion of model designation and performance/technology lettering
- Fuel tank (54 liters)
- Paint finish: Solid
- Parking Assistance Package (Parking Aid Plus - Parking Assist - Rearview Camera)
- Comfort package seats (variable headrests for the front seats - 4-way lumbar support for the front seats, electrically adjustable horizontally and vertically - comfort center armrest in the front, longitudinally adjustable and tiltable; additional storage option in the integrated storage compartment)
- Wheel: Audi new car tire warranty
- Wheel: Alloy wheels "5-twin-spoke star design" (8.5 J x 18 with tires 245/40 R 18)
- Wheel: Tires optimized for rolling resistance, speed-limited
- Glazing: Privacy glazing (tinted windows) (rear window, rear door and side windows tinted)
- Anti-theft alarm system (anti-theft alarm system - switchable ultrasonic interior monitoring - tow-away protection via tilt sensor - battery-powered horn against cable tampering; remote key with Safelock - locks and unlocks doors, luggage compartment and fuel filler flap - including keyless go - including comfort closing/opening of windows)
- Navigation package (Driver information system with color display: high-resolution 7-inch color display, time, mileage, outside temperature - MMI Navigation plus with MMI touch: navigation system on the high-resolution 10.1-inch color display, map updates, 3D city display, MMI search, MMI touch, online traffic information plus - Audi connect Navigation & Infotainment: hazard information, weather information, online voice input, Wi-Fi hotspot, Amazon Alexa integration, online radio)
- Front seat heating

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	A-pillar - trim - interior, left side - Soiled - Clean
2	Equipment	Tirefit filler - Expired - Replace
3	Interior	Interior (Rauch) - Odour - Ozone treatment
4	Side panel - rear left side	Side panel - dent(s) - Repair and paint
5	Side panel - rear right side	Side panel (Wellig) - Unprofessionally repaired - Repair and paint
6	Trim / covers	Roof lining - Holes - Replace
7	Vehicle glazing	Windscreen - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratch(es) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 30 Mar 2026	7.934,25 €

Repainting

No.	Repainting
1	Roof rail - right side, Mudguard - right side, Door - rear right side, Door - front right side, Professionally carried out, Invoice of repair done Non-existent
2	Side panel - rear right side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof rail - right side	203 µm	Mudguard - right side	190 µm
Side panel - rear right side	300 µm	Door - rear right side	233 µm
Door - front right side	218 µm		

Order/Scope of Order

- An order was placed to prepare a sales report for the described vehicle. This report includes the following:
- Description of key vehicle information
 - Documentation of equipment features
(Delivery by third-party service providers)
 - Documentation of damage, defects, missing parts
 - Documentation of prior damage, unrepaired prior damage, repainting
 - A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
 - a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Comments

- Der beiliegende Winterradsatz ist kein Bestandteil des
Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

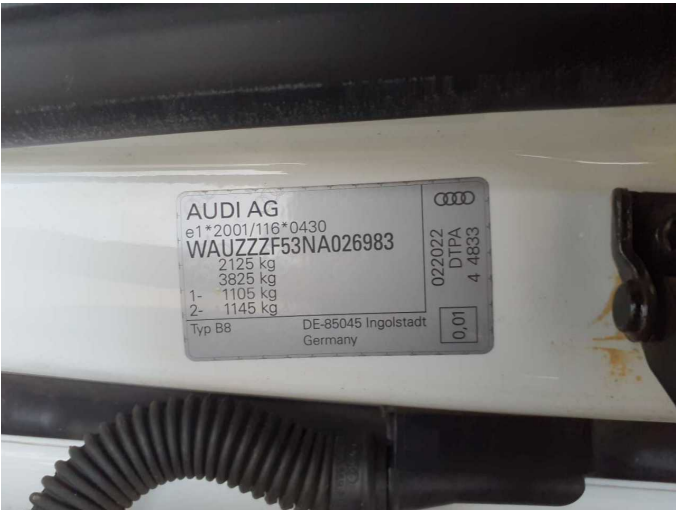


Figure 11: VIN



Figure 12: Mounted tyres

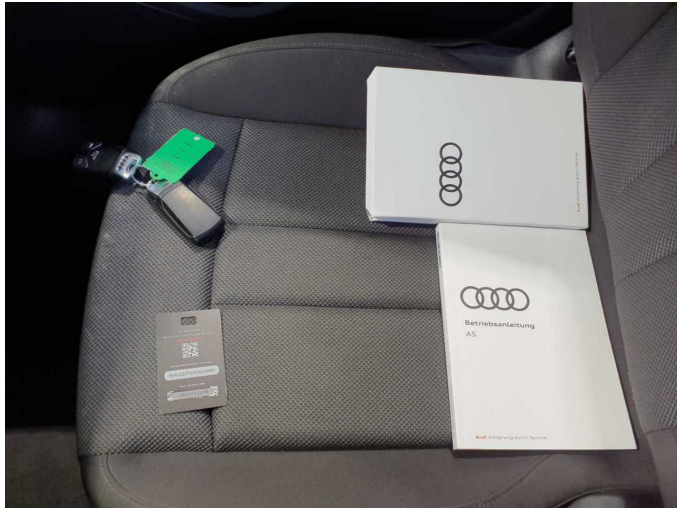


Figure 13: Documents



Figure 14: Additional tyres

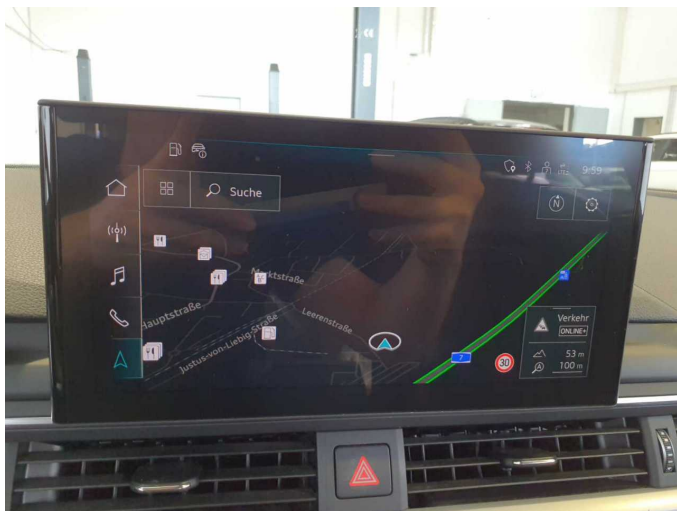


Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Damage 1: Trim / covers: A-pillar - trim - interior, left side - Soiled - Clean



Damage 1: Trim / covers: A-pillar - trim - interior, left side - Soiled - Clean



Damage 1: Trim / covers: A-pillar - trim - interior, left side - Soiled - Clean



Damage 2: Equipment: Tirefit filler - Expired - Replace




Damage 4: Side panel - rear left side: Side panel - dent(s) - Repair and paint



Damage 4: Side panel - rear left side: Side panel - dent(s) - Repair and paint




Damage 4: Side panel - rear left side: Side panel - dent(s) - Repair and paint

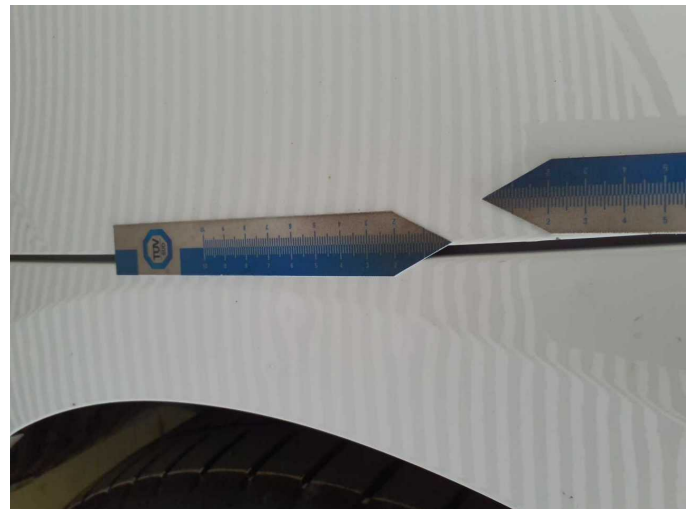

Damage 4: Side panel - rear left side: Side panel - dent(s) - Repair and paint



Damage 4: Side panel - rear left side: Side panel - dent(s) - Repair and paint

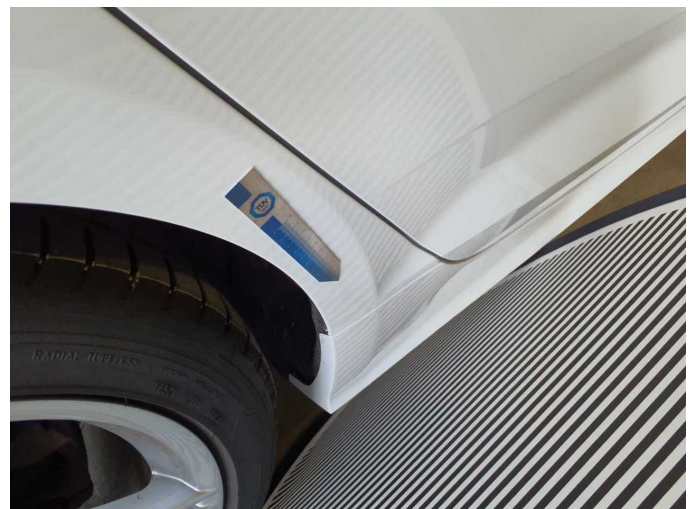

Damage 5: Side panel - rear right side: Side panel (Wellig) - Unprofessionally repaired - Repair and paint




Damage 5: Side panel - rear right side: Side panel (Wellig) - Unprofessionally repaired - Repair and paint




Damage 5: Side panel - rear right side: Side panel (Wellig) - Unprofessionally repaired - Repair and paint



Damage 5: Side panel - rear right side: Side panel (Wellig) - Unprofessionally repaired - Repair and paint

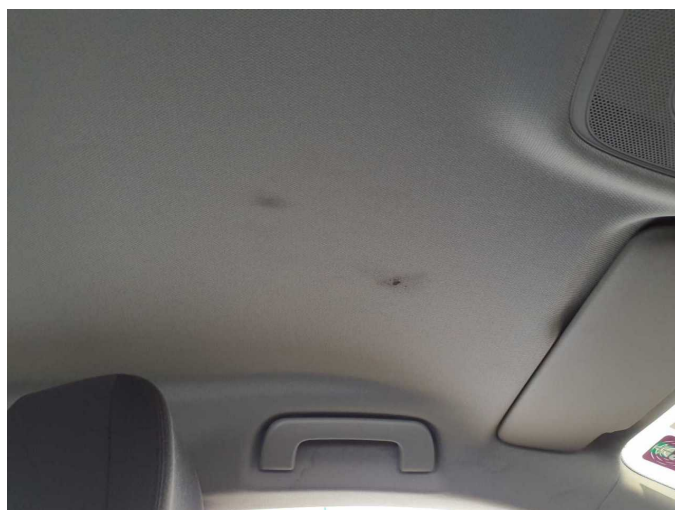

Damage 6: Trim / covers: Roof lining - Holes - Replace

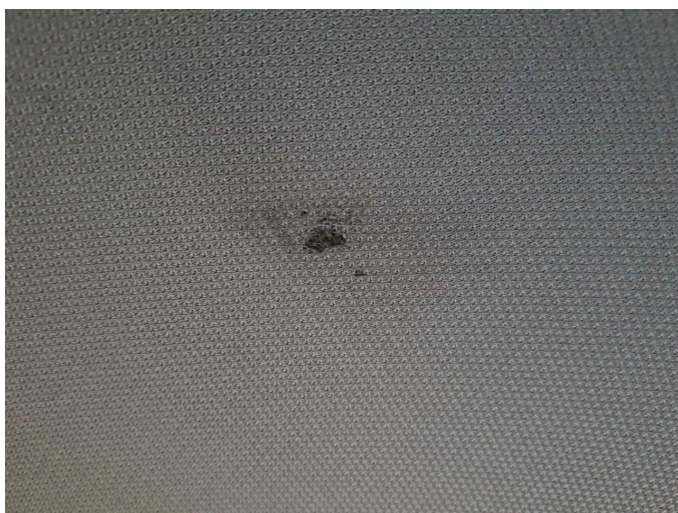

Damage 6: Trim / covers: Roof lining - Holes - Replace



Damage 6: Trim / covers: Roof lining - Holes - Replace



Damage 7: Vehicle glazing: Windscreen - Broken / torn - Replace




Damage 7: Vehicle glazing: Windscreen - Broken / torn - Replace



Damage 7: Vehicle glazing: Windscreen - Broken / torn - Replace



Damage 7: Vehicle glazing: Windscreen - Broken / torn - Replace

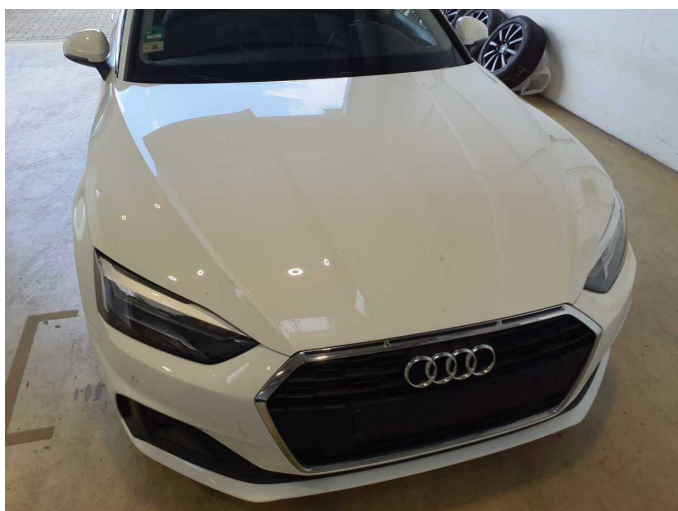

Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Repainting 1: Roof rail - right side, Mudguard - right side, Door - rear right side, Door - front right side



Repainting 1: Roof rail - right side, Mudguard - right side, Door - rear right side, Door - front right side



Repainting 1: Roof rail - right side, Mudguard - right side, Door - rear right side, Door - front right side



Repainting 1: Roof rail - right side, Mudguard - right side, Door - rear right side, Door - front right side



Repainting 1: Roof rail - right side, Mudguard - right side, Door - rear right side, Door - front right side



Repainting 1: Roof rail - right side, Mudguard - right side, Door - rear right side, Door - front right side



Repainting 1: Roof rail - right side, Mudguard - right side, Door - rear right side, Door - front right side



Repainting 1: Roof rail - right side, Mudguard - right side, Door - rear right side, Door - front right side



Repainting 2: Side panel - rear right side



Repainting 2: Side panel - rear right side