



Expertise

Protocol number: 46515629  
Order No. / Reference: 26570169  
Inspection date: 15 Jul 2026

Manufacturer: Skoda  
VIN: TMBJJ9NX7MY161786

Model: Octavia Combi 2.0 TDI DSG Style



| Vehicle details                         |                        |
|-----------------------------------------|------------------------|
| Manufacturer / Type / Model / Equipment |                        |
| Skoda Octavia Combi 2.0 TDI DSG Style   |                        |
| Vehicle Identification number           | TMBJJ9NX7MY161786      |
| Mileage (Read)                          | 130,178 km             |
| First registration                      | 26 May 2021            |
| Number of holders                       | 2                      |
| Next periodical technical inspection    | 07/2026                |
| (Report on hand)                        |                        |
| Power / Engine displacement             | 110 kw / 1,968 ccm     |
| Fuel type / Cylinder                    | Diesel / 4             |
| Gearbox / Number of gears               | Automatic / 7          |
| Type of drive                           | Front drive            |
| Type of vehicle                         | Station wagon          |
| Colour / colour code                    | Black Magic Perleffekt |
| Doors / Seats                           | 5 / 5                  |
| Upholstery type                         | Cloth                  |
| Colour of upholstery                    | Black                  |



## Vehicle details

|                                                  |                              |                                |                                                            |
|--------------------------------------------------|------------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>               | digital proof / complete     | <b>Next maintenance in</b>     | 14,600 km                                                  |
| <b>Last service on / at</b>                      | 12/2025 at 119,370 km        |                                |                                                            |
| <b>Key is / should be</b>                        | 3 / 3                        | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                  |                              | <b>Letter No.</b>              | GD045656                                                   |
| <b>Previous damage / Accident</b>                | Detectable                   | <b>Repainting</b>              | None detectable                                            |
| <b>Inspection conditions</b>                     | sufficient                   | <b>Lifting equipment / pit</b> | No                                                         |
| <b>Test drive</b>                                | Not performed                | <b>Engine function test</b>    | Performed                                                  |
| <b>Manufacturer key number/ type code number</b> | 8004 / AWL 00064             |                                |                                                            |
| <b>Emission standard</b>                         | EURO6;WLTP;AP;PI/CI; M, N1 I | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                    | 1,990 kg                     | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|----|----------------|-----------------------------|--------------|-------------|
| 1) | 205/60 R16 96H | Winter tyres on Light alloy | Hankook      | 4mm / 4mm   |
| 2) | 205/60 R16 96H | Winter tyres on Light alloy | Hankook      | 5mm / 5mm   |

### Additional tyres

| #  | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|----|----------------|-----------------------------|--------------|-------------|
| 1) | 225/45 R18 91W | Summer tyres on Light alloy | Pirelli      | 5mm / 5mm   |
| 2) | 225/45 R18 91W | Summer tyres on Light alloy | Pirelli      | 5mm / 5mm   |

### Replacement

| Typ | Tyre size      | Type of tyre          | Manufacturer | Tread depth |
|-----|----------------|-----------------------|--------------|-------------|
| N   | 125/70 R18 99M | Summer tyres on Steel | Sonstige     | 6 mm        |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

## Equipment

### Standard equipment

- Storage compartment in the luggage compartment with cargo element
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Center section of the dashboard with fabric covering
- Electrically adjustable and heated exterior mirrors
- Electrically folding exterior mirrors
- Hill start assist including auto-hold function
- Hydraulic brake assist (HBA)
- Grey headliner
- Diesel particulate filter
- Tachometer
- Electronic parking brake
- Electronic Stability Control (ESC)
- Driving profile selection
- Front radar assistant including city emergency braking function and pedestrian and cyclist detection
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec: Start/stop system including brake energy recuperation
- Heated rear window
- Interior mirror automatically dimming
- Kessy, keyless entry and start-stop system
- Electronic child safety lock
- Headrests (5) front and rear height adjustable
- LED taillights
- Remote release of the rear seat backrests in the trunk
- Steering wheel: Leather steering wheel with multifunction buttons and paddle shifters.
- Front center armrest, including storage compartment
- Front and rear parking sensors
- Radio accessories: 2 USB-C ports on the front
- Radio accessories: Voice control
- Tire pressure monitoring
- Seat belts
- Seats: Heated front seats
- Seats: Height-adjustable driver and passenger seats
- Seats: Rear seat backrest split 60:40, foldable
- Speed limiter
- Lane change and parking assist
- Telephone: Phonebox with inductive charging function (connection via external antenna)
- Bluetooth hands-free phone system
- Immobiliser
- Storage compartments
- Airbag, driver and passenger
- Airbag, head airbags
- Ambient lighting
- Traction control (ASR)
- Automatically dimming exterior mirror (driver's side)
- Exterior mirrors with memory function
- Heated windshield washer nozzles including 5l washer fluid reservoir
- Glasses compartment in the headliner
- Roof rails, anodized
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Third brake light
- Electronic transverse differential lock (XDS+)
- Driving light assistant
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Cruise control system
- Tinted windows
- Rear lights with crystal glass look and animated turn signals
- Rear window wiper including windshield washer system
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Removable boot cover
- LED fog lights
- LED license plate lights
- Steering wheel: height and reach adjustable
- Manual headlight range adjustment
- Rear center armrest with pass-through option
- Engine drag torque control (MSR)
- Upholstery: Cloth
- Radio accessories: Digital radio reception DAB+
- Rain sensor
- Electromechanical power steering
- Safety lights in the front side doors
- Seats: Electrically adjustable front seats with memory function
- SKODA Care Connect
- Lane keeping assistant (Lane Assist)
- 12V socket in the trunk
- Phone: SmartLink (MirrorLink, Apple CarPlay, Android Auto)
- Phone: Wireless SmartLink for Apple CarPlay
- Lashing eyes in the trunk
- Central locking including remote control integrated into the key and EASY Start



## Extra equipment

- Comfort opening with electric tailgate operation (incl. semi-automatic luggage compartment cover)
- Package: Infotainment Columbus Plus (Combi) (Columbus navigation system - Infotainment Online (3-year term) - Head-Up Display - Luggage net partition)
- Package: Parking & Visibility (cornering lights in the fog lights - headlight cleaning system - LED ambient lighting - LED matrix headlights and dynamic high beam assist (AFS) - crystal glass look taillights and animated turn signals - reversing camera - parking assist)
- Package: Travel (DSG) (Traveller assistance system: - Traffic sign recognition - Predictive and adaptive cruise control (pACC) - Adaptive lane keeping assist - Emergency and traffic jam assist - Capacitive steering wheel with hands-off detection - Adaptive cruise control (ACC) (control range 210 km/h) - Driver fatigue detection - Driving profile selection - Automatically dimming exterior mirror (driver's side))
- Variable loading floor in the trunk including organizer and aluminum crossbars
- Winter complete wheel set LM rim 205/60R16
- Faux leather upholstery on the backs of the front seats
- Paint finish: Pearl effect
- Package: Comfort & Relax (Combi) (3-zone Climatronic - Sunset (dark tinted rear window and rear side windows) - acoustic glazing in the front side windows - heated front and outer rear seats - heated steering wheel - 230 V socket and 3 x USB charging ports - sunshades in the rear doors - multi-function storage compartment in the boot - sleeping headrests in the rear - semi-automatic luggage compartment cover)
- Package: Simply Clever for variable loading floor (media holder - tablet holder - waste bin - 3rd vehicle key)
- Radio accessories: CANTON sound system and 18" steel spare wheel (12 speakers (10 speakers, 1 central speaker, 1 subwoofer in the spare wheel well) - 18" steel spare wheel (tire 125/70 R18) including jack and wheel wrench)
- Wheels: 18" Perseus alloy wheels, silver polished (7.5J x 18, ET 48 with 225/45 R18 tires)
- Heated windscreen

## Brief expert findings

|                      |                                                                                                                                                                                                                                               |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)                                                                  |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.                                                                     |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent. |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                                                                                         |
| Engine function test | An engine test run was performed.                                                                                                                                                                                                             |

## Value reducing factors

| No. | Component group | Description                                              |
|-----|-----------------|----------------------------------------------------------|
| 1   | Misc.           | Main inspection (diesen Monat) - Due - No deduction      |
| 2   | Fuel system     | Tank flap (Eiskratzer) - Missing - Replace               |
| 3   | Trim / covers   | Carpet - front left side - Broken / torn - Loss in value |
| 4   | Rear bumper     | Rear bumper - Scratch(es) - Smart repair                 |
| 5   | 2nd wheel set   | 1 alloy rim - Scratched - Loss in value                  |
| 6   | Bonnet          | Bonnet - Dent / paintcoat damage - Repair and paint      |

## Wear and tear

| No. | Component group | Description                          |
|-----|-----------------|--------------------------------------|
| 1   | Trim / covers   | Floor mats - Broken / torn - Replace |

The vehicle shows signs of wear and tear commensurate with its age and use.



## Previous damages

| No. | Previous damage                                                  | Extent of damage (Net) |
|-----|------------------------------------------------------------------|------------------------|
| 1   | Front, Side right, Provided by user / customer, from 15 May 2023 | 2.981,43 €             |
| 2   | Front, Provided by user / customer, from 3 May 2023              | 3.351,64 €             |

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

## Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.



**Figure 1:** Diagonal front (left)



**Figure 2:** Diagonal front (right)



**Figure 3:** Diagonal rear (left)



**Figure 4:** Diagonal rear (right)



**Figure 5:** Interior - front



**Figure 6:** Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

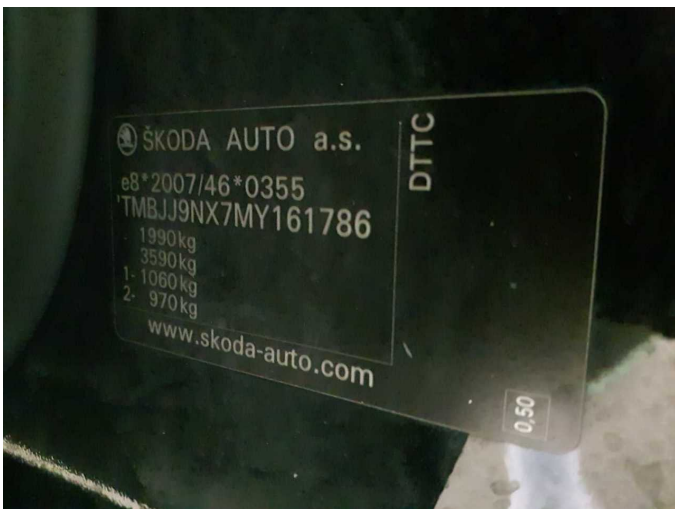


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

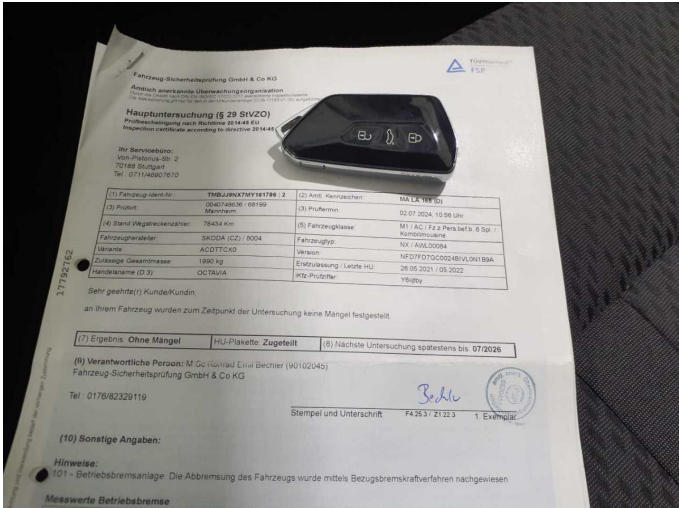


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

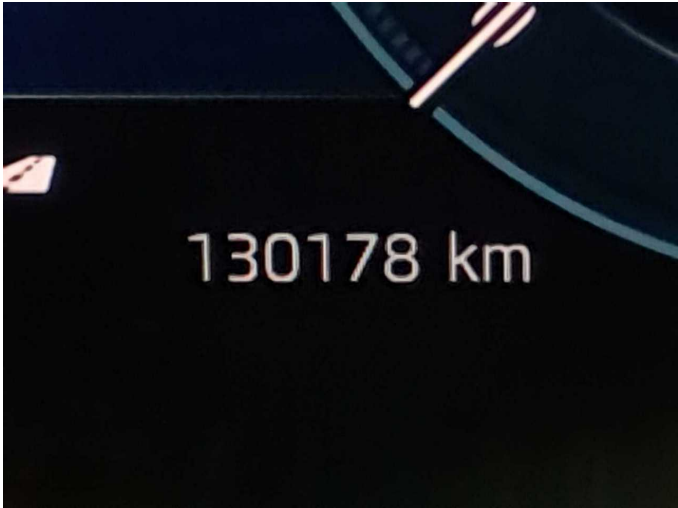


Figure 27: Misc.

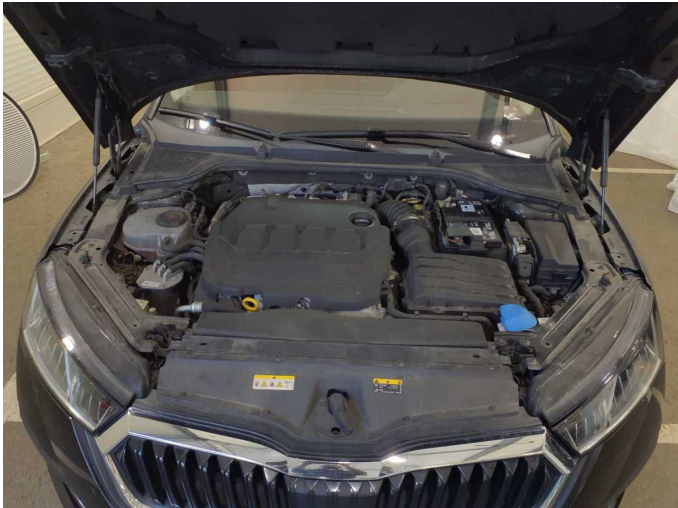


Figure 28: Misc.



Figure 29: Misc.

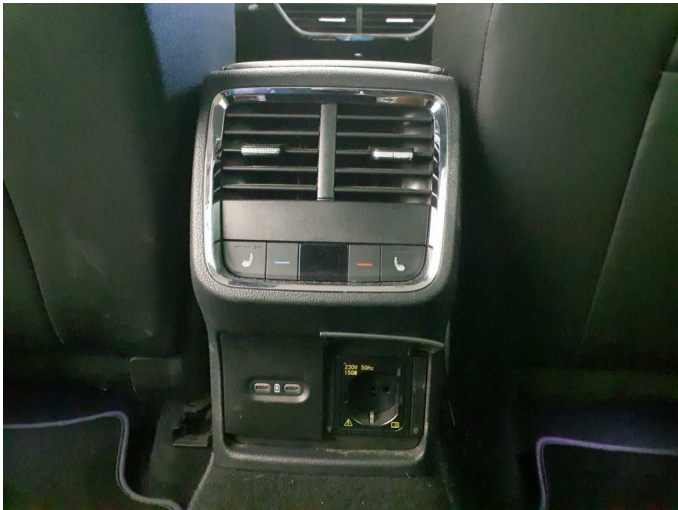


Figure 30: Misc.



Figure 31: Misc.

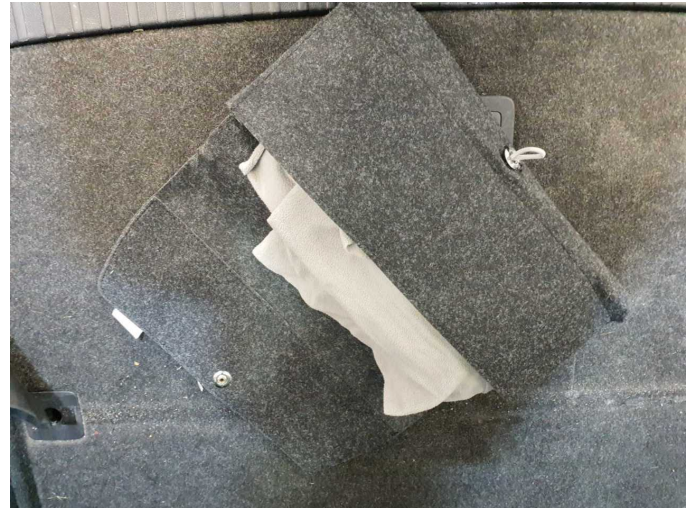


Figure 32: Misc.



Figure 33: Misc.

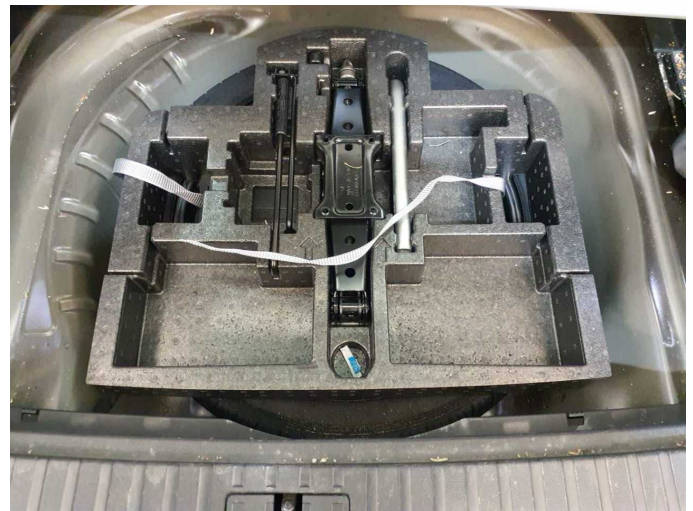


Figure 34: Misc.


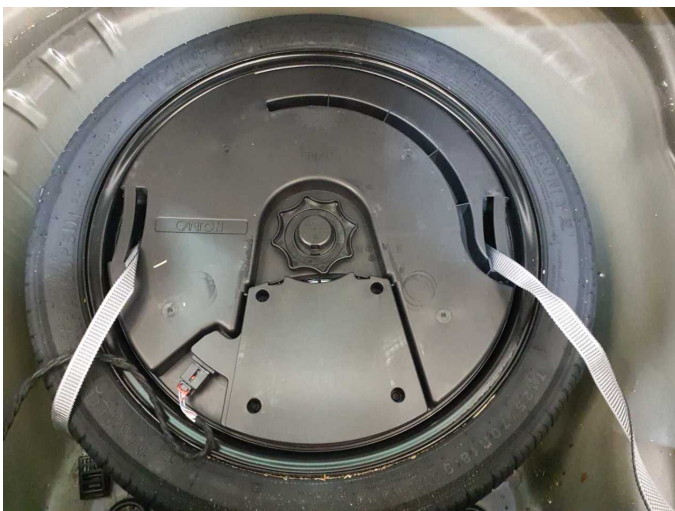


Figure 35: Misc.



Figure 36: Misc.

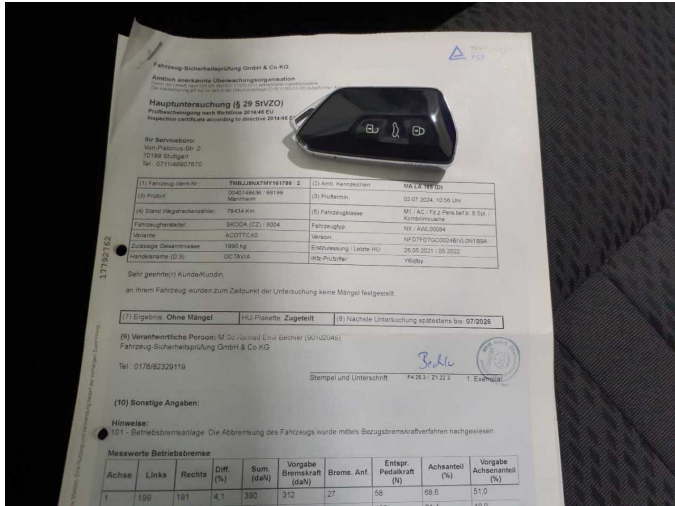


**Damage 1:** Misc.: Main inspection (diesen Monat) - Due - No deduction



**Damage 2:** Fuel system: Tank flap (Eiskratzer) - Missing - Replace




**Damage 3:** Trim / covers: Carpet - front left side - Broken / torn - Loss in value

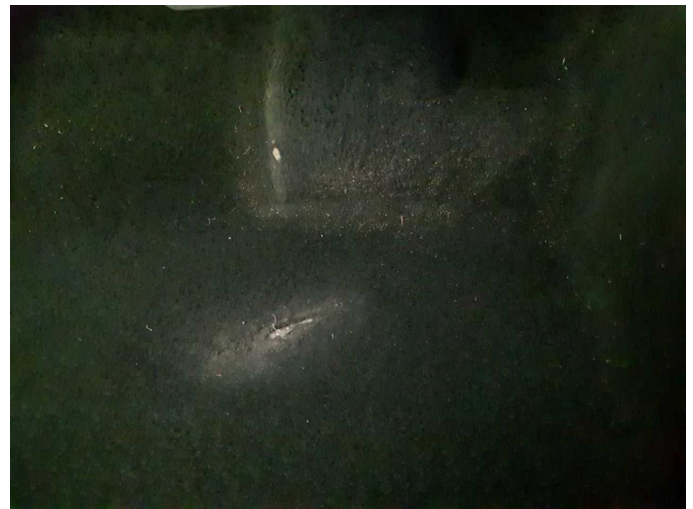

**Damage 3:** Trim / covers: Carpet - front left side - Broken / torn - Loss in value



**Damage 4:** Rear bumper: Rear bumper - Scratch(es) - Smart repair

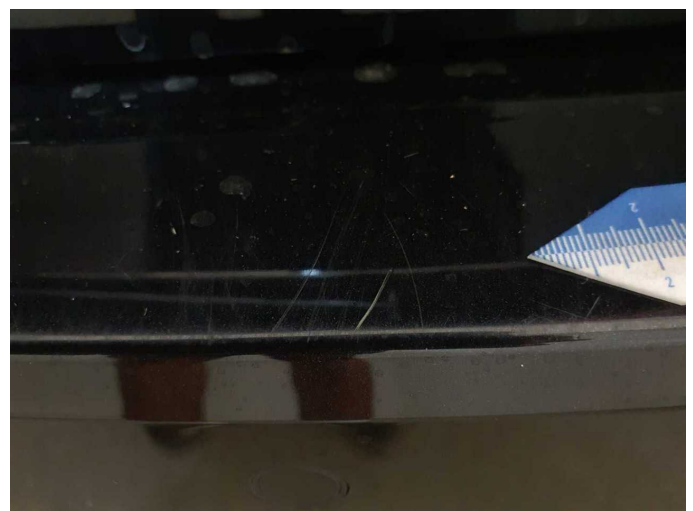


**Damage 4:** Rear bumper: Rear bumper - Scratch(es) - Smart repair



**Damage 4:** Rear bumper: Rear bumper - Scratch(es) - Smart repair



**Damage 4:** Rear bumper: Rear bumper - Scratch(es) - Smart repair

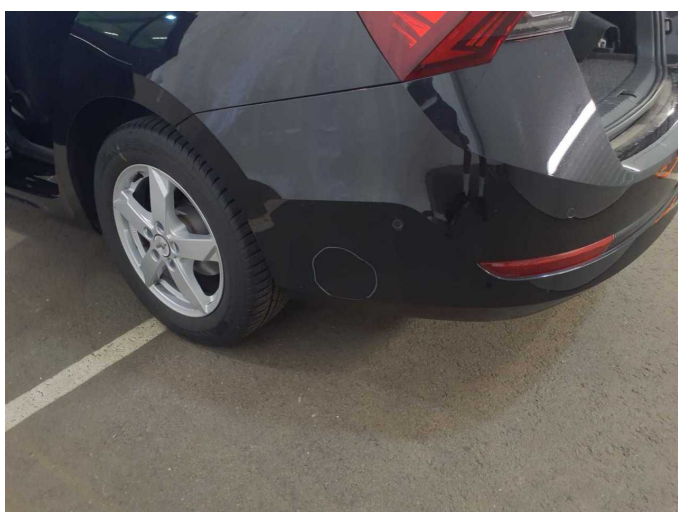


**Damage 4:** Rear bumper: Rear bumper - Scratch(es) - Smart repair



**Damage 4:** Rear bumper: Rear bumper - Scratch(es) - Smart repair



**Damage 5:** 2nd wheel set: 1 alloy rim - Scratched - Loss in value

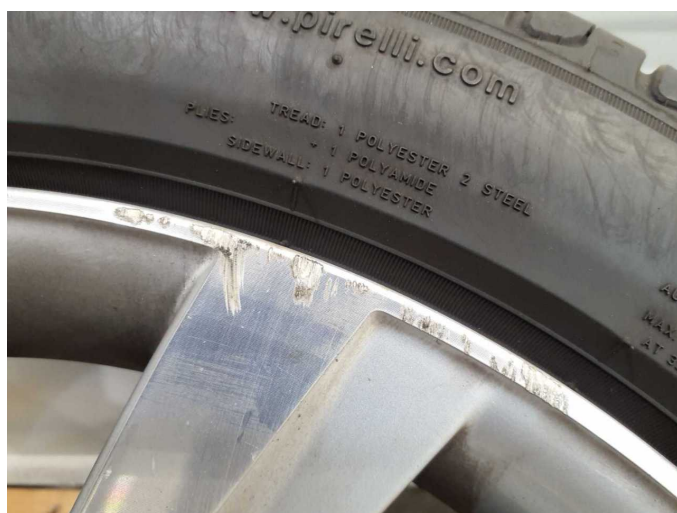

**Damage 5:** 2nd wheel set: 1 alloy rim - Scratched - Loss in value



**Damage 5:** 2nd wheel set: 1 alloy rim - Scratched - Loss in value




**Damage 6:** Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




**Damage 6:** Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



**Damage 6:** Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

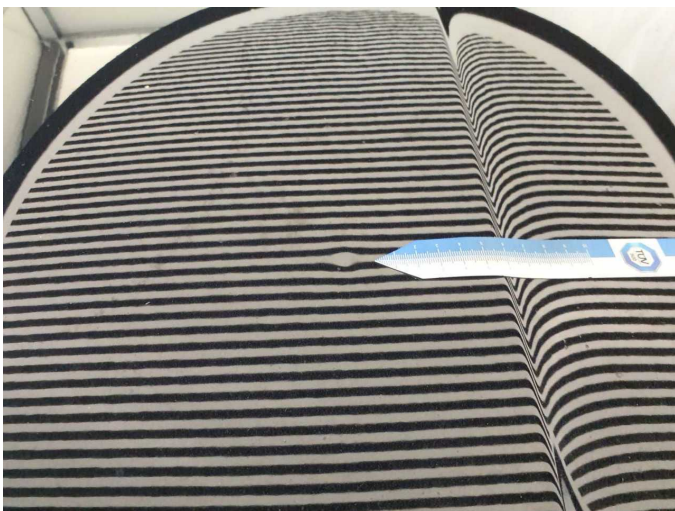


**Damage 6:** Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

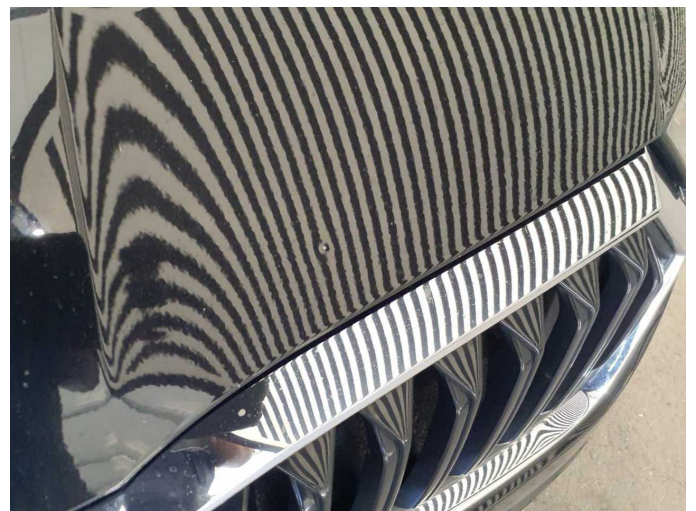

**Damage 6:** Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



**Wear and tear 1:** Trim / covers: Floor mats - Broken / torn - Replace

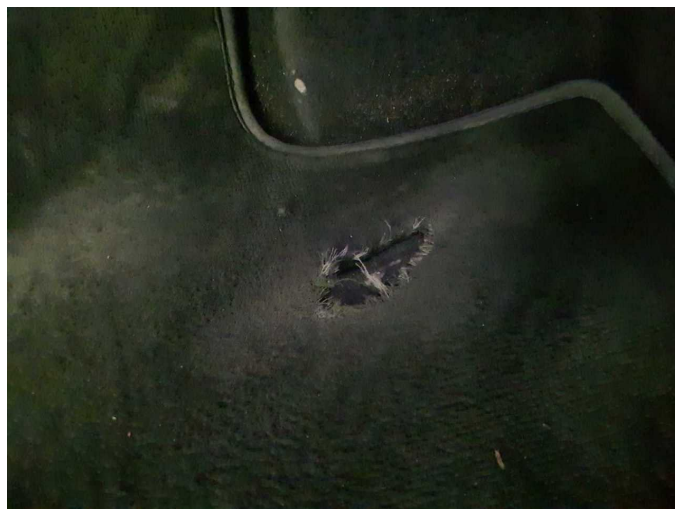

**Wear and tear 1:** Trim / covers: Floor mats - Broken / torn - Replace



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJJ9NX7MY161786  
Hersteller / Modell: SKODA SKODA Octavia Combi 2.0 TDI DSG Style

| Datum      | KM-Stand | Beschreibung                                                                                                                            |
|------------|----------|-----------------------------------------------------------------------------------------------------------------------------------------|
| 12.06.2026 | 129.996  | Batterie ern; Systemtest/Eigendiagnose                                                                                                  |
| 18.12.2025 | 119.370  | Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges |
| 14.08.2025 | 107.668  | Systemtest/Eigendiagnose                                                                                                                |
| 30.06.2025 | 103.248  | Bremsscheiben hinten; Reparatur Sonstiges; Systemtest/Eigendiagnose                                                                     |
| 26.05.2025 | 101.409  | Batterie ern; Luftfiltereinsatz ern; Systemtest/Eigendiagnose                                                                           |
| 20.05.2025 | 101.395  | Systemtest/Eigendiagnose                                                                                                                |
| 17.02.2025 | 95.099   | Bremse Sonstiges; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne                    |
| 09.10.2024 | 86.127   | Systemtest/Eigendiagnose                                                                                                                |
| 08.12.2023 | 69.948   | Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges              |
| 11.08.2023 | 64.993   | Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Wartung Sonstiges                                                          |
| 09.01.2023 | 49.014   | Bremsklötze vorne; Motoröl b. Wartung; Ölwechsel                                                                                        |
| 13.06.2022 | 31.366   | Regelwartungsdienst                                                                                                                     |
| 12.04.2022 | 26.056   | Motoröl b. Wartung; Ölwechsel                                                                                                           |