



CITROËN C5 AIRCROSS: GP-020-BK

Vinnumber:	VR7ARHNSSPL021116	Versionname:	CITROËN C5 AIRCROSS PureTech 130 S&S EAT8
First Registrationdate:	23/05/2023	Fiscalpower:	Feel Pack VP [5P] bva 8-131CH-7cv (SUV)
Expertise Mileage:	100652	Power Kw:	96
Bodytype:	SUV	Body colour:	Grey
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Front	Interior colour:	Black
Fueltype:	Petrol	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options

Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Headlights Xenon/LED/Laser	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Steering wheel leather		Rear view camera	
Type of climate control	Autom climate control	Seat cover lining	Lining Other
			Lining Semi-leather

Tyres

	225/55/18/102 V			
Winter tyres:	Fr.L.	Kleber: 40%	Fr.R.	Kleber: 30%
	Re.L.	Kleber: 30%	Re.R.	Kleber: 35%
Tyre profile depth FL				5.6
Tyre profile depth FR				6.1
Tyre profile depth RL				6.1
Tyre profile depth RR				6.0
Tyre size FL				225/55 R 18 102 V
Tyre size FR				225/55 R 18 102 V
Tyre size RL				225/55 R 18 102 V
Tyre size RR				225/55 R 18 102 V
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				2479
Tyre make FR				2479
Tyre make RL				2479
Tyre make RR				2479

Assistance equipment

Floor mat F, Tear, Replace



Remote ignition key (no insert), Missing, Repair/replace (lump sum)



Interior, Dirty, Cleaning



Tyre FL, Out of tolerance, Replace



Alloy rim FL bitone/polychrome, Scratch(es), Acceptable



Tyre RL, Out of tolerance, Replace



Tyre RR, Out of tolerance, Replace



Tyre FR, Out of tolerance, Replace



Alloy rim FR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Door RL, Dent(s) and scratch(es), Repair and paint (complete)



Wing RL, Dent(s), Repair and paint (complete)



Roof pillar L, Hail damage, Repair and paint (complete)



Door trim RL, Deformed / Strained, Replace



Door trim FL, Deformed / Strained, Replace



Windscreen, Stone chip(s), Windscreen repair 3 stonechips



Bumper F, Scratch(es), Acceptable



Bumper grille, Unclassped, Dismount/Mount



Bumper spoiler F, Scratch(es), Acceptable



Wing FR, Scratch(es), Polish




Side repeater R, Scratch(es), Replace



Door FR, Dent(s) and scratch(es), Repair and paint (complete)



Door RR, Scratch(es), Polish

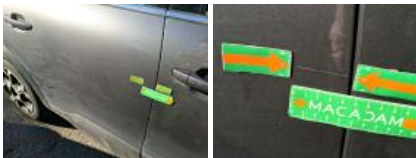

Outside rear-view mirror housing R, Scratch(es), Polish




Bumper R, Scratch(es), Polish



Roof, Hail damage, Repair and paint (complete)



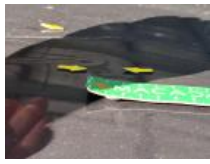

Historique Maintenance

Immatriculation: GP-020-BK Date de 1ère immatriculation: 23/05/2023

Modèle: Citroen C5 AIRCROSS PureTech 130 S&S EAT8 Feel Pack VP [5P] bva 8-131CH-7cv (SUV)

Date	Kilométrage	Fournisseur	Descriptif
17/12/2025	84.898	DMDA	REVISION ET CLIM ET AIR ET BOUGIES
10/06/2025	62.977	NOMBLOT 1912	REVISION
	0		LIQUIDE DE FREIN
07/11/2024	42.245	NOMBLOT 1912	FILTRE A AIR RPLT
	0		BOITIER D ALLUMAGE RPLT
	0		REVISION
	0		FILTRE CLIM RPLT
25/01/2024	19.469	NOMBLOT 1912	REVISION