



Expertise

Protocol number: 46434818
Order No. / Reference: 26663290
Inspection date: 2 Jul 2026

Manufacturer: Skoda
VIN: TMBLE9NY7PF053092

Model: ENYAQ iV 80X



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda ENYAQ iV 80X	
Vehicle Identification number	TMBLE9NY7PF053092
Mileage (Read)	76,159 km
First registration	22 Jun 2023
Number of holders	1
Next periodical technical inspection	06/2026
(Report not on hand)	
Power / Engine displacement	77 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Black-Magic Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	402 Tag(e)
Last service on / at	08/2025 at 48,407 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT104602
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWT 00039		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,750 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105V	All-season tyres on Light alloy	Hankook	6mm / 6mm
2)	255/50 R19 107V	All-season tyres on Light alloy	Hankook	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105V	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	255/50 R19 107V	Winter tyres on Light alloy	Goodyear	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Child safety locks on the rear doors
- Digital instrument cluster (Virtual Cockpit)
- E-Sound (external speaker for generating a driving sound)
- Electrically adjustable, heated and folding exterior mirrors, including automatic dimming.
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Front and rear headrests are height-adjustable.
- Front radar assist with pedestrian and cyclist detection and city emergency braking function (The front radar assist is a safety system with collision warning: If confronted with an unavoidable collision, it brakes the vehicle to minimize the consequences. It also performs emergency braking if a pedestrian or cyclist attempts to cross the vehicle's path. The front radar assist recognizes from the way the driver moves the vehicle that they are attempting to avoid an obstacle and actively intervenes in the steering to steer around it.)
- Grey headliner
- Hill start assist
- Increased battery charging power max. 125 kW incl. 1 year free monthly basic fee at Ionity
- LED headlights with daytime running lights
- LED taillights
- Outdoor temperature display
- Package: Chrome (chrome trim strips on the outside of the side windows - AERO anodized roof rails)
- Package: Parking BASIC (front and rear parking sensors - reversing camera)
- Paint finish: Solid
- Radio: Infotainment system with capacitive 13" color display (8 speakers - 2 x USB ports (Type-C) at the front - Navigation system preparation - DAB+ digital radio reception - Bluetooth hands-free phone system - Voice control - SmartLink (MirrorLink, Apple CarPlay, Android Auto) - Wireless SmartLink for Apple CarPlay and Android Auto)
- Removable boot cover
- Seat belts (Height-adjustable three-point seat belts in the front - Three three-point seat belts in the rear - Seat belt reminder indicators on the front and rear seats)
- Skoda Care Connect (SOS emergency call function (eCall including automatic activation in the event of an accident with airbag deployment) - Free remote vehicle access to iV-specific functions for 10 years (iV Remote Services Basic) such as starting and stopping the charging process, creating charging plans, setting the interior climate control before starting a journey, etc. - Mobility service (connection option for rapid assistance in the event of a breakdown) - Information service - Free remote vehicle access for 1 year (Remote Access))
- Steering wheel adjustable for height and reach
- 12V socket - in the trunk
- acoustic windscreen
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, center airbag front
- Airbag, front and rear head airbags
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Automatic interior mirror dimming
- Central locking including remote control integrated into the key (EASY START (keyless start-stop system))
- Charging cable for AC charging stations (Mode 3 charging cable, Type 2, 16A) (Fast charging connector (CCS / Combo 2))
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger, including odor and allergen filter)
- Cruise control
- Design Selection Loft (seat covers in fabric/faux leather - decorative trim strips "brushed aluminum" - headliner in grey - front center armrest, including storage compartment - rear center armrest with cup holders and pass-through - floor mats - ambient lighting for front door panels, multicoloured - footwell lighting and illuminated door handle recesses - umbrella)
- Electric windows front and rear (including anti-pinch protection and child safety lock)
- Evasive steering assist including turning assistant (The turning assistant monitors oncoming vehicles when you turn left (for left-hand drive vehicles). If there is an immediate danger, it brings the vehicle to a standstill and a warning signal sounds.)
- Heated rear window
- Immobiliser
- Isofix anchorage on the front passenger seat
- Isofix anchorage on the outer rear seats including top tether
- Lane keeping assistant (Lane Assist)
- Manual headlight range adjustment
- Package: Drive BASIC (paddle shifters for adjusting recuperation strength - driving profile selection - heated leather steering wheel with multifunction buttons - steering wheel with hands-off detection)
- Permanent all-wheel drive
- Power steering
- Radio accessories: SmartLink (Android Auto and Apple CarPlay)
- Radio accessories: Wireless SmartLink
- Rain sensor and driving light assistant with coming and leaving home function
- Rear seat backrest split 60:40, foldable
- Rear window wiper including windshield washer system
- Safety lights in the front side doors
- Seats: Front seats are height-adjustable, including manually adjustable lumbar support.
- Speed limiter



- Storage compartments (Four roof grab handles, rear with coat hooks - Warning vest compartment in the doors - Storage compartments in the front door panels with 1.5l bottle holders - Storage compartments in the rear door panels - Umbrella compartments in the front doors - Ticket holder on the windshield - Ice scraper in the tailgate panel - Coat hooks on the B-pillars - Cup holder in the front center console - Storage compartments in the trunk)
- Third brake light
- Wheels: 19" Proteus Silver alloy wheels (8Jx19 tires 235/55 R19 101T front, 255/50 R19 103T rear)

- Tinted windows
- Tire mobility kit (tire repair spray incl. compressor)
- Tire pressure monitoring
- Traction control (ASR)
- Traffic sign recognition
- Transmission: 1-speed (EV)

Extra equipment

- Airbag, rear side airbags
- Design Selection Lodge (seat covers in natural fiber/wool fabric - decorative strips "Silver square haptic" - headliner in grey - front center armrest, including storage compartment - rear center armrest with cup holders and pass-through - floor mats - ambient lighting for instrument panel and front door trim, multicoloured - footwell lighting and illuminated door handle recesses - umbrella)
- Package: Drive SPORT BASIC (paddle shifters for adjusting recuperation strength - driving profile selection - heated leather steering wheel in sport design with multifunction buttons - steering wheel with hands-off detection - progressive steering)
- Package: Family BASIC (sunshade roller blind for rear side windows - 230V socket and 2 x USB-C charging ports in the rear - storage box for rear seat row)
- Package: Infotainment BASIC (Navigation system - Infotainment Online 3 years (Online map updates for navigation; Display of weather data, news, headlines; Charging station and parking space search; Online POI search; Online destination import))

- Swiveling trailer hitch (including trailer stabilization)
- Chassis: Sport chassis
- Luggage net partition
- Paint finish: Pearl effect
- Package: Convenience BASIC (KESSY (Keyless Entry and Start-Stop System) - Phonebox with inductive charging function (connection via the external antenna) - Sunset including acoustic side glazing at the front - Extended acoustic measures - Driver fatigue detection - Removable glasses compartment)
- Package: Driving Assistance PLUS (Predictive Adaptive Cruise Control (pACC) incl. Traffic Jam Assist - Lane Change and Parking Assist - Proactive Occupant Protection - Traveller Assistance System incl. Emergency Assist (Traffic Sign Recognition, Adaptive Lane Keeping Assist))
- Package: Basic climate control (Heated front seats - Heated windscreen washer nozzles - Climatronic air conditioning (3-zone), fully automatic, separately adjustable for driver, front passenger and rear passengers, including odor and particle filter)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - rear left side	Door - Scratch(es) - Smart repair
2	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
3	Interior	Interior (Tierhaare) - Soiled - Clean
4	Door - front left side	Door edge - Scratch(es) - Smart repair
5	Rear bumper	Rear bumper - Scratch(es) - Smart repair
6	Body	C-pillar - left side - Dent / paintcoat damage - Smart repair



Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction
4	Front bumper	Spoiler - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Service book (Digitaler Ausdruck)

Documents - Log book

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 7 Oct 2024	1.863,51 €
2	Rear, Provided by user / customer, from 7 Jul 2025	2.019,25 €
3	Front, Provided by user / customer, from 27 Dec 2024	2.213,89 €
4	Side right, Provided by user / customer, from 1 Sept 2025	2.313,66 €

Repainting

No. Repainting

- 1 Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Door - front right side 245 µm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Der beiliegende Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Navigation

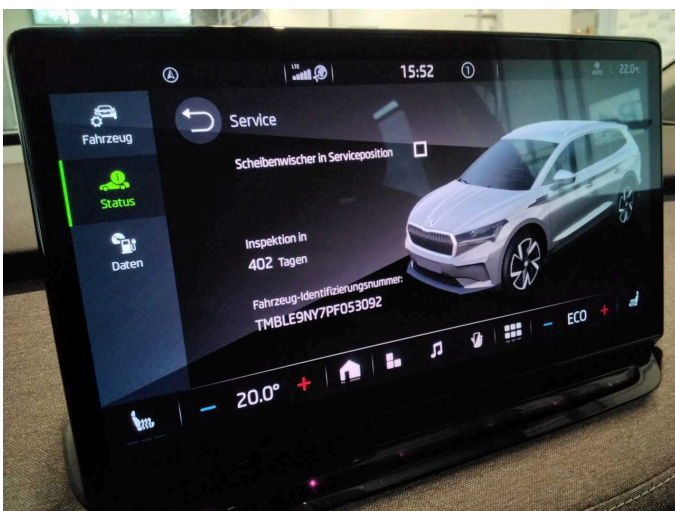


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

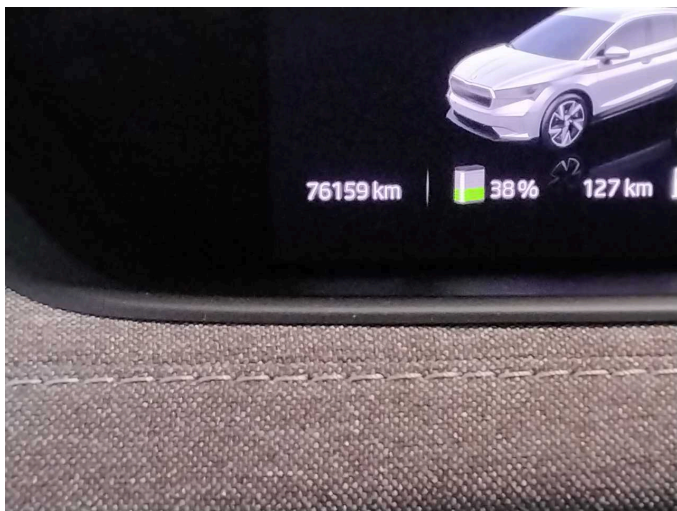


Figure 21: Misc.



Figure 22: Misc.

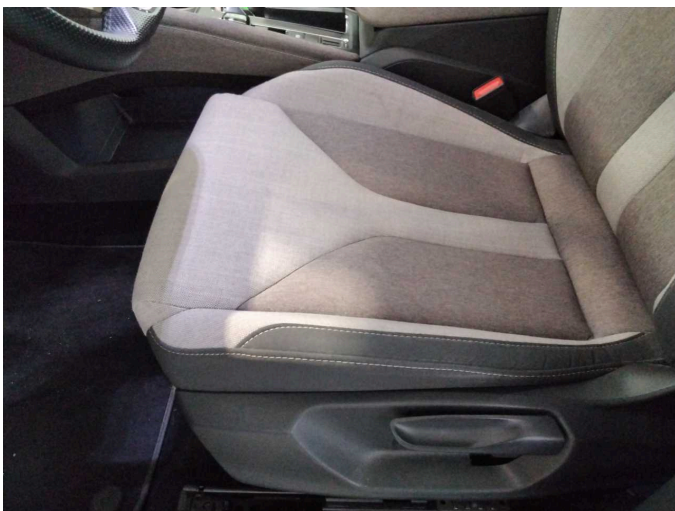


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

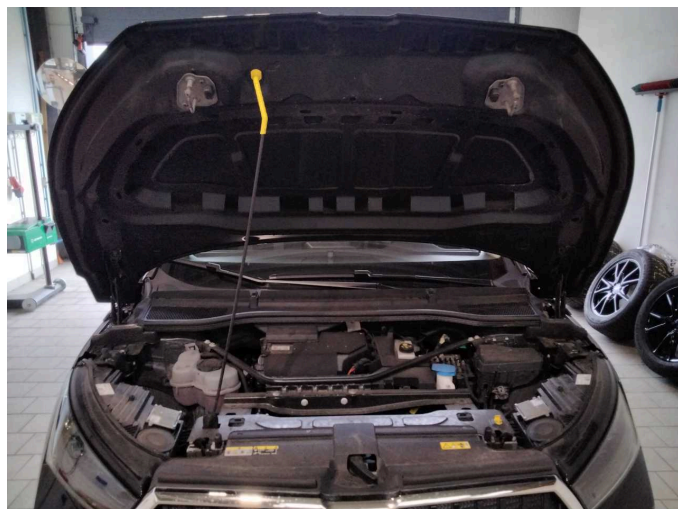


Figure 26: Misc.



Figure 27: Misc.

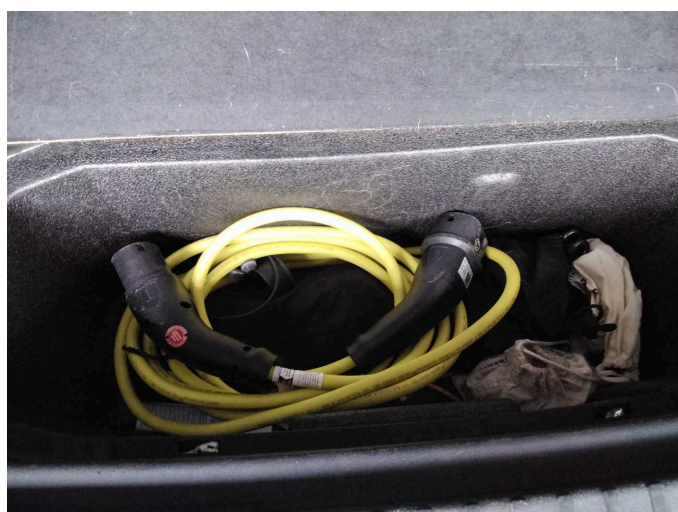


Figure 28: Misc.



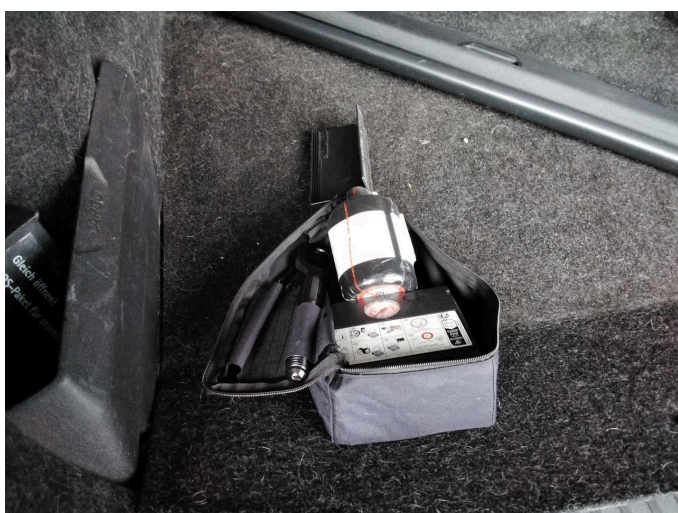


Figure 29: Misc.

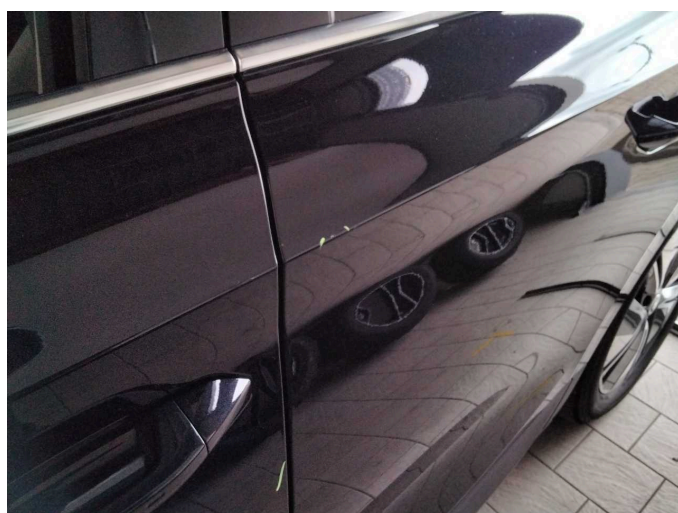

Damage 1: Door - rear left side: Door - Scratch(es) - Smart repair

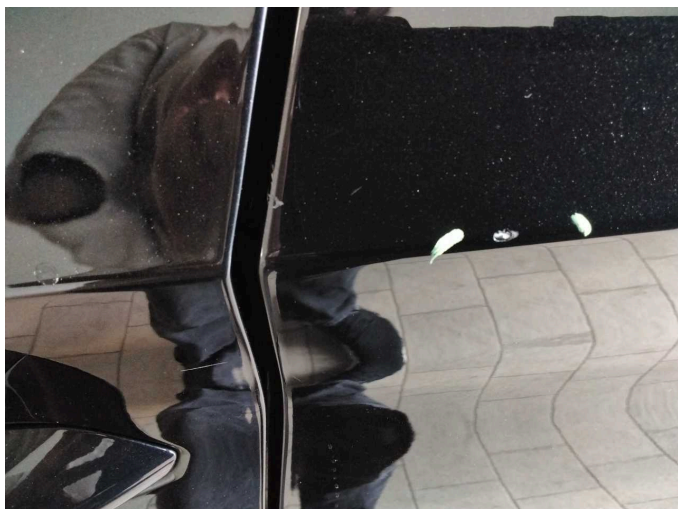

Damage 1: Door - rear left side: Door - Scratch(es) - Smart repair



Damage 2: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 2: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 2: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 3: Interior: Interior (Tierhaare) - Soiled - Clean



Damage 3: Interior: Interior (Tierhaare) - Soiled - Clean



Damage 3: Interior: Interior (Tierhaare) - Soiled - Clean



Damage 3: Interior: Interior (Tierhaare) - Soiled - Clean



Damage 3: Interior: Interior (Tierhaare) - Soiled - Clean



Damage 4: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 4: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair

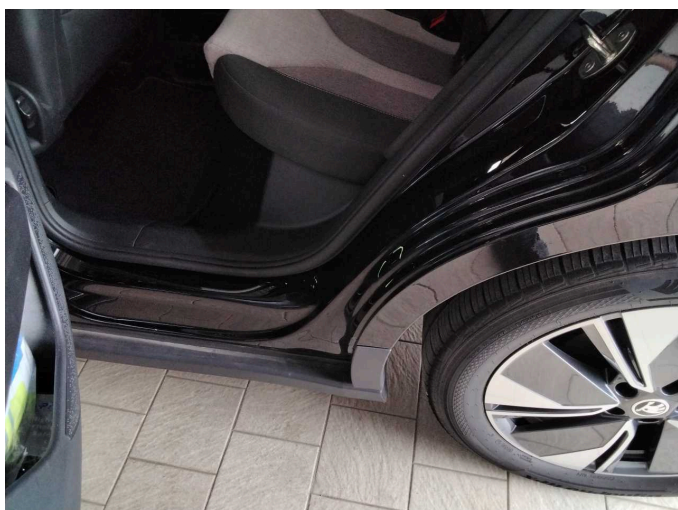

Damage 6: Body: C-pillar - left side - Dent / paintcoat damage - Smart repair

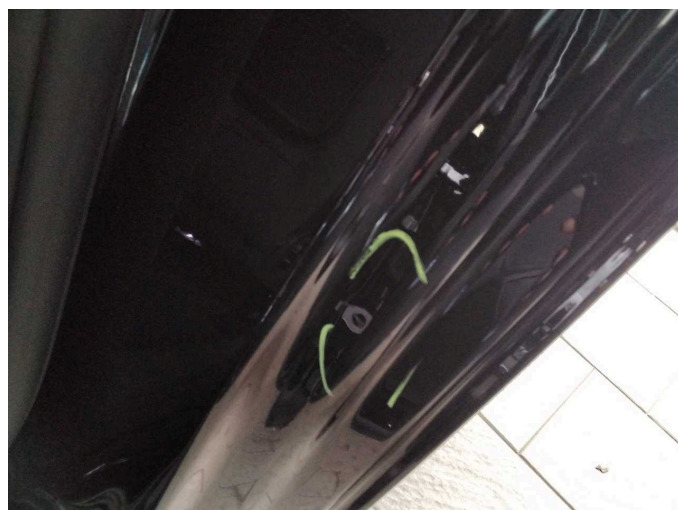


Damage 6: Body: C-pillar - left side - Dent / paintcoat damage - Smart repair

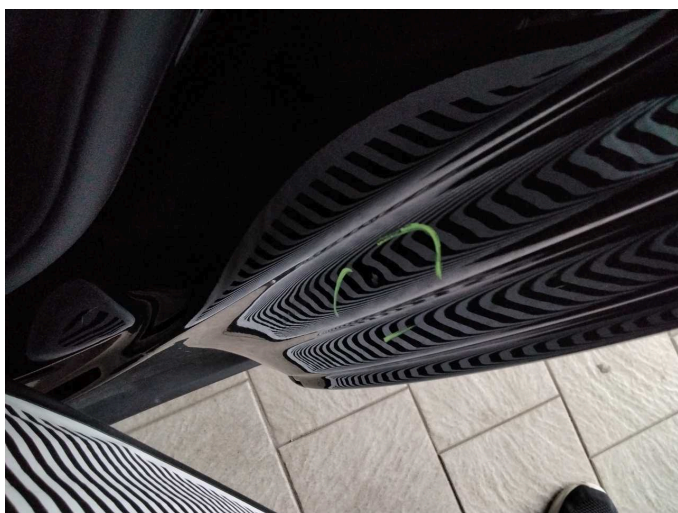

Damage 6: Body: C-pillar - left side - Dent / paintcoat damage - Smart repair




Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction

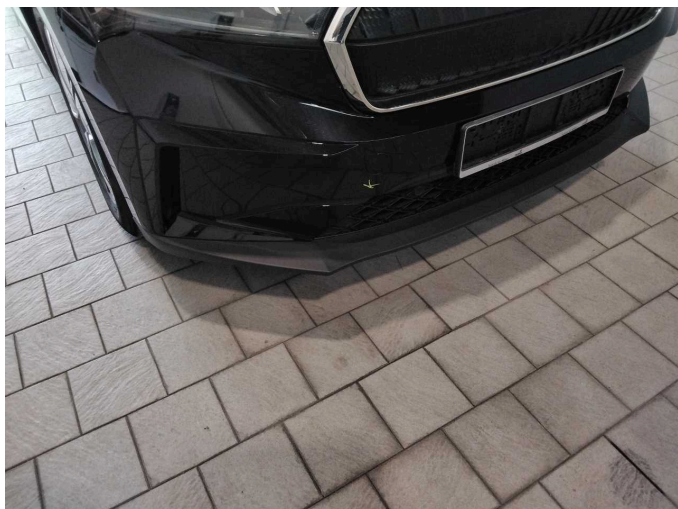

Wear and tear 4: Front bumper: Spoiler - Scratch(es) - No deduction



Wear and tear 4: Front bumper: Spoiler - Scratch(es) - No deduction

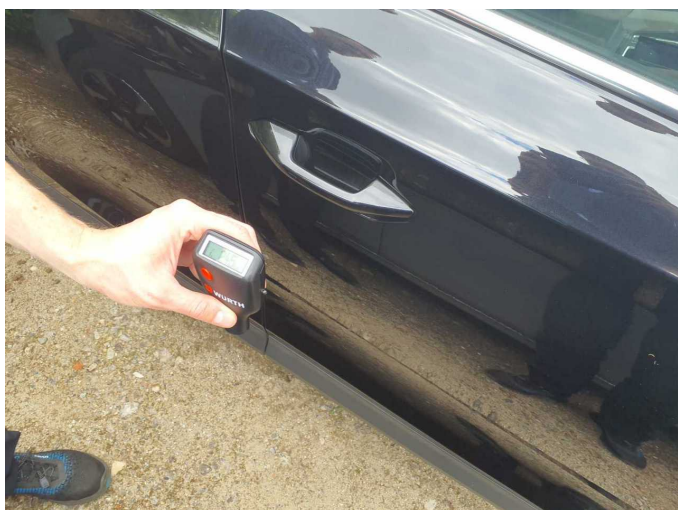

Repainting 1: Door - front right side



Repainting 1: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBLE9NY7PF053092
Hersteller / Modell: SKODA SKODA Enyaq iV 80x

Datum	KM-Stand	Beschreibung
11.08.2025	48.407	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst