



Expertise

Protocol number: 46564453
Order No. / Reference: 26621712
Inspection date: 13 Jul 2026

Manufacturer: Volvo	Model: XC60 T8 AWD Recharge Geartronic RDesign
VIN: LYVUZH5UDNB049333	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC60 T8 AWD Recharge Geartronic RDesign	
Vehicle Identification number	LYVUZH5UDNB049333
Mileage (Read)	157,191 km
First registration	10 Jun 2022
Number of holders	1
Power / Engine displacement	228 kw / 1,969 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Platinum Grey Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	Available / incomplete	Next maintenance in	48 Tag(e)
Last service on / at	09/2025 at 132,915 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ550160
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	9101 / BUP 00004		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,660 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/40 R21 102Y	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	255/40 R21 102Y	Summer tyres on Light alloy	Continental	5mm / 5mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103V	Winter tyres on Light alloy	Continental	6mm / 5mm
2)	235/60 R18 103V	Winter tyres on Light alloy	Continental	7mm / 7mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- 12-volt socket in the luggage compartment
- ABS - Anti-lock Braking System (with EBV)
- Driver and passenger side airbags with two-stage deployment system
- Passenger side airbag can be deactivated
- Airbag, side airbags for driver and front passenger and head/shoulder airbags (iC) for all occupants
- Android infotainment system (9" touchscreen (22.9 cm diagonal) - Bluetooth hands-free system incl. audio streaming - Digital vehicle owner's manual - Digital radio reception (DAB+) - 2 USB-C ports (compatible with Apple iPod/iPhone/iPad))
- Electrically adjustable and heated exterior mirrors
- Hill Descent Control (HDC)
- Fog sensor for automatic activation of the defroster function
- On-board computer (with vehicle control functions)
- CleanZone air quality system with activated carbon filter (automatic recirculation and pre-ventilation of the interior when the vehicle is unlocked)
- Anthracite headliner
- Roof rails in high-gloss black (integrated)
- Drive Mode (driving mode settings for engine, transmission, steering, brakes and suspension: Hybrid, Pure, AWD, Off Road, Power)
- Aluminum insert, metal mesh
- Aluminum door sill plates with Recharge lettering, front
- Electronic Stability Control (ESC)
- Electric windows front and rear (with auto-down and auto-up function)
- Luggage compartment partition net
- Transmission: 8-speed Geartronic automatic transmission
- Google Services with navigation (navigation via Google Maps, Google Assistant, Google Play Store and unlimited data (includes data for map updates, app downloads and streaming services) for the first 4 years)
- Intelligent driver information system (delays incoming calls or vehicle information in dangerous situations)
- ISOFIX mounting for the outer rear seats
- Keyless Drive (electronic access system) with sensor-controlled tailgate, illuminated door handles and puddle lights
- Headrests (5) front and rear
- Rear headrests foldable (electrically)
- Charging box under the cargo floor
- Stainless steel loading sill protector in the luggage compartment
- Cargo area roller blind
- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction buttons on the steering wheel
- Illuminated makeup mirror for driver and front passenger
- Front center armrest with integrated storage compartment and cup holders
- Panoramic glass sliding sunroof with lifting function (electric) (with integrated, continuously adjustable sunshade)
- 12-volt connection at the front
- Acoustic Vehicle Alerting System (AVAS) (Acoustic pedestrian/cyclist protection through artificially generated driving noises in the speed range up to 20 km/h)
- Airbag, driver's knee airbag
- All-wheel drive (AWD) (depending on the driving mode)
- Ambient lighting (Extended interior lighting with: - Ambient lighting front and rear - Exit lights front and rear - Work light on the tailgate - Illuminated door pockets and door openers front and rear - Rear footwell lighting - Rear reading lights)
- Electrically folding exterior mirrors
- Outdoor temperature display
- Hill Start Assist (HSA)
- LED turn signals integrated into the exterior mirrors
- Third brake light (emergency brake lights (brake lights flash rapidly in case of heavy deceleration; hazard warning lights are automatically activated at speeds below 10 km/h))
- Roof edge spoiler
- Digital instrumentation 2nd generation (Full graphic 12.3" driver display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Rear parking assist with automatic braking intervention (rear)
- Electronic differential lock
- Window surround in high-gloss black
- Automatic emergency braking (emergency braking mechanism after the deployment of the airbags or seatbelt pretensioners to prevent secondary accidents)
- Automatic tailgate (electric)
- Heated rear window
- Interior and exterior mirrors automatically dimming
- Interior lighting (headliner, front reading lights, front ambient lighting, front footwell, storage compartment behind center console, glove compartment and luggage compartment)
- Child safety lock (rear doors)
- Automatic climate control with separate temperature control for driver and front passenger (and additional air vents for the 2nd row of seats (integrated in the B-pillar))
- Paint finish: Solid
- Charging cable Schuko/Type 2 (Mode 2) (7 m length, 1-phase, 10A (for connection to a standard 230-volt household socket))
- LED headlights "Thor's Hammer" with high beam assist and integrated LED daytime running lights
- Steering wheel: Sports steering wheel
- Rear center armrest (foldable) (with cup holders)
- Package: Winter Package (front seat heating - steering wheel heating)
- Electric parking brake
- Upholstery: Part-leather/mesh-textile sports seats (including rear center armrest)
- Radio accessories: Digital radio reception (DAB+)



- Radio: Audio system High Performance Sound (330 watts of power - 10 speakers)
- Radio accessories: Two USB-C ports on the back of the center console
- Run-off Road Protection (preventive protection system in case of unintentional leaving the road or impending rollovers including pre-activation of the seat belt tensioners, deactivation of the battery and door unlocking)
- Safety Assistance (Automatic emergency braking system with detection of vehicles, cyclists, pedestrians and large animals including intersection braking assistant and emergency braking assistant - Connected Safety - Driver Alert - Attention warning - Variable speed limiter - Cruise control - Lane Keeping Aid (LKA) - Active lane keeping assistant - Oncoming Lane Mitigation - Ready to Drive notification - Road Edge Detection - Road Sign Information (RSI) - Traffic sign recognition)
- Seats: Adjustable (electric) leg rest for driver and front passenger seats
- Seats: Driver and front passenger seats height adjustable (electrically) (including manual tilt adjustment for the driver's seat)
- Seats: Lumbar support (4-way electrically adjustable) for driver and front passenger seats
- Sport front and rear apron
- Sport pedals
- Start/Stop technology
- Textile floor mats: Sport textile floor mats front and rear
- First aid kit and warning triangle
- Glazing: Colored glazing
- Volvo On Call (alerting the Volvo On Call service center at the touch of a button, as well as additional convenience services via the smartphone app, such as locking and unlocking the vehicle, direct start of pre-conditioning of the interior and retrieval of the high-voltage battery charge status)
- Radio accessories: Subwoofer
- Rain sensor
- Tire pressure monitoring system (with tire-specific pressure loss warning)
- Wheels: Tire sealant (Incl. 12-volt compressor, maximum speed 80 km/h)
- Rear seats in a 40/60 split or completely foldable with pass-through function
- Whiplash Protection System (WHIPS) (including immersion protection on all seats and energy-absorbing front seat cushions)
- Speed-sensitive power steering
- Safety braking system with disc brakes all around (internally ventilated) (automatic brake system pre-tensioning, brake assist and automatic hold function)
- Seat belts (active seat belts with belt tensioners, pre-activation of the belt tensioners - belt height adjustment at the front - warning tone / indicator when seat belts are not fastened (for all seats))
- Seats: Driver's seat electrically adjustable (with memory function for driver's seat and exterior mirror settings (stored in the remote control))
- Sport exterior mirrors in high-gloss black
- Sport front grille with horizontal struts and surround in high-gloss black
- Phone: Inductive smartphone charging system (Wirelessly charges smartphones that support the Qi standard on a charging pad)
- Lashing eyes in the luggage compartment (foldable)
- Preparation for Trailer Stability Assist (TSA)
- Immobilizer (deactivation of the high-voltage battery in the event of a collision)
- Central locking with two remote controls and integrated emergency keys (automatic locking of doors while driving (can be deactivated) - comfort opening/closing of side windows and, if applicable, sunroof via remote control - panic function integrated into the remote control)

Extra equipment

- Alarm system (with motion/tilt sensor, security locking and private locking (separate trunk lock))
- Fire extinguisher
- Head-up display: Graphic projection of driving information onto the windshield
- Child safety lock for the rear doors (electric)
- Package: Connect Edition (R-Design) (Electrically adjustable passenger seat - Headlight cleaning system - Driver Assistance - Memory function for passenger seat - Full LED headlights - Front and rear parking sensors - Rearview camera - 21" 5-V-spoke design diamond cut/high-gloss black with 255/40 R21 tires - Onyx Black Metallic)
- Wheels: 21" alloy wheels, 5-V-spoke design, diamond cut/high-gloss black (tires 255/40 R21 with rims 8.5 x 21")
- Glazing: Acoustic glazing for the side windows (UV and burglar-resistant laminated glass panes)
- Towbar (semi-electric)
- Chassis: Adaptive air suspension with Four-C technology (Continuously Controlled Chassis Concept) with adjustable modes Comfort, Eco, Dynamic, Off Road including automatic leveling and entry/rear lowering (4/5 cm)
- Package: Xenium Package (High Performance Sound Pro audio system by Harman/Kardon - 600 watts of power - 14 speakers - Fresh Air Subwoofer - Dirac Unison sound optimization; Advanced air quality system with fine dust filtration according to PM2.5 air quality standard)
- Parking camera with 360° surround view in conjunction with parking assistance or Connect Edition package
- Protection package
- Seats: Heated rear seats (outer seats of the 2nd row)
- Glazing: Side and rear windows tinted (from the B-pillar back)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (1.,2. und 3. Wartung überzogen)
2	Trim / covers	Boot lid - interior trim (Abdeckkappe) - Missing - Replace
3	Side panel - rear right side	Sill - Scratch(es) - Smart repair
4	Door - rear left side	Door (Zierleiste) - Scratch(es) - Smart repair
5	Door - rear right side	Door (Zierleiste) - Scratch(es) - Smart repair
6	Multimedia system	Navigation system (Bild bleibt weiß) - Functional / admissibility - Perform diagnosis
7	Engine	Engine cover - Damage caused by marten / rodent - Replace
8	Interior	Cargo area floor (Griff) - Broken / torn - Replace
9	Rear bumper	Rear bumper (Zierleiste) - Scratch(es) - Replace
10	Mudguard - right side	Mudguard - right side (Anätzung) - Paint defect - Repair and paint
11	Door - rear left side	Door - Scratch(es) - Paint
12	Bonnet	Bonnet (Spachtelmasse eingefallen und wellig) - Unprofessionally repaired - Repair and paint
13	Boot lid / rear door	Boot lid (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint
14	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Replace

Wear and tear

No.	Component group	Description
1	Side panel - rear right side	Side panel - dent(s) - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Door - front right side	Door edge - Scratch(es) - No deduction
4	Door - rear right side	Door edge - Scratch(es) - No deduction
5	Door - front left side	Door edge - Scratch(es) - No deduction
6	Trim / covers	Door trim - front right side - Scratch(es) - No deduction
7	Front bumper	Front bumper (unterhalb) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - charging cable (Schuko)



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 16 Jul 2025	5.880,29 €
2	Rear, Provided by user / customer, from 18 Dec 2025	5.917,77 €

Repainting

No.	Repainting
1	Side panel - rear left side, Side panel - rear right side, Professionally carried out
2	Bonnet, Unprofessionally carried out

Paint coat thickness measurement

Bonnet	287 µm	Side panel - rear left side	182 µm
Side panel - rear right side	187 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

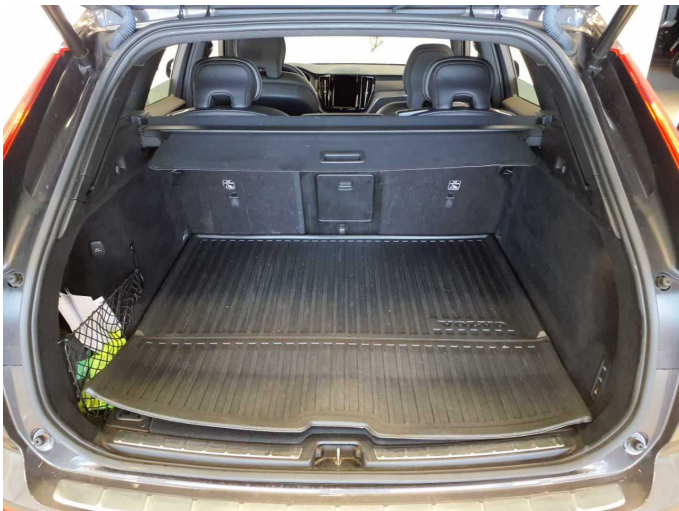


Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres

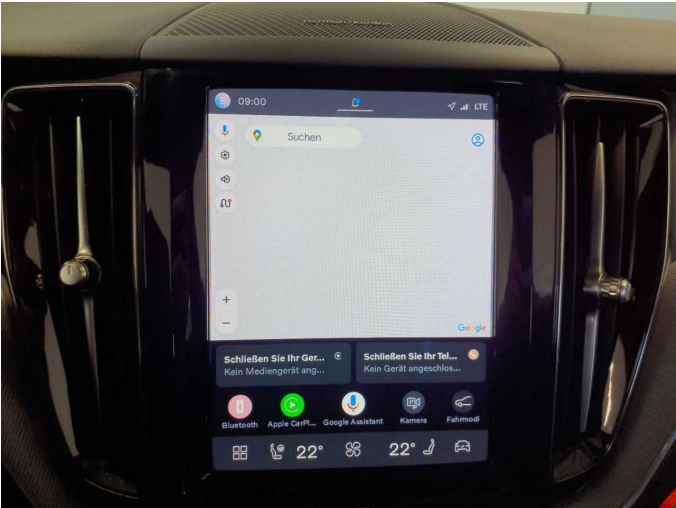


Figure 15: Navigation



Figure 16: Misc.

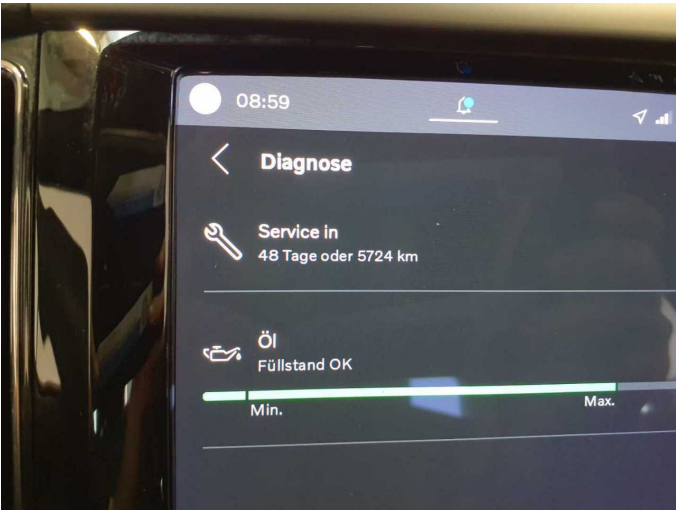


Figure 17: Misc.

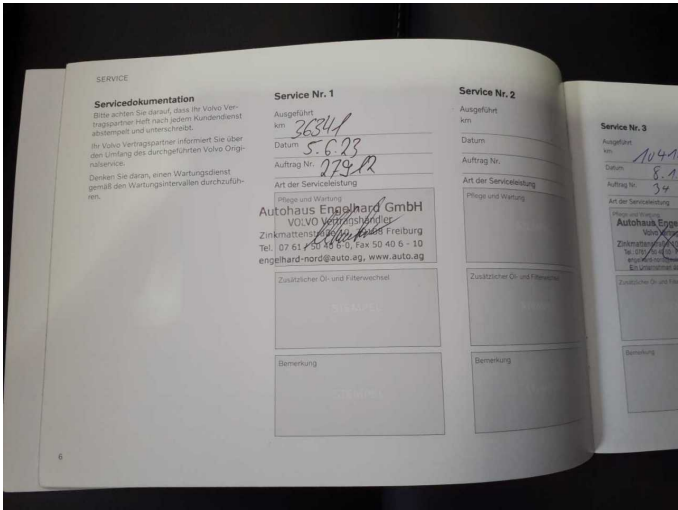


Figure 18: Misc.

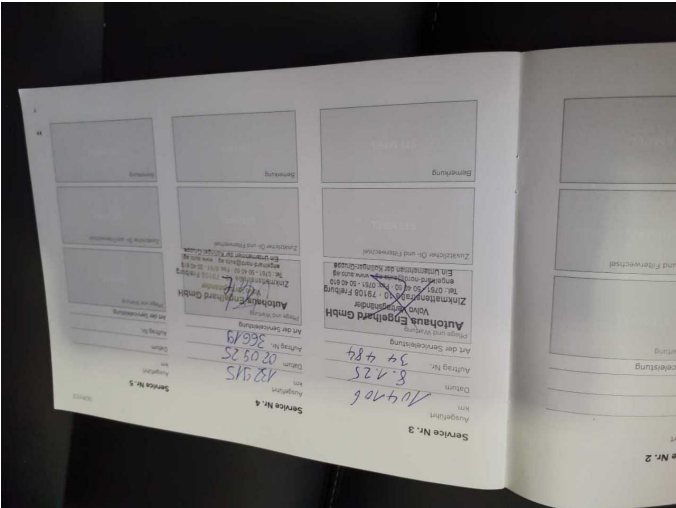


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

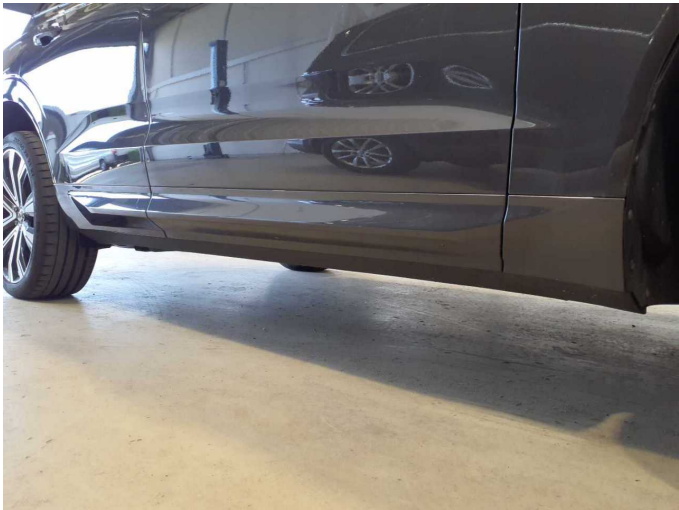


Figure 24: Misc.



Figure 25: Misc.

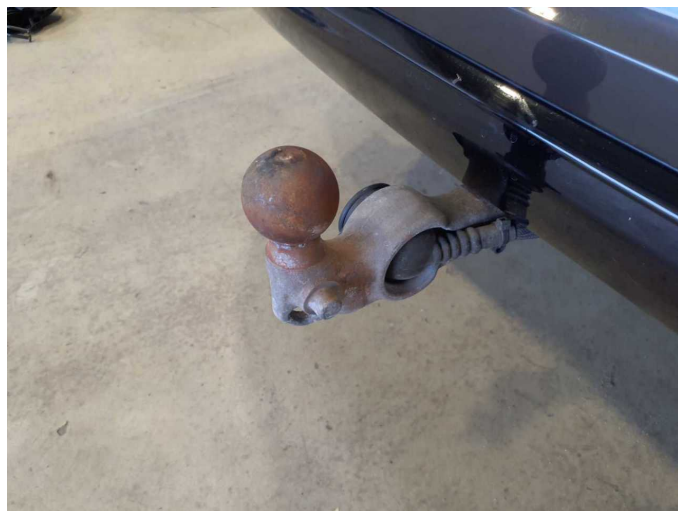


Figure 26: Misc.

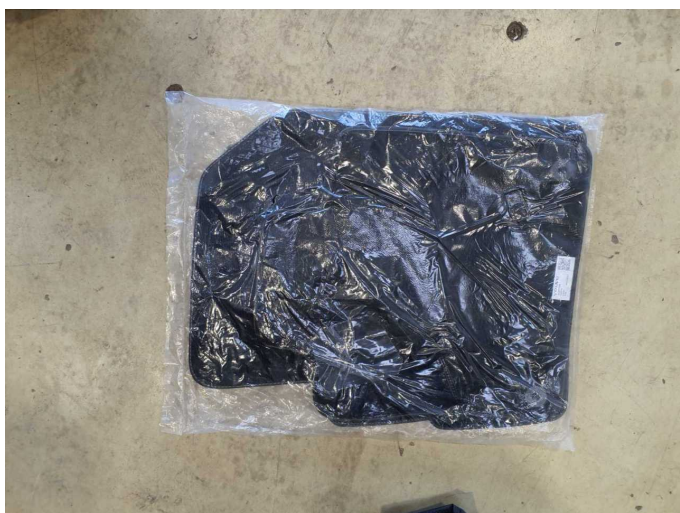


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.




Figure 33: Misc.



Damage 2: Trim / covers: Boot lid - interior trim (Abdeckkappe) - Missing - Replace



Damage 2: Trim / covers: Boot lid - interior trim (Abdeckkappe) - Missing - Replace

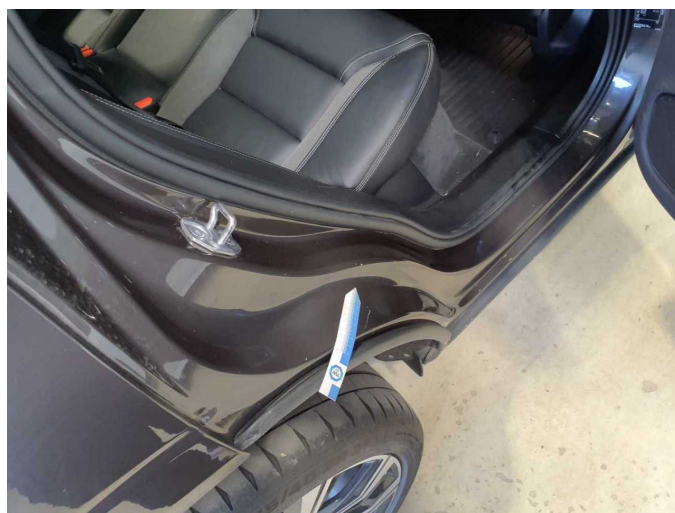

Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair




Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair




Damage 4: Door - rear left side: Door (Zierleiste) - Scratch(es) - Smart repair



Damage 4: Door - rear left side: Door (Zierleiste) - Scratch(es) - Smart repair

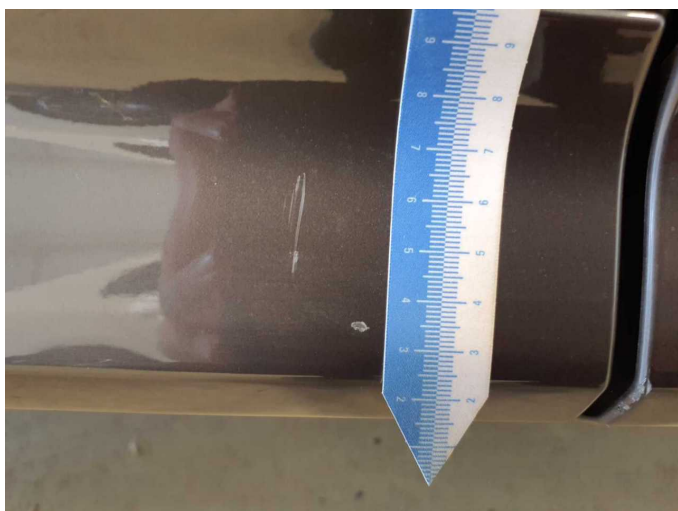


Damage 5: Door - rear right side: Door (Zierleiste) - Scratch(es) - Smart repair

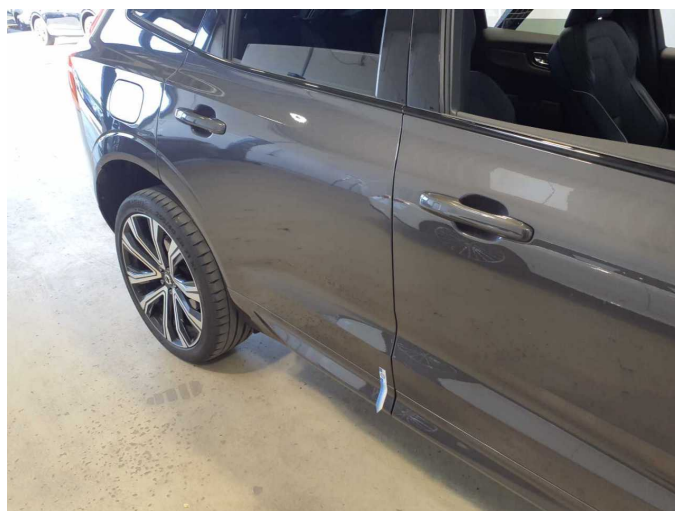

Damage 5: Door - rear right side: Door (Zierleiste) - Scratch(es) - Smart repair



Damage 7: Engine: Engine cover - Damage caused by marten / rodent - Replace

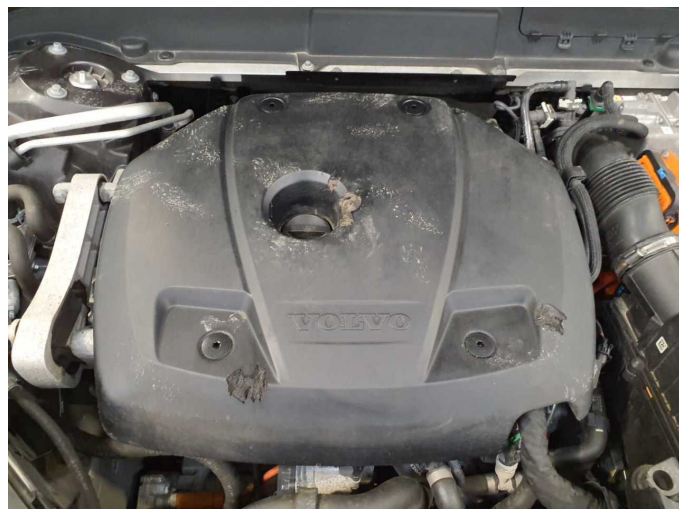

Damage 7: Engine: Engine cover - Damage caused by marten / rodent - Replace



Damage 8: Interior: Cargo area floor (Griff) - Broken / torn - Replace



Damage 8: Interior: Cargo area floor (Griff) - Broken / torn - Replace



Damage 9: Rear bumper: Rear bumper (Zierleiste) - Scratch(es) - Replace



Damage 9: Rear bumper: Rear bumper (Zierleiste) - Scratch(es) - Replace




Damage 10: Mudguard - right side: Mudguard - right side (Anätzung) - Paint defect - Repair and paint



Damage 10: Mudguard - right side: Mudguard - right side (Anätzung) - Paint defect - Repair and paint



Damage 11: Door - rear left side: Door - Scratch(es) - Paint

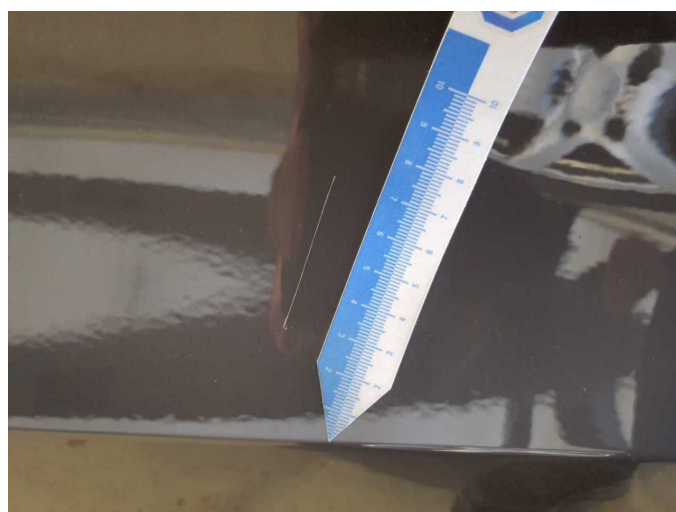

Damage 11: Door - rear left side: Door - Scratch(es) - Paint



Damage 12: Bonnet: Bonnet (Spachtelmasse eingefallen und wellig) - Unprofessionally repaired - Repair and paint



Damage 12: Bonnet: Bonnet (Spachtelmasse eingefallen und wellig) - Unprofessionally repaired - Repair and paint



Damage 12: Bonnet: Bonnet (Spachtelmasse eingefallen und wellig) - Unprofessionally repaired - Repair and paint



Damage 12: Bonnet: Bonnet (Spachtelmasse eingefallen und wellig) - Unprofessionally repaired - Repair and paint



Damage 12: Bonnet: Bonnet (Spachtelmasse eingefallen und wellig) - Unprofessionally repaired - Repair and paint



Damage 13: Boot lid / rear door: Boot lid (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint



Damage 13: Boot lid / rear door: Boot lid (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint



Damage 13: Boot lid / rear door: Boot lid (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint



Damage 14: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Replace



Damage 14: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Replace



Damage 14: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Replace



Damage 14: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Replace



Damage 14: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Replace




Damage 14: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Replace



Wear and tear 7: Front bumper: Front bumper (unterhalb) - Scratch(es) - No deduction



Wear and tear 7: Front bumper: Front bumper (unterhalb) - Scratch(es) - No deduction

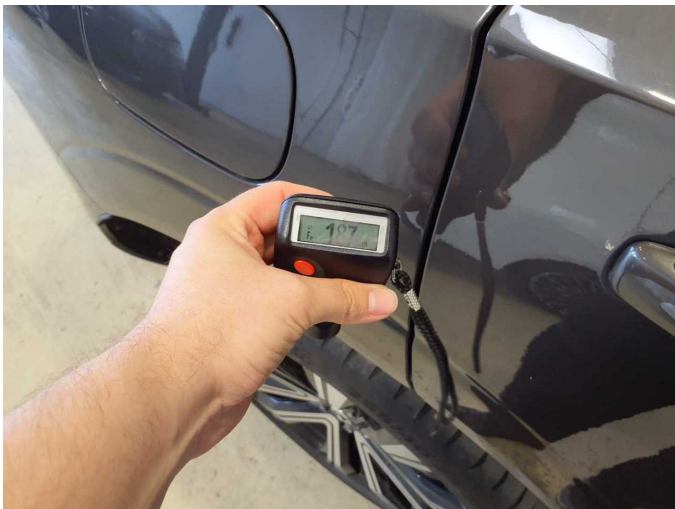

Repainting 1: Side panel - rear left side, Side panel - rear right side



Repainting 1: Side panel - rear left side, Side panel - rear right side



Repainting 1: Side panel - rear left side, Side panel - rear right side



Repainting 1: Side panel - rear left side, Side panel - rear right side



Repainting 2: Bonnet



Repainting 2: Bonnet



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: LYVUZH5UDNB049333

Hersteller / Modell: VOLVO VOLVO XC60 T8 AWD Recharge Geartronic RDesign

Datum	KM-Stand	Beschreibung
26.09.2025	133.655	Reparatur Sonstiges
23.04.2024	68.729	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges; Zündkerzen ern
21.08.2023	36.341	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/ Eigendiagnose; Wartung Sonstiges