



Expertise

Protocol number: 47179695
Order No. / Reference: 26884713
Inspection date: 21 Aug 2026

Manufacturer: Volvo

Model: XC90 T8 AWD Recharge Geartronic RDesign Edition

VIN: YV1LFH5UDN1867106



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC90 T8 AWD Recharge Geartronic RDesign Edition	
Vehicle Identification number	YV1LFH5UDN1867106
Mileage (Read)	133,478 km
First registration	20 Jun 2022
Number of holders	1
Next periodical technical inspection	06/2027
(Report on hand)	
Fuel type	Hybr.B/E ext.aufli
Engine displacement / Cylinder	1,969 ccm / 4
Power	228 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Onyx Schwarz-Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Anthracite-Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	95 Tag(e)
Last service on / at	11/2025 at 114,382 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ548974
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	9101 / BUL 00007		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,950 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/35 R22 104Y	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	275/35 R22 104Y	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105H	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	235/55 R19 105H	Winter tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbags (driver and front passenger airbags with two-stage deployment system - driver's knee airbag - driver and front passenger side airbags - head/shoulder airbags (IC) for all occupants)
- Aluminum door sill plates with Recharge lettering, front (illuminated) and rear
- Aluminum insert, metal mesh
- Aluminum loading sill protector in the luggage compartment
- Armrests with integrated storage compartment and cup holders for the 3rd row of seats (left and right)
- Attachment system for carrier bags in the luggage compartment
- Automatic climate control with 4-zone temperature control (Individual climate control for driver, front passenger and rear passengers left and right (2nd row of seats) including climate display for the 2nd row of seats)
- Automatic tailgate (electric)
- Bottle holder in the luggage compartment
- Cargo area roller blind (semi-automatic)
- Central locking with two remote controls and integrated emergency key (including automatic locking of the glove compartment and doors while driving (can be deactivated), panic function (integrated in the remote control), comfort opening/closing of the side windows and, if applicable, sunroof via remote control, luggage compartment lid release via remote control or from the driver's seat)
- CleanZone air quality system with activated carbon filter (automatic recirculation and pre-ventilation of the interior when the vehicle is unlocked)
- Connected Safety (Cloud-based warning of slippery road conditions and vehicles with hazard warning lights activated)
- Dashboard and door trim in leather look with contrasting stitching
- Drive Mode (driving mode settings for engine, transmission, steering, brakes and suspension)
- Electric parking brake
- Electric windows front and rear (with auto-down and auto-up function)
- Electrically folding exterior mirrors
- Fog sensor for automatic activation of the defroster function
- Full LED headlights "Thor's Hammer" ACTIVE HIGH BEAM (with extended high beam, dynamic cornering light, intelligent high beam assistant with adaptive headlight range control and integrated LED daytime running lights)
- Glazing: Colored glazing
- Headlight cleaning system
- Heated exterior mirrors and rear window (automatic)
- Heated rear window
- Heated windshield washer nozzles
- Illuminated makeup mirror for driver and front passenger
- Immobiliser
- ABS - Anti-lock Braking System (with EBV)
- Active safety belts with belt tensioners (pre-activation of the belt tensioners in dangerous situations and belt force limiter)
- Air conditioning for the 3rd row of seats
- All-wheel drive (AWD) (depending on the driving mode)
- Ambient lighting (Extended interior lighting with: - Ambient lighting (multicoloured) front and rear - Illuminated door pockets and door handles front and rear - Ambient lighting on the doors front and rear - Door sills with illuminated Recharge lettering - Exit lights in the rear doors - Ambient lighting on the dashboard top panel - Rear footwell lighting - Work light on the tailgate)
- Anthracite headliner
- Applications on the side windows in high-gloss black
- Automatic emergency braking (emergency braking mechanism after the deployment of the airbags or seatbelt pretensioners to prevent secondary accidents)
- Brake energy recuperation
- Charging cable Schuko/Type 2 (Mode 2), 4.5 m length (for connection to a standard 230-volt household socket)
- Child safety lock (manual for the rear doors)
- City Safety (automatic emergency braking system with detection of vehicles, cyclists, pedestrians and large animals, including intersection braking assistant, emergency braking assistant for oncoming traffic and steering support during evasive maneuvers)
- Cruise control system with variable speed limiter
- Digital instrumentation (12.3" full graphic display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Driver Alert - Attention Warning
- Electrically adjustable exterior mirrors
- Electronic differential lock
- Electronic stability control
- Emergency brake lights (brake lights flash rapidly during heavy deceleration; hazard warning lights are automatically activated at speeds below 10 km/h)
- First aid kit and warning triangle
- Front center armrest including cup holder
- Headrests (7)
- Headrests of the 2nd row of seats can be folded down (electrically)
- Hill Descent Control (HDC)
- Hill Start Assist (HSA)



- Intelligent driver information system (delays incoming calls or vehicle information in dangerous situations)
- IntelliSafe Assistant (Pilot Assist - Adaptive cruise control with distance warning and lane keeping assist up to speeds of 130 km/h - Curve Speed Assist (CSA) - Adjustment of vehicle speed before curves based on map data - Traffic Jam Assist Stop & Go - Lane Keeping Aid (LKA) - Active lane keeping assist)
- Interior and exterior mirrors automatically dimming
- ISOFIX mounting for the outer rear seats
- Keyless Drive (electronic access system with sensor-controlled tailgate, waterproof micro key and illuminated door handles and puddle lights)
- Keyless Start (electronic engine start system)
- Luggage compartment partition net
- On-board computer (with vehicle control functions)
- Paint finish: Solid
- Pollen filter
- Power outlet (12-volt connection in the luggage compartment)
- Preparation for Trailer Stability Assist (TSA)
- Radio: Sensus Connect infotainment system with High Performance Sound (9" touchscreen (22.9 cm diagonal) - 330 watts of power - 10 speakers - 2x USB ports (compatible with Apple iPod/iPhone/iPad) - Bluetooth hands-free system including audio streaming - Internet access including internet radio and apps (via paired smartphone) - Voice control - Digital vehicle owner's manual - Connected Service Booking
- Rear view camera
- Road Edge Detection (system to protect against unintentional leaving of the roadway through steering and braking interventions)
- Roof spoiler
- Seats: Adjustable (electric) leg rest for driver and front passenger seats
- Seats: Driver and front passenger seats electrically adjustable (8-way) with memory function for driver seat, front passenger seat and exterior mirror settings (stored in the remote control)
- Seats: Lumbar support (4-way electrically adjustable) for driver and front passenger seats
- Sensus Connect infotainment system (9" touchscreen (22.9 cm diagonal) - Bluetooth hands-free system incl. audio streaming - Digital vehicle owner's manual - Digital radio reception (DAB+) - Internet access incl. internet radio and apps (via paired smartphone) - Voice control)
- Sensus navigation system (3D navigation - destination input via natural voice control - dynamic route guidance with real-time traffic information - local search (search for surroundings using keywords with information, ratings and photos) - send-to-car (route planning via internet or smartphone) - Volvo Lifetime MapCare)
- Sport front and rear apron
- Sport pedals
- Start/Stop technology
- Steering wheel adjustable for height and reach
- IntelliSafe Surround (Blind Spot Information System (BLIS) Blind Spot Assist including Lane Departure Warning for rapidly approaching vehicles including steering intervention if warning signals are ignored - Cross Traffic Alert (CTA) Cross Traffic Warning with braking intervention - warning for vehicles, cyclists and pedestrians approaching from the side when reversing out of parking spaces including braking to a standstill if warning signals are ignored - Rear Impact Mitigation - preventive protection in case of impending rear-end collisions)
- Interior lighting (headliner, front and rear reading lights - individually dimmable, front footwell, glove compartment and luggage compartment)
- Lashing eyes in the luggage compartment (foldable)
- LED turn signals integrated into the exterior mirrors
- Oncoming Lane Mitigation (preventive protection system when crossing the center line and approaching oncoming traffic including active steering intervention towards one's own lane)
- Outdoor temperature display
- Parking assistance, front and rear
- Passenger side airbag can be deactivated
- Radio accessories: Smartphone integration Apple CarPlay and Android Auto (integration of Apple iPhones and Android smartphones into the Sensus operating system)
- Radio accessories: Two USB-C ports on the back of the center console
- Rain sensor with automatic light function
- Rear seat backrests can be folded down in a 60/40 split or completely.
- rear window wiper
- Road Sign Information (RSI) - Traffic Sign Recognition
- Roof rails in high-gloss black (integrated)
- Run-off Road Protection (preventive protection system in case of unintentional road leaving or impending rollovers including pre-activation of the seat belt tensioners, deactivation of the battery (plug-in hybrid only), emergency call via Volvo On Call and door unlocking)
- Safety braking system with disc brakes all around (internally ventilated) (automatic brake system pre-tensioning, brake assist and automatic hold function)
- Seat belt height adjustment front and rear (2nd row of seats)
- Seats: Driver and front passenger seats height adjustable (electrically) (including manual tilt adjustment for the driver's seat)
- Seats: Heated front seats
- Seats: Third row of seats (7-seater) (manually adjustable and retractable with longitudinal adjustment (120 mm) for the 2nd row of seats and easy-entry function)
- Speed-sensitive power steering
- Sport exterior mirrors in high-gloss black
- Sport front grille with horizontal struts and surround in high-gloss black
- Steering wheel: Sport leather steering wheel



- Steering wheel: Multifunction buttons on the steering wheel
- Sun blinds for the rear side windows (integrated)
- Tachometer
- Textile floor mats (4-piece set)
- third brake light
- Transmission: 8-speed Geartronic automatic transmission
- Warning tone/indicator when seat belts are not fastened (for all seats)
- Wheels: 20" 5-spoke alloy wheels, sport design, diamond cut/black (tires 275/45 R20; rims 9 x 20)
- Wheels: Tire sealant (Incl. 12-volt compressor, maximum speed 80 km/h)

- Steering wheel: Steering wheel heating
- Storage compartment under the cargo floor
- subwoofer
- Textile floor mat for the 3rd row of seats
- Tire pressure monitoring system (with tire-specific pressure loss warning)
- Upholstery: RDesign nubuck textile/nappa leather, sports seats
- Volvo On Call with Wi-Fi hotspot (including integrated modem, external antenna, and Wi-Fi hotspot for mobile devices) – Volvo On Call features: automatic emergency call function with transmission of vehicle position and data, and alerting the Volvo On Call service center at the touch of a button (10-year subscription). Additionally, various convenience services via the smartphone app such as Send-to-Car, trip log, and locking/unlocking the vehicle (3-year subscription, extendable upon request; includes extension of the emergency call function).
- Whiplash Protection System (WHIPS) (including immersion protection on all seats and energy-absorbing front seat cushions)

Extra equipment

- Alarm system (with motion/tilt sensor, safety locking and private locking (separate glove compartment and trunk locking))
- Paint finish: Metallic paint
- Parking camera with 360° surround view
- Upholstery: Nappa leather sports seats (perforated side bolsters of the front seats) (including rear center armrest)
- Phone: Inductive smartphone charging system (Wirelessly charges smartphones that support the Qi standard on a charging pad)
- Glazing: Side and rear windows tinted (from the B-pillar back)

- Towbar (semi-electric)
- Head-up display: Graphic projection of driving information onto the windshield
- Charging cable Type 2 / Type 2 (Mode 3) (7 m length, single-phase, 16A (for connection to a charging station with Type 2 connector))
- Wheels: 22" alloy wheels, 6-twin-spoke design, diamond cut/graphite look (with 275/35 R 22 tires - 9 x 22" rims)
- Glazing: Acoustic glazing for the side windows (UV and burglar-resistant laminated glass panes)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Due - Replace
2	Side panel - rear right side	Sill - Scratch(es) - Smart repair
3	Seat - rear	Seat cover - 3 seater bench - Scratch(es) - Smart repair
4	Seat - rear	Upholstery - Scratch(es) - Smart repair
5	Mudguard - right side	Wheel well extension - Scratch(es) - Smart repair
6	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
7	Side panel - rear right side	Wheel well extension - Scratch(es) - Smart repair
8	Front bumper	Spoiler - Scratched - Smart repair
9	Front axle	Axles / undercarriage (wegen der beschädigten Felgen) - Specify findings - Measure
10	Front bumper	Front bumper - Scratched - Smart repair
11	Door - rear right side	Door - Dent / paintcoat damage - Smart repair
12	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Smart repair
13	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value
14	Wheel / tyres	Alloy rim - rear left side - Scratched - Loss in value
15	Wheel / tyres	Alloy rim - front left side - Scratched - Loss in value
16	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
17	Body	Body - Damage by hail - repair according to calculation

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Front bumper	Cover bumper - front - Scratch(es) - Cover / polish
3	Door - front right side	Door - dent(s) - Smooth repair work

The vehicle shows signs of wear and tear commensurate with its age and use.

Accident damages

No.	Accident
1	Rear, Side right
2	Side - left

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Auslieferungsumfangs.

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

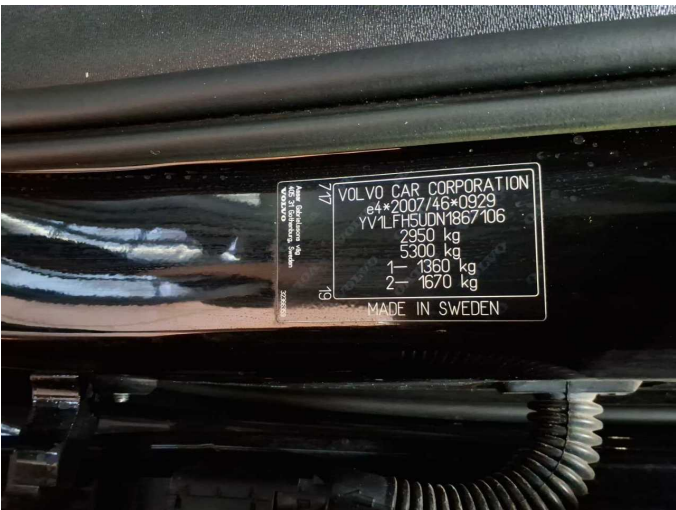


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

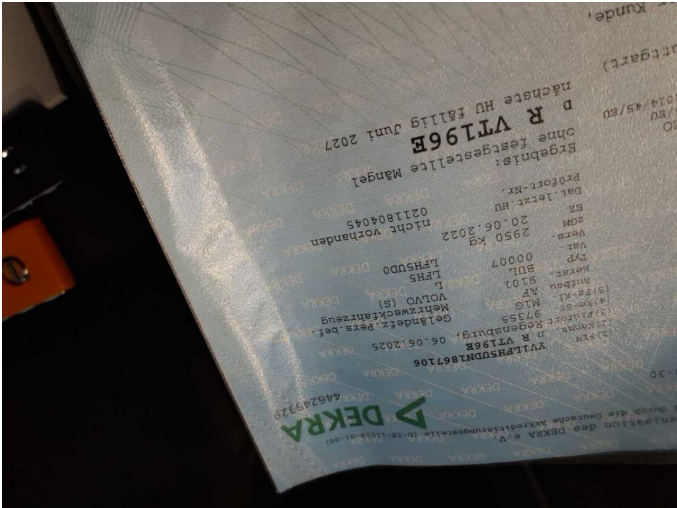


Figure 14: Documents



Figure 15: Documents

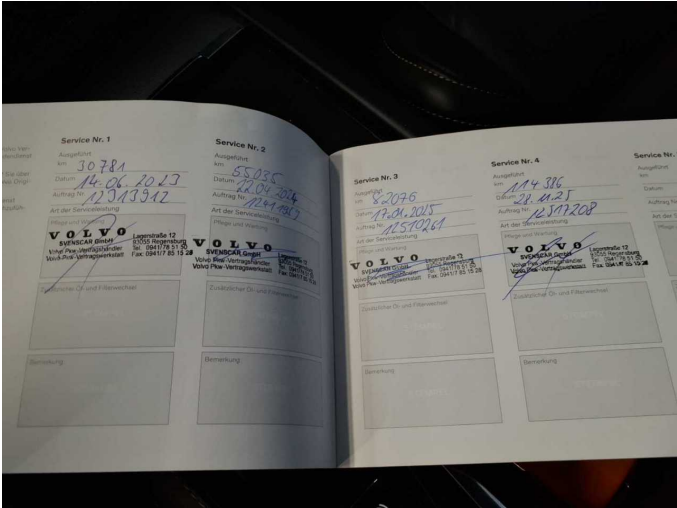


Figure 16: Documents



Figure 17: Additional tyres

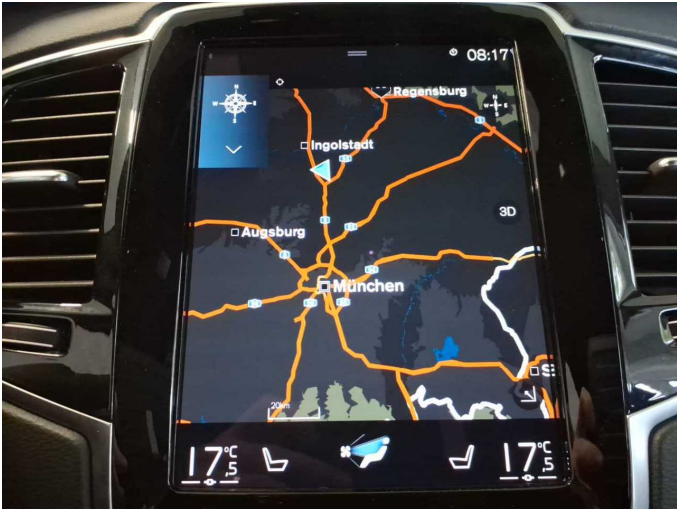


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

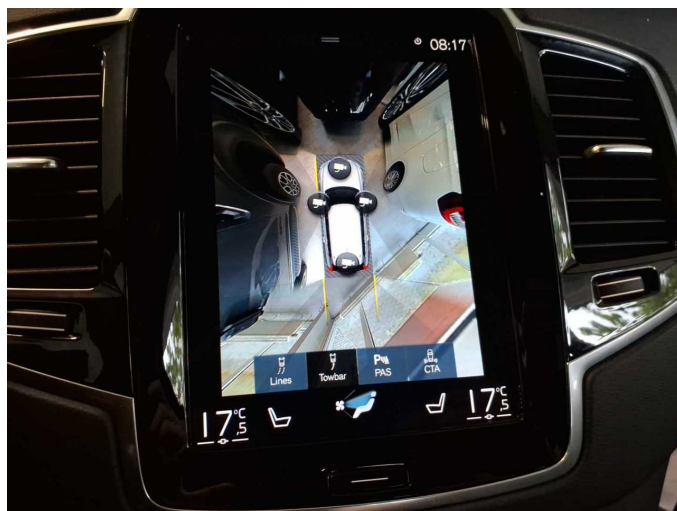


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.




Figure 36: Misc.



Damage 1: Equipment: Tirefit filler - Due - Replace



Damage 2: Side panel - rear right side: Sill - Scratch(es) - Smart repair

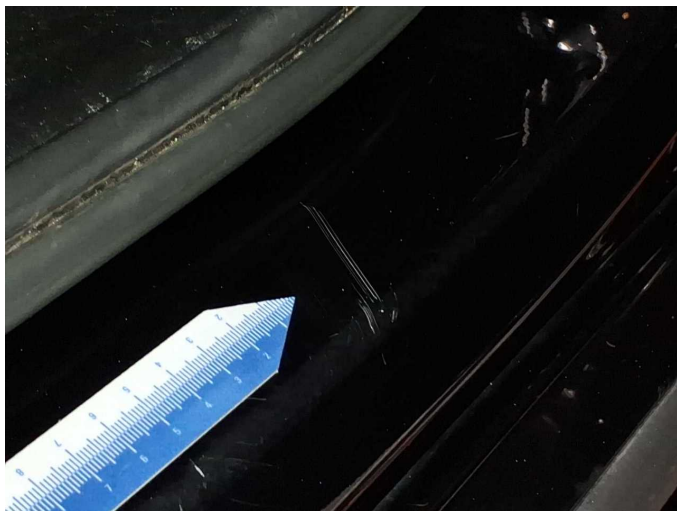

Damage 2: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 3: Seat - rear: Seat cover - 3 seater bench - Scratch(es) - Smart repair



Damage 3: Seat - rear: Seat cover - 3 seater bench - Scratch(es) - Smart repair



Damage 4: Seat - rear: Upholstery - Scratch(es) - Smart repair



Damage 4: Seat - rear: Upholstery - Scratch(es) - Smart repair



Damage 5: Mudguard - right side: Wheel well extension - Scratch(es) - Smart repair



Damage 5: Mudguard - right side: Wheel well extension - Scratch(es) - Smart repair



Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 7: Side panel - rear right side: Wheel well extension - Scratch(es) - Smart repair



Damage 7: Side panel - rear right side: Wheel well extension - Scratch(es) - Smart repair




Damage 8: Front bumper: Spoiler - Scratched - Smart repair



Damage 8: Front bumper: Spoiler - Scratched - Smart repair




Damage 10: Front bumper: Front bumper - Scratched - Smart repair

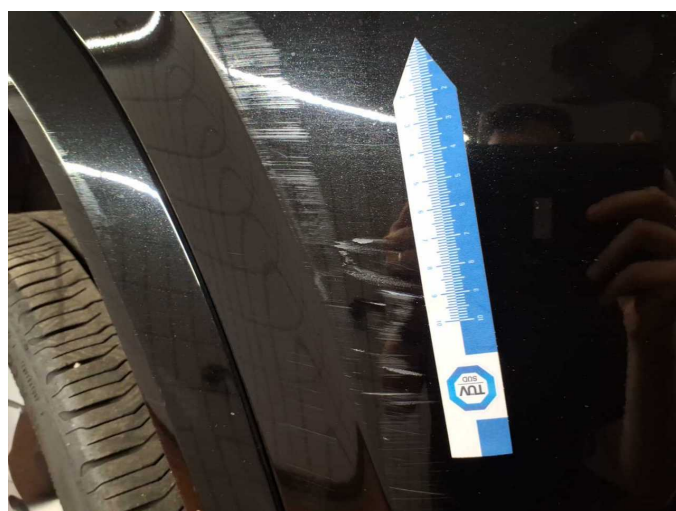

Damage 10: Front bumper: Front bumper - Scratched - Smart repair



Damage 11: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

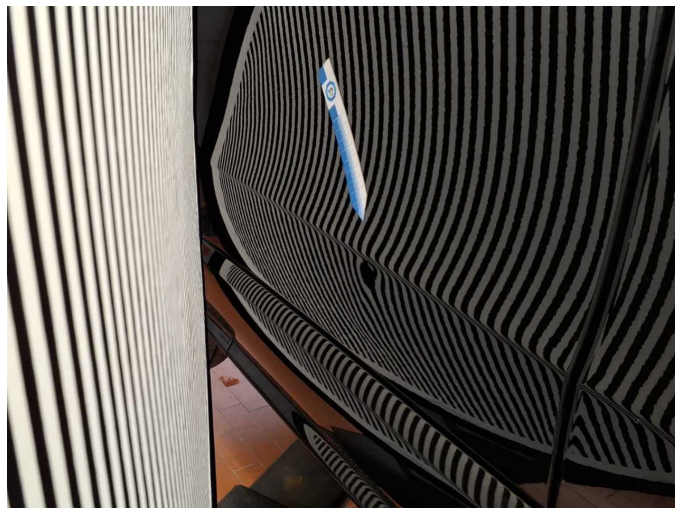

Damage 11: Door - rear right side: Door - Dent / paintcoat damage - Smart repair




Damage 11: Door - rear right side: Door - Dent / paintcoat damage - Smart repair




Damage 11: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 12: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair

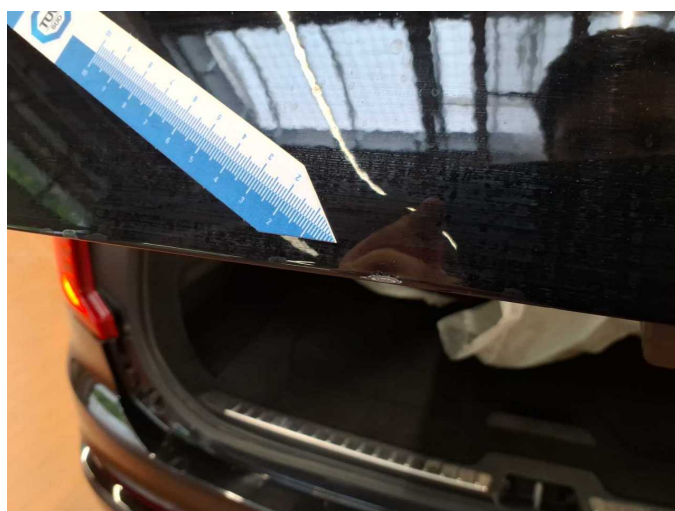

Damage 12: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair

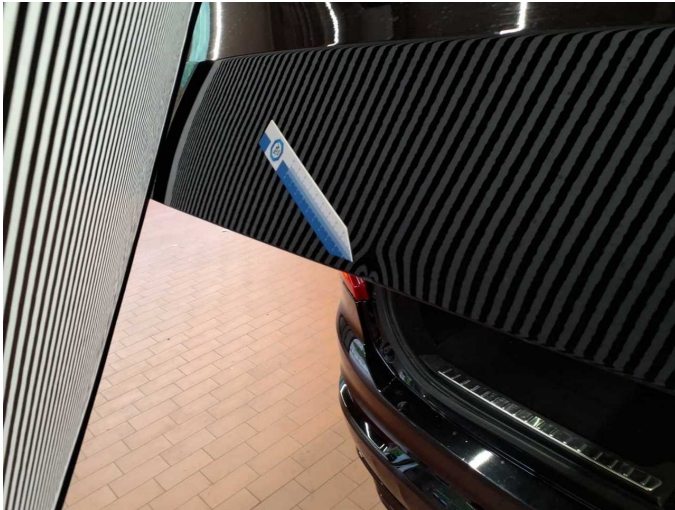

Damage 12: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair



Damage 13: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 13: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 14: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 14: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 15: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 15: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 15: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value




Damage 15: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 16: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 16: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value

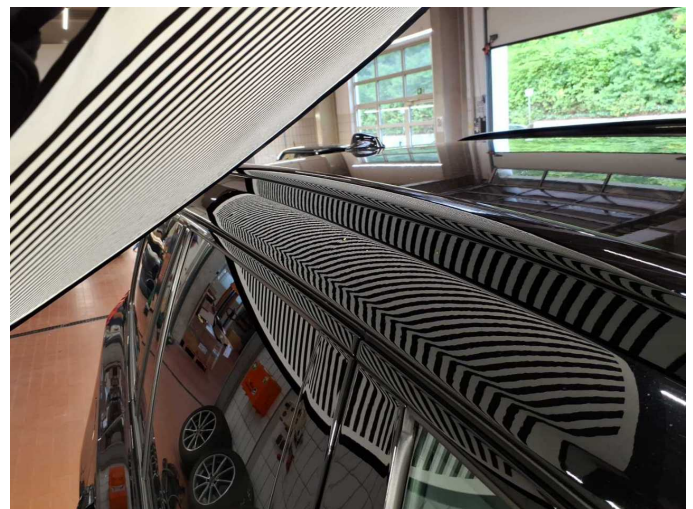

Damage 17: Body: Body - Damage by hail - repair according to calculation



Damage 17: Body: Body - Damage by hail - repair according to calculation




Damage 17: Body: Body - Damage by hail - repair according to calculation




Damage 17: Body: Body - Damage by hail - repair according to calculation




Damage 17: Body: Body - Damage by hail - repair according to calculation

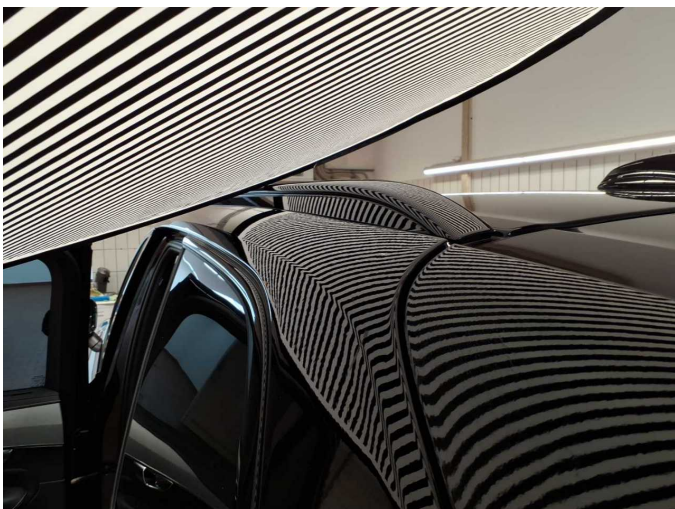


Damage 17: Body: Body - Damage by hail - repair according to calculation

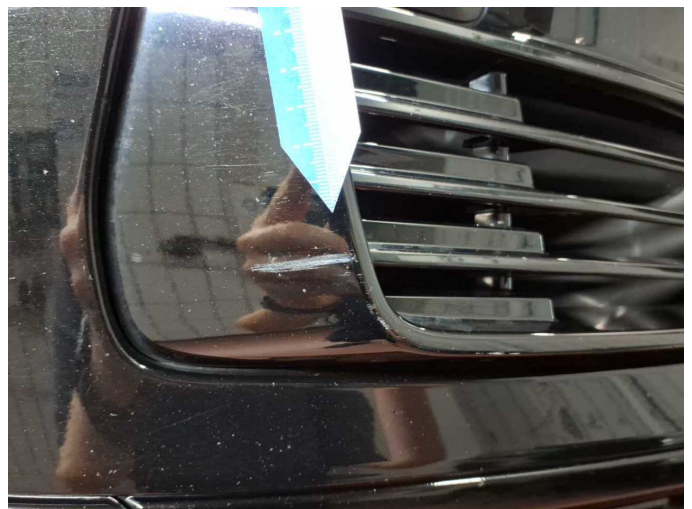

Wear and tear 2: Front bumper: Cover bumper - front - Scratch(es) - Cover / polish

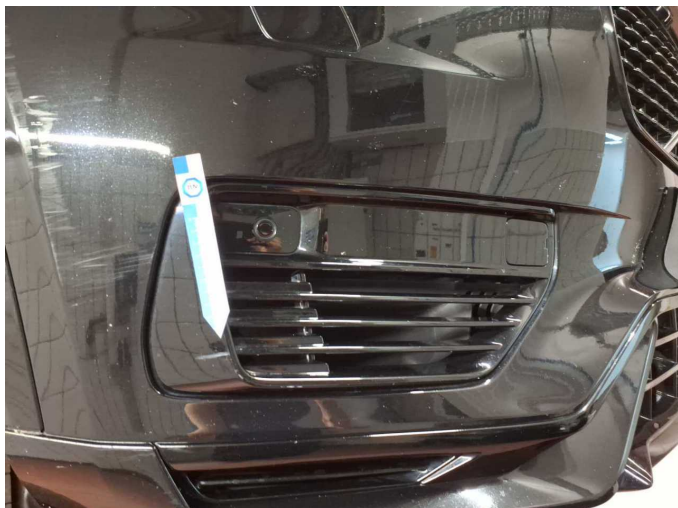

Wear and tear 2: Front bumper: Cover bumper - front - Scratch(es) - Cover / polish

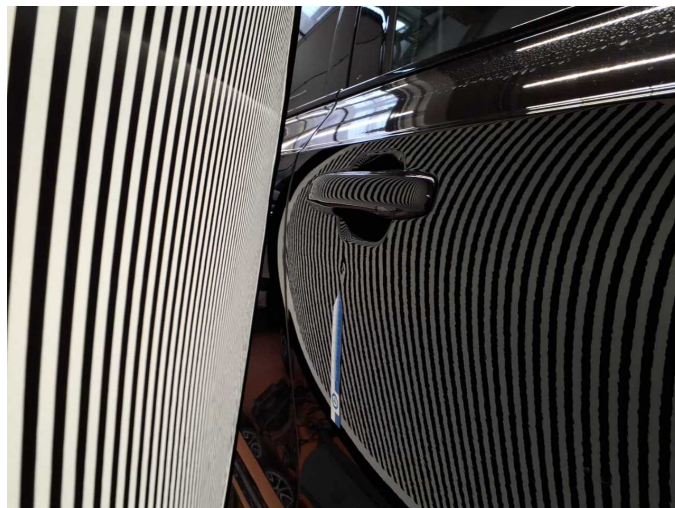


Wear and tear 3: Door - front right side: Door - dent(s) - Smooth repair work




Wear and tear 3: Door - front right side: Door - dent(s) - Smooth repair work




Accident 1: Rear, Side right

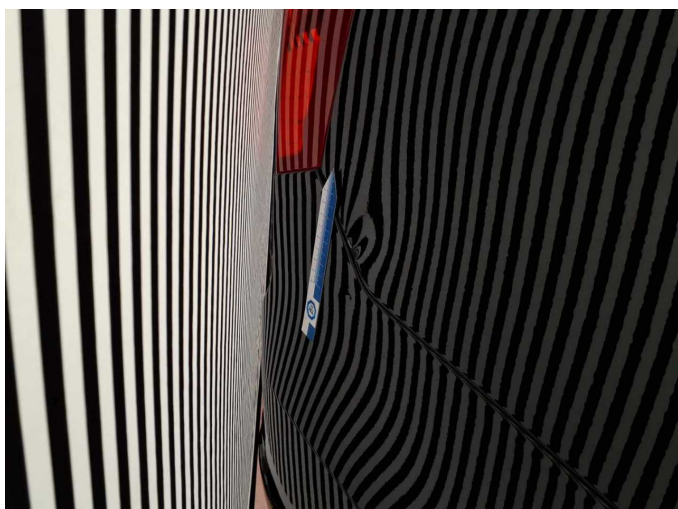

Accident 1: Rear, Side right

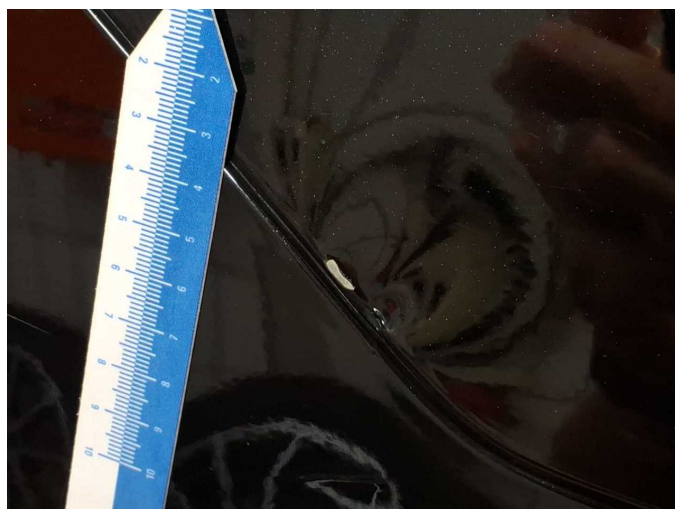

Accident 1: Rear, Side right

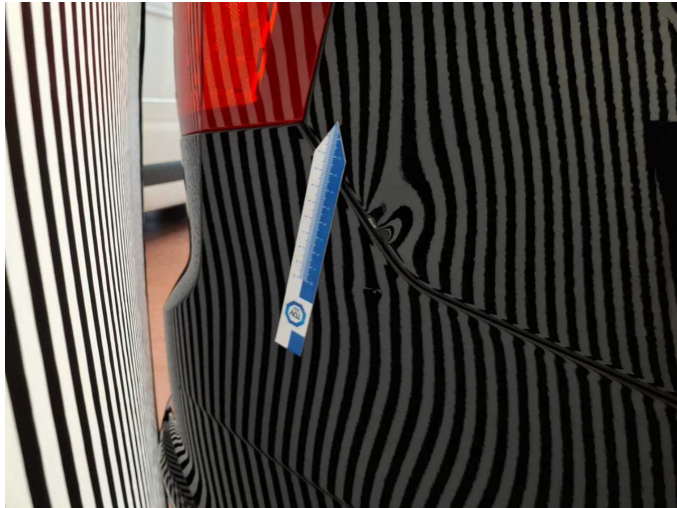


Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right

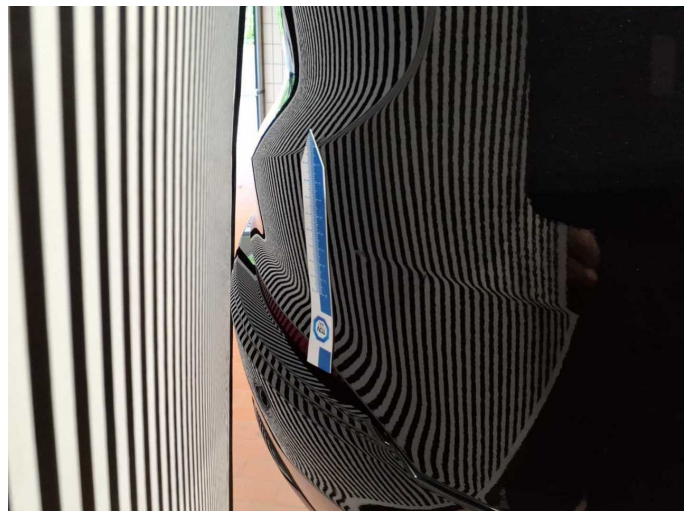

Accident 1: Rear, Side right




Accident 1: Rear, Side right



Accident 2: Side - left



Accident 2: Side - left

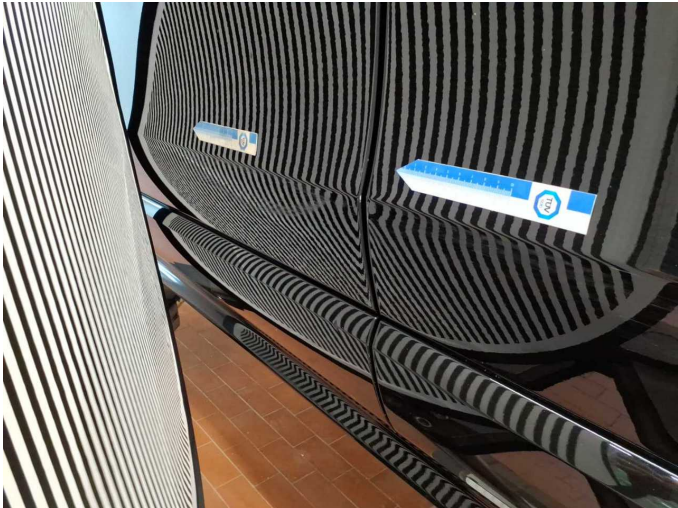

Accident 2: Side - left




Accident 2: Side - left



Accident 2: Side - left



Accident 2: Side - left

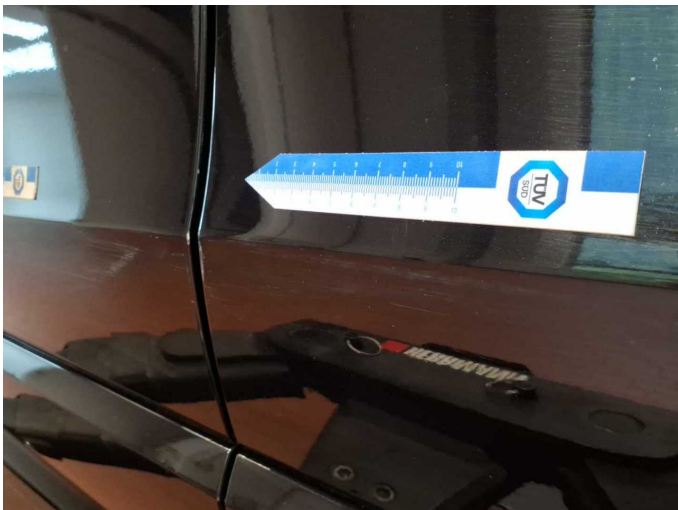

Accident 2: Side - left




Accident 2: Side - left




Accident 2: Side - left



Accident 2: Side - left

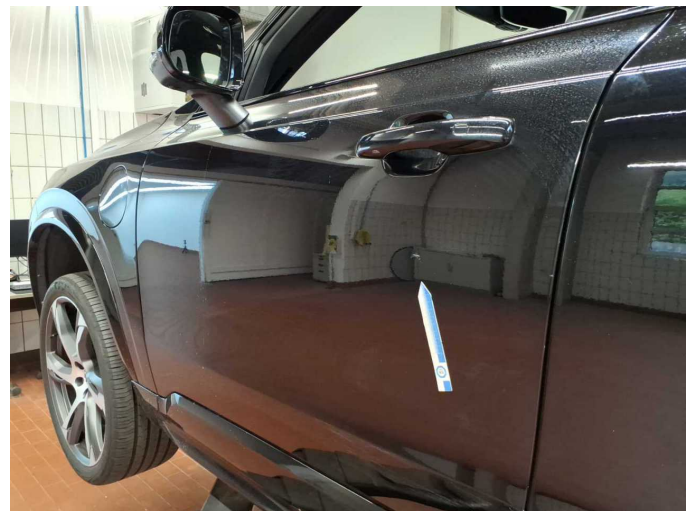

Accident 2: Side - left

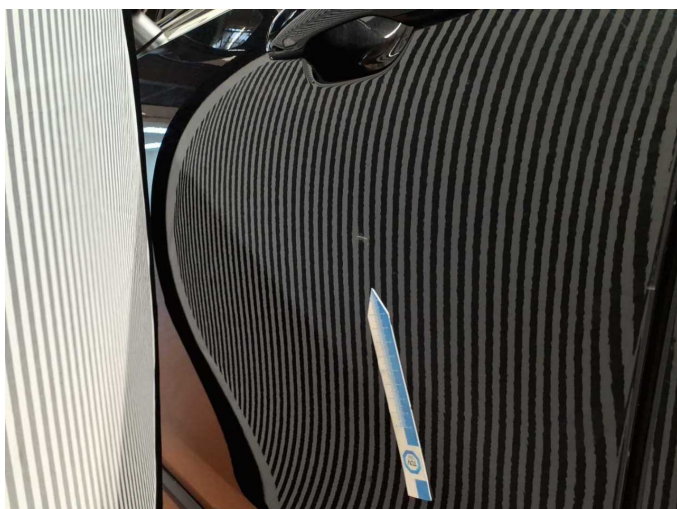

Accident 2: Side - left



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1LFH5UDN1867106

Hersteller / Modell: VOLVO VOLVO XC90 T8 AWD Recharge Geartronic RDesign
Edition

Datum	KM-Stand	Beschreibung
28.11.2025	114.382	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges; Zündkerzen ern
06.06.2025	97.355	AU
15.04.2025	90.637	Reparatur Sonstiges; Systemtest/Eigendiagnose
17.01.2025	82.080	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
22.04.2024	55.038	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges; Zündkerzen ern
14.06.2023	30.781	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges