



Expertise

Protocol number: 46425635
Order No. / Reference: 26679716
Inspection date: 7 Jul 2026

Manufacturer: Volkswagen

Model: Caddy 2.0 TDI BMT (5-Si.) Life

VIN: WV2ZZZSKZNX048003



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Caddy 2.0 TDI BMT (5-Si.) Life	
Vehicle Identification number	WV2ZZZSKZNX048003
Mileage (Read)	161,773 km
First registration	28 Apr 2022
Number of holders	1
Next periodical technical inspection	04/2027
(Report not on hand)	
Power / Engine displacement	75 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Reflexsilber-metallic (A7W)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	29,300 km
Last service on / at	05/2026 at 161,005 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ071165
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0603 / CLF 00315		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,220 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres on Light alloy	Falken	5mm / 5mm
2)	205/60 R16 96H	Summer tyres on Light alloy	Nexen	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Steel	Continental	4mm / 4mm
2)	205/60 R16 96H	Winter tyres on Steel	Continental	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	205/60 R16	Summer tyres on Steel	Nexen	7 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Waste bin with removable lid (for driver's cab)
- Storage compartments: Storage tray on the headliner with 2 roof grab handles in the driver's cab
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Exterior mirrors, electrically adjustable, heated and folding
- Exterior mirror housings in black, door handles in body color and sliding door rail in silver
- Floor coverings, carpeting in the driver's cab and passenger compartment (carpeting in the driver's cab and passenger compartment)
- Three-phase generator 140 A
- Electronic parking brake including auto-hold function
- Electronic Stability Program with Brake Assist (including Anti-lock Braking System (ABS), Traction Control System (ASR), (EDS and MSR) - Evasive Steering Assist and Turn Assist)
- Window: Side window in the passenger/cargo compartment, rear right, permanently installed
- Window: Side window in the passenger/cargo compartment, front right, permanently installed
- Windows: Green heat-insulating glass
- electric window regulator
- Cruise control system including speed limiter
- Halogen dual headlights-H7
- Tailgate with window cutout
- Interior lighting: in the passenger compartment (LED reading lights)
- Electric child safety lock for sliding doors
- Child seat anchorage (I-Size) and top tether (for seats in the passenger compartment (except the middle seat of the 2nd row))
- Steering wheel: Multifunction steering wheel
- Steering column adjustable in height and tilt
- Headlight range control
- Multifunction display "Plus"
- Multifunctional camera
- Fatigue detection
- Emergency braking assistant "Front Assist" (with pedestrian and cyclist detection)
- Upholstery: Fabric, "Triolog" design
- Radio "Composition Audio" with 20.96 cm (8.25 inch) touch color display (2 USB interfaces (Type C) in the center console, front - 6 speakers)
- Wheels/Tires: "Vienna" alloy wheels 6.5 J x 16, in brilliant silver
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Windscreen wiper intermittent control with light sensor
- Sliding door, on the right in the passenger/cargo area
- Side paneling for comfort in the passenger compartment
- Speed-sensitive power steering (Servotronic)
- Seat belts: in the passenger compartment (with belt tensioners for the outer seats in the 2nd row)
- Driver's cab seats: Height adjustment for both front seats, manual
- Storage compartments and boxes (drawers under the front seats)
- Towing eye front and rear, screw-in
- Airbag: Side and head airbags for driver and front passenger (head airbags for the outer rear seats - center airbag in the front)
- Reinforced battery (70 Ah/ 420 A)
- Operating voltage 12 V
- Brake booster
- third brake light
- Roof rails, black
- Electrical interface for external use (2 USB ports (Type C) in the center console, front - 2 USB charging ports (Type C) on the center armrest at the rear)
- Automatic headlight control with daytime running lights
- Windows: Heated rear window
- Window: Side window in the passenger/cargo compartment, rear left, permanently installed
- Window: Side window in the passenger/cargo compartment, front left, permanently installed
- Windows: Laminated glass front pane in heat-insulating glazing
- Luggage compartment cover, extendable and removable
- Transmission: 6-speed transmission
- Glove compartment with lid, illuminated
- Rear window wiper/washer system with intermittent function
- Instrument cluster (km/h) (displays for speed, total/trip distance, engine speed, fuel level and time)
- Air conditioning with manual control
- Headrests (2), height adjustable
- Paint protection/transport protection film (transport protection film (minimum protection) with additional transport protection measures)
- Front center armrest (height and length adjustable with 2 cup holders in the front and 2 air vents in the rear)
- Multi-collision brake
- Non-smoking version
- eCall emergency call system
- Particulate filter: Diesel particulate filter (incl. SCR and AdBlue tank)
- Radio accessories: Digital radio reception DAB+
- Wheels, tires: Covers for alloy wheels
- Wheels/Tires: 205/60 R 16 96 H XL, optimized for low rolling resistance
- Wheels/Tires: Tire pressure monitoring system
- reversing light
- Gearshift lever in plastic
- Sliding door, left side in the passenger/cargo area
- Keys for locking system: 2 remote control flip keys
- Side indicator lights
- Seat belts: Three-point automatic seat belts (front with belt height adjustment and electric belt tensioners)
- dimmable interior safety mirror
- Seats in the driver's cab: Backrest release for the right front seat



- Seats in the driver's cab: Lumbar support manually adjustable, left and right
- Seats: Folding tables on the backrests of the seats in the 1st row.
- Seats: Seat left and right, in the 1st row
- Lane keeping assistant "Lane Assist"
- Start-stop system (with brake energy recuperation)
- Bumpers in body color
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened front seat belts
- Central locking with remote control and interior operation
- Additional dust protection seal on the outside

- Seats in the passenger compartment: 3-seater bench in the 2nd row (foldable, rollable and removable) (ISOFIX and Top Tether on outer seats in the passenger compartment - 3 rear headrests)
- Sun visors with mirrors, airbag label on passenger sun visor
- Power outlets: 12-volt socket in the cargo area
- Telephone: Mobile phone interface
- Lashing points: 4 lashing points for securing cargo
- Electronic immobilizer
- Auxiliary heating: Electric auxiliary air heater

Extra equipment

- Navigation system "Discover Media" (Life, PanAmericana, Style) (25.4 cm (10 inch) touch color display - streaming & internet)
- Package: Winter package (Seat heating for seats in the driver's cab, left and right, separately adjustable - Washer fluid level indicator with enlarged washer fluid reservoir - Heated windshield washer nozzles at the front)
- Seats in the driver's cab: AGR ergoComfort seat, left (Life, Move, Style) (drawer under the right front seat - front seats height-adjustable, seat cushion tilt and depth adjustment for left seat - 4-way electrically adjustable lumbar support left and manually adjustable lumbar support right)
- Package: Cool & Sound (Refrigerant R1234yf - Safety interior mirror, automatically dimming - Air Care Climatronic air conditioning with 2-zone temperature control and air purification function)
- Paint finish: Metallic
- Parking assistance (rear parking distance control)
- Rigid towbar (including trailer stabilization)
- Steering wheel: Multifunction leather steering wheel (gearshift lever in leather)
- Wheels/Tires: Spare wheel in driving tire size, steel (spare wheel in driving tire size, steel - on-board tools and jack)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (1., 4. und 5. Wartung überzogen) - No deduction
2	Front bumper	Front bumper - Scratch(es) - Smart repair



Wear and tear

No.	Component group	Description
1	Trim / covers	D-pillar trim - interior, left side - Soiled - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Rear bumper	Rear bumper - Scratch(es) - No deduction
4	Trim / covers	Roof lining - Soiled - No deduction
5	Door - front left side	Door edge - Scratch(es) - No deduction
6	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
7	Roof	Roof - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 16 Apr 2024	2.983,73 €
2	Side - left, Provided by user / customer, from 21 Jun 2023	3.020,02 €

Repainting

No.	Repainting
1	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Door - rear left side	196 µm
-----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

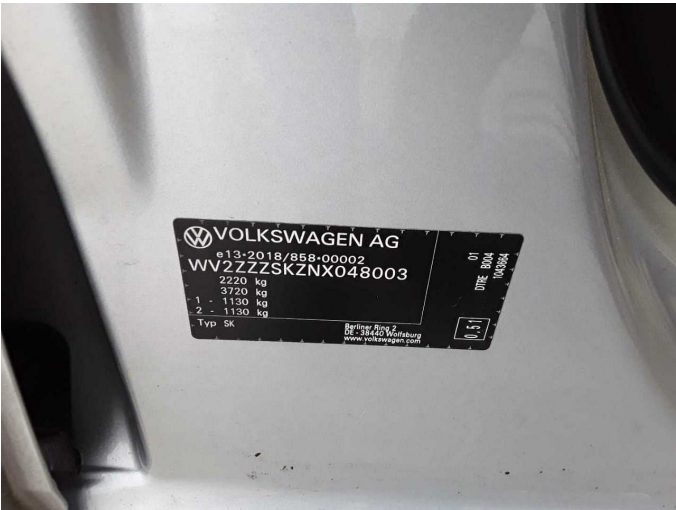


Figure 11: VIN



Figure 12: Mounted tyres

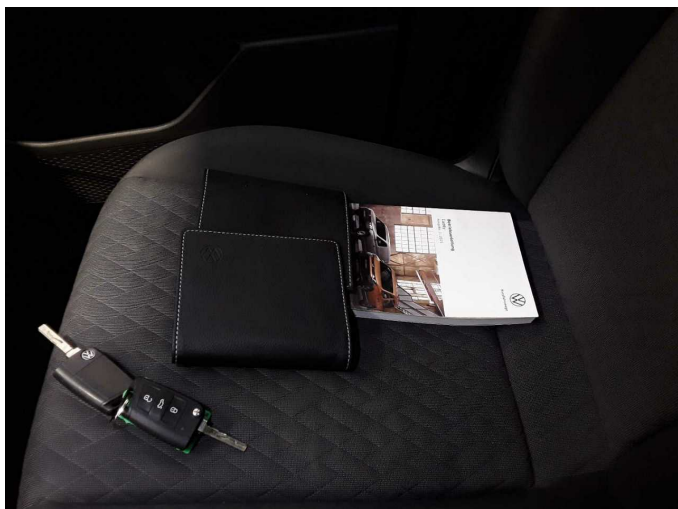


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.

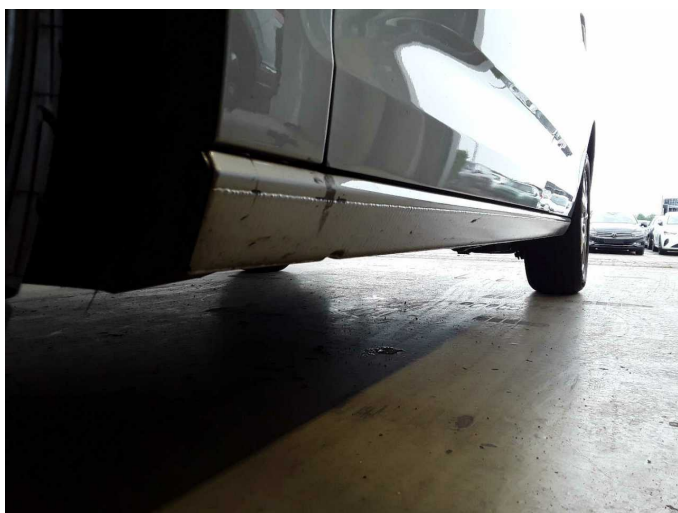


Figure 17: Misc.

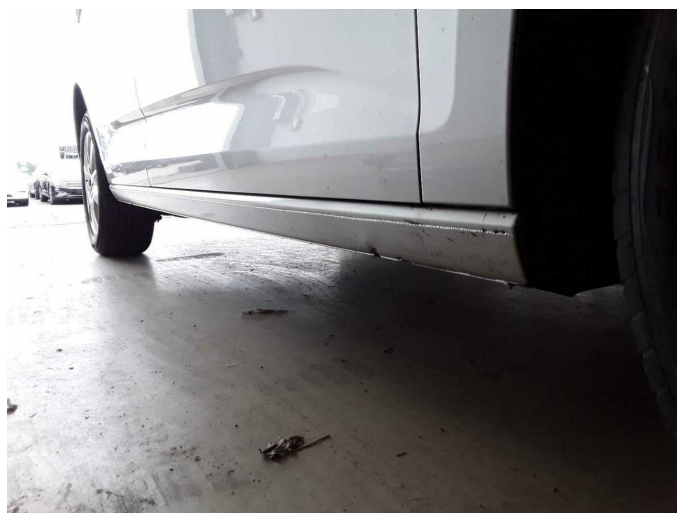


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.




Figure 26: Misc.



Damage 2: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 2: Front bumper: Front bumper - Scratch(es) - Smart repair

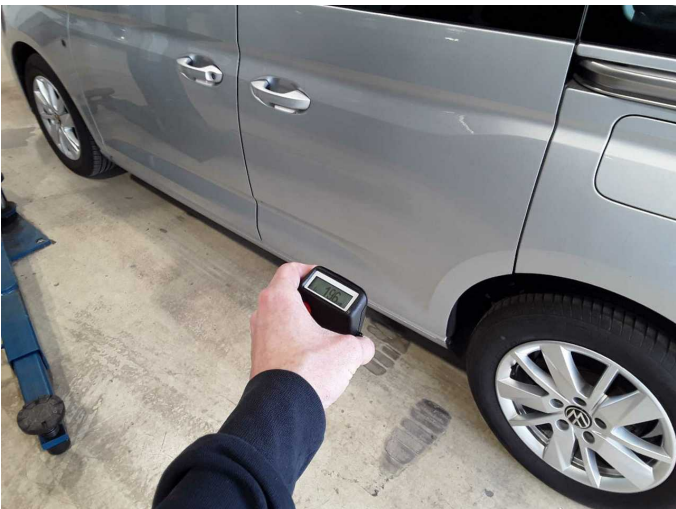

Repainting 1: Door - rear left side



Repainting 1: Door - rear left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WV2ZZZSKZNX048003

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Caddy 2.0 TDI BMT (5-Si.) Life

Datum	KM-Stand	Beschreibung
18.06.2026	161.667	Systemtest/Eigendiagnose
22.05.2026	161.005	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
15.09.2025	130.352	Reparatur Sonstiges; Systemtest/Eigendiagnose
22.08.2025	127.684	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
24.04.2025	113.213	AU; HU + AU
22.10.2024	95.613	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
08.08.2024	90.240	Systemtest/Eigendiagnose; Systemtest/Eigendiagnose
20.11.2023	65.630	Motoröl b. Wartung; Regelwartungsdienst; Wartung Sonstiges
21.03.2023	36.023	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges