



CITROËN C3 SOCIÉTÉ GF-056-ZG

Vinnumber:	VF7SWYHTUNT551179	Versionname:	CITROËN C3 SOCIÉTÉ BlueHDi 100 S&S BVM
First Registrationdate:	25/04/2022	Fiscalpower:	Feel Business R VF [5P] 6-102CH-5cv (bi-corps VU-)
Expertise Mileage:	56621	Power Kw:	73
Bodytype:	Berline	Body colour:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Front	Interior colour:	Black
Fueltype:	Diesel	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	2		
Number head rests:	2		
Type of rims (mounted):	Steel		
Category:	VS		

Options

Number of keys total	1	Radio	
Number keys remote	1	Luggage cover	
GPS big screen color		Headlights Xenon/LED/Laser	
GPS storage		Rear parking sensors	
GPS storage	HD	Seat cover lining	Lining Other
Windows electric F			
Cruise Control			
Steering wheel multifunctional			
Type of climate control	Autom climate control		

Tyres

185/65/15/88 T				
Summer tyres:	Fr.L.	Firestone: 70%	Fr.R.	Firestone: 70%
	Re.L.	Bridgestone: 65%	Re.R.	Bridgestone: 80%
Tyre profile depth FL				3.8
Tyre profile depth FR				3.8
Tyre profile depth RL				3.9
Tyre profile depth RR				2.9
Tyre size FL				185/65 R 15 88 T
Tyre size FR				185/65 R 15 88 T
Tyre size RL				185/65 R 15 88 T
Tyre size RR				185/65 R 15 88 T
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				258
Tyre make FR				258
Tyre make RL				255
Tyre make RR				255

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Remote ignition key, Missing, Repair/replace (lump sum)			



Seat cover FR, Stain, Cleaning



Seat cover FL, Stain, Cleaning



Tyre FL, Out of tolerance, Replace



Tyre RL, Out of tolerance, Replace



Tyre RR, Out of tolerance, Replace




Tyre FR, Out of tolerance, Replace



Door FL, Scratch(es), Paint



Wing RR, Dent(s) and scratch(es), Repair and paint (complete)

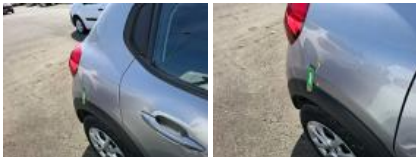

Luggage cover cord, Missing, Replace



Bumper R, Broken, Replace



Bodywork, Glue residues, Sticker removal small



Roof, Dent(s), Repair and paint (complete)

