

Expertise

Protocol number: 46267089
Order No. / Reference: 26644445
Inspection date: 30 Jun 2026

Manufacturer: Skoda

Model: Enyaq iV 80x Sportline

VIN: TMBLE7NY1NF038122



Vehicle details

Manufacturer / Type / Model / Equipment

Skoda Enyaq iV 80x Sportline

Vehicle Identification number TMBLE7NY1NF038122

Mileage (Read) 97,600 km

First registration 11 May 2022

Number of holders 1

Power / Engine displacement 195 kw / 0 ccm

Fuel type / Cylinder Electric / 0

Gearbox / Number of gears Direct drive / 1

Type of drive All-wheel drive

Type of vehicle Station wagon

Colour / colour code Brilliant-Silber Metallic

Doors / Seats 5 / 5

Upholstery type Alcantara / Leather

Colour of upholstery Black-Anthracite



Vehicle details

| | | | |
|--|--------------------------------|--------------------------------|--|
| Maintenance booklet / proof | digital proof / complete | Next maintenance in | 662 Tag(e) |
| Last service on / at | 04/2026 at 80,846 km | | |
| Key is / should be | 2 / 2 | FZG documents | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
| | | Letter No. | GJ913586 |
| Previous damage / Accident | None detectable | Repainting | None detectable |
| Inspection conditions | sufficient | Lifting equipment / pit | yes |
| Test drive | Not performed | Engine function test | Performed |
| Manufacturer key number/ type code number | 8004 / AWT 00013 | | |
| Emission standard | 2017/1151;WLTP;reine Elektrofz | fine dust sticker | |
| Permitted total weight | 2,750 kg | Empty weight | |

Tyres

Mounted tyres

| # | Tyre size | Type of tyre | Manufacturer | Tread depth |
|----|-----------------|---|--------------|-------------|
| 1) | 235/50 R20 100T | Summer tires (with run-flat tires) on Light alloy | Pirelli | 5mm / 5mm |
| 2) | 255/45 R20 101T | Summer tires (with run-flat tires) on Light alloy | Pirelli | 6mm / 6mm |

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Fleet Professionals GmbH
Leerenstraße 25
29683 Bad Fallingbommel



Equipment



Standard equipment

- Front and rear parking sensors
- Rain sensor and driving light assistant with coming and leaving home function
- Tire pressure monitoring
- Wheels: 20" Vega anthracite-gloss-turned alloy wheels (front: 8Jx20 tires 235/50 R20 100T, Seal rear: 9Jx20 tires 255/45 R20 101T)
- Rear view camera
- Headlight cleaning system including washer fluid level control (5l washer fluid reservoir)
- Safety lights in the front side doors
- Seats: Front seats are height-adjustable, including manually adjustable lumbar support.
- Speed limiter
- Lane keeping assistant (Lane Assist)
- 12V socket - in the trunk
- Traffic sign recognition
- Immobiliser
- Central locking including remote control integrated into the key (EASY START (keyless start-stop system))
- Airbag, center airbag front
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, front and rear head airbags
- Airbag, front side airbags
- acoustic windscreen
- Permanent all-wheel drive
- Anti-lock braking system (ABS)
- Evasive steering assist including turning assistant (The turning assistant monitors oncoming vehicles when you turn left (for left-hand drive vehicles). If there is an immediate danger, it brings the vehicle to a standstill and a warning signal sounds.)
- Design Selection Sportline (seat covers in leather/fabric/microfiber black with decorative stitching in grey - decorative strips "carbon look" - headliner in black - front center armrest, including storage compartment - rear center armrest with cup holders and pass-through - floor mats - ambient lighting for instrument panel and front door trim, multicoloured - footwell lighting and illuminated door handle recesses - umbrella)
- Electric windows front and rear (including anti-pinch protection and child safety lock)
- Cruise control
- Transmission: 1-speed (EV)
- Tinted windows
- Heated rear window
- rear window wiper
- Automatic interior mirror dimming
- Isofix anchorage on the front passenger seat
- Isofix anchorage on the outer rear seats including top tether
- Radio: Infotainment system with capacitive 13" color display (8 speakers - 2 x USB ports (Type-C) at the front - Navigation system preparation - DAB+ digital radio reception - Bluetooth hands-free phone system - Voice control - SmartLink (MirrorLink, Apple CarPlay, Android Auto) - Wireless SmartLink for Apple CarPlay and Android Auto)
- Rear seat backrest split 60:40, foldable
- Power steering
- Seat belts (Height-adjustable three-point seat belts in the front - Three three-point seat belts in the rear - Seat belt reminder indicators on the front and rear seats)
- Skoda Care Connect (SOS emergency call function (eCall including automatic activation in the event of an accident with airbag deployment) - Free remote vehicle access to iV-specific functions for 10 years (iV Remote Services Basic) such as starting and stopping the charging process, creating charging plans, setting the interior climate control before starting the journey, etc.)
- Storage compartments (Four roof grab handles, rear with coat hooks - Warning vest compartment in the doors - Storage compartments in the front door panels with 1.5l bottle holders - Storage compartments in the rear door panels - Umbrella compartments in the front doors - Ticket holder on the windshield - Ice scraper in the tailgate panel - Coat hooks on the B-pillars - Cup holder in the front center console - Storage compartments in the trunk)
- Traction control (ASR)
- Electrically adjustable, heated and folding exterior mirrors, including automatic dimming.
- Outdoor temperature display
- Hill start assist
- AERO roof rails in glossy black
- Digital instrument cluster (Virtual Cockpit)
- Third brake light
- E-Sound (external speaker for generating a driving sound)
- Electronic parking brake including auto-hold function
- Increased battery charging power max. 125 kW incl. 1 year free monthly basic fee at Ionity
- ESC Electronic Stability Control
- Chassis: Sport chassis
- Front radar assist with pedestrian and cyclist detection and city emergency braking function (The front radar assist is a safety system with collision warning: If confronted with an unavoidable collision, it brakes the vehicle to minimize the consequences. It also performs emergency braking if a pedestrian or cyclist attempts to cross the vehicle's path. The front radar assist recognizes from the way the driver moves the vehicle that they are attempting to avoid an obstacle and actively intervenes in the steering to steer around it.)
- Child safety locks on the rear doors
- Removable boot cover
- Rear headrests are height-adjustable, front headrests are integrated (sports seat)



- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger, including odor and allergen filter)
- Charging cable for AC charging stations (Mode 3 charging cable, Type 2, 16A) (Fast charging connector (CCS / Combo 2))
- LED taillights with animated turn signals
- Steering wheel adjustable for height and reach
- Dynamic and automatic headlight range control
- Package: Convenience BASIC (KESSY (Keyless Entry and Start-Stop System) - Phonebox with inductive charging function (connection via the external antenna) - Sunset including acoustic side glazing at the front - Extended acoustic measures - Driver fatigue detection)

- LED matrix headlights with AFS (The system detects whether the vehicle is traveling in the city, on a country road or a motorway and automatically adjusts features such as the lateral illumination of the road or the active cornering lights. In rain and poor weather conditions, the cornering and bending lights illuminate the area directly in front of the car more effectively.)
- Package: Drive SPORT BASIC (paddle shifters for adjusting recuperation strength - driving profile selection - heated leather steering wheel in sport design with multifunction buttons - steering wheel with hands-off detection - progressive steering)

Extra equipment

- Package: Driving Assistance PLUS (Predictive Adaptive Cruise Control (pACC) incl. Traffic Jam Assist - Lane Change and Parking Assist - Proactive Occupant Protection - Traveller Assistance System incl. Emergency Assist (Traffic Sign Recognition, Adaptive Lane Keeping Assist))
- Package: Parking PLUS (front and rear parking sensors - reversing camera incl. 360° surround view camera)
- Package: Seating comfort BASIC (electrically adjustable driver's seat with memory function - electrically adjustable lumbar support in the driver's seat)
- Panoramic sunroof, electric (deletion of the glasses compartment in the headliner)
- heat pump
- Luggage net partition
- Mobile charging station "iV Universal Charger" with interchangeable connection adapters

- Package: Infotainment PLUS (Navigation system - Infotainment Online 3 years (Online map updates for navigation; display of weather data, news, headlines; charging station and parking space search) - Augmented reality head-up display)
- Package: Light & Sight PLUS (LED matrix headlights incl. AFS and dynamic high beam assist - headlight cleaning system - full LED taillights with animated turn signals - illuminated front grille "Crystal Face")
- Package: Transport (Net program in the trunk incl. charging cable bag - Variable loading floor in the trunk - Remote release of the rear seat backrests in the trunk - Cargo elements in the trunk)
- Swiveling trailer hitch (including trailer stabilization)
- Paint finish: Pearl effect
- Package: Drive SPORT PLUS (Sportline) (Adaptive chassis DCC incl. driving profile selection)

Brief expert findings

| | |
|----------------------|--|
| Documents submitted | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection. |
| Inspection | The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle. |
| Test drive | No test drive/shunting maneuver was carried out during the inspection of the vehicle. |
| Engine function test | An engine test run was performed. |

Value reducing factors

| No. | Component group | Description |
|-----|-----------------|---------------------------------------|
| 1 | Bonnet | Bonnet - dent(s) - Smooth repair work |



Wear and tear

| No. | Component group | Description |
|-----|----------------------|---|
| 1 | Roof | Roof - dent(s) - No deduction |
| 2 | Mudguard - left side | Mudguard - left side - dent(s) - No deduction |

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

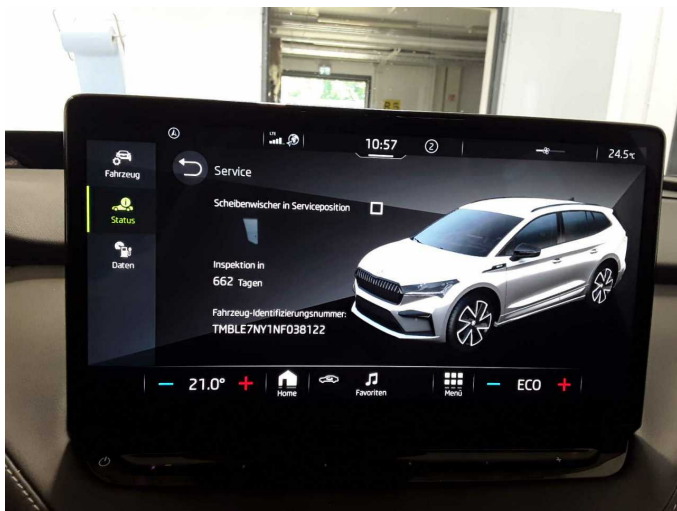


Figure 15: Documents



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Damage 1: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage 1: Bonnet: Bonnet - dent(s) - Smooth repair work



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBLE7NY1NF038122
Hersteller / Modell: SKODA SKODA Enyaq iV 80x

| Datum | KM-Stand | Beschreibung |
|------------|----------|---|
| 27.04.2026 | 80.846 | Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Systemtest/ Eigendiagnose |
| 10.01.2025 | 63.732 | Bremsbacken hi ern; Bremse Sonstiges; Systemtest/Eigendiagnose |
| 26.08.2024 | 53.258 | Systemtest/Eigendiagnose; Wartung Sonstiges |
| 10.04.2024 | 44.943 | Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst |