



Expertise

Protocol number: 47197531
Order No. / Reference: 26702274
Inspection date: 21 Aug 2026

Manufacturer: Volkswagen

Model: Touran 2.0 TDI SCR DSG Comfortline

VIN: WVGZZZ1T1RW000993



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Touran 2.0 TDI SCR DSG Comfortline	
Vehicle Identification number	WVGZZZ1T1RW000993
Mileage (Read)	90,327 km
First registration	11 Aug 2023
Number of holders	1
Next periodical technical inspection	08/2026
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Reflexsilber-metallic (A7W)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	2,900 km
Last service on / at	07/2025 at 63,235 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV302412
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BWR 00513		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,230 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres on Light alloy	Pirelli	3mm / 3mm
2)	205/60 R16 96V	Summer tyres on Light alloy	Pirelli	3mm / 3mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment with lid on the instrument panel
- Airbag for driver and front passenger (with front passenger airbag deactivation, including driver's side knee airbag)
- Adaptive Cruise Control (ACC) "stop & go", with speed limiter
- Exterior mirror housings and door handles in body color
- third brake light
- black roof rails
- Decorative inlays "Piano Black" (for center console)
- Diesel particulate filter
- Tachometer
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Automatic headlight control with daytime running lights ("Leaving home" function and manual "Coming home" function)
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage management package (with luggage net that can be fixed to rails)
- Additional luggage compartment lighting (removable and usable as a flashlight)
- Transmission: 7-speed DSG (7-speed dual-clutch transmission DSG)
- Rear window wiper with intermittent function
- Interior mirror automatically dimming
- ISOFIX mounting points on rear seats (device for attaching child seats to the rear seats)
- Front headrests (safety-optimized, longitudinally and height-adjustable)
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- Front center armrest (height and length adjustable - with removable storage box - 2 rear air vents)
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency call service (no registration required, service is activated upon delivery)
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Wheels: Light alloy (4) "Karlstad" 6.5 J x 16 (tires 205/60 R 16)
- Gearshift knob in leather
- Keyless start system without safe locking
- Electromechanical power steering (speed-dependent control)
- Seats: 3 individual seats in the 2nd row (longitudinal adjustment, backrest tilt adjustment, armrest and "EasyFold" folding function)
- Seats: Comfort seats in the front
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- Start-stop system (with brake energy recuperation)
- 12V power outlet on the rear center console (and in the luggage compartment)
- Bumpers in body color
- Storage compartments in the overhead console
- Airbag, head airbag system for front and rear passengers (including front side airbags)
- Electrically folding exterior mirrors (dimming on the driver's side, ambient lighting and passenger-side mirror lowering)
- Headliner in Storm Grey
- Decorative inserts "New Brushed Design" (for instrument panel and front door trim)
- Digital Cockpit, multi-colored (various info profiles selectable)
- Electronic parking brake including auto-hold function
- Electronic Stability Program (ESP) with counter-steering support (Incl. ABS with brake assist, ASR (traction slip control), EDS (electronic differential lock), MSR (engine drag torque control) and trailer stabilization)
- Pedestrian and cyclist detection as well as active front hood
- Luggage compartment cover (with comfort opening, extendable, removable and stowable)
- Luggage compartment floor height adjustable (with fixing element)
- Glove compartment with cooling option
- Rear window heated
- Interior lights with delayed shut-off and dimming function, 2 reading lights front and rear
- Air conditioning (with active combination filter)
- Headrests (3) in the 2nd row of seats (height adjustable)
- Black radiator grille with chrome strips on the slats
- Paint finish: Solid
- Headlight range control
- Illuminated makeup mirrors in the sun visors
- Multifunctional camera
- Fatigue detection
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Upholstery in fabric
- Proactive occupant protection system in conjunction with "Front Assist" and "Side Assist"
- Rain sensor
- Wheels: Tire pressure monitoring system
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Drawers under the front seats
- Seat belts: 3 three-point automatic seat belts in the rear (and seat belt tensioners in the rear)
- Seats: Front passenger seat backrest folds down completely (with table and pass-through function)
- Seats: Folding tables on the backs of the front seats (tilt adjustable)
- Seats: Front seats are height-adjustable



- Telephone interface
- Textile floor mats (front and rear)
- USB-C interface (charging power up to 45 W)
- First aid kit, warning triangle and high-visibility vest
- Prepared for "We Connect" and "We Connect Plus" (online information is transmitted directly to the car (e.g. navigation with point-of-interest search, online traffic information, parking information, etc.))
- Central locking without safe locking, with remote control and 2 remote folding keys

Extra equipment

- Trailer Assist including Park Assist and Parking Aid (provides support to the driver during maneuvering operations with a trailer; the maneuvering direction is specified via the mirror adjustment switch; the vehicle steers automatically)
- Heated windscreen (TDI) (Laminated safety glass windscreen, noise-reducing and heated; 180 A three-phase alternator)
- Navigation system "Discover Pro" incl. "Streaming & Internet" (23.4 cm (9.2 inch) touchscreen with voice control and traffic sign recognition - navigation system - USB-C interfaces and a mobile phone interface via Bluetooth - DAB+C - App-Connect Wireless for Apple CarPlay and Android Auto - voice control)
- Package: Business Premium incl. Navigation (DSG) (Air Care Climatronic air conditioning - Lumbar support front, electrically adjustable on driver's side, massage function driver's side - Multifunction leather steering wheel with shift paddles - Cargo net partition - Automatically heated windshield washer nozzles front - Headlight cleaning system - Drawer under the right front seat - Microfleece seat center panels "ArtVelours" - Top comfort seats front - Heated front seats - Height-adjustable front seats, ergoActive seat on the driver's side - Washer fluid level warning light)
- 230V power outlet in the luggage compartment on the left (additional luggage compartment lighting, removable and usable as a flashlight)
- "Comfort" telephone interface with inductive charging function (hands-free system)
- Front USB-C ports (2) (2 USB-C charging ports on the rear center console; charging power up to 45 W)

- Lane change assistant "Side Assist" and parking assistant (warns the driver of vehicles that could pose a danger during lane changes by means of visual signals in the respective exterior mirror - monitors the area behind and beside the vehicle when reversing out of a parking space - issues visual and acoustic warning signals when a vehicle is detected crossing the parking space path - can initiate emergency braking to reduce the severity of a collision or to prevent a collision altogether)
- Warning tone and light for unfastened front seat belts (warning light for unfastened rear seat belts)
- Electronic immobilizer
- Green heat-insulating glazing (sides and rear)
- Black trim strips on the side windows

- Towbar, foldable with electric release
- Anti-theft alarm system (with interior monitoring, backup horn and tow-away protection)
- Chassis: Rough road chassis including engine underbody protection (approx. 15 mm increased ground clearance)
- Paint finish: Metallic
- LED taillights
- Fog lights and cornering lights
- Package: "Easy Open & Close" package with safe locking (tailgate with sensor-controlled opening and closing, with remote unlocking - keyless locking and starting system "Keyless Access" with safe locking)
- Package: Assistance package "IQ.DRIVE" incl. IQ.LIGHT (DSG) (Dynamic Light Assist high beam - Travel Assist, Lane Assist and Emergency Assist - LED headlights with LED daytime running lights and cornering lights - Dynamic headlight range control with dynamic cornering lights)
- Rearview camera for trailer maneuvering assistant "Trailer Assist" (displays the rear of the vehicle in real time on the radio/navigation system display)
- Rear side windows and rear window tinted
- Seats: ergoActive seat with 14-way adjustment and massage function in front in conjunction with Business Package Premium (ergoActive front seats height-adjustable, seat and backrest tilt adjustable - lumbar support in front electrically adjustable and with massage function - without drawers under the front seats - seat center panels in microfleece "ArtVelours" - top comfort seats in front - heated front seats)
- Traffic sign recognition in conjunction with the "IQ.DRIVE" assistance package including IQ.LIGHT



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door edge - Scratch(es) - Smart repair
2	Instrument panel	Indicator light (Reifendruck) - on - Perform diagnosis
3	Front bumper	Front bumper - Scratch(es) - Smart repair
4	Side panel - rear right side	Side panel - Scratch(es) - Paint
5	Rear bumper	Rear bumper - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lining - Scratch(es) - No deduction
2	Vehicle glazing	Rear window - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen (+ kratzer) - Stone chips - No deduction
4	Side panel - rear right side	Sill - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side right, Provided by user / customer, from 26 Apr 2024	6.080,94 €

Repainting

No.	Repainting
1	Mudguard - right side, Bonnet, Professionally carried out

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster

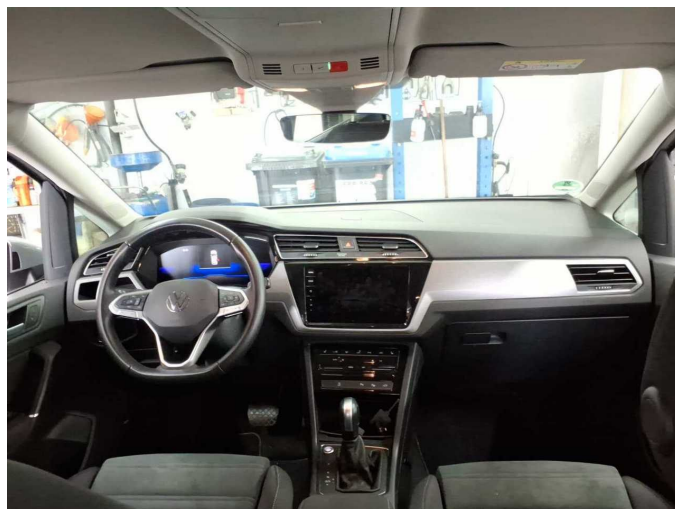


Figure 8: Instrument panel



Figure 9: Cargo area



Figure 10: VIN



Figure 11: Mounted tyres

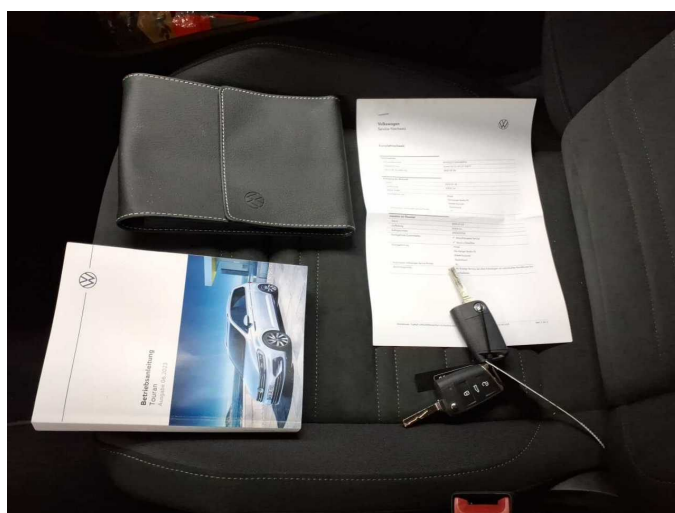


Figure 12: Documents

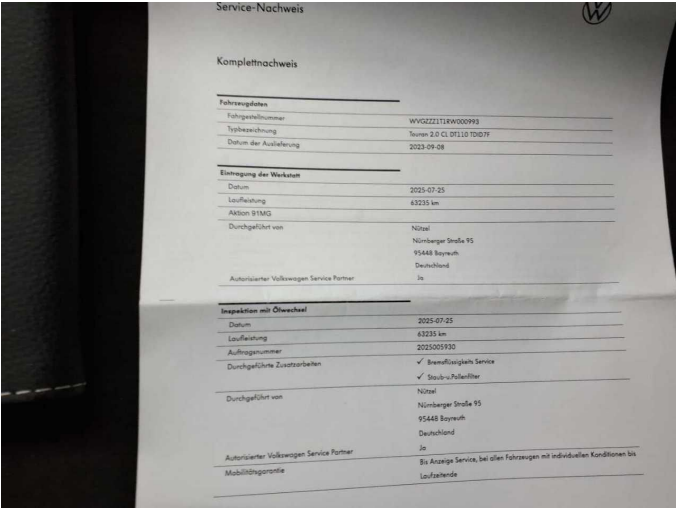


Figure 13: Documents

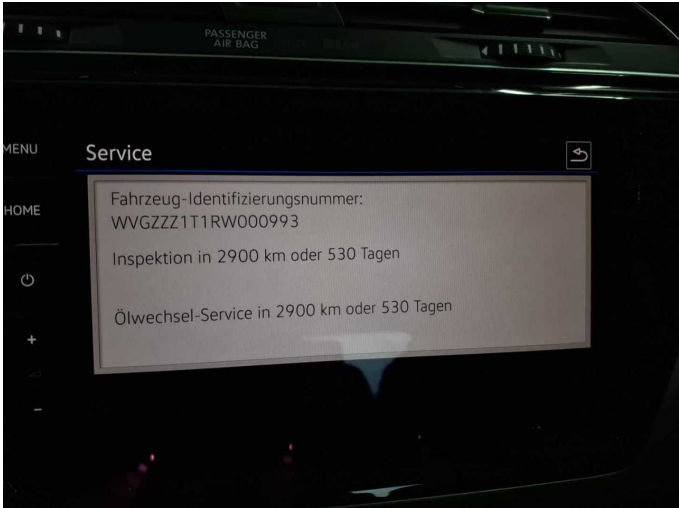


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

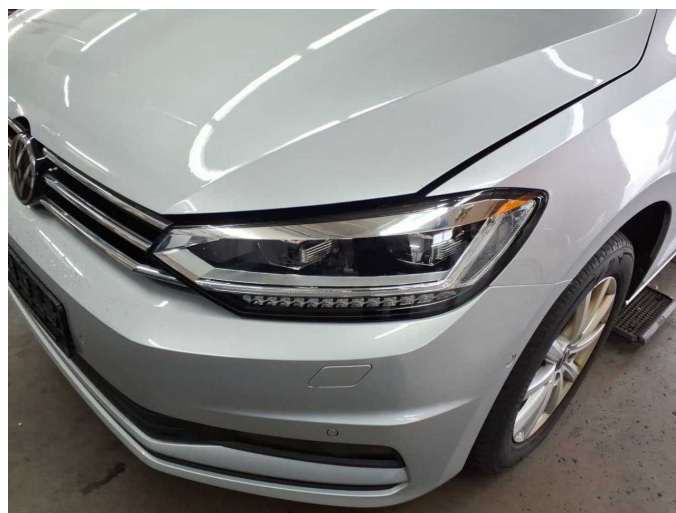


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

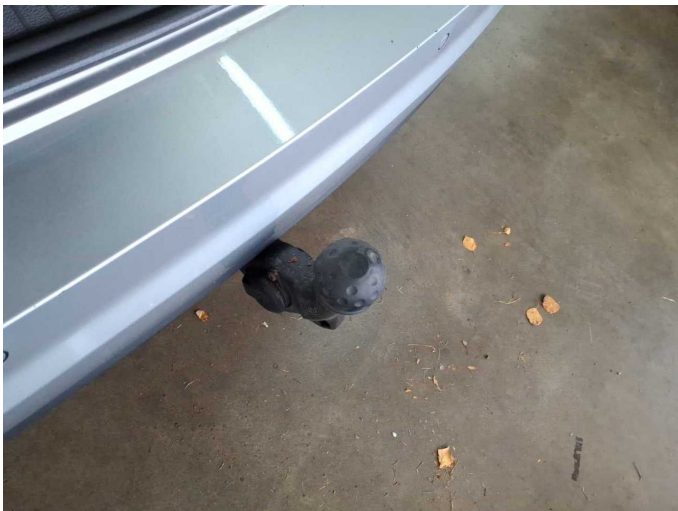


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 2: Instrument panel: Indicator light (Reifendruck) - on - Perform diagnosis



Damage 2: Instrument panel: Indicator light (Reifendruck) - on - Perform diagnosis



Damage 3: Front bumper: Front bumper - Scratch(es) - Smart repair




Damage 3: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Paint




Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Paint

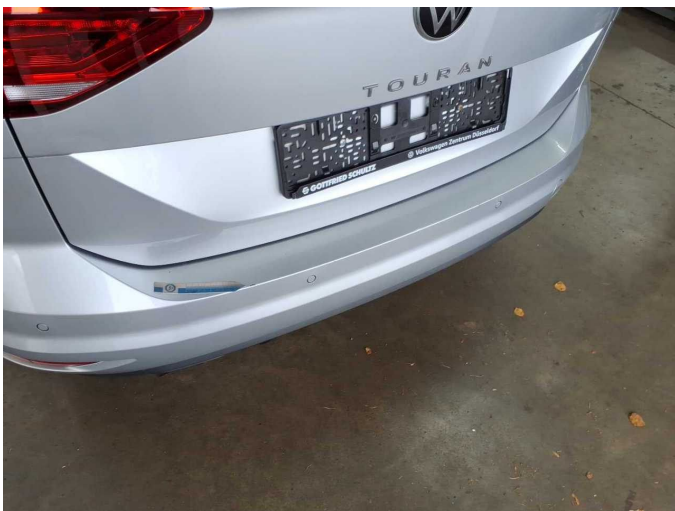

Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint

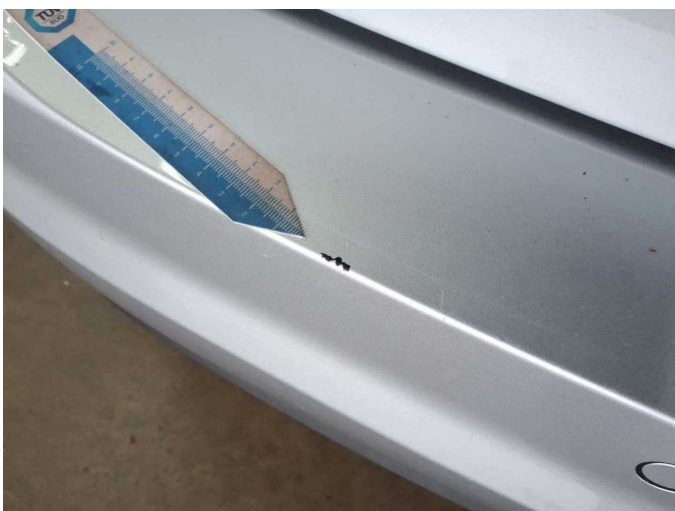

Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Wear and tear 4: Side panel - rear right side: Sill - dent(s) - No deduction



Wear and tear 4: Side panel - rear right side: Sill - dent(s) - No deduction



Previous damage 1: Front, Side right



Previous damage 1: Front, Side right



Previous damage 1: Front, Side right




Previous damage 1: Front, Side right



Previous damage 1: Front, Side right



Previous damage 1: Front, Side right

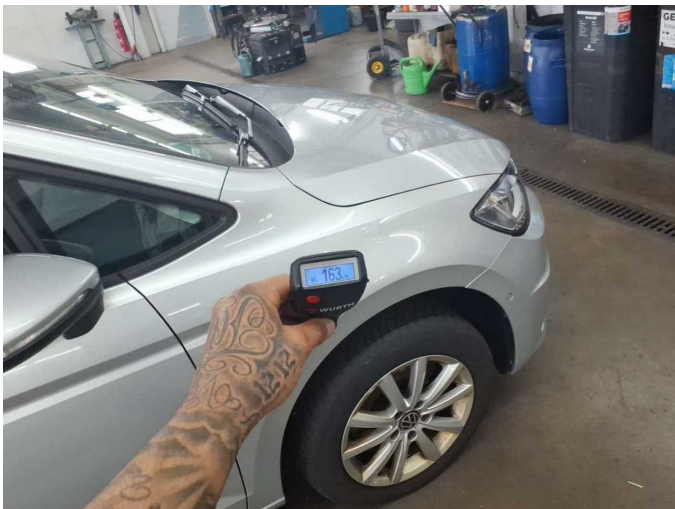

Previous damage 1: Front, Side right



Previous damage 1: Front, Side right



Previous damage 1: Front, Side right




Previous damage 1: Front, Side right



Repainting 1: Mudguard - right side, Bonnet



Repainting 1: Mudguard - right side, Bonnet

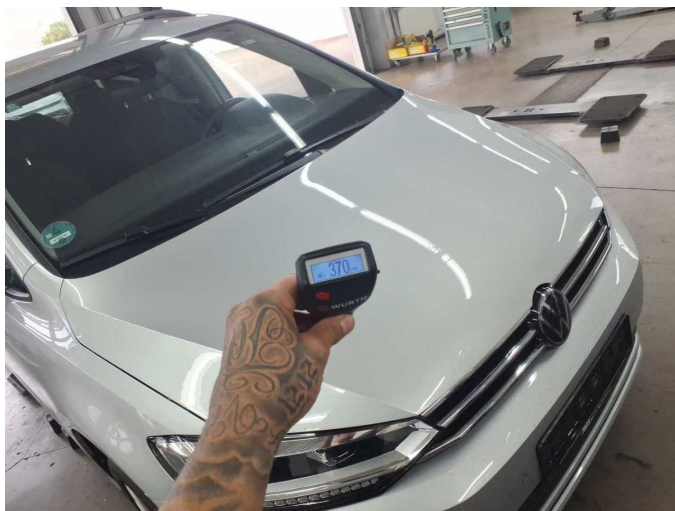

Repainting 1: Mudguard - right side, Bonnet



Repainting 1: Mudguard - right side, Bonnet



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ1T1RW000993

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Touran 2.0 TDI SCR DSG
Comfortline

Datum	KM-Stand	Beschreibung
28.07.2025	63.235	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
02.08.2024	31.369	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges