



Expertise

Protocol number: 46572204
Order No. / Reference: 26694915
Inspection date: 16 Jul 2026

Manufacturer: Seat

Model: Leon Sportstourer 2.0 TDI DSG FR

VIN: VSSZZZKL7PR057583



Vehicle details	
Manufacturer / Type / Model / Equipment	
Seat Leon Sportstourer 2.0 TDI DSG FR	
Vehicle Identification number	VSSZZZKL7PR057583
Mileage (Read)	106,975 km
First registration	29 Jun 2023
Number of holders	1
Next periodical technical inspection	06/2028
(Report on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Midnight Black (Y9T)
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	504 Tag(e)
Last service on / at	08/2026 at 93,653 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT053585
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	7593 / ASL 00421		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,070 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/40 R18 92Y	Summer tyres on Light alloy	Bridgestone	5mm / 5mm
2)	225/40 R18 92Y	Summer tyres on Light alloy	Goodyear	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91H	Winter tyres on Light alloy	Pirelli	3mm / 3mm
2)	205/55 R16 91H	Winter tyres on Light alloy	Pirelli	7mm / 7mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	125/70 R18 99M	Summer tyres on Steel	Sonstige	3 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartment in the front doors
- Driver and front passenger airbags (including center airbag)
- Airbag: Side airbag for driver and front passenger
- Electrically adjustable and heated exterior mirrors
- Exterior mirror housings painted in Cosmo Grey
- On-board computer
- Roof rails, black
- Electronic differential lock XDS (for front axle)
- Electronic parking brake (with auto-hold function)
- Electric window regulator with anti-pinch protection and one-touch function
- Gear recommendation display
- Luggage compartment roller blind
- Cruise control system
- Illuminated glove compartment
- Rear window wiper
- Keyless Go (engine start/stop button)
- "Climatronic" air conditioning (3 zones with electronic temperature control - front center armrest and 2 USB-C ports in the front and 2 in the rear (charging function))
- LED technology for headlights, daytime running lights and taillights
- Reading light front/rear
- Front center armrest
- Fatigue detection
- Emergency call service (no registration required, service is activated upon delivery)
- Upholstery: Cloth
- Radio: Media System Plus (audio system with 8.25" color touchscreen - 2 USB-C ports at the front)
- Radio accessories: Digital radio reception DAB+
- Radio accessories: USB-C interface (2 rear)
- Wheels: Tyre fit
- SEAT CONNECT (prepared for activation of the service packages Security/Assistance and Remote Access)
- Side windows from the 2nd row of seats and rear window are dark tinted.
- Power steering (electromechanical)
- Seats, passenger seat height adjustable
- Seats: Driver's seat with height adjustment
- Seats: Lumbar support for front passenger
- Seats: Lumbar support for driver
- Seats: Sport comfort seats in the front
- Sun visor on driver and passenger side with make-up mirror and lighting
- Start-stop system and recuperation
- Power outlet: 12V socket at the front
- Ultrasonic rear parking aid
- Variable luggage compartment floor (with storage compartments in the luggage compartment)
- Storage pockets on the backs of the front seats
- Airbag: Passenger airbag deactivation
- Airbag: Head airbag system, front and rear
- Electrically folding exterior mirrors including passenger side mirror lowering
- LED turn signals integrated into the exterior mirrors
- Third brake light (integrated into tailgate)
- Diesel particulate filter
- Tachometer
- Electronic Stability Control (ESC) including Anti-lock Braking System (ABS) (including Traction Control System (ASR))
- Luggage compartment lighting
- Speed limiter
- Transmission: 7-speed DSG
- Heated rear window
- ISOFIX child seat restraint system, triple in the 2nd row of seats
- Front headrests (2)
- Rear headrests (3)
- Paint finish: Solid
- Steering wheel: Three-spoke leather steering wheel with multifunction and logo
- Lights: Full LED taillights (and Infinite Light; dynamic LED light strip at the rear)
- Fog lights with cornering light function in LED technology
- Package: LED interior lighting package (LED technology for - storage compartment in the center console - footwell lighting)
- Radio accessories: 6 speakers
- Radio accessories: Bluetooth interface with integrated hands-free system and audio streaming
- Tire pressure monitoring system
- Paddle shifters on the steering wheel
- SEAT Drive Profile (Driving profiles can be individually selected - Selected driving profile influences steering assistance, throttle response, chassis control (with DCC) and shift characteristics (with DSG))
- Seat belts: Three-point automatic fastening front and rear (warning tone for unfastened seat belts)
- Seats: Remote release for folding down the rear seat backrest into the boot
- Seats: Rear seat backrest asymmetrically split and foldable
- Sport suspension "FR"
- Lane departure warning system
- Power outlet: 12V socket in the trunk
- Illuminated front door sill trims
- Front Assist area monitoring system with City Emergency Braking function
- Lashing eyes in the luggage compartment
- Electronic immobilizer
- Thermal insulation glazing



- Virtual Cockpit (Fully digital instrument cluster with 10.25" TFT display)
- Central locking with remote control (incl. tailgate - door locking system from inside - 2 remote folding keys)

Extra equipment

- Swiveling tow bar
- Black headliner
- Luggage partition net
- Lights: Full LED headlights (Full LED headlights - "Hola!" light projection for greeting under the exterior mirrors - Dynamic headlight range control - Rear turn signals with dynamic LED technology Infinite Light; Dynamic LED light strip at the rear)
- Package: Driving Assistance Package XL for navigation system (Adaptive Cruise Control ACC up to 210 km/h with Predictive Cruise Control PCC - High Beam Assist - Side Assist incl. Blind Spot Assist - Exit Assist Information and Exit Warning - Lane Keeping Assist Plus incl. Travel Assist, Emergency Assist and Traffic Jam Assist - Traffic Sign Recognition)
- Package: Light and Sight (Rain sensor - Automatically dimming interior mirror - Light sensor with automatic headlight control - Automatic coming home and leaving home function)
- Park Assist with front parking aid
- Wheels: Alloy wheels (4) 7.5 J x 18" "Performance I" in Cosmo Grey, diamond-turned (With tires 225/40 R 18)
- Wheels: Spare wheel as emergency wheel
- Keyless locking and unlocking system; Kessy Advanced
- Auxiliary heater, with remote control
- Roof: Panoramic glass sunroof, electric (with sunshade blind)
- Paint finish: Metallic
- Package: Business Package INFOTAIN (Navigation system, prepared for activation of the SEAT CONNECT Online anti-theft package - Infotainment, navigation system with 10" display, 3D navigation, voice control, MAPCARE with integrated map for Europe - Wireless Full Link Connectivity incl. Android Auto and Apple CarPlay - Connectivity Box in the storage compartment of the center console incl. wireless charger - Anti-theft alarm system incl. interior monitoring, backup horn and tow-away protection)
- Package: Leather (leather seat center section, color black - electrically adjustable driver's seat with memory function - electrically adjustable lumbar support for driver's side - exterior mirrors with memory function - rear center armrest with pass-through; Winter package; heated steering wheel, heated front seats)
- Radio accessories: BeatsAudio sound system (10 speakers (with subwoofer), digital 12-channel amplifier, subwoofer, 340 watts total power)
- Rear view camera
- Smart Ambient Light (All-around ambient lighting in the interior - Welcome ceremony - Interaction with assistance systems and Drive Profile in FR)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Door - rear left side	Door - dent(s) - Smooth repair work
2	Roof	Roof rail - left side (leichte Korrosion) - Stone chips - Smart repair
3	Wing mirror - left side	Cap - Scratch(es) - Smart repair
4	Front bumper	Cover bumper - front (Rechts) - Broken / torn - Replace
5	Rear bumper	Rear bumper - Scratch(es) - Paint
6	Bonnet	Bonnet - Stone chips - Paint
7	Wheel / tyres	Alloy rim - rear right side - Scratched - Replace



Wear and tear

No.	Component group	Description
1	2nd wheel set	2 tyres (Profiltiefe 3mm) - Does not meet the leasing specifications - No deduction
2	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - No deduction
3	Sill - right side	Sill - Scratch(es) - No deduction
4	Door - rear right side	Door - Scratch(es) - No deduction
5	Side panel - rear left side	Elbow - dent(s) - No deduction
6	Wing mirror - left side	Mirror housing - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 7 Jul 2024	1.818,18 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

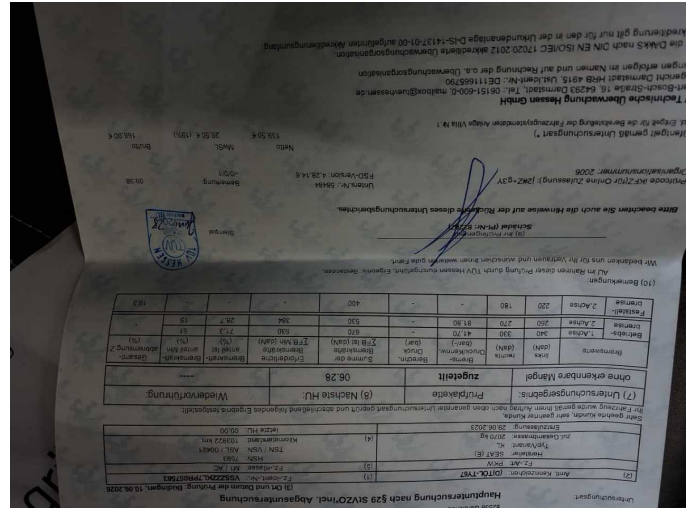


Figure 14: Documents

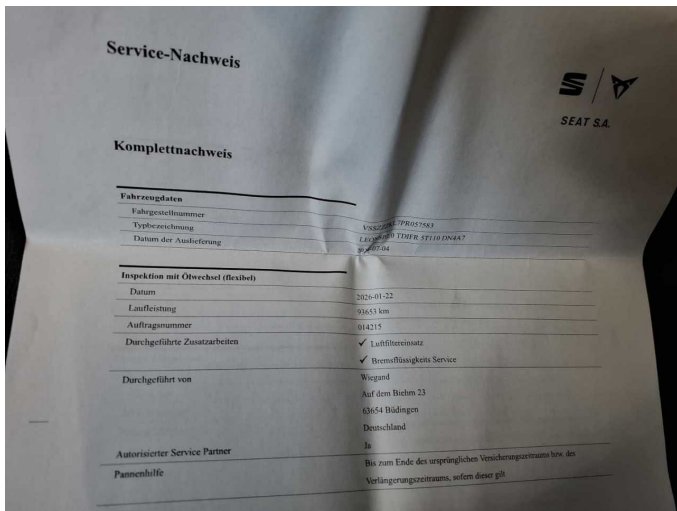


Figure 15: Documents

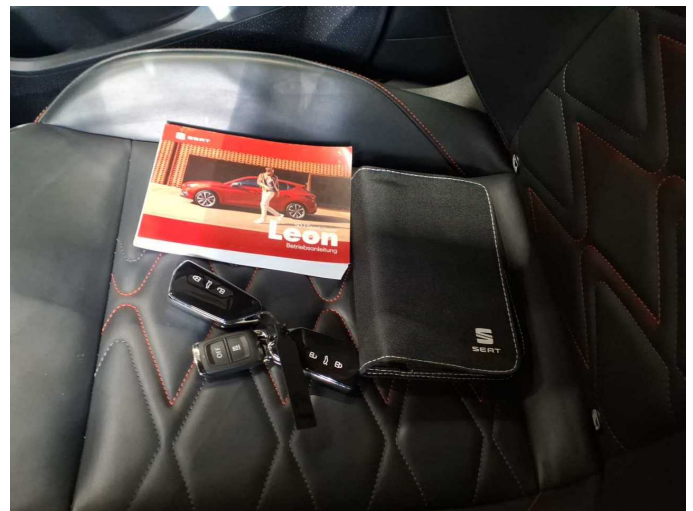


Figure 16: Documents



Figure 17: Additional tyres

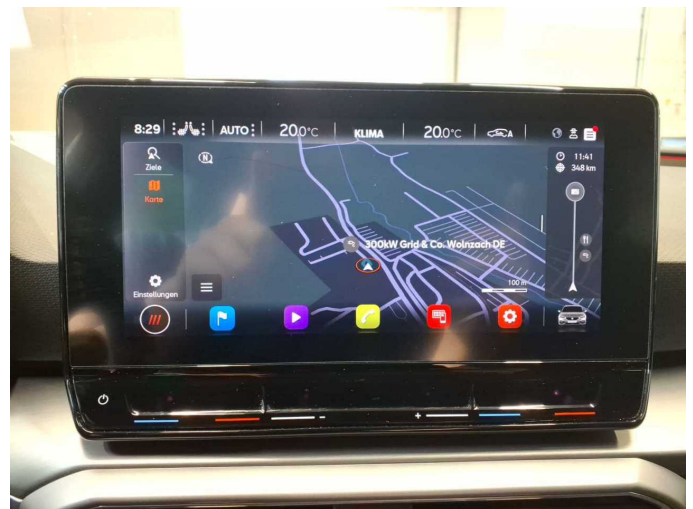


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

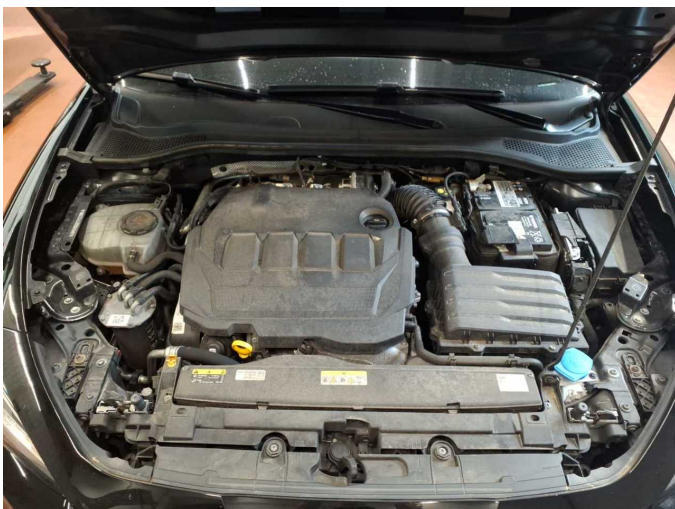


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

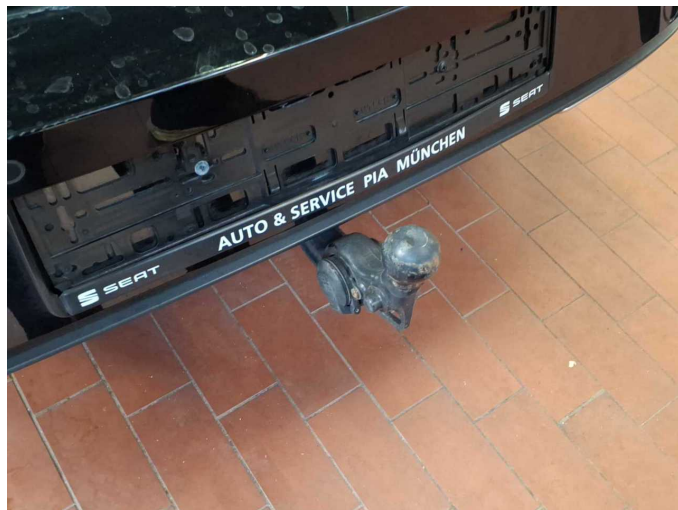


Figure 26: Misc.

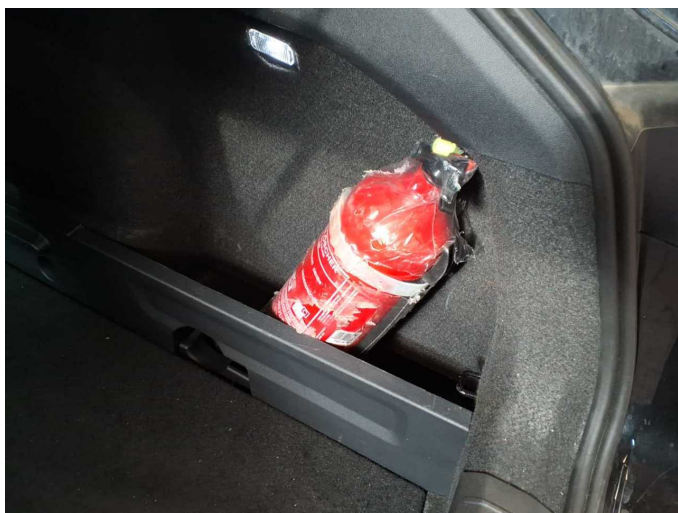


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.

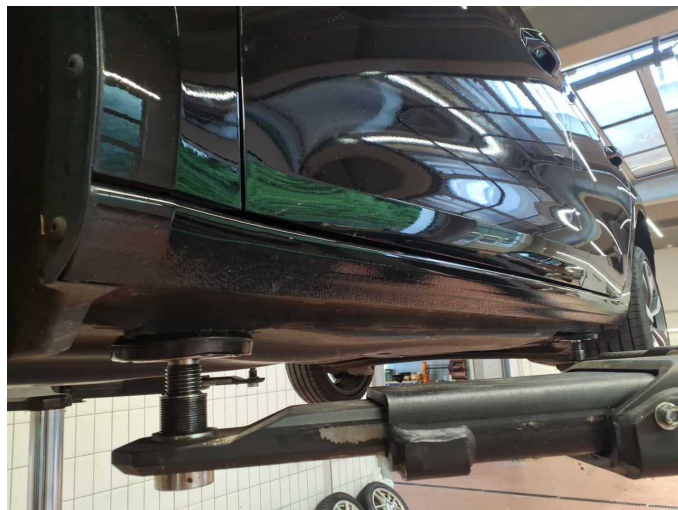


Figure 32: Misc.



Figure 33: Misc.




Damage 1: Door - rear left side: Door - dent(s) - Smooth repair work




Damage 1: Door - rear left side: Door - dent(s) - Smooth repair work




Damage 2: Roof: Roof rail - left side (leichte Korrosion) - Stone chips - Smart repair

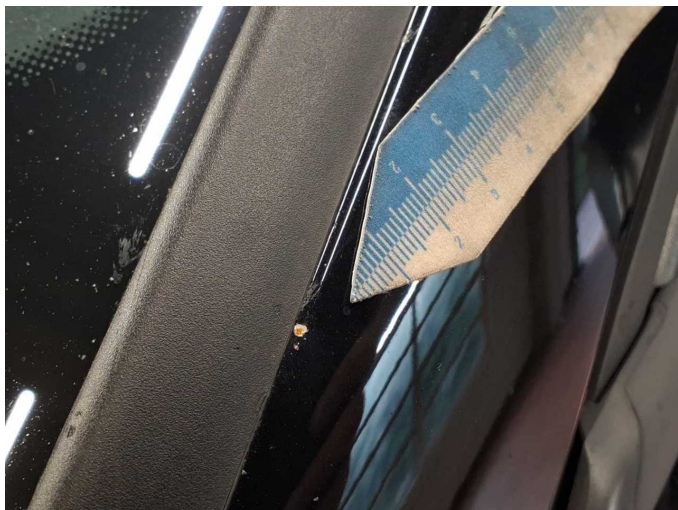

Damage 2: Roof: Roof rail - left side (leichte Korrosion) - Stone chips - Smart repair

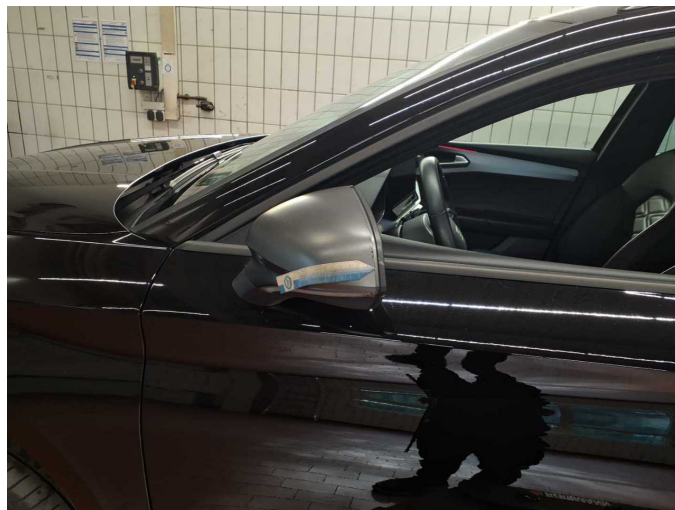

Damage 3: Wing mirror - left side: Cap - Scratch(es) - Smart repair

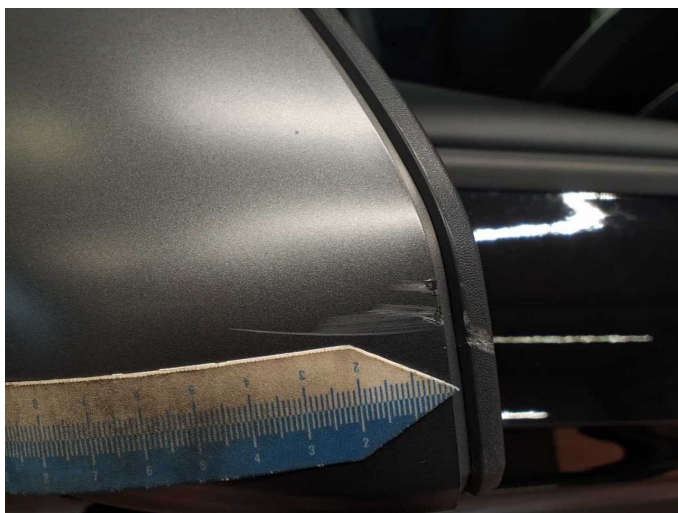

Damage 3: Wing mirror - left side: Cap - Scratch(es) - Smart repair




Damage 4: Front bumper: Cover bumper - front (Rechts) - Broken / torn - Replace



Damage 4: Front bumper: Cover bumper - front (Rechts) - Broken / torn - Replace



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint

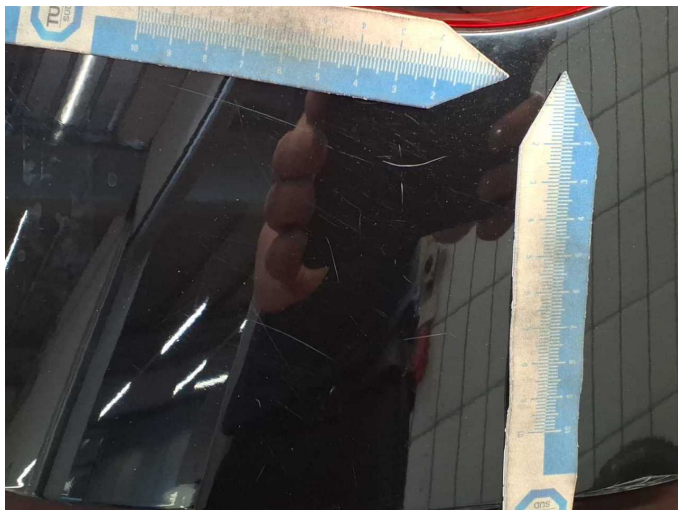

Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Bonnet: Bonnet - Stone chips - Paint

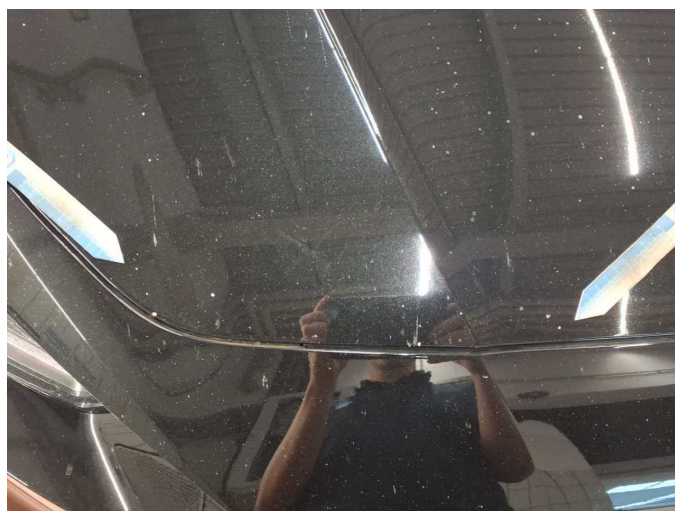


Damage 6: Bonnet: Bonnet - Stone chips - Paint



Damage 6: Bonnet: Bonnet - Stone chips - Paint




Damage 6: Bonnet: Bonnet - Stone chips - Paint

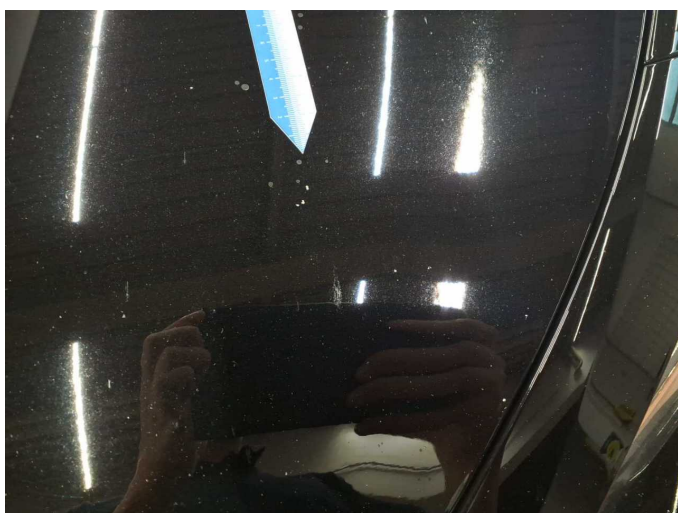


Damage 6: Bonnet: Bonnet - Stone chips - Paint



Damage 6: Bonnet: Bonnet - Stone chips - Paint

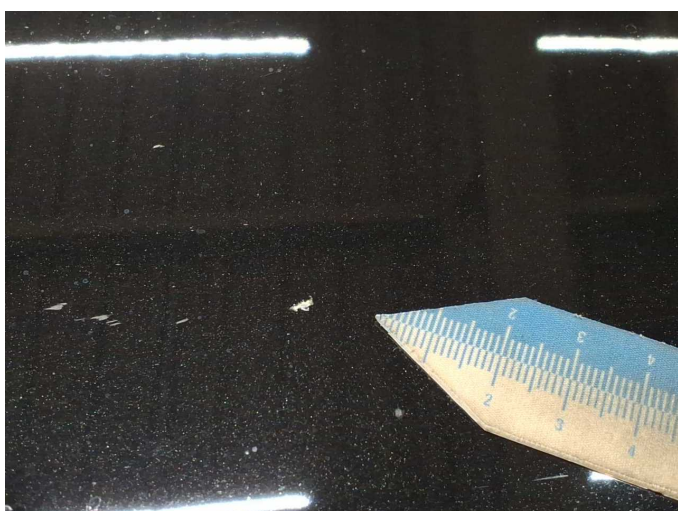

Damage 6: Bonnet: Bonnet - Stone chips - Paint

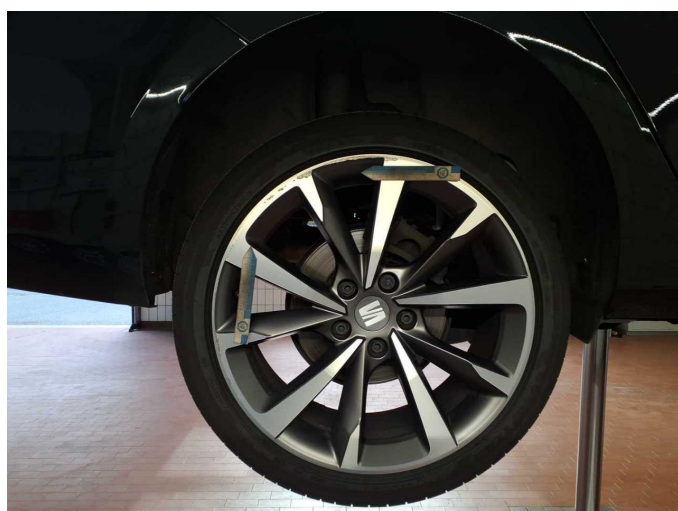

Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Wear and tear 2: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - No deduction



Wear and tear 2: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - No deduction



Wear and tear 6: Wing mirror - left side: Mirror housing - Scratch(es) - No deduction



Wear and tear 6: Wing mirror - left side: Mirror housing - Scratch(es) -
No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VSSZZZKL7PR057583

Hersteller / Modell: SEAT SEAT Leon Sportstourer 2.0 TDI DSG FR

Datum	KM-Stand	Beschreibung
10.06.2026	103.922	HU + AU
03.12.2025	88.179	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne
21.03.2025	63.529	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
27.05.2024	30.507	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
30.06.2023	14	Reparatur Sonstiges