



Expertise

Protocol number: 46627029
Order No. / Reference: 26426382
Inspection date: 15 Jul 2026

Manufacturer: Ford

Model: Transit Connect 230 L2 S&S Trend

VIN: WF07XXWPG7NY70929



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Transit Connect 230 L2 S&S Trend

Vehicle Identification number	WF07XXWPG7NY70929
Mileage (Read)	220,589 km
First registration	21 Jun 2022
Number of holders	1
Next periodical technical inspection	07/2027
(Report on hand)	

Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	88 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Polar-Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	68 %
Last service on / at	12/2025 at 211,100 km		
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH427756
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	Conditional: Light/moisture/dirt	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Not possible
Manufacturer key number/ type code number	8566 / BLK 00440		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,290 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Steel rim with wheel cover	Goodyear	3mm / 3mm
2)	205/60 R16 96H	Winter tyres on Steel rim with wheel cover	Goodyear	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres on Steel	Pirelli	4mm / 4mm
2)	205/60 R16 96V	Summer tyres on Steel	Pirelli	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ABS with EBD
- Airbag package
- Exterior mirror housing black
- Hill start assist
- On-board computer including outside temperature display
- Tachometer
- Electronic Safety and Stability Program (ESP)
- Rear electric windows, right and left (at the height of the 2nd row of seats)
- Ford Easy Fuel
- FordPass Connect
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Transmission: 6-speed transmission
- Glove compartment with lid
- Rear window wiper/washer system
- Isofix bracket
- Alternator/Generator
- Fog light
- Package: Car version package with rear swing door
- Tire pressure monitoring system
- Wheels: Steel wheels 6.5 J x 16 with 205/60 R 16 tires and wheel trims
- Electro-mechanical power steering
- Automatic door locking mechanism (45 sec.)
- Front spoiler lip
- Dust and pollen filter
- Power outlet: 12-volt connection on the center console, front and rear
- Daytime running light
- Child safety lock on sliding doors
- Lashing eyes
- Electronic immobilizer (EPATS)
- Central locking with remote control
- Driver's side airbag
- Exterior mirrors, narrow mirror format
- Battery (12 V / 71h)
- Floor covering: Carpet (1st and 2nd row)
- Diesel particulate filter (DPF)
- Third brake light
- Fixed rear windows, right and left (at the height of the 3rd row of seats)
- Front electric windows
- Ford ECO-Coach
- Heated windshield
- Rubberized luggage compartment floor mat
- Cruise control system with intelligent speed limiter (camera-based)
- Heated rear windows
- Front interior lighting with delay function
- Steering column, adjustable in height and reach
- Center console, front
- Emergency brake light
- Camera-based pre-collision assist
- Wheels: Tire repair kit
- Sliding door, right and left
- Side protection strips, plastic
- Safety brake assist
- Seats for passenger compartment: 2nd row of seats
- Start-stop system
- Concealed storage compartment
- Front bumper and rear bumper end caps painted in body color
- Carpet floor mats, front (2-piece set)
- Door handles, black
- Warning system for unfastened seat belts
- Heat-insulating glazing, lightly tinted
- Auxiliary electric heater (PTC), front



Extra equipment

- Detachable towbar (including ESP trailer stabilization and continuous power supply)
- Anti-theft alarm system with interior monitoring (including double locking and 2 remote control keys)
- Air conditioning with automatic temperature control (2 zones) (for driver and passenger side, separately adjustable)
- Paint finish: Metallic
- Front and rear parking pilot system
- Radio: Ford Audio System 9 (Ford navigation system incl. Ford SYNC 3 with AppLink, 6" touchscreen radio (FM/AM), 2 USB ports, audio remote control on the steering wheel, Bluetooth hands-free system and audio streaming, emergency call assistant, SMS text-to-speech function, SMS sending function, voice control, reversing camera, phase diversity antenna, DAB/DAB+, acoustic and visual route guidance, road map for Europe, TMCpro live traffic, detailed 3D visualization, Michelin travel guide for Europe)
- Fuel-operated auxiliary heater, programmable via on-board computer
- Heat-insulating glazing, tinted (from the B-pillar) (side windows from the 2nd row of seats)
- Xenon: Bi-xenon headlights with LED daytime running lights (with automatic headlight range control)
- Electrically adjustable and heated exterior mirrors with blind spot assist (blind spot assist including cross traffic alert)
- Adaptive cruise control (with intelligent speed limiter - including radar- and camera-based pre-collision assist with pedestrian and cyclist detection, lane keeping assist including lane keeping assist and driver drowsiness detection - including traffic sign recognition system - leather multifunction steering wheel with 4 spokes in aluminum trim)
- Crosswind Assist and Roll Stability Control (RSC)
- Safety partition net for separating passenger and luggage compartments (including attachment points (retrofitting not possible later))
- Seats: Seat Package 6 (Fabric "Capitol/City" in Ebony (black) - Driver's seat, 3-way manually adjustable (forward/backward, height, backrest) - Front passenger single seat, 2-way adjustable (forward/backward/backrest) and foldable - Headrests, height adjustable - Seat heating driver, front passenger - Lumbar support, manual (driver) - Map pocket for driver's seat - Airbag package for driver and front passenger)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	A proper visual inspection of the paintwork and bodywork was only possible to a limited extent due to insufficient lighting conditions/dampness or dirt. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run could not be performed. This is due to the following reason.: Motorschaden

Value reducing factors

No.	Component group	Description
1	Sliding door - left side	Sliding door with glass panel - dent(s) - Smooth repair work
2	Body	Body - Glued / labelled - De-glue / neutralise
3	Front bumper	Front bumper (Steinschlag) - Deformed - Repair and paint
4	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
5	Vehicle glazing	Windscreen (Rissbildung) - Stone chips - Replace
6	Engine	Engine - Non-operational - repair according to calculation



Wear and tear

No.	Component group	Description
-----	-----------------	-------------

1	Door - front right side	Door - dent(s) - No deduction
---	-------------------------	-------------------------------

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Tirefit complete

Equipment - Vehicle key with remote control

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Comments

Wartungshistorie gemäß Auftraggeber Informationen.

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.
- Fahrzeugzugang eingeschränkt. Keine Begutachtung von Unterboden/Fahrwerk/Achsen/Aggregate möglich.
- Fahrzeug zum Besichtigungszeitpunkt verschmutzt. Mehrkosten können entstehen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)

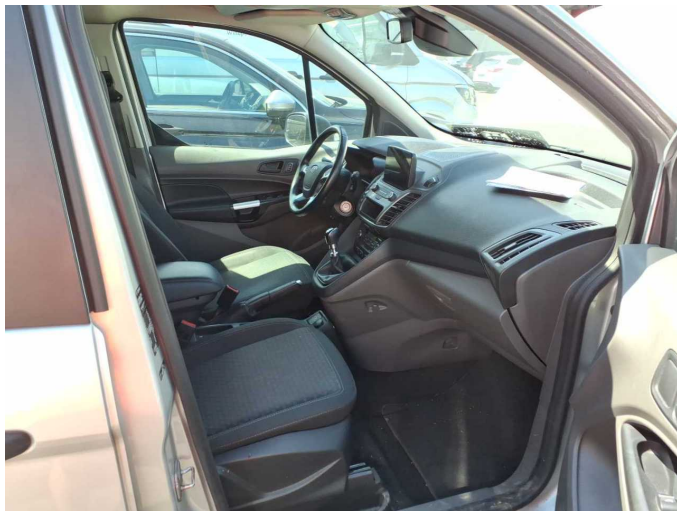


Figure 3: Interior - front

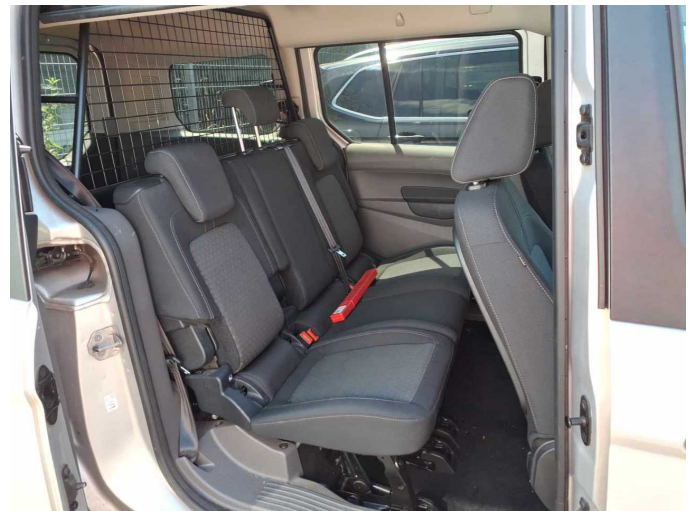


Figure 4: Interior - rear



Figure 5: Instrument cluster



Figure 6: Instrument panel



Figure 7: Interior 360° view



Figure 8: Cargo area

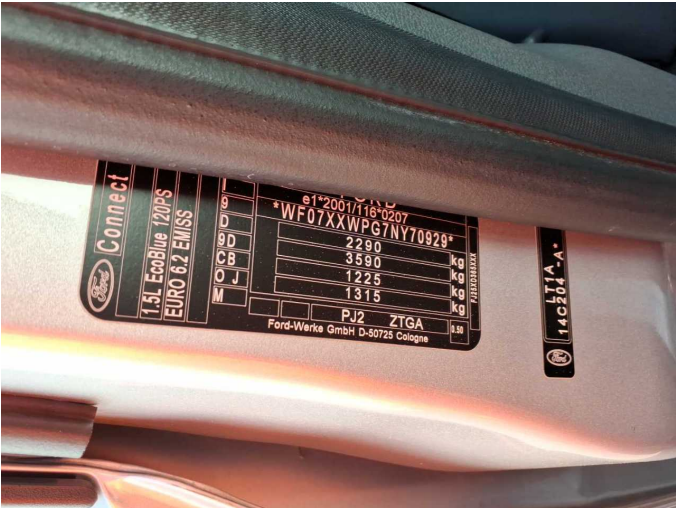


Figure 9: VIN

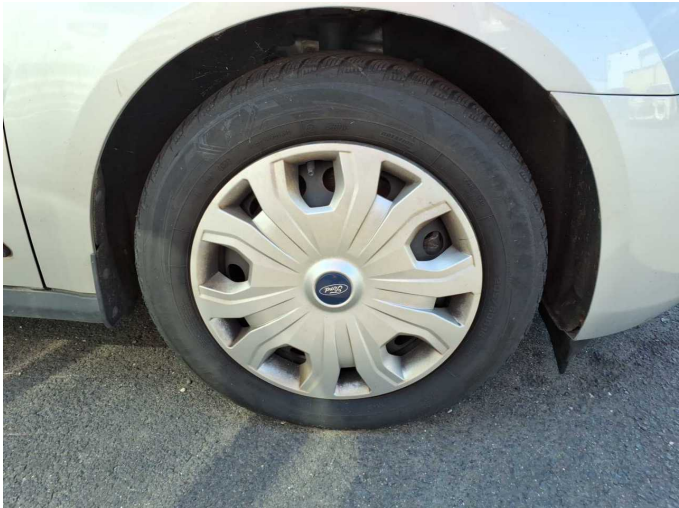


Figure 10: Mounted tyres



Figure 11: Documents

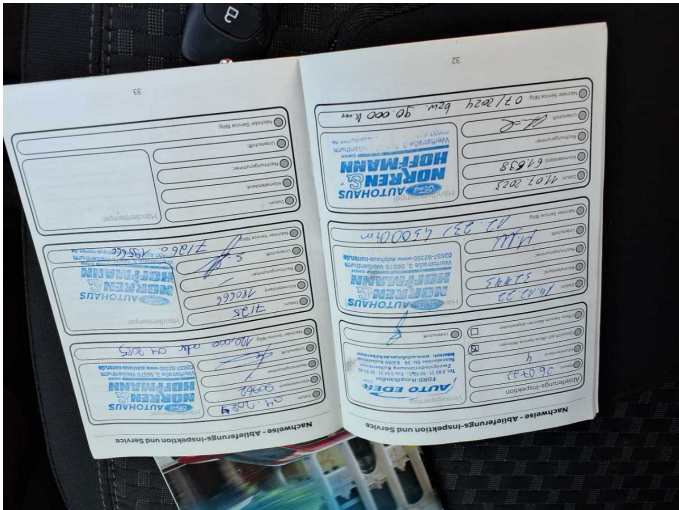


Figure 12: Documents

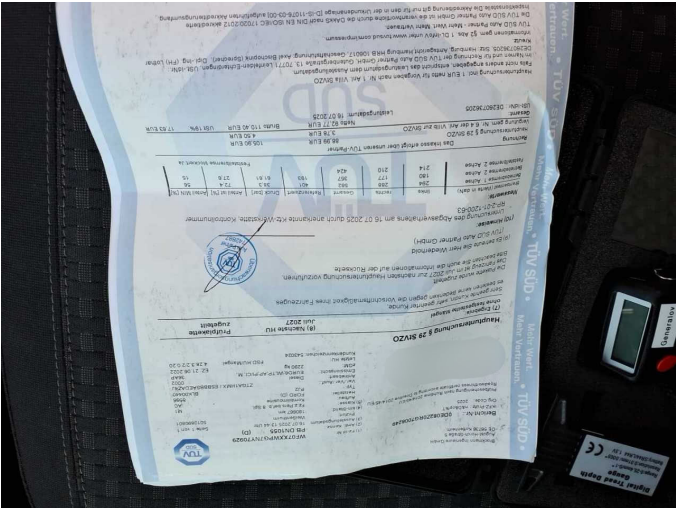


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.

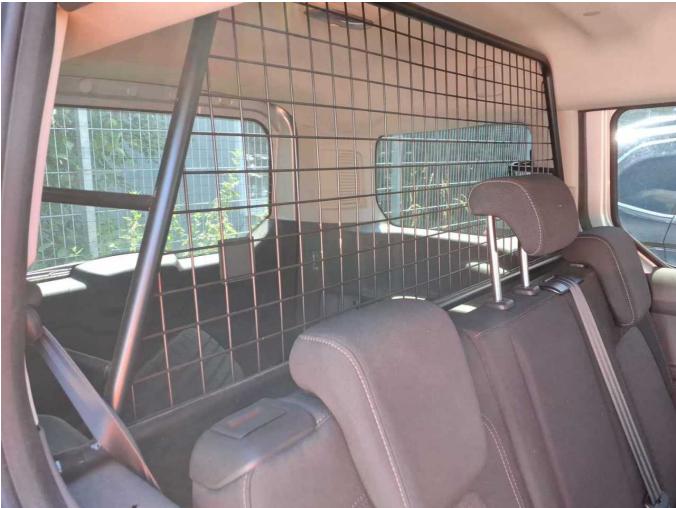


Figure 19: Misc.



Figure 20: Misc.

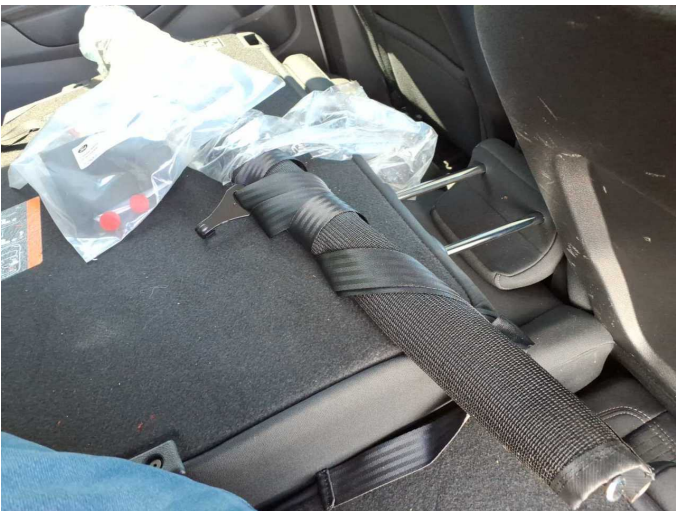


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.




Figure 24: Misc.




Figure 25: Misc.



Figure 26: Misc.

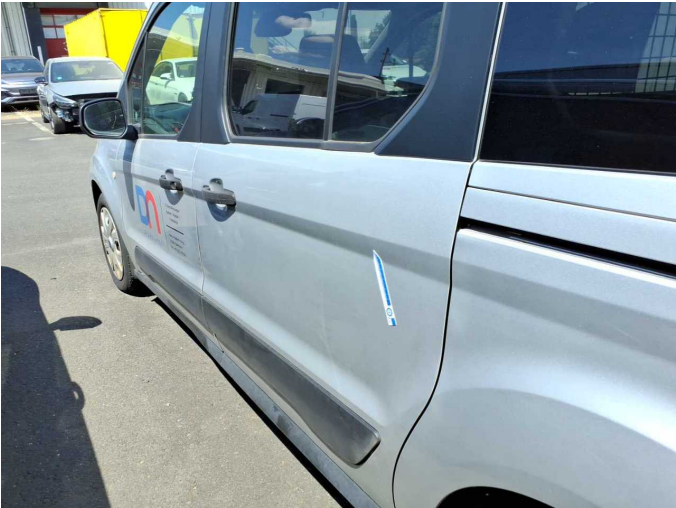


Damage 1: Sliding door - left side: Sliding door with glass panel - dent(s)
- Smooth repair work

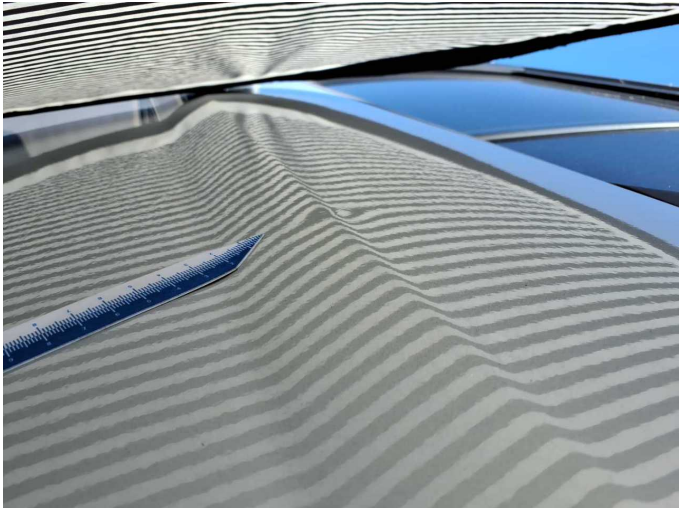

Damage 1: Sliding door - left side: Sliding door with glass panel - dent(s)
- Smooth repair work



Damage 2: Body: Body - Glued / labelled - De-glue / neutralise

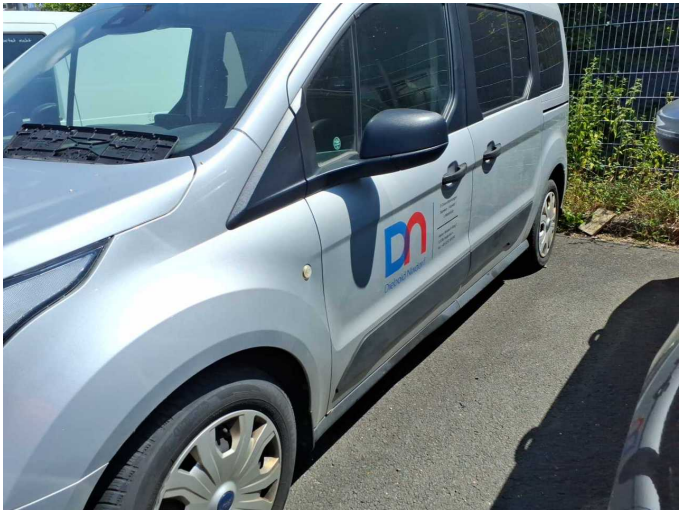


Damage 2: Body: Body - Glued / labelled - De-glue / neutralise




Damage 2: Body: Body - Glued / labelled - De-glue / neutralise



Damage 3: Front bumper: Front bumper (Steinschlag) - Deformed - Repair and paint

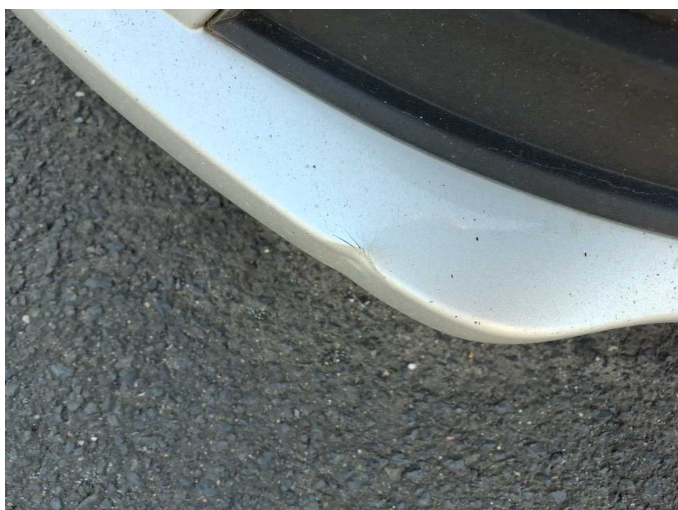

Damage 3: Front bumper: Front bumper (Steinschlag) - Deformed - Repair and paint

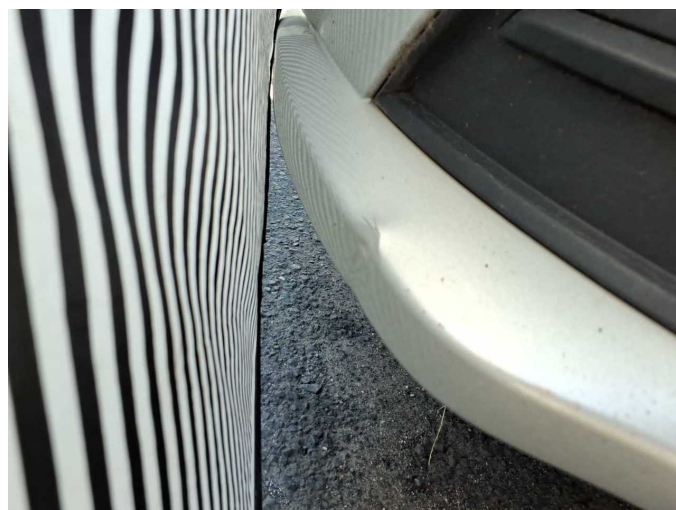

Damage 3: Front bumper: Front bumper (Steinschlag) - Deformed - Repair and paint



Damage 3: Front bumper: Front bumper (Steinschlag) - Deformed - Repair and paint



Damage 3: Front bumper: Front bumper (Steinschlag) - Deformed - Repair and paint



Damage 3: Front bumper: Front bumper (Steinschlag) - Deformed - Repair and paint



Damage 4: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 4: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 4: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 5: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Damage 5: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace




Damage 5: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Damage 6: Engine: Engine - Non-operational - repair according to calculation



Damage 6: Engine: Engine - Non-operational - repair according to calculation

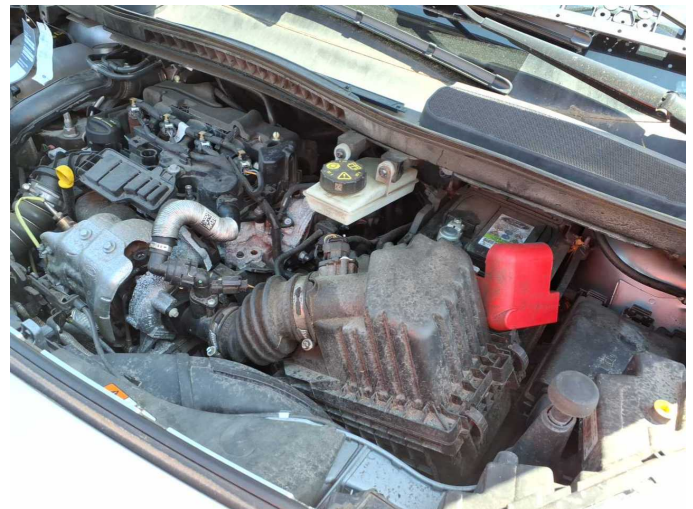

Damage 6: Engine: Engine - Non-operational - repair according to calculation



Damage 6: Engine: Engine - Non-operational - repair according to calculation



Missing part 1: Equipment: Tirefit complete - Missing - Replace



Missing part 2: Equipment: Vehicle key with remote control - Missing -
Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF07XXWPG7NY70929

Hersteller / Modell: FORD FORD Transit Connect 230 L2 S&S Trend

Datum	KM-Stand	Beschreibung
04.12.2025	211.100	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
16.07.2025	180.666	AU; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
08.04.2025	151.901	Bremsklötze hinten; Motoröl b. Wartung; Regelwartungsdienst
07.09.2024	120.663	Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
10.04.2024	90.962	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.08.2023	61.696	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
14.12.2022	31.993	Motoröl b. Wartung; Regelwartungsdienst