



Expertise

Protocol number: 46444785  
Order No. / Reference: 26587566  
Inspection date: 10 Jul 2026

|                        |                                 |
|------------------------|---------------------------------|
| Manufacturer: Volvo    | Model: XC60 B5 B AWD Ultra Dark |
| VIN: YV1UZM1V2T1424376 |                                 |



| Vehicle details                         |                       |
|-----------------------------------------|-----------------------|
| Manufacturer / Type / Model / Equipment |                       |
| Volvo XC60 B5 B AWD Ultra Dark          |                       |
| Vehicle Identification number           | YV1UZM1V2T1424376     |
| Mileage (Read)                          | 13,800 km             |
| First registration                      | 8 Dec 2025            |
| Number of holders                       | 1                     |
| Next periodical technical inspection    | 12/2028               |
| (Report not on hand)                    |                       |
| Power / Engine displacement             | 184 kw / 1,969 ccm    |
| Fuel type / Cylinder                    | Hybrid Petrol / E / 4 |
| Gearbox / Number of gears               | Automatic / 8         |
| Type of drive                           | All-wheel drive       |
| Type of vehicle                         | SUV                   |
| Colour / colour code                    | Onyx Black Metallic   |
| Doors / Seats                           | 5 / 5                 |
| Upholstery type                         | Artificial leather    |
| Colour of upholstery                    | Black                 |
| Vehicle with smoke odor                 | no                    |



## Vehicle details

|                                                      |                               |                                |                                                            |
|------------------------------------------------------|-------------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>                   | Non-existent                  | <b>Next maintenance in</b>     | 16,205 km                                                  |
| <b>Key is / should be</b>                            | 2 / 2                         | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                      |                               | <b>Letter No.</b>              | HQ509740                                                   |
| <b>Previous damage / Accident</b>                    | None detectable               | <b>Repainting</b>              | None detectable                                            |
| <b>Inspection conditions</b>                         | sufficient                    | <b>Lifting equipment / pit</b> | yes                                                        |
| <b>Test drive</b>                                    | Not performed                 | <b>Engine function test</b>    | Performed                                                  |
| <b>Manufacturer key number/<br/>type code number</b> | 9101 / BRB 00057              |                                |                                                            |
| <b>Emission standard</b>                             | EURO6;WLTP;EB;PI/CI;M, N1, N2 | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                        | 2,450 kg                      | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 255/40 R21 102V | Summer tyres on Light alloy | Pirelli      | 6mm / 6mm   |
| 2) | 255/40 R21 102V | Summer tyres on Light alloy | Pirelli      | 6mm / 6mm   |

### Additional tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 235/55 R19 101H | Winter tyres on Light alloy | Pirelli      | 7mm / 7mm   |
| 2) | 235/55 R19 101H | Winter tyres on Light alloy | Pirelli      | 7mm / 7mm   |

### Replacement

| Typ | Tyre size | Type of tyre            | Manufacturer | Tread depth |
|-----|-----------|-------------------------|--------------|-------------|
|     | Tirefit   | Expiration date 12/2029 |              |             |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



## Equipment



## Standard equipment

- ABS - Anti-lock Braking System
- Active safety belts with belt tensioners
- Advanced air purification system with fine dust filtration according to air quality standard PM2.5
- Airbag, driver's knee airbag
- All-wheel drive (AWD) (via electronically controlled multi-plate clutch (5th generation) with Instant Traction)
- Android infotainment system (11.2" touchscreen (28.4 cm diagonal) - Bluetooth hands-free system incl. audio streaming - Digital vehicle owner's manual - Digital radio reception (DAB+) - 2 USB-C ports)
- Comfort opening/closing of the side windows and, if applicable, the sunroof via radio remote control
- Dashboard in leather look with contrasting stitching
- Digital Services (Google Services (includes Google Maps, Google Assistant, Google Play Store and unlimited data) - Volvo On Call (includes, among other things, alerting the Volvo On Call service center at the touch of a button as well as additional convenience services via the Volvo CarsApp, such as locking and unlocking the vehicle, displaying the vehicle position and digital manual))
- Electrically folding exterior mirrors
- Electronic Stability Control (ESC)
- Fog sensor for automatic activation of the defroster function
- Front center armrest with integrated storage compartment and cup holders
- Front seat belt height adjustment
- Heated exterior mirrors and rear window (automatic)
- Heated rear window
- Hill Descent Control (HDC)
- Illuminated makeup mirror for driver and front passenger
- Intelligent driver information system (delays incoming calls or vehicle information in dangerous situations)
- Intelligent Speed Assist (Intelligent speed assistant - warning when exceeding the maximum permitted speed)
- Interior and exterior mirrors automatically dimming
- Keyless Drive (electronic access system) (with sensor-controlled tailgate, illuminated door handles and floor lights)
- Lashing eyes in the luggage compartment (foldable)
- Luggage compartment partition net
- On-board computer (with vehicle control functions)
- Otto particulate filter
- Package: Driver Assistance Package (Pilot Assist: - Lane Keeping Assist with Adaptive Cruise Control up to speeds of 130 km/h - Emergency Stop Assist - Automatic emergency braking system if warnings are ignored; Driver Awareness: - Blind Spot Information System - Blind Spot Assist including Lane Change Warning for rapidly approaching vehicles with steering intervention - Cross Traffic Alert - Cross-traffic alert with braking intervention - Rear Impact Mitigation - Preventive protection in case of an impending rear-end collision)
- Air quality system with activated carbon filter (automatic recirculation and pre-ventilation of the interior when the vehicle is unlocked)
- Airbag, side airbags for driver and front passenger and head/shoulder airbags for all occupants
- Aluminum door sill plates with Volvo lettering at the front
- Ambient lighting (Extended interior lighting with: - Ambient lighting front and rear - Exit lights front and rear - Work light on the tailgate - Illuminated door pockets and door openers front and rear - Rear footwell lighting - Rear reading lights)
- Automatic climate control with 4-zone temperature control
- Automatic emergency braking (emergency braking mechanism after the deployment of the airbags or seatbelt pretensioners to prevent secondary accidents)
- Automatic tailgate (electric)
- Cargo area roller blind
- Central locking with two remote controls and integrated emergency keys (automatic locking of doors while driving (can be deactivated) - comfort opening/closing of side windows and, if applicable, sunroof via remote control - panic function integrated into the remote control)
- Child safety lock for the rear doors (electric)
- Digital instrumentation 2nd generation (Full graphic 12.3" driver display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Driver and passenger side airbags with two-stage deployment system
- Electric parking brake
- Electric windows front and rear (with auto-down and auto-up function)
- Electrically adjustable exterior mirrors
- Electronic differential lock
- Emergency brake lights (brake lights flash rapidly during heavy deceleration; hazard warning lights are automatically activated below 10 km/h)
- First aid kit and warning triangle
- Front and rear parking sensors with automatic braking intervention (rear)
- Glazing: Colored glazing
- Headrests (5) front and rear
- Headrests of the 2nd row of seats can be folded down (electrically)
- Hill Start Assist (HSA)
- Immobiliser
- Interior lighting (headliner, front reading lights, front ambient lighting, front footwell, storage compartment behind center console, glove compartment and luggage compartment)
- ISOFIX mounting for the outer rear seats
- Keyless Start (electronic engine start system)
- LED turn signals integrated into the exterior mirrors
- Outdoor temperature display



- Package: Seat Comfort Package (Electrically adjustable front passenger seat - Electrically adjustable driver's seat with memory function for driver's seat and exterior mirror settings (stored in remote control) - Lumbar support (4-way electrically adjustable) for driver and front passenger seats - Memory function for front passenger seat - Adjustable leg support for driver and front passenger seats)
- Passenger side airbag can be deactivated
- Phone: Inductive smartphone charging system (Qi standard) (Wirelessly charges smartphones on a charging pad (compatibility required))
- Radio accessories: Two USB-C ports on the back of the center console
- Radio: Premium Sound audio system by Harman/Kardon (600 watts of power - 14 speakers - Fresh Air - Subwoofer - Dirac Unison - Sound optimization)
- Rear seats in a 40/60 split or completely foldable with pass-through function
- Roof edge spoiler
- Run-off Road Protection (preventive protection system in case of unintentional leaving the road or impending rollovers including emergency call via Volvo On Call and door unlocking)
- Safety braking system with disc brakes all around (internally ventilated) (automatic brake system pre-tensioning, brake assist and automatic hold function)
- Safety steering column (adaptive)
- Seats: Driver and front passenger seats height adjustable (electrically) (including manual tilt adjustment)
- Speed-sensitive power steering
- Sport exterior mirrors in high-gloss black
- Sport front grille with horizontal struts and grille surround in high-gloss black
- Stainless steel loading sill protector in the luggage compartment
- Steering wheel adjustable for height and reach
- Steering wheel: Sports steering wheel, leather-free
- Transmission: 8-speed automatic transmission
- Warning tone/indicator when seat belts are not fastened (for all seats)
- Whiplash protection system WHIPS (including immersion protection on all seats and energy-absorbing front seat cushions)
- Window surround in high-gloss black

### Extra equipment

- Towbar (semi-electric)
- Package: Premium (Massage function for driver and front passenger seats - Premium Sound audio system by Bowers & Wilkins - Adaptive air suspension with Four-C technology - 21" 5-V-spoke design diamond cut/graphite look with 255/40 R21 tires - Upholstery: Nappa leather/leatherette comfort seats)
- Wheels: 21" alloy wheels, 5-V-spoke design, diamond cut/high-gloss black (tires 255/40 R21 with rims 8.5 x 21")
- Glazing: Side and rear windows tinted (from the B-pillar back)

- Package: Lagom Package (panoramic glass sunroof with lifting function and integrated, continuously adjustable sunshade (electric) - Head-up display - Parking camera with 360° surround view incl. front, side and rear parking aid with automatic braking intervention (rear))
- Package: Lighting Package (LED fog lights (integrated into the front spoiler) - headlight cleaning system - full LED headlights "Thor's Hammer" Active High Beam with extended high beam, dynamic cornering lights, intelligent high beam assist with adaptive headlight range control and integrated LED daytime running lights)
- Package: Winter Package (front seat heating - rear seat heating - steering wheel heating)
- Power outlet (12-volt connection in the luggage compartment)
- Preparation for Trailer Stability Assist (TSA)
- Radio accessories: Smartphone integration Apple CarPlay
- Rain sensor
- Rear view camera
- rear window wiper
- Roof rails in high-gloss black (integrated)
- Safety Assistance (Automatic Emergency Braking System with detection of vehicles, cyclists, pedestrians and large animals including intersection and emergency braking assistance for oncoming traffic - Connected Safety - Driver Monitoring System - Distraction Warning (ADDW) - Driver Alert - Attention Warning - Distance Warning - Lane Keeping Aid (LKA) - Active Lane Keeping Assist - Oncoming Lane Mitigation - Ready to Drive notification - Road Edge Detection - Road Sign Information (RSI) - Traffic sign recognition - Run-off Road Protection (including emergency call via Volvo On Call and door unlocking))
- Seats: Premium textile comfort seats
- Sport front and rear apron
- Start/Stop technology
- Steering wheel: Multifunction buttons on the steering wheel
- third brake light
- Tire pressure monitoring system (with tire-specific pressure loss warning)
- Upholstery: Nordico vinyl/imitation leather - anthracite (incl. rear center armrest - upholstery: anthracite - interior design: anthracite - carpet: anthracite - headliner: light beige - real wood trim: natural driftwood)
- Wheels: Tire sealant (Incl. 12-volt compressor, maximum speed 80 km/h)

- Paint finish: Metallic paint
- Upholstery: Nappa leather/imitation leather comfort seats (perforated front seats) Anthracite (with active ventilation and electrically adjustable side bolsters for driver and front passenger seats - incl. rear center armrest - gearshift lever made of Swedish crystal glass by Orrefors - inlay: Drift Wood - headliner: Light Beige)
- Glazing: Acoustic glazing for the side windows (UV and burglar-resistant laminated glass panes)



## Brief expert findings

|                      |                                                                                                                                                                              |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.    |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                     |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                        |
| Engine function test | An engine test run was performed.                                                                                                                                            |

## Value reducing factors

| No. | Component group              | Description                                                         |
|-----|------------------------------|---------------------------------------------------------------------|
| 1   | Trim / covers                | Door trim - rear left side - Deformed - Loss in value               |
| 2   | Mudguard - left side         | Mudguard - left side (Polieren) - Scratch(es) - Smart repair        |
| 3   | Sill - left side             | Sill - Scratch(es) - Smart repair                                   |
| 4   | Seat - rear                  | Back seat - Deformed - Loss in value                                |
| 5   | Side panel - rear right side | Sill - Scratch(es) - Smart repair                                   |
| 6   | Vehicle glazing              | Windscreen (vorbehaltlich Folgekosten) - Stone chips - Smart repair |
| 7   | Bonnet                       | Insulation lining - Missing - Replace                               |

## Wear and tear

| No. | Component group         | Description                            |
|-----|-------------------------|----------------------------------------|
| 1   | Body                    | Body - Scratch(es) - No deduction      |
| 2   | Door - front right side | Door edge - Scratch(es) - No deduction |

The vehicle shows signs of wear and tear commensurate with its age and use.

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

## Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



**Figure 1:** Diagonal front (left)



**Figure 2:** Diagonal front (right)



**Figure 3:** Diagonal rear (left)



**Figure 4:** Diagonal rear (right)



**Figure 5:** Interior - front



**Figure 6:** Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN

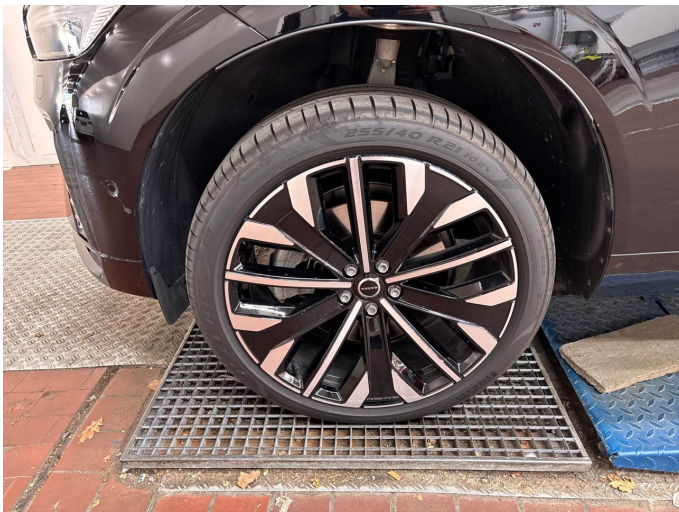


Figure 12: Mounted tyres

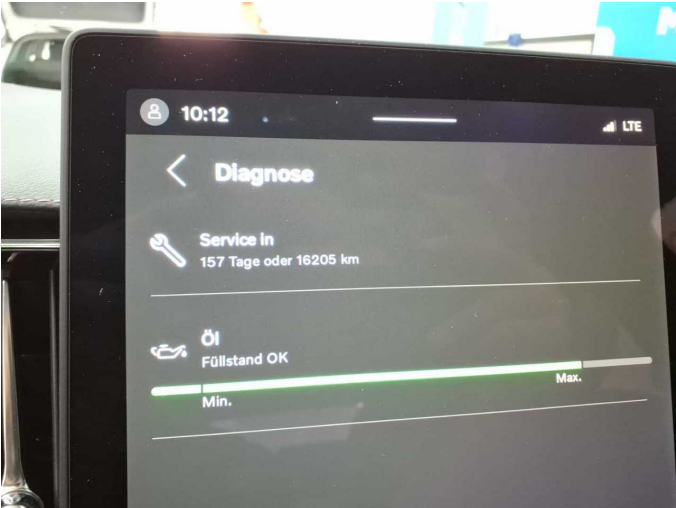


Figure 13: Documents

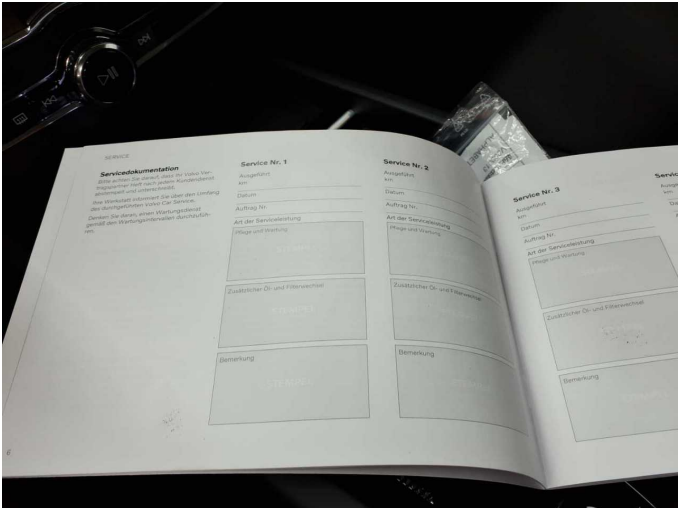


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

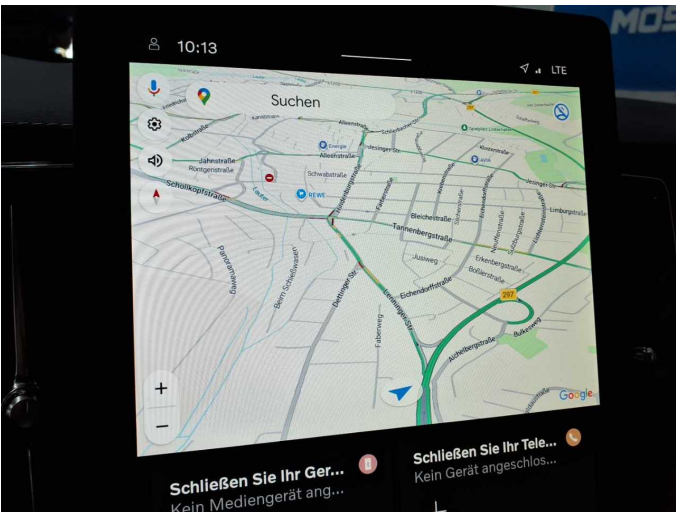


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

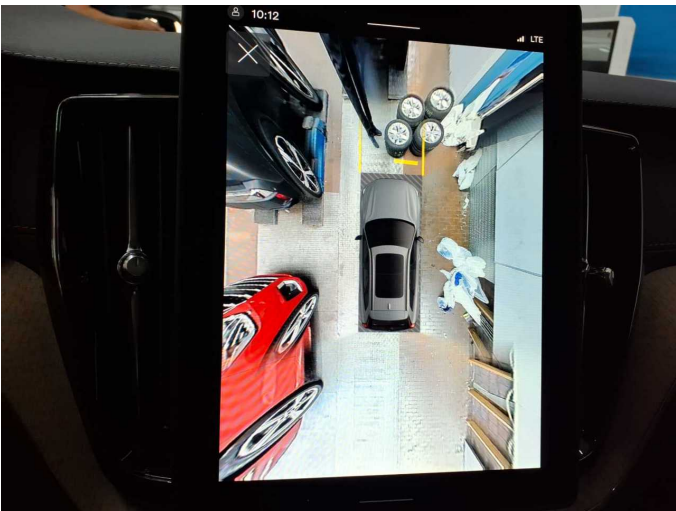


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

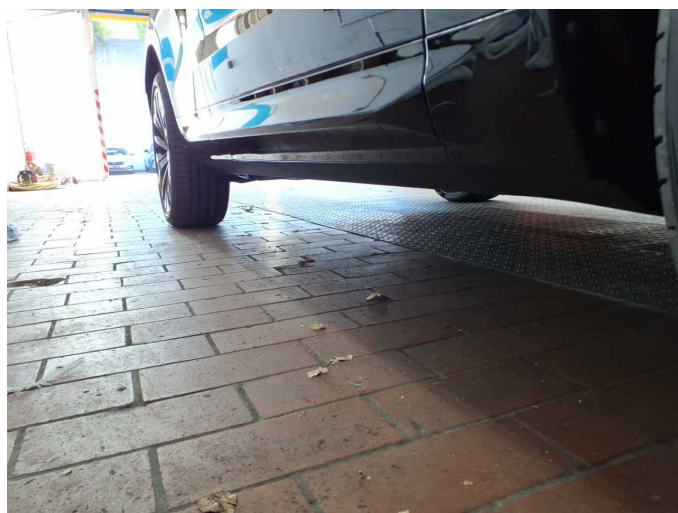


Figure 28: Misc.

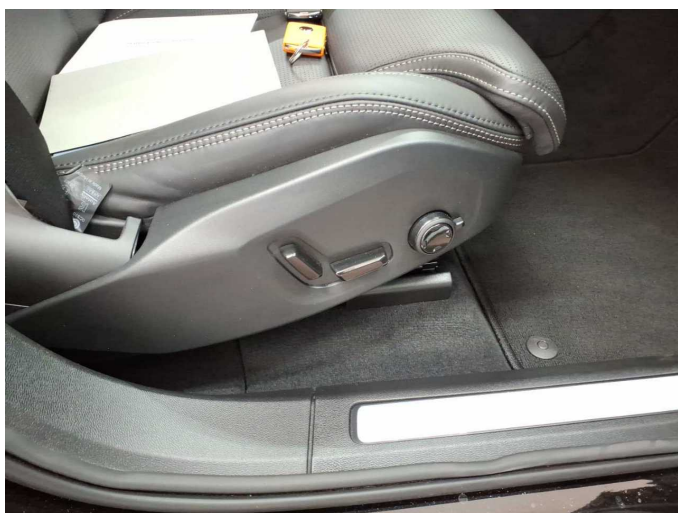


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.




Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.

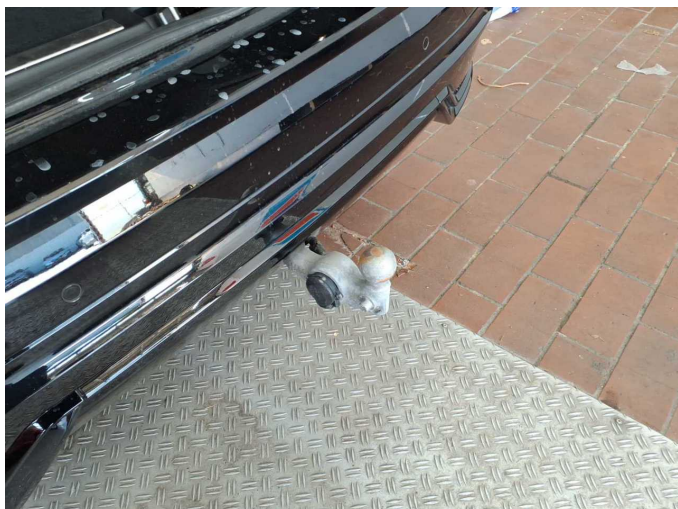

**Figure 37:** Misc.



**Figure 38:** Misc.



**Damage 1:** Trim / covers: Door trim - rear left side - Deformed - Loss in value



**Damage 1:** Trim / covers: Door trim - rear left side - Deformed - Loss in value



**Damage 2:** Mudguard - left side: Mudguard - left side (Polieren) - Scratch(es) - Smart repair



**Damage 2:** Mudguard - left side: Mudguard - left side (Polieren) - Scratch(es) - Smart repair




**Damage 3:** Sill - left side: Sill - Scratch(es) - Smart repair




**Damage 3:** Sill - left side: Sill - Scratch(es) - Smart repair




**Damage 4:** Seat - rear: Back seat - Deformed - Loss in value

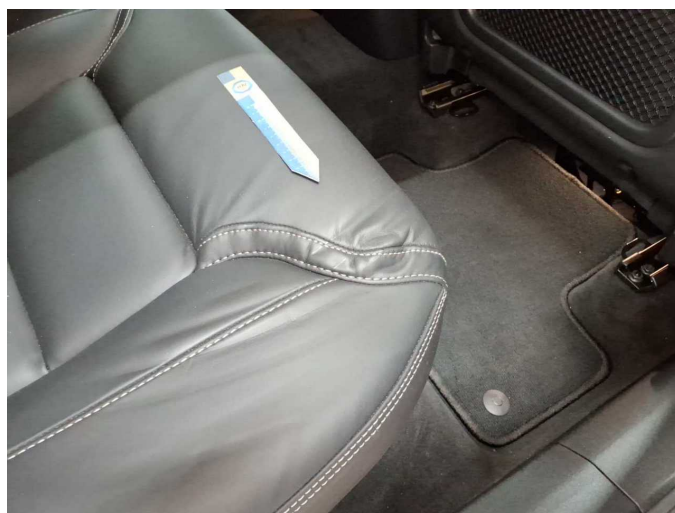

**Damage 4:** Seat - rear: Back seat - Deformed - Loss in value

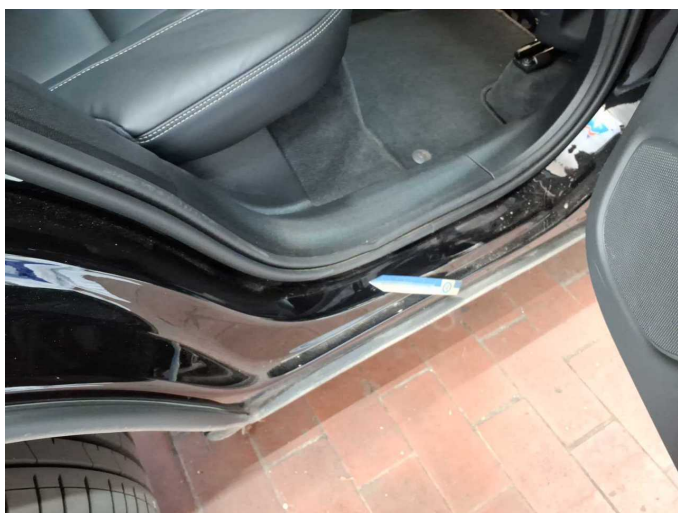

**Damage 5:** Side panel - rear right side: Sill - Scratch(es) - Smart repair

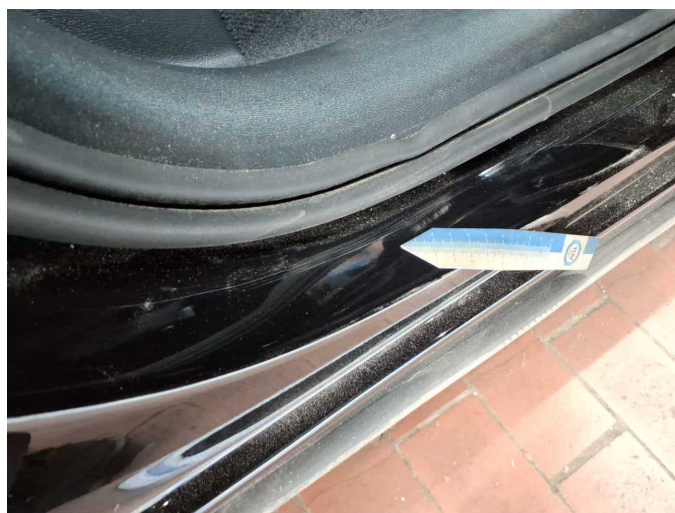

**Damage 5:** Side panel - rear right side: Sill - Scratch(es) - Smart repair



**Damage 6:** Vehicle glazing: Windscreen (vorbehaltlich Folgekosten) - Stone chips - Smart repair



**Damage 6:** Vehicle glazing: Windscreen (vorbehaltlich Folgekosten) - Stone chips - Smart repair



**Damage 7:** Bonnet: Insulation lining - Missing - Replace