



RENAULT MASTER: EJ-186-SM

Vinnumber:	VF1MA000056734106	Versionname:	RENAULT MASTER FG GCf Trac F3500 L2H2 dCi 110 Euro6 VU [4P] bvm 6-110CH-8cv (fourgon tA '1A@simple cabine)
First Registrationdate:	31/01/2017	Fiscalpower:	
Expertise Mileage:	190465	Power Kw:	81
Bodytype:	Transporter	Body colour:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Front	Interior colour:	Black
Fueltype:	Diesel	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Type of rims (mounted):	Steel		
Category:	Light Commercial Vehicle		

Options

Number of keys total	2	Tow bar	
Number keys remote	2	Radio	
Windows electric F		Central consol F	
Cruise Control		Sliding door right-side	
Steering wheel multifunctional		Seat cover lining	
Type of climate control	Manual climate control	Lining Other	Lining Semi-leather

Tyres

	225/65/16/112 R			
Summer tyres:	Fr.L.	Falken: 50%	Fr.R.	Falken: 55%
	Re.L.	Hankook: 20%	Re.R.	Hankook: 20%
Tyre profile depth FL				4.8
Tyre profile depth FR				4.7
Tyre profile depth RL				7.0
Tyre profile depth RR				7.0
Tyre size FL				225/65 R 16 112 R
Tyre size FR				225/65 R 16 112 R
Tyre size RL				225/65 R 16 112 R
Tyre size RR				225/65 R 16 112 R
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				1957074
Tyre make FR				1957074
Tyre make RL				260
Tyre make RR				260

Assistance equipment

Spare wheel	Yes	Jack	Yes
Air vent, mid-dashboard, Broken, Replace			



Steering wheel, Worn, Repair/replace (lump sum)



Interior trim, Broken, Replace



Interior, Stain, Cleaning



Armrest F M, Worn, Acceptable



Seat cover FL, Tear, Replace



Wheel cover RR, Missing, Replace



Outside rear-view mirror housing L, Broken, Replace



Outer sill L, Rust, Paint



Side panel L, Dent(s) and scratch(es), Repair and paint (complete)



Side wall RL, Dent(s) and scratch(es), Repair and paint (complete)



Car body corner RL, Dent(s) and scratch(es), Repair and paint (complete)



Bumper F, Deformed / Strained, Replace



Headlight L, Broken, Replace



Step R, Broken, Replace



Side panel moulding R, Broken, Replace



Side wall RR, Scratch(es), Paint



Side panel moulding R, Missing, Replace



Outer sill R, Bad repair, Repair and paint (complete)





Outside rear-view mirror housing R, Scratch(es), Replace



Sliding door R, Adjust, Adjust



Rear light L, Broken, Replace



Shutter / cover R, Broken, Replace




Rear light R tailgate, Broken, Replace



Boot door panel RL, Rust, Paint



Boot door panel RR, Rust, Paint

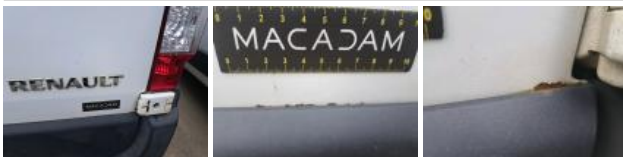

Bumper corner RR, Unclasp(ed), Dismount/Mount



Bumper R, Deformed / Strained, Repair and paint (complete)



Rear bulkhead lining, Broken, Replace



Door seal R, Tear, Replace



Door seal R, Unclapsed, Dismount/Mount



Historique Maintenance

Immatriculation: **EJ-186-SM**

Date de 1ère immatriculation: **31/01/2017**

Modèle: **Renault MASTER FG GCf Trac F3500 L2H2 dCi 110 Euro6 VU [4P] bvm 6-110CH-8cv (fourgon tôle simple cabine)**

Date	Kilométrage	Fournisseur	Descriptif
24/04/2025	177.337	DEKRA AUTOMOTIVE S.A	CONTROLE TECHNIQUE
31/10/2024	161.950	SAS TADEN AUTO DISTRIBUTION	PLAQUETTES AR RPLT
28/10/2024	161.949	SAS TADEN AUTO DISTRIBUTION	ETRIERS AV RPLT
	0		LAMPE RPLT
	0		LAMPE CODE AVD RPLT
	0		DISQUES PLAQUETTES AV RPLT
	0		PURGE CIRCUIT FREIN CTRL
30/05/2024	148.261	SAS TADEN AUTO DISTRIBUTION	DISQUES PLAQUETTES AR RPLT
18/07/2022	99.253	SAS TADEN AUTO DISTRIBUTION	DISQUES PLAQUETTES AR RPLT
	0		PLAQUETTES AV RPLT
15/06/2022	97.257	SAS TADEN AUTO DISTRIBUTION	LIQUIDE DE FREIN
	0		REVISION ET CLIM
	0		BALAIS ESSUIE GLACE AV
30/07/2020	63.450	SAS TADEN AUTO DISTRIBUTION	REVISION
	0		DISQUES PLAQUETTES AR RPLT
	0		DISQUES PLAQUETTES AV RPLT
27/05/2020	60.182	SAS TADEN AUTO DISTRIBUTION	APPOINT D HUILE
05/02/2020	55.276	SAS TADEN AUTO DISTRIBUTION	AMORTISSEURS AR RPLT
	0		DIVERS ELEC
18/10/2019	49.519	SAS TADEN AUTO DISTRIBUTION	APPOINT D HUILE
13/03/2019	36.953	SAS TADEN AUTO DISTRIBUTION	BALAIS ESSUIE GLACE AV
	0		PLAQUETTES AR RPLT
	0		PLAQUETTES AV RPLT
13/09/2018	26.534	SAS TADEN AUTO DISTRIBUTION	REVISION ET CLIM