



Expertise

Protocol number: 46539516
Order No. / Reference: 26653034
Inspection date: 15 Jul 2026

Manufacturer: Volkswagen

Model: Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE

VIN: WVGZZZ3CZME120537



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE	
Vehicle Identification number	WVGZZZ3CZME120537
Mileage (Read)	187,039 km
First registration	27 May 2021
Number of holders	1
Power / Engine displacement	115 kw / 1,395 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Deep Black Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Blue
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	4,100 km
Last service on / at	04/2026 at 176,096 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC297131
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BRZ 00077		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,270 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tires (with run-flat tires) on Light alloy	Pirelli	6mm / 6mm
2)	215/55 R17 94V	Summer tires (with run-flat tires) on Light alloy	Pirelli	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94H	Winter tires (with run-flat tires) on Light alloy	Continental	4mm / 4mm
2)	215/55 R17 94H	Winter tires (with run-flat tires) on Light alloy	Pirelli	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger (airbag deactivation switch on the passenger side)
- Anti-lock braking system (ABS)
- Adaptive Cruise Control (ACC) "stop & go", including speed limiter
- Electrically adjustable and heated exterior mirrors (driver's side aspherical)
- third brake light
- black roof rails
- Electronic parking brake including auto-hold function
- Electronic stability program and electromechanical brake booster
- Pedestrian detection
- Adjustable luggage compartment floor
- Interior lights front and rear with delayed shut-off and dimming function (2 reading lights at the front)
- Air conditioning system "Air Care Climatronic" with 3-zone temperature control and allergen filter
- Rear headrests (3)
- Front headrests (safety-optimized)
- LED taillights
- Steering wheel: Multifunction sports steering wheel in leather, with paddle shifters (gearshift knob in leather)
- Multifunction display "Premium" with multi-color display (showing, among other things: - Outside temperature - Average consumption - Average speed - Trip distance - Trip time - Gear recommendation - Speed warning - Comfort - Current consumption - Range - Service - Time with extended display options, e.g.: - Digital speedometer - Digital oil temperature display - Lights & visibility - Language - Auxiliary heater - Winter tires)
- Mesh partition
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Emergency call service (no registration required, service is activated upon delivery)
- Upholstery: Fabric "Weave" (center panels of the front seats and outer rear seats in fabric "Weave")
- Proactive occupant protection system in conjunction with "Front Assist" (detects critical traffic situations with increased accident potential - prepares vehicle occupants and the vehicle for a possible accident by tightening the front, fastened seat belts and securing the driver and front passenger, and closing open windows and the sunroof except for a gap)
- Radio accessories: Digital radio reception DAB+ (reception of digitally broadcast radio stations and traffic information in addition to the analog station offering - reception depends on the local availability of digital networks - expanded range of radio programs - improved reception performance)
- Keyless start system without safe locking
- Power steering (electromechanical, speed-dependent)
- Airbag, head airbag system for front and rear passengers (including front side airbags)
- App-Connect Wireless (Volkswagen offers three interfaces for connecting smartphones with numerous possibilities: - Apple CarPlay - Android Auto from Google - MirrorLink)
- Cup holders (2) front
- Hill start assist
- Headliner in Mistral Grey
- Parking aid - warning signals for obstacles in the front and rear area
- Remote release for luggage compartment lid
- Windscreen made of laminated safety glass, heat and sound insulating
- Transmission: 6-speed DSG (6-speed dual-clutch transmission DSG)
- ISOFIX mounting points (for attaching 2 child seats to the rear seats, also for i-Size child seats)
- Instrument cluster with electronic speedometer, odometer and trip odometer, tachometer
- Paint finish: Solid
- LED headlights with daytime running lights
- Headlight range control
- Makeup mirrors in the sun visors
- Fatigue detection (detects signs of possible driver fatigue based on characteristic steering behavior, time of day and driving duration and issues a visual and audible warning)
- Navigation system "Discover Media" incl. "Streaming & Internet" (4x20 watts, user interface with proximity sensor, dual tuner with phase diversity, vehicle menu, speed, volume adjustment, map, 2D display, tone control, 3-way TFT display with touchscreen operation, navigation "Discover Media" incl. "Streaming & Internet", MP3 radio, telephone contact addresses for navigation, telephone interface, 2 USB ports also for iPod/iPhone, traffic sign recognition "VW Media Control", We Connect Plus, 3 years, incl. We Connect route guidance, dynamic RDS, TMC tuner)
- Package: Light and Sight Package "Plus" (LED lights in the front footwell - Electrically adjustable and heated exterior mirrors, automatically dimming on the driver's side - Entry/warning lights in the front doors, in LED technology - Automatic headlight control, with daytime running lights, "Leaving Home" function and manual "Coming Home" function - Interior light with delayed shut-off and dimming function, 2 LED reading lights each in the front and rear - Automatically dimming interior mirror - Illuminated vanity mirrors - Extendable sun visors - Rain sensor)
- Tire pressure monitoring system (passive)
- Wheels: 4 "Montpellier" alloy wheels 7 J x 17 (rolling resistance optimized - AirStop tires 215/55 R 17 - wheel locks with enhanced theft protection)
- LED taillights
- Rear bench seat undivided, backrest asymmetrically split and foldable, with center armrest (and pass-through option)
- Seats: Front seats are height-adjustable



- Seat belts: Three-point automatic seat belt (seat belt for middle rear seat - seat belts for outer rear seats - front seat belts with height adjustment and belt tensioner)
- Bumpers in body color
- Textile floor mats (front and rear)
- Warning tone and light for unfastened seat belts front and rear

- Start-stop system (with brake energy recuperation)
- 12V power outlet on the rear of the center console
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Black trim strips on the side windows

Extra equipment

- Towbar, foldable (with electric release)
- Paint finish: Pearl effect
- Package: "Business Premium" package incl. navigation (from Business trim level) (2 USB-C ports in the front, 1 USB-C charging port in the rear, 230V socket, App-Connect incl. wireless, Apple CarPlay, Android Auto, "Travel Assist" driver assistance system and "Lane Assist" lane keeping system, Air Care Climatronic with 3-zone temperature control, allergen filter and rear controls, lumbar support in the front, electric on the driver's side, massage function on the driver's side, "Rear View" reversing camera, heated windshield washer nozzles, Comfort telephone interface, inductive charging function, heated front seats)

- Cable for AC charging station (incl. standard mains charging cable for household socket)
- Wheels: Tire Mobility Set omitted
- Rear side windows and rear window tinted
- Seats: ergoComfort seat with 14-way electric adjustment, memory and massage on driver's side in conjunction with Business Package (electrically folding exterior mirrors, auto-dimming on driver's side, ambient lighting and memory - electrically adjustable lumbar support in front, massage function on driver's side - electrically adjustable front seats, ergoComfort seat on driver's side, with memory function and comfort entry)
- "Comfort" telephone interface with inductive charging function (hands-free system)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Vehicle key with remote control (Batterie) - Empty - Replace
2	Instrument panel	Indicator light (Reifendruckkontrollsystem) - on - Perform diagnosis
3	Interior	Interior - Scratch(es) - Loss in value
4	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
5	Body	Body - Glued / labelled - De-glue / neutralise
6	Mudguard - left side	Mudguard - left side - Dent / paintcoat damage - Repair and paint
7	Front bumper	Front bumper (Mit Blende L und Spoiler) - Scratch(es) - Paint
8	Vehicle glazing	Windscreen - Stone chips - Replace



Wear and tear

No.	Component group	Description
1	2nd wheel set	Tyres - complete set - Does not meet the leasing specifications - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Interior	Interior - Soiled - No deduction
4	Side panel - rear right side	Side panel - dent(s) - No deduction
5	Rear bumper	Rear bumper (Ladekante) - Scratch(es) - No deduction
6	Body	Body - Scratch(es) - No deduction
7	Body	Underbody - Corrosion - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer	2.533,77 €

Paint coat thickness measurement

Side panel - rear right side 81 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Das Fahrzeug weist der Laufzeit entsprechende Gebrauchsspuren auf.

Winter - Radsatz ist kein Bestandteil des Lieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

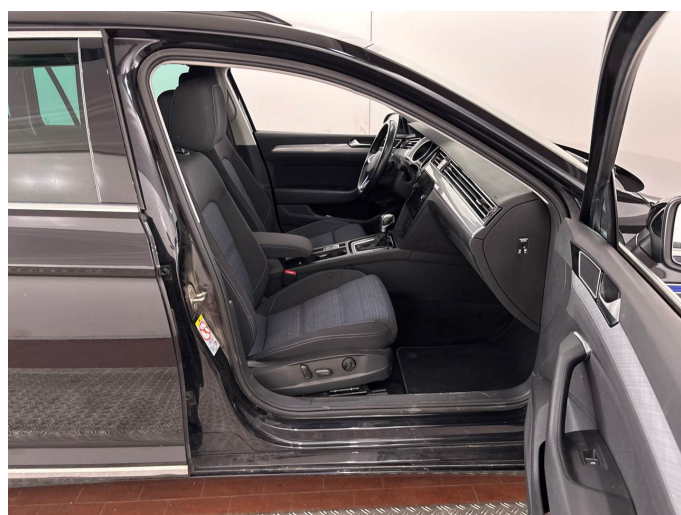


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

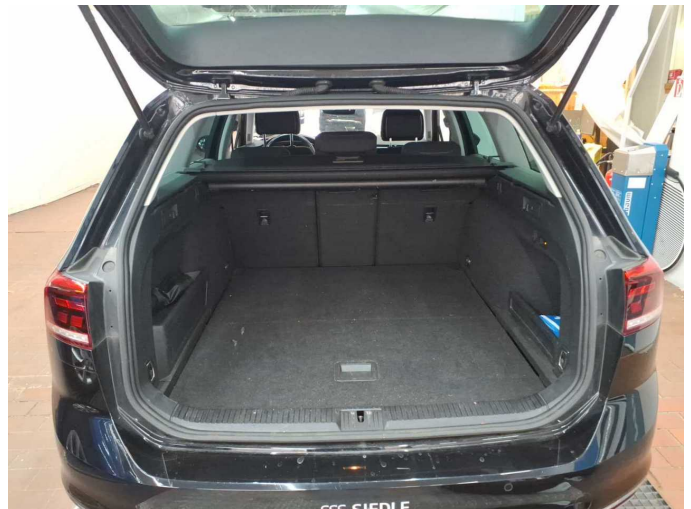


Figure 10: Cargo area

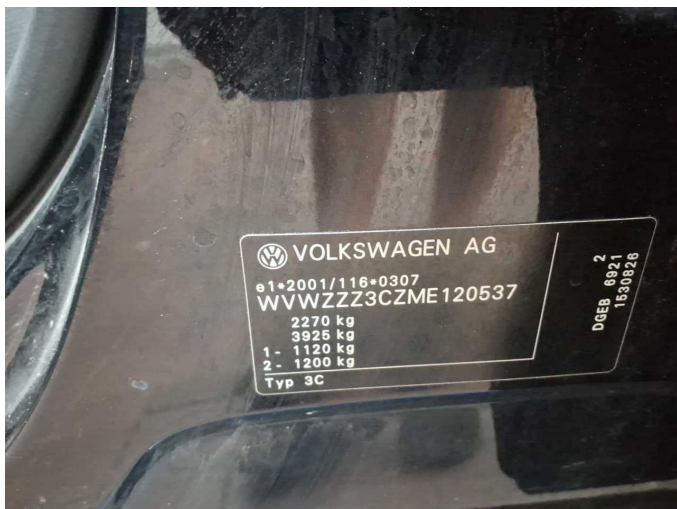


Figure 11: VIN



Figure 12: Mounted tyres

Komplettanweisung

Fahrzeugdaten

Fahrzeugnummer	WVWZZZ3CZME120537
Typbezeichnung	PASSAT 1.4 TFSI 115 TSDP
Datum der Ausfertigung	2024-06-02

Inspektion mit Ölwechsel

Datum	2024-06-02
Laufleistung	17674 km
Auftragsnummer	2024000001
Durchgeführte Zusatzarbeiten	☒ Ölwechsel ☒ Strahl-/Poliermittel ☒ Zündkerze ☒ Lichtverschöner
Durchgeführt von	Dr. Rabe-Stralle 3 36043 Fulda Deutschland Ja
Autorisierter Volkswagen Service Partner	Ja
Mobilitätsgarantie	Bis Anzeige Service, bei allen Fahrzeugen mit individuellen Konditionen bis Laufzeitende

Ölwechsel-Service

Datum	2024-01-09
Laufleistung	161920 km
Auftragsnummer	2024000001
Durchgeführt von	Kirker-Ludwig Dr. Rabe-Stralle 3 36043 Fulda Deutschland Ja
Autorisierter Volkswagen Service Partner	Ja
Mobilitätsgarantie	Bis Anzeige Service, bei allen Fahrzeugen mit individuellen Konditionen bis Laufzeitende

Figure 13: Documents

Inspektion mit Ölwechsel

Datum	2025-10-13
Laufleistung	150141 km
Auftragsnummer	2025004583
Durchgeführte Zusatzarbeiten	☒ Bremsflüssigkeit Service
Durchgeführt von	Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetriebs nur enthalten, soweit der Servicebetriebs auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.
Autorisierter Volkswagen Service Partner	Ja
Mobilitätsgarantie	Bis Anzeige Service, bei allen Fahrzeugen mit individuellen Konditionen bis Laufzeitende

Eintragung der Werkstatt

Datum	2025-02-17
Laufleistung	139487 km
Durchgeführt von	Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetriebs nur enthalten, soweit der Servicebetriebs auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.
Autorisierter Volkswagen Service Partner	Ja

Ölwechsel-Service

Datum	2025-02-17
Laufleistung	139487 km
Auftragsnummer	2025101043
Durchgeführt von	Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetriebs nur enthalten, soweit der Servicebetriebs auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.
Autorisierter Volkswagen Service Partner	Ja
Mobilitätsgarantie	Bis Anzeige Service, bei allen Fahrzeugen mit individuellen Konditionen bis Laufzeitende

Figure 14: Documents

Volkswagen Service-Nachweis

Inspektion mit Ölwechsel

Datum	2024-06-11
Laufleistung	17674 km
Auftragsnummer	2024000001
Durchgeführte Zusatzarbeiten	☒ Ölwechsel ☒ Strahl-/Poliermittel ☒ Zündkerze ☒ Lichtverschöner
Durchgeführt von	Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetriebs nur enthalten, soweit der Servicebetriebs auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.
Autorisierter Volkswagen Service Partner	Ja
Mobilitätsgarantie	Bis Anzeige Service, bei allen Fahrzeugen mit individuellen Konditionen bis Laufzeitende

Ölwechsel-Service

Datum	2024-01-09
Laufleistung	161920 km
Auftragsnummer	2024000001
Durchgeführt von	Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetriebs nur enthalten, soweit der Servicebetriebs auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.
Autorisierter Volkswagen Service Partner	Ja
Mobilitätsgarantie	Bis Anzeige Service, bei allen Fahrzeugen mit individuellen Konditionen bis Laufzeitende

Inspektion mit Ölwechsel

Datum	2023-09-19
Laufleistung	88976 km
Auftragsnummer	2023100187
Durchgeführte Zusatzarbeiten	☒ Bremsflüssigkeit Service ☒ Lichtverschöner
Durchgeführt von	Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetriebs nur enthalten, soweit der Servicebetriebs auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.
Autorisierter Volkswagen Service Partner	Ja
Mobilitätsgarantie	Bis Anzeige Service, bei allen Fahrzeugen mit individuellen Konditionen bis Laufzeitende

Figure 15: Documents

Service-Nachweis

Ölwechsel-Service

Datum	2022-06-03
Laufleistung	43710 km
Auftragsnummer	2022104773
Durchgeführt von	Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetriebs nur enthalten, soweit der Servicebetriebs auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.
Autorisierter Volkswagen Service Partner	Ja
Mobilitätsgarantie	Bis Anzeige Service, bei allen Fahrzeugen mit individuellen Konditionen bis Laufzeitende

Eintragung der Werkstatt

Datum	2022-06-03
Laufleistung	39276 km
Durchgeführt von	Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetriebs nur enthalten, soweit der Servicebetriebs auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.
Autorisierter Volkswagen Service Partner	Ja

Ölwechsel-Service

Datum	2021-08-31
Laufleistung	14125 km
Auftragsnummer	2021106179
Durchgeführt von	Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetriebs nur enthalten, soweit der Servicebetriebs auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.
Autorisierter Volkswagen Service Partner	Ja
Mobilitätsgarantie	Bis Anzeige Service, bei allen Fahrzeugen mit individuellen Konditionen bis Laufzeitende

Figure 16: Documents

Volkswagen Service-Nachweis

Übergabe-Inspektion

Datum	2021-05-25
Laufleistung	10 km
Auftragsnummer	14246
Durchgeführt von	Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetriebs nur enthalten, soweit der Servicebetriebs auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.
Autorisierter Volkswagen Service Partner	Ja
Mobilitätsgarantie	Bis Anzeige Service, bei allen Fahrzeugen mit individuellen Konditionen bis Laufzeitende

Figure 17: Documents

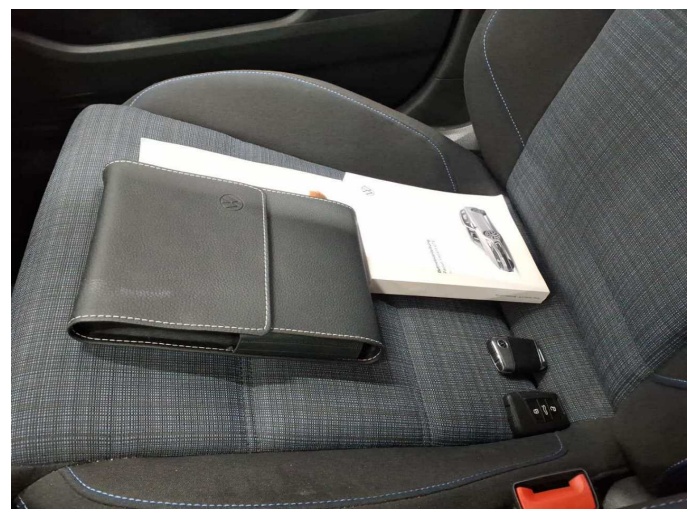


Figure 18: Documents



Figure 19: Documents



Figure 20: Additional tyres



Figure 21: Additional tyres



Figure 22: Navigation



Figure 23: Misc.



Figure 24: Misc.

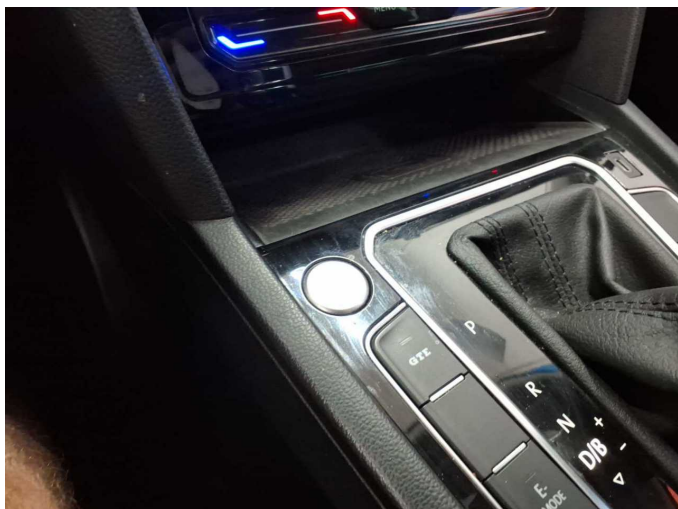


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

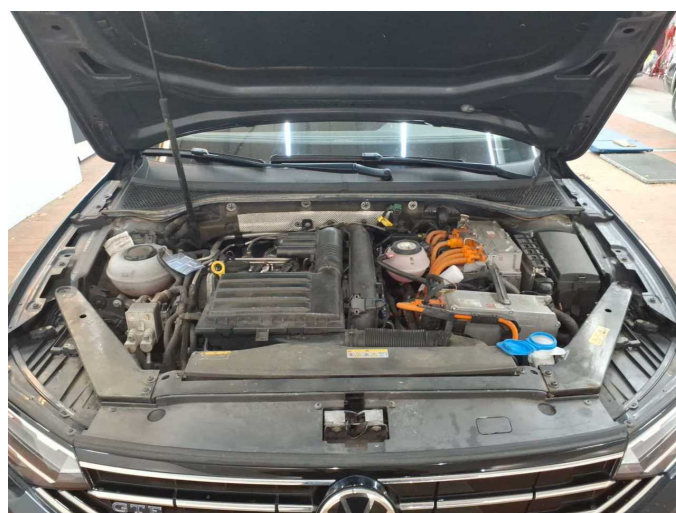


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

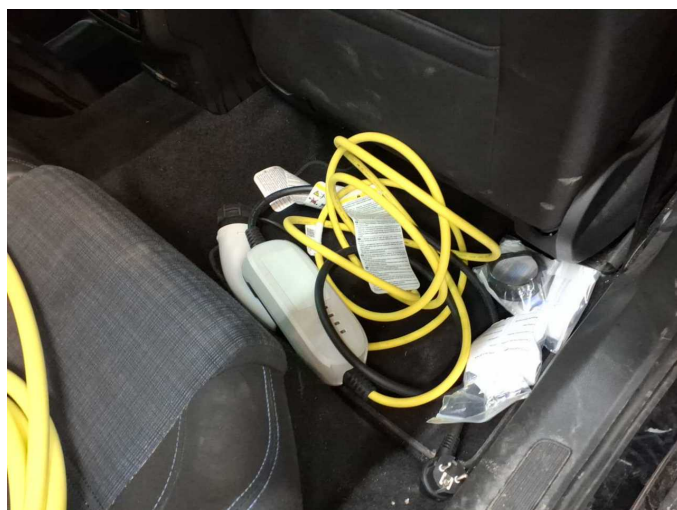


Figure 34: Misc.

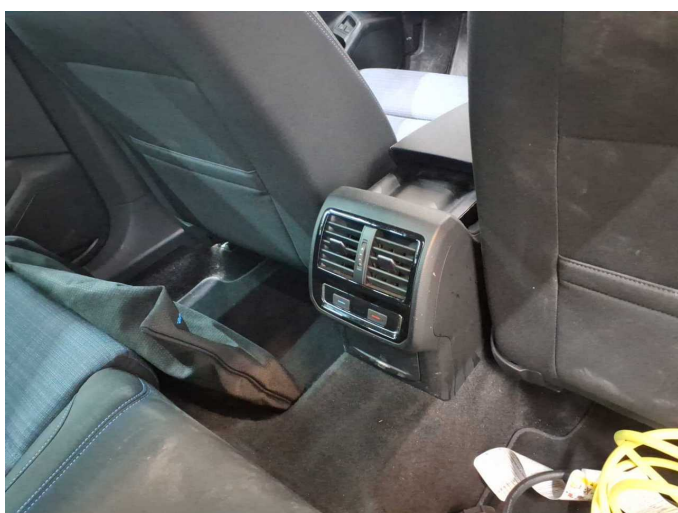


Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.



Figure 39: Misc.



Figure 40: Misc.

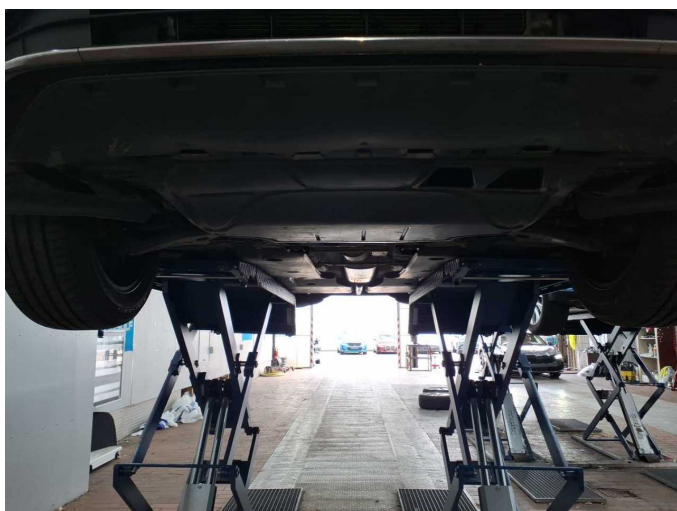


Figure 41: Misc.



Damage 2: Instrument panel: Indicator light (Reifendruckkontrollsystem) - on - Perform diagnosis



Damage 2: Instrument panel: Indicator light (Reifendruckkontrollsystem) - on - Perform diagnosis



Damage 3: Interior: Interior - Scratch(es) - Loss in value




Damage 3: Interior: Interior - Scratch(es) - Loss in value



Damage 3: Interior: Interior - Scratch(es) - Loss in value



Damage 3: Interior: Interior - Scratch(es) - Loss in value

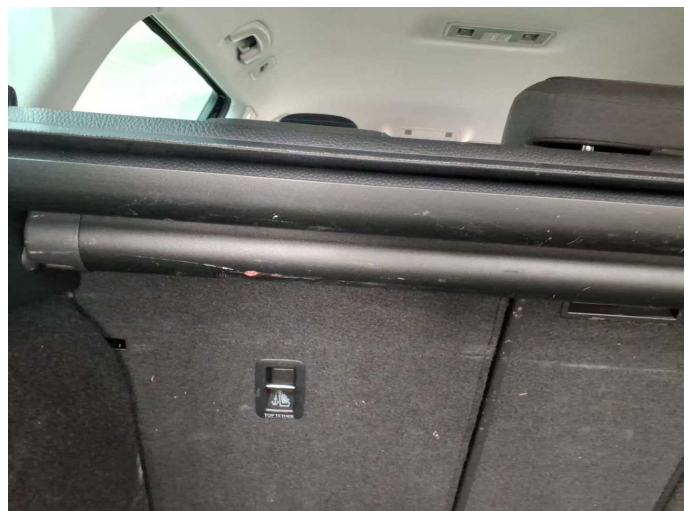

Damage 3: Interior: Interior - Scratch(es) - Loss in value



Damage 3: Interior: Interior - Scratch(es) - Loss in value




Damage 3: Interior: Interior - Scratch(es) - Loss in value




Damage 3: Interior: Interior - Scratch(es) - Loss in value




Damage 4: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

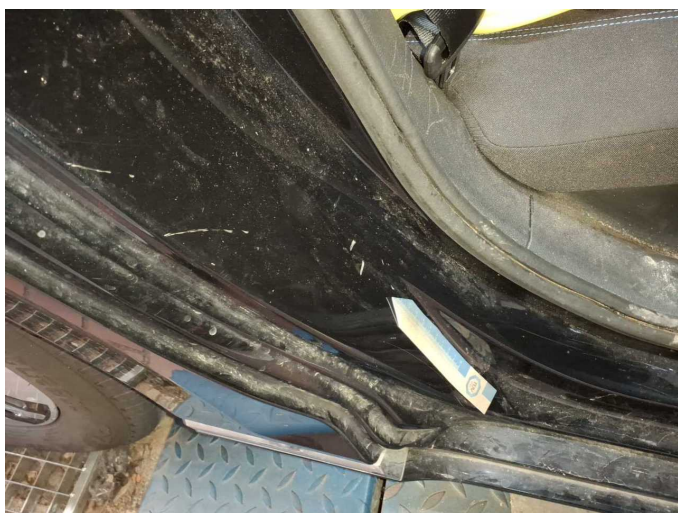

Damage 4: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

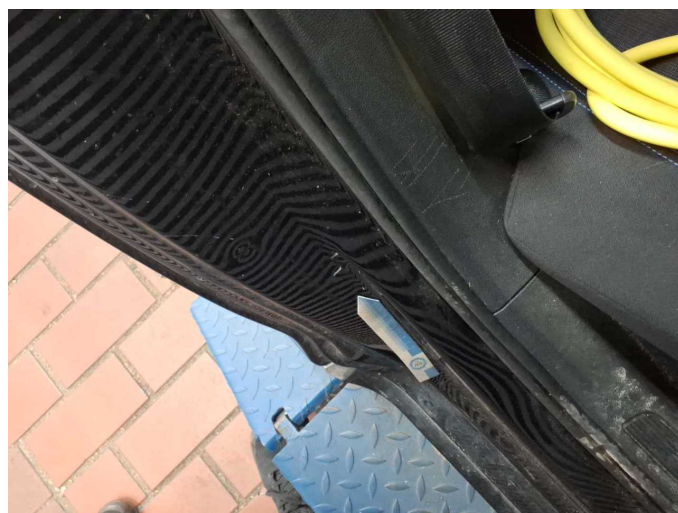

Damage 4: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

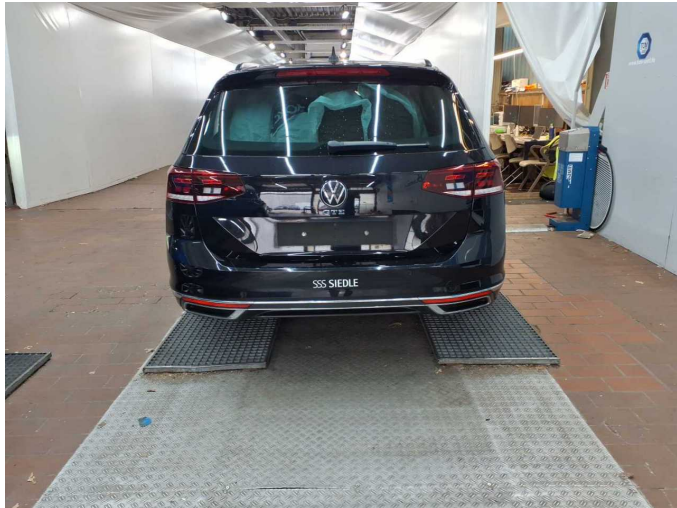

Damage 5: Body: Body - Glued / labelled - De-glue / neutralise



Damage 5: Body: Body - Glued / labelled - De-glue / neutralise




Damage 5: Body: Body - Glued / labelled - De-glue / neutralise




Damage 6: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint




Damage 6: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint

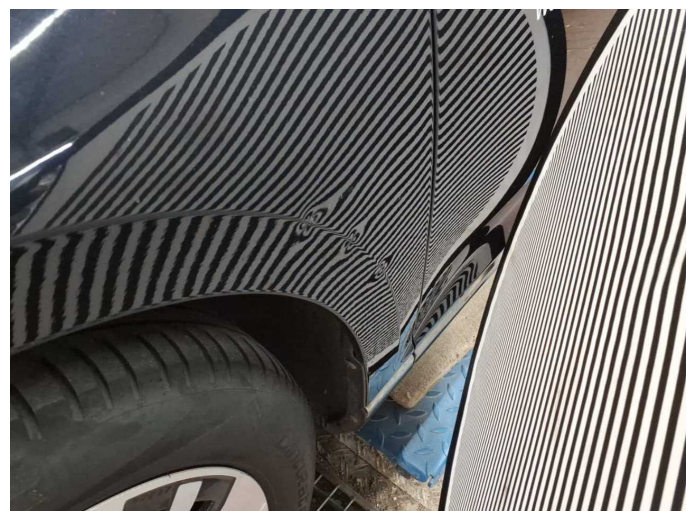

Damage 6: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint

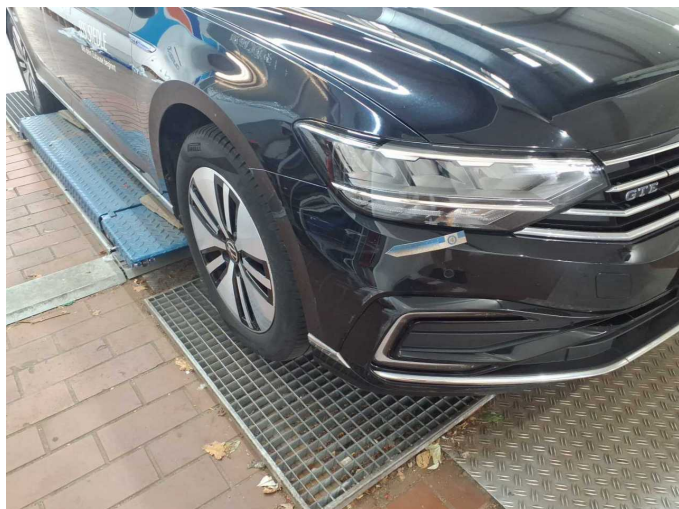


Damage 7: Front bumper: Front bumper (Mit Blende L und Spoiler) - Scratch(es) - Paint

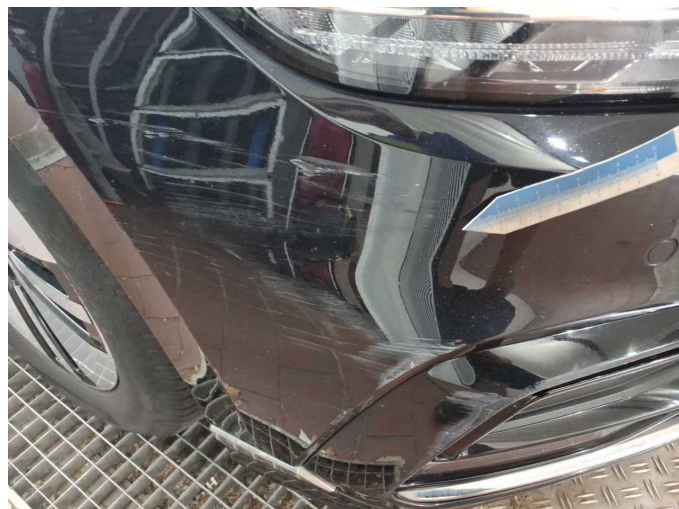

Damage 7: Front bumper: Front bumper (Mit Blende L und Spoiler) - Scratch(es) - Paint




Damage 7: Front bumper: Front bumper (Mit Blende L und Spoiler) - Scratch(es) - Paint

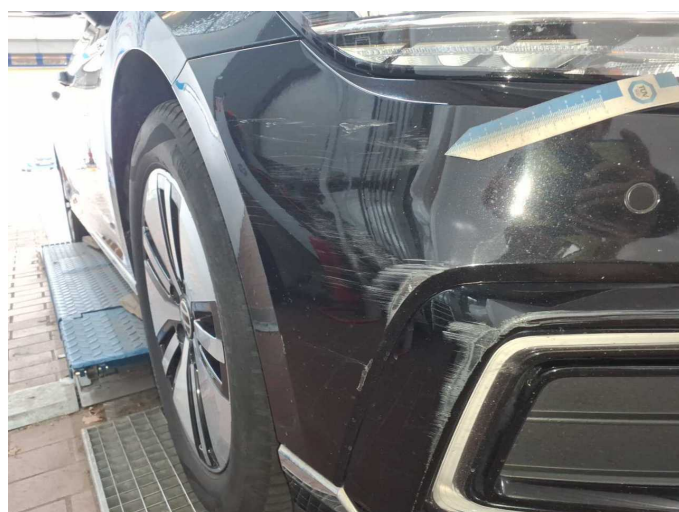

Damage 7: Front bumper: Front bumper (Mit Blende L und Spoiler) - Scratch(es) - Paint




Damage 7: Front bumper: Front bumper (Mit Blende L und Spoiler) - Scratch(es) - Paint

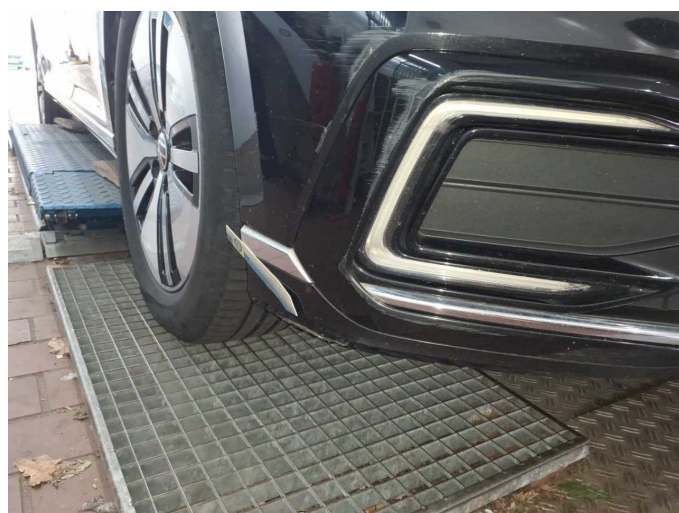


Damage 7: Front bumper: Front bumper (Mit Blende L und Spoiler) - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper (Mit Blende L und Spoiler) - Scratch(es) - Paint

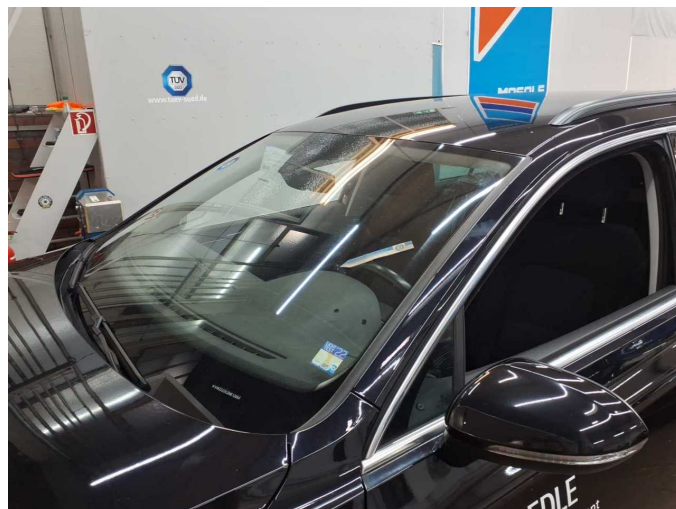

Damage 8: Vehicle glazing: Windscreen - Stone chips - Replace

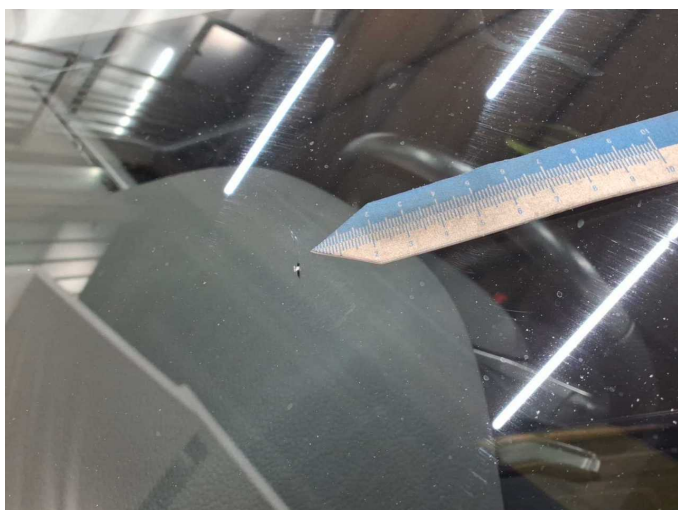

Damage 8: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 8: Vehicle glazing: Windscreen - Stone chips - Replace



Previous damage 1: Side right



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVWZZZ3CZME120537
Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE

Datum	KM-Stand	Beschreibung
08.04.2026	176.096	Bremse Sonstiges; Bremsscheiben + Klötze v; Getriebeöl ern/prüfen; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
09.01.2026	161.920	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
13.10.2025	150.146	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
17.02.2025	135.887	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
12.06.2024	119.805	Getriebeöl ern/prüfen; HU + AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
21.12.2023	104.382	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
19.06.2023	88.977	Bremsflüssigkeit ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Regelwartungsdienst
09.03.2023	77.191	Systemtest/Eigendiagnose
24.02.2023	75.790	Motoröl b. Wartung; Ölwechsel
25.10.2022	59.552	Getriebeöl ern/prüfen; Motoröl b. Wartung; Regelwartungsdienst; Zündkerzen ern
03.06.2022	43.710	Motoröl b. Wartung; Ölwechsel
14.03.2022	28.886	Motoröl b. Wartung; Regelwartungsdienst