

Opel

VIN: W0VECYHZ2NN554778

Estimated repair cost

580.14 EUR
TOTAL



Description

Registration number 2CWN288	Registration date -	Odometer 72464 km
Color -	Year -	Upholstery -
Number of doors -	Number of seats -	Generation -

Vehicle Equipments

Rear-view camera	Automatic headlights	Cruise control
Climate control	Rain-sensitive wipers	SATNAV
Rear sensors	Front sensors	

Statement details

Inspection loc PARC GENERAL LEASE	Statement date 21/01/2026	Inspection approval date 22/01/2026
---	-------------------------------------	---







Control





Engine start issue No	Is not roadworthy No
---------------------------------	--------------------------------

Defects & corrections

#	Element	Defect	Correction	net cost
001	Interior tailgate lining / -	Scratched	Smart repair	53.00 EUR

	Bodywork time	Paint time	Part Price	Lumpsum 53.00 EUR
	-	-	-	
	Bodywork cost	Paint cost	MaterialCost	
	-	-	-	
002	Tyre repair kit complete / -	Missing	Acceptable	-
	Bodywork time	Paint time	Part Price	Lumpsum -
	-	-	-	
	Bodywork cost	Paint cost	MaterialCost	
	-	-	-	
003	Wheel trim / Front Right Rim/Tyre diameter : 16 "	Broken	Replace	25.14 EUR
	Bodywork time	Paint time	Part Price	Lumpsum -
	0.20 h	-	13.14 EUR	
	Bodywork cost	Paint cost	MaterialCost	
	12.00 EUR	-	-	
004	Wheel trim / Back Left Rim/Tyre diameter : 16 "	Scratched	Acceptable	-
	Bodywork time	Paint time	Part Price	Lumpsum -
	-	-	-	
	Bodywork cost	Paint cost	MaterialCost	
	-	-	-	
005	Bumper / Front Painted : Yes	Scratched	Repair	193.00 EUR
	Bodywork time	Paint time	Part Price	Lumpsum -
	-	-	-	
	Bodywork cost	Paint cost	MaterialCost	
	-	193.00 EUR	-	
006	Spoiler / Front Painted : Yes	Scratched	Repair	65.00 EUR
	Bodywork time	Paint time	Part Price	Lumpsum -
	-	-	-	
	Bodywork cost	Paint cost	MaterialCost	
	-	65.00 EUR	-	
007	Seat cover / Front Left	Burn mark	Smart repair	53.00 EUR

	Bodywork time	Paint time	Part Price	Lumpsum 53.00 EUR
	Bodywork cost	Paint cost	MaterialCost	
008	Door sill / Front Left ¹	Dent	Smart repair	40.00 EUR
	Bodywork time	Paint time	Part Price	Lumpsum 40.00 EUR
	Bodywork cost	Paint cost	MaterialCost	
009	Carpet / Front Left	Burn mark	Smart repair	53.00 EUR
	Bodywork time	Paint time	Part Price	Lumpsum 53.00 EUR
	Bodywork cost	Paint cost	MaterialCost	
010	Door moulding / Front Left Painted : No	Scratched	Acceptable	-
	Bodywork time	Paint time	Part Price	Lumpsum -
	Bodywork cost	Paint cost	MaterialCost	
011	Door / Back Left Windowed : Yes	Scratched	Acceptable	-
	Bodywork time	Paint time	Part Price	Lumpsum -
	Bodywork cost	Paint cost	MaterialCost	
012	Door / Front Left	Scratched	Acceptable	-
	Bodywork time	Paint time	Part Price	Lumpsum -
	Bodywork cost	Paint cost	MaterialCost	
013	Tailgate / Boot door / -	Scratched	Polishing	29.00 EUR

	Bodywork time	Paint time	Part Price	Lumpsum 29.00 EUR
	Bodywork cost	Paint cost	MaterialCost	
014	Wing / Back Right ²	Dent	Smart repair	40.00 EUR
	Bodywork time	Paint time	Part Price	Lumpsum 40.00 EUR
	Bodywork cost	Paint cost	MaterialCost	
015	Door / Back Right	Scratched	Polishing	29.00 EUR
	Bodywork time	Paint time	Part Price	Lumpsum 29.00 EUR
	Bodywork cost	Paint cost	MaterialCost	
016	Door / Front Right ³	Scratched	Acceptable	-
	Bodywork time	Paint time	Part Price	Lumpsum -
	Bodywork cost	Paint cost	MaterialCost	

¹ 2x deuk +kras

² +kras

³ +reeds hersteld

Loose Items

- | | | |
|---|--|--|
| <input checked="" type="checkbox"/> Rear parcel shelf | <input checked="" type="checkbox"/> Remote key | <input type="checkbox"/> Tyre repair kit complete |
| <input type="checkbox"/> Security Kit | <input type="checkbox"/> Cabrio wind deflector | <input type="checkbox"/> Cabrio wind deflector bag |
| <input type="checkbox"/> Compressor tyre repair kit | <input type="checkbox"/> Document holder | <input type="checkbox"/> Triangle |
| <input type="checkbox"/> DVD screen | <input type="checkbox"/> First aid kit | <input type="checkbox"/> Warranty booklet |
| <input type="checkbox"/> User manual | <input type="checkbox"/> Memory card | <input type="checkbox"/> Toolkit |
| <input type="checkbox"/> Fragrance diffuser | <input type="checkbox"/> Hook /Hitch ball | <input type="checkbox"/> Jack |
| <input type="checkbox"/> Jack handle crank | <input type="checkbox"/> Card key | <input type="checkbox"/> Load cover |
| <input type="checkbox"/> Slow charging cable | <input type="checkbox"/> Mechanical key | <input type="checkbox"/> Refill tyre repair kit |
| <input type="checkbox"/> Charging cable bag | <input checked="" type="checkbox"/> Conformity certificate | <input checked="" type="checkbox"/> Spare Key |
| <input type="checkbox"/> Spare wheel tyre | <input type="checkbox"/> Separation net | <input type="checkbox"/> Service book |
| <input type="checkbox"/> Quick charging cable | <input type="checkbox"/> In-car tools | <input type="checkbox"/> Towing hook |
| <input type="checkbox"/> Safety vest | <input type="checkbox"/> Divider bar of the bag | <input type="checkbox"/> Locking wheel nut |
| <input type="checkbox"/> Cargo net | | |

Main set of tyres

Front Left	UNIROYAL	205 / 60 / 16 / Summer	6 mm
Front Right	UNIROYAL	205 / 60 / 16 / Summer	6 mm
Back Left	MICHELIN	205 / 60 / 16 / Summer	3 mm
Back Right	MICHELIN	205 / 60 / 16 / Summer	3 mm

Comments

Pictures



Front left



Rear left



Boot opened



Rear right



Rear passenger compartment



Dashboard from rear seat



Front passenger compartment




Front right



Odometer




Navigation

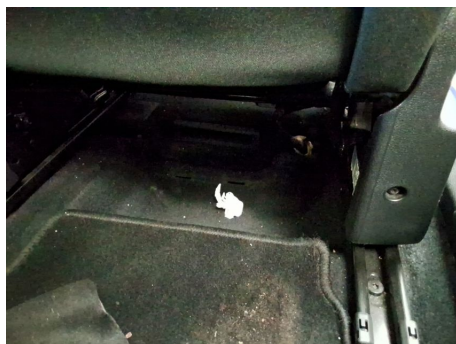


Spare Tyre



Vin

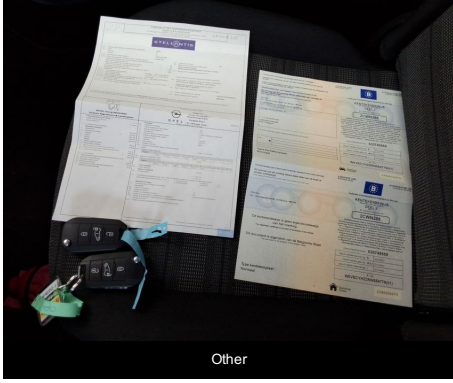


Other

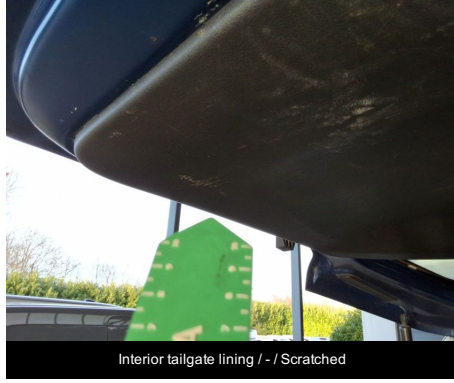


Interior tailgate lining / - / Scratched




Interior tailgate lining / - / Scratched

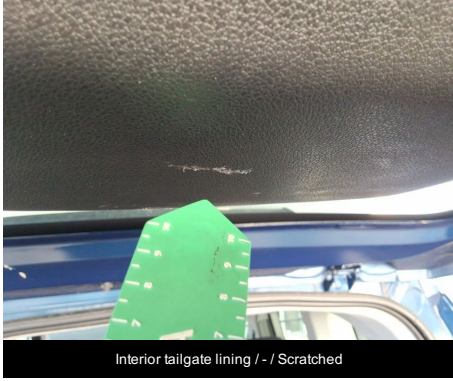

Interior tailgate lining / - / Scratched

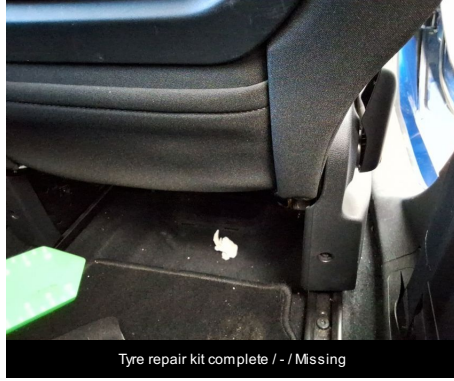

Tyre repair kit complete / - / Missing

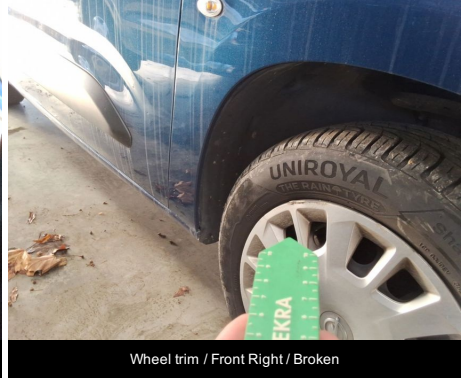


Wheel trim / Front Right / Broken



Wheel trim / Front Right / Broken



Wheel trim / Front Right / Broken

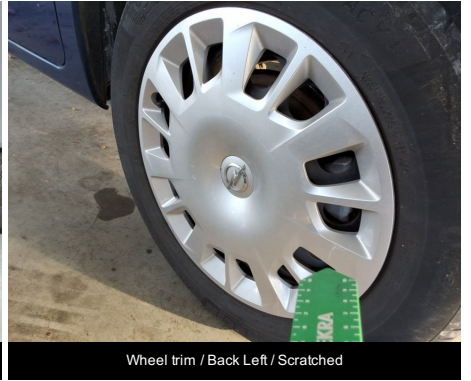

Wheel trim / Back Left / Scratched



Bumper / Front / Scratched



Bumper / Front / Scratched



Bumper / Front / Scratched



Bumper / Front / Scratched



Bumper / Front / Scratched



Spoiler / Front / Scratched



Spoiler / Front / Scratched



Seat cover / Front Left / Burn mark



Seat cover / Front Left / Burn mark



Door sill / Front Left / Dent




Door sill / Front Left / Dent



Door sill / Front Left / Dent



Carpet / Front Left / Burn mark

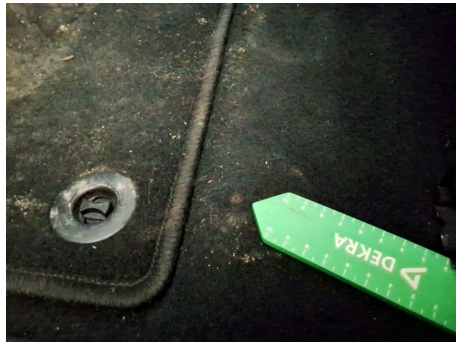

Carpet / Front Left / Burn mark




Door moulding / Front Left / Scratched



Door moulding / Front Left / Scratched



Door moulding / Front Left / Scratched

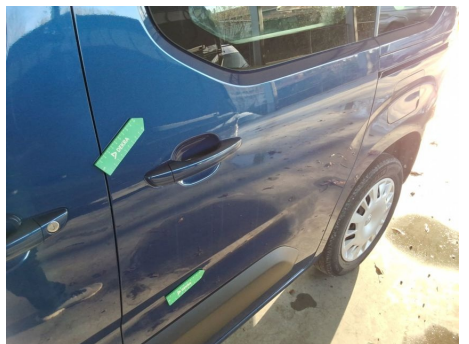

Door / Back Left / Scratched



Door / Front Left / Scratched



Tailgate / Boot door / - / Scratched



Tailgate / Boot door / - / Scratched



Tailgate / Boot door / - / Scratched



Tailgate / Boot door / - / Scratched



Tailgate / Boot door / - / Scratched



Wing / Back Right / Dent



Wing / Back Right / Dent



Wing / Back Right / Dent



Wing / Back Right / Dent



Wing / Back Right / Dent




Door / Back Right / Scratched



Door / Back Right / Scratched



Door / Front Right / Scratched

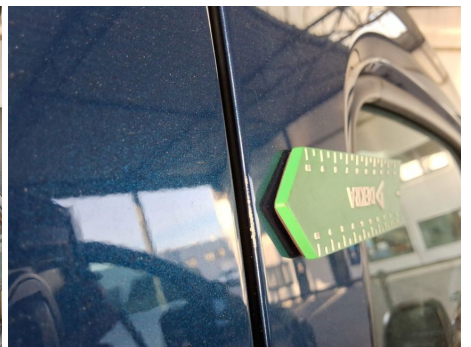

Door / Front Right / Scratched



Door / Front Right / Scratched